

003-33



PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3392743 Invoice Date: 6/11/2025 Location: 01 Work Order Number: 493106 Payment Type: Page: 1 of 13
		Make/Model: JOHN DEERE R4060 CF 132' 1600GL EA 800/ Meter: 1109 Serial Number: 1N04060RLM0217388 Eq ID: 026199 Fleet No:

JGLSPR JD ALL**COMPLAINT:**

01 SPRAYER VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

SELF PROPELLED SPRAYER VALUEMAX GREEN LIGHT INSPECTION CHECKOVER

NOTE: SPRAY TANK MUST BE RINSED AS WELL AS BOOMS WASHED
 OFF BEFORE SPRAYER IS BROUGHT INTO SHOP.
 IF NOT ADDITIONAL CHARGES WILL APPLY.

ENGINE HOURS

DOES THIS UNIT GET A VALUEMAX STICKER ☒ YES ☐ NO
 HAS THE STICKER BEEN INSTALLED ☒ YES ☐ NO
 CAB HAS BEEN COMPLETELY CLEANED ☐ AV (INITIAL)
 THIS UNIT HAS HAD A FINAL CHECKOVER ☐ BT (INITIAL)
 THIS UNIT HAS HAD A COMPLETE GREASE JOB ☐ JL (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMER'S INSTRUCTIONS:



Job Total: \$2,600.00

J21120010 JD R4060**COMPLAINT:**

03 INSTALL AND ASSEMBLE BKK10003 FLOTATION FENDER KIT.
 ORDER A NEW KIT AND INSTALL AS PER CODY K. VERBAL COMMUNICATION 5/29/2025

CORRECTION:

INSTALL KIT AS PER INSTRUCTIONS. PACKAGE UP REMOVED FENDERS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3392743 Invoice Date: 6/11/2025 Location: 01 Work Order Number: 493106 Payment Type: Page: 2 of 13
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

J21120010 JD R4060
 BKK10003 Floatation Fender Bundle 1.00 5,079.24 5,079.24 \$5,079.24 N

Labor: \$0.00	Parts: \$5,079.24	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$5,079.24
---------------	-------------------	--------------	--------------	-----------------------

JGEN29-

COMPLAINT:

04 Top Up All Planetary Hub Oil Levels.

CORRECTION:

Monday, June 2, 2025 11:27 AM - 12:01 PM
 TOPPED UP 3/4 HUBS. WENT TO PARTS FOR MORE OIL, DON'T HAVE ANY IN STOCK.
 FRONT LEFT NEEDS TO BE FILLED YET.

Tuesday, June 3, 2025 9:11 AM - 9:22 AM
 TOPPED UP LAST PLANETARY.
 HAD 4 BOTTLES OF OIL SHOW UP, USED TWO YESTERDAY, AND THERES ONLY FOUR ON THE WORK ORDER, NOT
 SURE WHY THERE'S ONLY FOUR.
 RETURNED EXCESS OIL.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26372	SYN GL-5 80W-140 BOTTLE 946ml	3.00	47.83	47.83	\$143.49	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF15	ENVIRO FEE	3.00	0.15	0.15	\$0.45	N
Labor: \$75.00	Parts: \$143.49	OL&M: \$0.00	Misc: \$0.45	Sub-Total: \$218.94		

JGEN24-

COMPLAINT:

09 Repair All Dripping Nozzles. (48)

48 DRIPPING NOZZLES. PLUNGERS REQUIRE STRIPPING AND INSPECTING AND REPLACING IF DAMAGED

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

		Invoice Number: 3392743 Invoice Date: 6/11/2025 Location: 01 Work Order Number: 493106 Payment Type: Page: 3 of 13
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

JGEN24-

KYLE- REPAIRED RH SIDE, REPLACED PARTS AS REQUIRED.

Saturday, May 31, 2025 1:51 PM - 4:37 PM
 REPAIRED LH SIDE, REPLACED AS REQUIRED.

Monday, June 2, 2025 7:56 AM - 11:28 AM
 REPAIRED CENTER FRAME. REPLACED PARTS AS REQUIRED.
 FILLED WITH WATER AND DID RUN CHECKS. STILL HAD A FEW DRIPPING, REPAIRED AS REQUIRED.
 ORDERED SOLENOIDS.

Thursday, June 5, 2025 10:24 AM - 11:13 AM
 GRABBED PARTS FROM PARTS SHELF.
 FILLED SPRAYER WITH WATER.
 UNFOLDED SPRAYER AND INSTALLED SOLENOIDS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK27643	ExactApply Poppet	2.00	37.46	37.46	\$74.92	N
AKK39954	Sprayer Nozzle Electrical Coil	131.00	68.83	68.83	\$9,016.73	N
AKK57869	Solenoid Valve -Exact Apply	148.00	90.95	90.95	\$13,460.60	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
FRT	FREIGHT	1.00	35.00	35.00	\$35.00	N

Labor: \$2,920.00	Parts: \$22,552.25	OL&M: \$0.00	Misc: \$35.00	Sub-Total: \$25,507.25
--------------------------	---------------------------	-------------------------	----------------------	-------------------------------

JGEN23-

COMPLAINT:

10 Replace Both Right and Left Hand Break Away Chain Tension Arm Guide.

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3392743
		Invoice Date:	6/11/2025
		Location:	01
		Work Order Number:	493106
		Payment Type:	
		Page:	4 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

JGEN23-

Wednesday, June 4, 2025 8:19 AM - 12:02 PM

FOUND A SPOT TO UNFOLD SPRAYER.

ON LH SIDE, MARKED TENSION AND LOOSENED SPRING TENSIONER.

DISCONNECTED SPRING TENSIONER FROM TENSION ARM.

DRILLED OUT OLD RIVETS.

REMOVED OLD GUIDE.

INSTALLED NEW GUIDE WITH NEW RIVETS, WAS USING SHOP HAND RIVETER AND ON THE FIRST RIVET, RIVET GUN EXPLODED.

FOUND SHOP ELECTRIC RIVET GUN.

INSTALLED REMAINING RIVETS ON LH SIDE.

CONNECTED SPRING TENSIONER TO TENSION ARM.

TENSIONED TENSIONER TO MARK.

REPEATED PROCEDURE FOR RH SIDE.

CHECKED BREAKAWAY TENSION, WAS ABOUT 20 LBS TOO LOW.

TENSIONED BREAKAWAY TRIP FORCE TILL 51-52 LBS OF TRIPPING FORCE, WHICH IS AT THE BOTTOM OF THE 55 +/- 4 LBS OF TRIPPING FORCE.

SPRING TENSIONERS ARE ALMOST MAXED OUT.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK19630	Rivet - 3/16 Dome Head	8.00	8.18	8.18	\$65.44	N
KK31370	Guard	2.00	82.43	82.43	\$164.86	N
Labor: \$362.00		Parts: \$230.30	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$592.30	

JGEN22-

COMPLAINT:

11 Adjust Center Boom Frame.

CORRECTION:

Thursday, June 5, 2025 8:16 AM -

LOOSENED HARDWARE ADJUSTED CYLINDER 1 REVOLUTION.

AFTER DOING SO CENTER BOOM WAS SITTING ON PADS NO GAPS AND COULD NOT SEE LIGHT.

Labor: \$130.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$130.00
-----------------	---------------	--------------	--------------	---------------------

CONTINUED ON NEXT PAGE->



PATTISON AGRICULTURE LIMITED
2777 North Service Road West
Swift Current, SK S9H 5M1
Phone: (306) 773-9351
Fax: (306) 773-2045
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeseville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3392743
		Invoice Date:	6/11/2025
		Location:	01
		Work Order Number:	493106
		Payment Type:	
		Page:	5 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

JGEN21-

COMPLAINT:

12 Diagnose and Repair Left Hand Steering Cylinder Leak

Causing toe issue.

- Adjust Wheel Toe -In

CORRECTION:

Friday, May 30, 2025 9:38 AM-

REMOVED COTTER PINS.

LOOSENED CASTLE NUTS.

REMOVED BRACKET TO GET BETTER ACCESS TO HIT REAR NUT.

REMOVED STEERING CYLINDER AND TOOK TO BENCH.

DRAINED OIL.

REMOVED SNAP RING.

REMOVED PISTON ASSEMBLY.

INSPECTED CYLINDER AND FOUND GROOVE INTO HOUSING THAT WAS QUITE DEEP.

CYLINDER HOUSING NO GOOD.

ACQUIRED NEW STEERING CYLINDER AND INSTALLED ONTO SPRAYER.

SWAPPED FITTINGS FROM OTHER STEERING CYLINDER INSTALLED NEW O-RINGS ONTO FITTINGS BEFORE

INSTALLATION ONTO NEW STEERING CYLINDER.

TORQUED CASTLE NUT HARDWARE TO SPEC AS PER MANUAL.

INSTALLED COTTER PINS.

REINSTALLED AND TIGHTENED HYDRAULIC FITTING CONNECTIONS.

STARTED AND RAN SPRAYER.

REPHASED CYLINDERS.

Monday, June 2, 2025 1:44 PM - 4:08 PM

REPHASED STEERING CYLINDERS.

DROVE STRAIGHT FOR 6 M.

MEASURED DIAGONALLY BOTH WAYS TO ENSURE WHEELS WERE STRAIGHT, ADJUSTED IF NECESSARY.

CHECKED FRONT AXLE TOE-IN, FRONT AXLE TOE-IN MEASURED 1".

MADE ADJUSTMENTS 3 TIMES, AND RECHECKED. WAS ALL OVER THE PLACE.

NOTICED THAT THREADS WERE UNEVEN ON CYLINDERS.

ADJUSTED SO THAT CYLINDERS WERE AT THE SAME LENGTH.

MADE ADJUSTMENTS UNTIL TOE WAS SET PROPERLY. FRONT AXLE TOE-IN MEASURES 1/8"

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7087	M4x40 COTTER PIN	2.00	0.77	0.77	\$1.54	N

CONTINUED ON NEXT PAGE->



PATTISON AGRICULTURE LIMITED
2777 North Service Road West
Swift Current, SK S9H 5M1
Phone: (306) 773-9351
Fax: (306) 773-2045
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Belcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2672	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

		INVOICE	
		Invoice Number:	3392743
		Invoice Date:	6/11/2025
		Location:	01
		Work Order Number:	493106
		Payment Type:	
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	6 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

JGEN21-

14H875	7/8-14 CASTLE NUT GR5	1.00	13.44	13.44	\$13.44	N
51M7042	O-RING M16	2.00	4.94	4.94	\$9.88	N
AHC16971	Hydraulic Cylinder Bore Seal Kit	1.00	190.25	190.25	\$190.25	N
AHC17555	Hydraulic Cylinder	1.00	2,023.64	2,023.64	\$2,023.64	N
AN209814	Tie Rod End	1.00	304.97	304.97	\$304.97	N
T77613	-6FF O-ring	2.00	3.35	3.35	\$6.70	N

Labor: \$900.00	Parts: \$2,550.42	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$3,450.42
-----------------	-------------------	--------------	--------------	-----------------------

JGEN19-

COMPLAINT:

14 On board Air System Repairs.

- Adjust Line AKK46063 (kinked)
- Tighten Fitting (Leaking)

CORRECTION:

Saturday, May 31, 2025 7:30 AM - 8:06 AM

TIGHTENED LOOSE FITTINGS.

LOOSENED FITTINGS FOR LINE, LINE IS DAMAGED FROM BEING KINKED. TALKED TO BRAYDEN, GOING TO REPLACE LINE.

ORDERED NEW LINE, COMING FROM MILAND.

Thursday, June 5, 2025 12:59 PM - 4:21 PM

GRABBED PARTS FROM PARTS SHELF.

REMOVED CLAMPS.

REMOVED OLD LINE.

ROUTED NEW LINE INTO PLACE.

STARTED FITTINGS ON BOTH ENDS.

INSTALLED CLAMPS AND TIGHTENED CLAMPS.

TIGHTENED FITTINGS.

CLEANED UP AREA.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3392743 Invoice Date: 6/11/2025 Location: 01 Work Order Number: 493106 Payment Type: Page: 7 of 13
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

JGEN19-

AKK46063	AIR HOSE - COMPRESSOR TO DRYER	1.00	584.26	584.26	\$584.26	N
----------	--------------------------------	------	--------	--------	----------	---

Labor: \$800.00	Parts: \$584.26	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,384.26
------------------------	------------------------	-------------------------	---------------------	------------------------------

JGEN15-

COMPLAINT:

18 Diagnose and Repair Boom Break Away Valve Leak.

CORRECTION:

Saturday, May 31, 2025 1:44 PM - 1:50 PM

CLEANED OFF VALVE. GOING TO HAVE TO RUN TO DETERMINE WHERE LEAK IS COMING FROM.

Tuesday, June 3, 2025 11:16 AM - 12:02 PM

LOWERED BOOM. INSPECTED VALVE BLOCK. COULD NOT FIND ANY LEAKS.

TALKED TO WILL, SAID IT LOOKED LIKE IT WAS COMING FROM THE TOP. STILL COULDN'T SEE ANY POSSIBLE LEAKS.

TALKED TO BARRY, SINCE THERE ARE NO VISIBLE LEAKS, DETERMINED IT WASN'T LEAKING.

FOLDED SPRAYER AND PARKED.

Labor: \$180.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$180.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN12-

COMPLAINT:

21 Diagnose and Repair Combo valve Leak.

CORRECTION:

CONTINUED ON NEXT PAGE->



PATTISON AGRICULTURE LIMITED
2777 North Service Road West
Swift Current, SK S9H 5M1
Phone: (306) 773-9351
Fax: (306) 773-2045
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeseville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

		Invoice Number:	3392743
		Invoice Date:	6/11/2025
		Location:	01
		Work Order Number:	493106
		Payment Type:	
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	8 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

JGEN12-

SCOTT CLEANED BLOCK AND TIGHTENED ALL FITTINGS.

Monday, June 2, 2025 4:09 PM - 5:03 PM

REPEATEDLY USED TREAD ADJUST, AUTOTRAC, BOOMTRAC AND STEERING FUNCTIONS, CHECKED FOR LEAKS, CAN NOT FIND ANY LEAKS.

Tuesday, June 3, 2025 7:55 AM - 9:11 AM

USED ALL FUNCTIONS AGAIN, INSPECTED AND STILL COULDN'T FIND ANY LEAKS.

Tuesday, June 3, 2025 9:22 AM - 11:16 AM

TALKED TO BRAYDEN, SAID TO PUT CARDBOARD IN THE RAD TO HEAT UP OIL MORE.

PLACED CARDBOARD IN FRONT OF THE RAD AND COOLERS.

DROVE SPRAYER UP AND DOWN THE HILL TO HEAT HYDRAULIC OIL. ENDED UP GETTING STOP CODES FOR CHARGE AIR COOLER TEMPERATURE. COULD ONLY GET HYDRAULIC OIL TO 160 DEGREES.

USED ALL FUNCTIONS AGAIN, INSPECTED FOR LEAK NO LEAKS FOUND.

Labor: \$436.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$436.00
-----------------	---------------	--------------	--------------	---------------------

JGEN09-

COMPLAINT:

24 Diagnose Discoloring in Coolant Reservoir.

CORRECTION:

Thursday, June 5, 2025 8:22 AM -

AT THIS TIME WE WILL MONITOR CONDITION OF COOLANT AS PER BRAYDEN.

TOPPED UP COOLANT.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26576	COOL-GARD II 50/50 PRE-MIX JUG 9.46L	2.00	65.35	65.35	\$130.70	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF150	ENVIRO FEE	2.00	1.50	1.50	\$3.00	N
Labor: \$100.00	Parts: \$130.70	OL&M: \$0.00	Misc: \$3.00	Sub-Total: \$233.70		

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3392743
		Invoice Date:	6/11/2025
		Location:	01
		Work Order Number:	493106
		Payment Type:	
		Page:	9 of 13

Make/Model:	Meter:	Serial Number:	Eq ID	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

JGEN08-

COMPLAINT:

25 Misc Repairs.

- Replace missing washer on LH side shield. (at rear bolt) X
- Secure LH rear wheel motor harness. X
- Replace Speed decal X
- Replace control decal at solution control door.X
- Adjust Right Hand boom rope, resting on boom harness. X
- Repair Subnet 1 CAN terminator mount. X
- Replace Exact Apply remote batteries. X
- Replace Hydraulic Reservoir Fill Cap X

CORRECTION:

Saturday, May 31, 2025 11:27 AM - 12:01 PM
 SECURED LH WHEEL MOTOR HARNESS.
 REPLACED HYDRAULIC RESERVOIR CAP.
 ADJUSTED RH BOOM CONTROL HARNESS/ROPE.

Monday, June 2, 2025 12:59 PM - 1:43 PM
 REPLACED CAN TERMINATOR MOUNT.
 REPLACED EXACT APPLY REMOTE BATTERIES.
 REMOVED OLD SPEED DECAL. INSTALLED NEW SPEED DECAL.

Tuesday, June 3, 2025 8:48 AM - 8:51 AM
 GOT NEW WASHER FOR LH SIDE SHIELD.
 INSTALLED WASHER.

Wednesday, June 4, 2025 7:56 AM - 8:17 AM
 GRABBED PARTS FROM PARTS.
 CLEANED AREA FOR CONTROL DECAL.
 INSTALLED CONTROL DECAL.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
21M7297	Screw M8x16 Ctsk Phillips	-1.00	1.28	1.28	(\$1.28)	N
57M9940	Connector Barb Mount	1.00	2.25	2.25	\$2.25	N
AKK25690	Hydraulic Reservoir Filler Cap	1.00	90.01	90.01	\$90.01	N
KK119336	Decal, Fill Station	1.00	14.04	14.04	\$14.04	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

		Invoice Number:	3392743
		Invoice Date:	6/11/2025
		Location:	01
		Work Order Number:	493106
		Payment Type:	
Bus Phone:	Bus Phone:	Page:	10 of 13
Prv Phone:	Prv Phone:		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

JGEN08-

KK54915	Washer	1.00	1.71	1.71	\$1.71	N
L55475	O-RING	-1.00	8.36	8.36	(\$8.36)	N
PSLDXQ2005	LDX-Brown Nozzle	-14.00	13.82	13.82	(\$193.48)	N
R260459	55km/h Label	1.00	26.70	26.70	\$26.70	N
TY27956	TORQ-GARD II 10W30 CK4 18.9L	-1.00	144.50	144.50	(\$144.50)	N
ECR2032BP	Lithium Coin Battery 3V	2.00	3.62	3.62	\$7.24	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF300	ENVIRO FEE	-1.00	3.00	3.00	(\$3.00)	N

Labor: \$300.00 Parts: (\$205.67) OL&M: \$0.00 Misc: (\$3.00) Sub-Total: \$91.33

JGEN06-

COMPLAINT:
 27 Replace Rubber Charge Air Cooler Hose

CORRECTION:
 Saturday, May 31, 2025 11:04 AM - 11:27 AM
 REMOVED OLD HOSE.
 ORDERED NEW CLAMPS.
 INSTALLED NEW HOSE WITH OLD CLAMPS.
 WILL INSTALL NEW CLAMPS WHEN THEY GET HERE.

Wednesday, June 4, 2025 8:17 AM -
 REMOVED OLD CLAMPS.
 INSTALLED NEW CLAMPS. TORQUED TO 80 IN/LBS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AT301456	Clamp	1.00	49.06	49.06	\$49.06	N
R183295	Hose	1.00	142.84	142.84	\$142.84	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preecaville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3392743 Invoice Date: 6/11/2025 Location: 01 Work Order Number: 493106 Payment Type: Page 11 of 13
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

JGEN06-

RE518716	Tension Hose Clamp	1.00	35.98	35.98	\$35.98	N
----------	--------------------	------	-------	-------	---------	---

Labor: \$90.00	Parts: \$227.88	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$317.88
----------------	-----------------	--------------	--------------	---------------------

JGEN03-

COMPLAINT:

30 Stored MNA 1669.11 and 1669.09.

- See if codes come back when testing wet system.

CORRECTION:

FILL SPRAYER WITH WATER

Thursday, June 5, 2025 11:13 AM - 12:07 PM

SPRAYED 500 GALLONS OF WATER, DID NOT HAVE ANY CODES POP UP.

Labor: \$280.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$280.00
-----------------	---------------	--------------	--------------	---------------------

JGEN32-

COMPLAINT:

32 CODY WANTS US TO CHECK ALL PLUNGERS FOR DAMAGE

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

		Invoice Number:	3392743
		Invoice Date:	6/11/2025
		Location:	01
		Work Order Number:	493106
		Payment Type:	
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	12 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

JGEN32-

Friday, June 6, 2025 8:05 AM - 12:02 PM

HAD TO WAIT FOR TRUCKS AND AUGER TO GET OUT OF THE WAY SO THAT I COULD GET SPRAYER OUT.
 STARTED REMOVING EVERY SOLENOID AND PLUNGER AND INSPECTING SOLENOID FOR CRACKING AND PLUNGERS
 FOR WEAR. REPLACED CRACKED SOLENOIDS UNTIL WE RAN OUT, STARTED REASSEMBLING WITH CRACKED
 SOLENOIDS BUT MARKING. WILL HAVE TO ORDER MORE.
 REPLACED PLUNGERS AS REQUIRED.

Friday, June 6, 2025 12:57 PM - 5:00 PM

FINISHED CHECKING ALL SOLENOIDS AND PLUNGERS. 86 CRACKED SOLENOIDS, MARKED TO BE REPLACED.
 ORDERED PARTS. MIGHT BE COMING IN THE MORNING.
 SPRAYED 400 GALLONS, HAD NO CODES POP UP, HAD MULTIPLE DRIPPING NOZZLES AFTER NOT BEING ABLE TO
 REPLACE BROKEN ONES.

Monday, June 9, 2025 7:59 AM - 12:02 PM

GRABBED ALL PARTS FROM PARTS SHELF.
 UNFOLDED SPRAYER.
 REPLACED ALL PREVIOUSLY MARKED SOLENOIDS, AND PLUNGERS AS REQUIRED.
 FILLED SPRAYER WITH 300 GALLONS.

Monday, June 9, 2025 12:54 PM - 2:25 PM

SPRAYED 300 GALLONS.
 CHECKED FOR DRIPPING NOZZLES AND PROPER OPERATIONS OF ALL NOZZLES. EVERYTHING GOOD.
 FOLDED SPRAYER.
 PARKED SPRAYER.
 RETURNED EXTRA PARTS.
 TALKED TO PARTS TO SEE IF UNRECEIVED PARTS COULD BE REMOVED FROM BACK ORDER.



CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3392743
		Invoice Date:	6/11/2025
		Location:	01
		Work Order Number:	493106
		Payment Type:	
		Page:	13 of 13

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1109	1N04060RLM0217388	026199	

JGEN32-

Labor: \$4,260.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$4,260.00
-------------------	---------------	--------------	--------------	-----------------------

INVOICE CONTAINS \$88.87 DISCOUNT

Miscellaneous Charges:
 SERVICE ACCESSORIES

\$150.00

Customer PO No:
 Tax Exempt No:
 Advisor:

Job Total: \$44,911.32
Grand Total: \$44,911.32

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: _____ Date: _____

003-33



PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Presceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3320316
		Invoice Date:	1/23/2025
		Location:	11
		Work Order Number:	476148
		Payment Type:	
		Page:	1 of 14

Make/Model:	Meter:	Serial Number:	Eq ID	Fleet No:
JOHN DEERE R4060 CF 132' 1600GLEA 800/	1107	1N04060RLM0217388	026199	

JGLSPR NOWET JD ALL**COMPLAINT:**

SPRAYER VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER. WET TESTING SOLUTION SYSTEM NOT INCLUDED.

CORRECTION:

SELF PROPELLED SPRAYER VALUEMAX GREEN LIGHT INSPECTION CHECKOVER

NOTE: SPRAY TANK MUST BE RINSED AS WELL AS BOOMS WASHED
OFF BEFORE SPRAYER IS BROUGHT INTO SHOP.
IF NOT ADDITIONAL CHARGES WILL APPLY.

ENGINE HOURS 1107

DOES THIS UNIT GET A VALUEMAX STICKER X YES
HAS THE STICKER BEEN INSTALLED X YES
CAB HAS BEEN COMPLETELY CLEANED BP (INITIAL)
THIS UNIT HAS HAD A FINAL CHECKOVER MB (INITIAL)
THIS UNIT HAS HAD A COMPLETE GREASE JOB MB (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMER'S INSTRUCTIONS:

SEE ATTACHED QUOTE

WARRANTY DATES ON REPAIRS COMPLETED:

START: APRIL 1, 2025

END: APRIL 1, 2026

Job Total: **\$1,725.00**

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No	Deliver To:	Invoice Number: 3320316 Invoice Date: 1/23/2025 Location: 11 Work Order Number: 476148 Payment Type: Page: 2 of 14
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
Make/Model:	Meter:	Serial Number:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388
		Eq ID: 026199
		Fleet No:

JSOFTWARE JD R4060

COMPLAINT:
UPDATE ALL CONTROLLER SOFTWARE

CORRECTION:
UPDATED STARFIRE 6000 RECEIVER AND GEN 4 DISPLAY

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JTOPCOOLANT JD ALL

COMPLAINT:
TOP UP COOLANT.

CORRECTION:
TOPPED UP COOLANT

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26575	COOL-GARDII 3.78L 50/50 PREMIX	1.00	26.48	26.48	\$26.48	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF25	ENVIRO FEE	1.00	0.25	0.25	\$0.25	N
Labor: \$25.00	Parts: \$26.48	OL&M: \$0.00	Misc: \$0.25	Sub-Total: \$51.73		

JGEN08-

COMPLAINT:
HYDRAULIC PUMP PRESSURE HOSE LEAKING

CORRECTION:
REMOVED LEAKING HOSE AND INSTALLED NEW HOSE WITH NEW O-RINGS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK41764	Hydraulic Hose	1.00	1,054.02	1,054.02	\$1,054.02	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3320316
		Invoice Date:	1/23/2025
		Location:	11
		Work Order Number:	476148
		Payment Type:	
		Page:	3 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	



JGEN08-
T76938 O-RING 2.00 4.86 4.86 \$9.72 N

Labor: \$300.00 Parts: \$1,063.74 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,363.74

JGEN09-
COMPLAINT:
LEAKING HOSES ON THE STEERING VALVE

CORRECTION:
TILTED HOOD FORWARD.
REMOVED INTAKE PIPE TO GAIN ACCESS TO STEERING VALVE.
FOUND THE ONE HOSE THAT IS LEAKING HAS A SPECIAL END SO HAD TO ORDER THAT HOSE.
REMOVED HOSE.
INSTALLED NEW HOSE WITH NEW O-RINGS

FOUND THE HOSE ON THE BACK OF THE STEERING VALVE WAS LEAKING AT THE FITTING.
REMOVED HOSE.
REMOVED FITTING.
REPLACED O-RINGS AND REINSTALLED FITTING.
INSTALLED HOSE.
INSTALLED INTAKE PIPE AND HOOD.

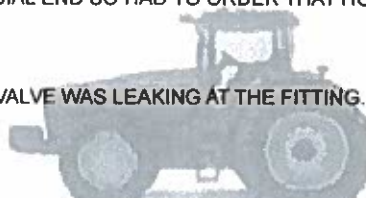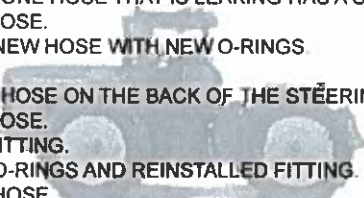

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
51M7040	O-RING M12	1.00	4.10	4.10	\$4.10	N
51M7043	O-RING	1.00	4.85	4.85	\$4.85	N
AKK15371	Hydraulic Hose	1.00	234.57	234.57	\$234.57	N
T77613	-6FF O-ring	1.00	3.24	3.24	\$3.24	N
T77857	-8FF O-ring	1.00	3.30	3.30	\$3.30	N

Labor: \$800.00 Parts: \$250.06 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,050.06

JGEN10-
COMPLAINT:
CAB NOT PRESSURIZING

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3320316
		Invoice Date:	1/23/2025
		Location:	11
		Work Order Number:	476148
		Payment Type:	
		Page:	4 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	

JGEN10-

CORRECTION:

TURNED ON FAN AND CHECKED AROUND CAB FOR AIR LEAKS.
FOUND THE BACK CORNERS WERE LEAKING.
SILICONED THE AREAS.
TESTED AND IT WAS A BIT BETTER BUT NOT GOOD ENOUGH.
REMOVED ROOF CAP.
THE A/C LINES WERE NOT QUITE ALIGNED CORRECTLY WHERE THEY ENTER THE CAB CAUSING A LEAK.
ADJUSTED LINES.
INSTALLED ROOF CAP.
TESTED AND IT IS PRESSURIZING NOW.

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
-----------------	---------------	--------------	--------------	---------------------

JTREADADJ1 JD R4060

COMPLAINT:
ADJUST AXLE TREAD ADJUST SHIMS. FRONT AND REAR

CORRECTION:

RAISED WHEEL FROM GROUND
ADJUSTED TREAD ADJUST WIDTH ON WHEEL STATION TO 70 INCHES
REMOVED ADJUSTING SCREWS AND FIXED WEDGE SCREWS ONE AT A TIME AND COATED WITH NEVER SEIZE
REINSTALLED FIXED WEDGE BOLTS BUT LEFT LOOSE TO ALLOW WEDGE TO SHIFT TO CORRECT POSITION
REINSTALLED ADJUSTING SCREWS AND TORQUED TO 105 FT LBS
TORQUED FIXED WEDGE SCREWS TO 184 FT LBS
BACKED OFF ADJUSTING SCREWS 1/6TH OF A TURN
TORQUED JAM NUTS TO 350 FT LBS

REPEATED FOR ALL FOUR WHEEL STATIONS
CHECKED OPERATION OF TREAD ADJUST
CALIBRATED SENSORS IF NECESSARY

Labor: \$500.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$500.00
-----------------	---------------	--------------	--------------	---------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3320316
		Invoice Date:	1/23/2025
		Location:	11
		Work Order Number:	476148
		Payment Type:	
		Page:	5 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	

JWHLTOEADJ JD R4060

COMPLAINT:

ADJUST FRONT WHEEL TOE

CORRECTION:

REPHASED STEERING CYLINDERS

ADJUSTED TOE IN TO SPEC

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
-----------------	---------------	--------------	--------------	---------------------

JGEN14-

COMPLAINT:

RESEAL FULL BOOM BREAKAWAY CYLINDER

CORRECTION:

RELEASED HYDRAULIC PRESSURE ON FULL BOOM BREAKAWAY CYLINDER

REMOVED HOSES AND PINS AND REMOVED CYLINDER

DRAINED OIL FROM CYLINDER

DISASSEMBLED CYLINDER AND FOUND THE SEAL KITS WERE WRONG

WENT TO PARTS TO GET CORRECT SEAL KITS AND THE PART NUMBER ON THE CYLINDER DOESN'T MATCH THIS SPRAYER

THERE IS NO SEAL KITS AVAILABLE FOR THIS CYLINDER

TALKED TO TYREL AND TODD AND DECIDED TO ORDER A NEW CYLINDER

SWAPPED FITTINGS TO NEW CYLINDER

INSTALLED NEW CYLINDER

BLEED AIR OUT OF CYLINDER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AHC21565	Hydraulic Cylinder	1.00	1,168.47	1,168.47	\$1,168.47	N

Labor: \$700.00	Parts: \$1,168.47	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,868.47
-----------------	-------------------	--------------	--------------	-----------------------

J21130104 JD R4060

COMPLAINT:

BOOM BREAKAWAY, ADJUST (LH SIDE)

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preaceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: 3320316
Invoice Date: 1/23/2025
Location: 11
Work Order Number: 476148
Payment Type:
Page: 6 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	

J21130104 JD R4060

CORRECTION:
ADJUSTED BOOM BREAKAWAY

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
-----------------	---------------	--------------	--------------	---------------------

JSOLUGAUGE JD R4060

COMPLAINT:
REPLACE SOLUTION TANK SIGHT GAUGE

CORRECTION:
REMOVED MOUNTING CLAMPS.
REPLACED SIGHT GAUGE TUBE.
INSTALLED REMOVED HARDWARE.
FUNCTIONED AND LEAK TESTED.
REPEATED FOR SECOND SIGHT GAUGE TUBE.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
PMK010-1216	3/4" Clear PVC /ft	12.00	3.54	3.54	\$42.48	N
Labor: \$140.00		Parts: \$42.48	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$182.48	

JRINSEGAUGE JD R4060

COMPLAINT:
REPLACE RINSE TANK SIGHT GAUGE

CORRECTION:
REMOVED MOUNTING CLAMPS
REPLACED SIGHT GAUGE TUBE
INSTALLED REMOVED HARDWARE
FUNCTIONED AND LEAK TESTED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3320316
		Invoice Date:	1/23/2025
		Location:	11
		Work Order Number:	476148
		Payment Type:	
		Page:	7 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	

JRINSEGAUGE JD R4060

PMK010-1216	3/4" Clear PVC /ft	4.00	3.54	3.54	\$14.16	N
-------------	--------------------	------	------	------	---------	---

Labor: \$140.00	Parts: \$14.16	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$154.16
------------------------	-----------------------	-------------------------	---------------------	----------------------------

JGEN20-

COMPLAINT:

REPLACE EXACT APPLY PLUNGER

CORRECTION:

REPLACED LEAKING EXACT APPLY PLUNGER ON THE RIGHT SIDE OF THE BOOM

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK57869	VALVE	1.00	97.91	97.91	\$97.91	N

Labor: \$100.00	Parts: \$97.91	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$197.91
------------------------	-----------------------	-------------------------	---------------------	----------------------------

JGEN15-

COMPLAINT:

ADJUST INNER FOLD CYLINDERS

CORRECTION:

ADJUSTED INNER FOLD CYLINDERS SO CENTER BOOM FRAME WAS TILTED FORWARD SO IT WOULD NO LONGER HIT ON THE BOTTOM.

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

J21001051 JD R4060

COMPLAINT:

REMOVE AND CLEAN ALL SOLUTION STRAINERS.

CORRECTION:

REMOVED ALL SOLUTION STRAINERS.
CLEANED STRAINERS AND INSTALLED.

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3320316
		Invoice Date:	1/23/2025
		Location:	11
		Work Order Number:	476148
		Payment Type:	
		Page:	8 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	

J21001051 JD R4060

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JENGAIRFILT JD R4060

COMPLAINT:
REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS

CORRECTION:
REPLACED ENGINE AIR FILTERS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AN403918	Primary Eng Air Filter	1.00	309.14	309.14	\$309.14	N
AN403919	AIR FILTER	1.00	268.81	268.81	\$268.81	N
Labor: \$50.00	Parts: \$577.95	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$627.95		

JENGOILCHNG JD R4060

COMPLAINT:
REPLACE ENGINE OIL AND FILTER

CORRECTION:
WARMED UP ENGINE.
DRAINED ENGINE OIL.
REPLACED ENGINE OIL FILTER.
FILLED WITH NEW ENGINE OIL.
RAN ENGINE.
TOPPED UP OIL.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE509672	FILTER ELE	1.00	49.00	49.00	\$49.00	N
TY26673	15W40 3.78L Plus-50II CK4/SN	1.00	37.78	37.78	\$37.78	N
TY26675	PLUS-50 II 15W-40 CK4/SN JUG 9.46L	1.00	89.73	89.73	\$89.73	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3320316 Invoice Date: 1/23/2025 Location: 11 Work Order Number: 476148 Payment Type: Page: 9 of 14
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	

JENGOILCHNG JD R4060

TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	1.00	170.86	170.86	\$170.86	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF150	ENVIRO FEE	1.00	1.50	1.50	\$1.50	N
EF300	ENVIRO FEE	1.00	3.00	3.00	\$3.00	N
EF50	ENVIRO FEE	1.00	0.55	0.55	\$0.55	N
EF60	ENVIRO FEE	1.00	0.60	0.60	\$0.60	N

Labor: \$100.00 Parts: \$347.37 OL&M: \$0.00 Misc: \$5.65 Sub-Total: \$453.02

J21001090 JD R4060

COMPLAINT:
REPLACE ENGINE FUEL FILTERS

CORRECTION:
REPLACED ENGINE FUEL FILTERS.
BLED FUEL SYSTEM.
RAN ENGINE AND CHECKED FOR LEAKS.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ112918	FINAL FUEL FILTER	1.00	236.54	236.54	\$236.54	N
DZ130550	FILTER ELE	1.00	232.82	232.82	\$232.82	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N

Labor: \$70.00 Parts: \$469.36 OL&M: \$0.00 Misc: \$2.50 Sub-Total: \$541.86

JHYDOILCHG JD R4060

COMPLAINT:
REPLACE HYDRAULIC OIL AND FILTERS.

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

		Invoice Number:3320316 Invoice Date:1/23/2025 Location:11 Work Order Number:476148 Payment Type: Page:10 of 14
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	

JHYDOILCHG JD R4060

DRAINED HYDRAULIC RESERVOIR.
REPLACED HYDRAULIC FILTER.
REPLACED HYDROSTATIC FILTER.
REPLACED HIGH PRESSURE HYDRAULIC FILTER.
INSTALLED NEW OIL.
CHECKED AND ADJUSTED LEVEL AS REQUIRED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK23814	Hydraulic Filter	1.00	315.21	315.21	\$315.21	N
AKK25690	FILLER CAP	1.00	87.24	87.24	\$87.24	N
AT318160	OIL FILTER	1.00	209.99	209.99	\$209.99	N
KK49213	HYDRAULIC	1.00	163.52	163.52	\$163.52	N
KK49221	O-Ring	1.00	59.10	59.10	\$59.10	N
TY26797	10W30 18.9L Torq-Gard CJ4/SM	5.00	144.33	144.33	\$721.65	N
Miscellaneous						
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N
EF300	ENVIRO FEE	5.00	3.00	3.00	\$15.00	N
Labor: \$210.00		Parts: \$1,556.71	OL&M: \$0.00	Misc: \$17.50	Sub-Total: \$1,784.21	

JHUBMAINT JD

COMPLAINT:
SPRAYER PLANETARY MAINTENANCE.

CORRECTION:
DRAINED PLANETARY WHEEL HUB OIL.
REMOVED PLANETARY HUB COVERS.
REMOVED AND SWAPPED INTERNAL GEARS.
INSTALLED HUB COVERS.
INSTALLED NEW PLANETARY OIL.
FUNCTION AND LEAK CHECKED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarras, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3320316 Invoice Date: 1/23/2025 Location: 11 Work Order Number: 476148 Payment Type: Page: 11 of 14
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	

JHUBMAINT JD

N306339	O-RING	4.00	20.91	20.91	\$83.64	N
TY26372	SYN GL-5 80W-140 BOTTLE 946ml	10.00	47.83	47.83	\$478.30	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF15	ENVIRO FEE	10.00	0.15	0.15	\$1.50	N

Labor: \$400.00 Parts: \$561.94 OL&M: \$0.00 Misc: \$1.50 Sub-Total: \$963.44

JGEN27-

COMPLAINT:

CLEAN AUTO TRAC STRAINER

CORRECTION:

REMOVED HOSE FROM STRAINER FITTING.
REMOVED AND CLEANED STRAINER FITTING.
INSTALLED HOSE.
CLEANED OFF OIL.



Labor: \$100.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$100.00

JCABFILTER JD R4060

COMPLAINT:

REPLACE CAB AIR FILTERS

CORRECTION:

REPLACED CAB AIR FILTERS.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
RE333567	CabFreshFilter Carbon	1.00	690.56	690.56	\$690.56	N
RE333569	CabRecircFilter Carbon	1.00	612.06	612.06	\$612.06	N

Labor: \$50.00 Parts: \$1,302.62 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,352.62

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preecerville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number:	3320316
Invoice Date:	1/23/2025
Location:	11
Work Order Number:	476148
Payment Type:	
Page:	12 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	

J21001008 JD R4060

COMPLAINT:

REPLACE AIR DRYER CARTRIDGE FILTER

CORRECTION:

REPLACED AIR DRYER CARTRIDGE.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK11031	Air Dryer Cartridge	1.00	320.43	320.43	\$320.43	N
Labor: \$35.00		Parts: \$320.43	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$355.43	

JGEN05-

COMPLAINT:

TIGHTEN HOSE CLAMP ON HYDRAULIC TANK.

CORRECTION:

TIGHTENED CLAMPS ON LEAKING SUCTION HOSE ON FRONT OF HYDRAULIC RESERVOIR.
CLEANED OFF OIL.

Labor: \$50.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$50.00
----------------	---------------	--------------	--------------	--------------------

JGEN28-

COMPLAINT:

CHANGE SHRAEDER VALVES AND CHECK TIRE PRESSURES

CORRECTION:

BOTH LEFT TIRES WERE LEAKING FROM THE VALVE STEM.
REPLACED VALVE STEMS.
FILLED TIRES WITH AIR.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2672	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3320316
		Invoice Date:	1/23/2025
		Location:	11
		Work Order Number:	476148
		Payment Type:	
		Page:	13 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	

JGEN28-

AT25226	TIRE VALVE	2.00	22 62	22 62	\$45.24	N
Labor: \$100.00		Parts: \$45.24	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$145.24	

J21070102 JD R4060

COMPLAINT:

HYDRO DRIVE MOTOR REAR FORWARD PROPEL HOSE, REPLACE (RIGHT REAR)

CORRECTION:


REMOVED HOSE CLAMPS.

REMOVED LEAKING HYDRO DRIVE HOSE.

INSTALLED NEW HOSE WITH NEW O-RINGS.

INSTALLED CLAMPS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AKK33877	Hydro Hose -Rear FWD Propel	1.00	1,031.58	1,031.58	\$1,031.58	N

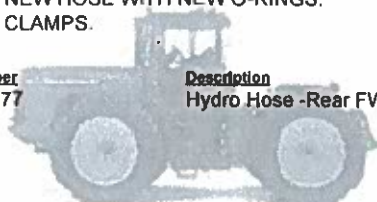

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
P.O. Box 248
Yorkton, SK S3N 2V7
Phone: (306) 783-9459
Fax: (306) 783-7177
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3320316
		Invoice Date:	1/23/2025
		Location:	11
		Work Order Number:	476148
		Payment Type:	
		Page:	14 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE R4060 CF 132' 1600GL EA 800/	1107	1N04060RLM0217388	026199	

J21070102 JD R4060
T78313 -16_6xFlg O-ring 2.00 8.03 8.03 \$16.06 N

Labor: \$600.00 Parts: \$1,047.64 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,647.64

Miscellaneous Charges:
SERVICE ACCESSORIES \$150.00

Customer PO No:
Tax Exempt No:
Advisor:

Job Total: \$16,864.96
Grand Total: \$16,864.96

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: