PO3-1

NEW WEST TRUCK CENTRES

Lethbridge
1001 41 ST. NORTH
LETHBRIDGE, AB T1H 6J3
P: (403) 327-7611

BODYSHOP
6533 79th AVE SE
CALGARY, AB T2C 4S6
P: (825) 257-5782

SERVICE ORDER: R103006528
ESTIMATE: E103002639
Tag Number:
License Plate Number:

BILL TO
ANDREW SLOMP - 17989
LETHBRIDGE AB T1H 6J3
P: (780) 779-1015

DELIVER TO
ANDREW SLOMP - 17989
LETHBRIDGE AB T1H 6J3
P: (780) 779-1015

DATE INVOICE	SALES TYPE	ADVISOR	TERMS	PO #
	SRET	3307	CASH	

YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	ENGINE HOURS	IN SERVICE	Component Serial #	ODOMETER
2017	FREIGHTLINER	CASCADIA 113	3AKJGHDV8HSJA4789	#004	0	8/16/2009		0

Sold Operations

JOB #1 MILEAG| PLEASE OBTAIN CURRENT MILEAGE & ENGINE HOURS FOR UNIT

COMPLAINT PLEASE OBTAIN CURRENT MILEAGE & ENGINE HOURS FOR UNIT
CAUSE
CORRECTION

QTY	ITEM

UNIT PRICE	EXTD PRICE

Misc: Sublet:

NEW WEST FREIGHTLINER
1001-41ST ST NORTH T1H6J3
LETHBRIDGE AB
21490409
QB2149040901

SALE

06-26-2024 17:50:04
Acct # [redacted] C
Exp Date **/** Card Type [redacted]
[redacted]

Trace # [redacted]
Inv. # 103006528
Auth # [redacted] RRN 001957011

Sale $9,000.00

TOTAL $9,000.00

++++++++++++++++++++++++++
001 APPROVED-THANK YOU
++++++++++++++++++++++++++

Retain this copy for your records
Customer copy

NEW WEST FREIGHTLINER
1001-41ST ST NORTH T1H6J3
LETHBRIDGE AB
21490409
QB2149040901

SALE

06-26-2024 17:54:56
[redacted] C
Exp Date **/** Card Type [redacted]
[redacted]


Trace # [redacted]
Inv. # [redacted]
Auth # [redacted] RRN 001957012

Sale $4,040.67

TOTAL $4,040.67

++++++++++++++++++++++++++
001 APPROVED-THANK YOU
++++++++++++++++++++++++++

Retain this copy for your records
Customer copy

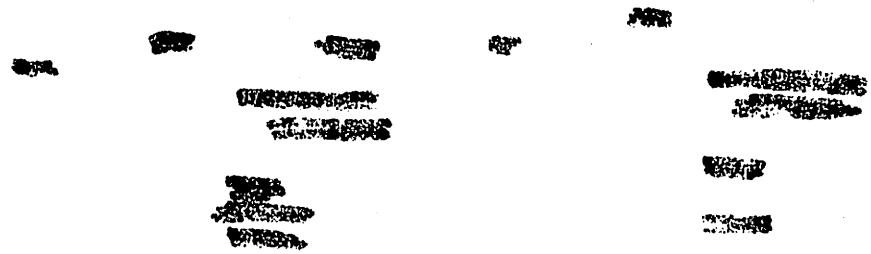

NEW WEST TRUCK CENTRES

SERVICE ORDER: R103006528
ESTIMATE: E103002639

Sold Operations (Cont.)

JOB #2 99-0 ***MISCELLEANOUS***

COMPLAINT REPLACE ONE BOX AND PERFORM VERIFICATION TESTING
CAUSE ONE BOX REPLACEMENT
CORRECTION 3317 - REMOVED RHS STEPS AND COVER
-REMOVED STEP BRACKETS
-REMOVED EXHAUST PIPES AND CONNECTORS FROM 1-BOX
-REMOVED 1-BOX
3317 - REMOVED ALL SENSORS, HAD TO HEAT UP EACH SENSOR EXCEPT FOR SOOT SENSOR AND INLET NOX SENSOR
-ALL OTHER SENSORS DAMAGED UPON REMOVAL AND CAN NOT BE REUSED
-REMOVED HARNESS
-REMOVED ALL BRACKETS
-REMOVED HEAT SHIELDS
-REMOVED DPFS
-INSTALLED ALL REMOVED COMPONENTS TO NEW 1-BOX
-INSTALLED NEW TEMP SENSORS, AND NEW OUTLET NOX SENSOR
-INSTALLED 1-BOX ONTO UNIT AND TIGHTENED ALL MOUNTING BOLTS
-INSTALLED EXHAUST PIPES USING NEW CLAMPS
3317 - REINSTALLED STEPS AND COVERS
-CONNECTED DIAGNOSTIC LINK AND PERFORMED SCR REPLACEMENT ROUTINE, RECORDED NEW SERIAL NUMBER OF SCR UNIT

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
8.00	LABOR 99-0	REPLACE ONE BOX AND PERFORM VERIFICATION TES		1,279.60
1.00	103D/DDE EA6804901356	DOC/SCR - AFTERTREATMENT ASSEM	13,483.72	13,483.72
1.00	103D/DDE EA6804901356-CORE	DOC/SCR - AFTERTREATMENT ASSEM	812.50	812.50
10.00	103D/DDE A0049941645	SPRING NUT, DPF COVER	4.33	43.30
10.00	103D/DDE N910143006001	SCREW, M6X16	3.24	32.40
2.00	103D/DDE A0004902241	EXH CLAMP	193.87	387.74
2.00	103D/DDE A6809950202	CLAMP, V-BAND, DPF	82.46	164.92
1.00	103D/DDE A6805402117	SENSOR, TEMPERATURE, DOC IN, S	65.68	65.68
1.00	103D/DDE A6805402417	SENSOR, DOC INLET TEMPERATURE	79.57	79.57
1.00	103D/DDE A6805402117	SENSOR, TEMPERATURE, DOC IN, S	65.68	65.68
1.00	103D/DDE A6805401317	SENSOR - EXHAUST GAS TEMPERATU	82.46	82.46
2.00	103D/DDE A0019959702	CLAMP - GENERAL	67.26	134.52
1.00	103D/DDE A6804913737	TUBE, ATS PRESSURE	47.88	47.88
1.00	FRT	FREIGHT	25.00	25.00
6.00	103D/DDE N910143006001	SCREW, M6X16	3.24	19.44
6.00	103D/DDE A0049941645	SPRING NUT, DPF COVER	4.33	25.98
3.00	103D/DDE A0019909403	SCREW, DEF DOSING UNIT, 16MM	9.55	28.65
2.00	103D/23-13241-000	STRAP-TIE,STAINLESS,ST	9.63	19.26
1.00	103D/DDE A0001421180	GASKET, DEF DOSING UNIT	24.00	24.00
1.00	103D/DDE EA0101538128	NOX SENSOR, OUTLET	564.97	564.97
1.00	103D/DDE EA0101538128-CORE	NOX SENSOR, OUTLET	162.50	162.50
-1.00	103D/DDE EA6804901356-CORE	DOC/SCR - AFTERTREATMENT ASSEM	812.50	-812.50

Prepay: $0.00 Parts: $15,432.67 Labor: $1,279.60 Misc: $25.00 Sublet: $0.00 $16,737.27

Sold Operations (Cont.)

JOB #9 99-0 ***MISCELLEANOUS***

COMPLAINT HOOK UP DDE CONNECT WITH CUSTOMER SUPPLIED BOX

CAUSE

CORRECTION 3317 - REVIEWED FIELD SERVICE CAMPAIGN THAT WAS PROVIDED WITH HOTSPOT BOX FROM CUSTOMER
-THIS SERVICE CAMPAIGN IS FOR THE P4 CASCADIA WITH A CTP MODULE
-WILL NEED POWER CABLE FOR HOTSPOT BOX TO BE ABLE TO POWER UP
-ALSO UNSURE IF UPDATE ON CTP CAN BE PERFORMED AS IT DOES NOT COME UP ON DIAGNOSTIC LINK
ROLL CALL FOR CTP

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.00	LABOR 99-0	HOOK UP DDE CONNECT WITH CUSTOMER SUPPLIED I		0.00

Prepay: $0.00 Parts: $0.00 Labor: $0.00 Misc: $0.00 Sublet: $0.00 $0.00

Sold Operations (Cont.)

JOB #10 077 **CAB TILT CYLINDER REPAIR OR REPLACE**

COMPLAINT REPLACE CYLINDER HEAD
CAUSE VALVES RECEDING ON HEAD
CORRECTION 3302

-DRAINED COOLANT, RAIN TRAY, REMOVED THE ENGINE AIR FILTER HOUSING, REMOVED HOUSING BRACKETS AND WATER MANIFOLD BRACKET, REMOVED DEF COOLANT LINES, REMOVE COMPRESSOR RESONATOR LINE, USED HEAT ON THE LARGE COOLANT FITTING ON THE EGR, COULD NOT BREAK FREE, HAD TO REMOVE CONNECTED COOLANT LINES TO SPIN OFF, REMOVED THE SURGE TANK AND REMOVED THE ROCKER COVER

-REMOVED CRANK POSISTION SENOR, TURNED ENGINE TO TDC 1 AND PINNED ENGINE, INSTALLED TIMING TOOL ON CAM GEARS, REMOVED ALL THE INJECTOR AND HIGH PRESSURE FUEL LINES, CAPPED ANY EXPOSE PORTS, REMOVED ALL INJECTOR HOLD DOWN BOLTS AND PULLED ALL INJECTORS KEEPING THEM IN ORDER, REMOVED ALL CAM HOUSING BOLTS EXCEPT 14/15/16/17, TURNED THE REMANAING BOLTS A HALF TURN UNTIL THE CAM WAS RELEASED, RIGGED UP CRANE AND PULLED THE CAM HOUSING AND PLACE ON BLOCKS

REMOVED THE TURBO MOUNT BOLTS, COOLANT LINES AND EGR ACTUATOR ARM, REMOVED THE AIR INTAKE MANIFOLD PIPING AND RAD SUPPORTS, DISCONNECTED ENGINE HARNESS, REMOVED HEAD BOLTS, RIGGED UP CRANE AND REMOVED THE HEAD, CAPPED OFF ALL OIL PASSAGE

-CLEANED THE BLOCK, CLEANED THE HEAD BOLT HOLE THREADS, SWAPPED OVER THE AIR MANIFOLD, EXHAUST MANIFOLD AND EGR COOLER/WATER MANIFOLD INSTALLING NEW GASKETS AND TORQUING TO SPEC, WIPED HEAD CLEAN, PLACED HEAD GASKET DOWN AND WITH ASSISTANCE PLACED HEAD ON BLOCK, INSTALLED HEAD BOLTS AND TORUQED TO SPEC IN SEQUENCE, INSTALLED ALL PREVSOULY MENTIONED ITEMS

-CLEANED CAM HOUSING AND INSTALLED NEW GASKET, WITH ASSISTANCE PLACES CAM HOUSING ON HEAD LINING UP TIMING MARKS, PULLED CAM HOUSING DOWN SLOWLY AND VERIFIED TIMING, TORUQED CAM HOUSING BOLTS TO SPEC IN SEQUENCE

-ON TDC 1 ADJUSTED INTAKE VALVES 1,2,4 AND EXHAUST 1,3,5, TURNED ENGINE TO TDC 6 AND ADJUSTED INTAKE VALVES 3,5,6 AND EXHAUST 2,4,6, WITH A HELPER TURING THE ENGINE OVER ADJUSTED THE ENGINE BRAKES

-INSTALLED NEW O-RINGS ON THE INJECTOR, PLACED INJECTORS IN THE CAM HOUSING, INSTALLED INJECTOR FUEL LINES AND SEALS FOLLOWING THE TORQUE PROCEDURE, INSTALLED NEW HIGH PRESSURE FUEL LINES AND SECURED, INSTALLED ALL PREVIOULSY REMOVED ITEMS ON THE CAM HOUSING, ZIP TIED ANY LOOSE LINES

-PRIMED THE FUEL SYSTEM AND VAC FILLED THE COOLANT SYSTEM, STARTED UNIT AND RAN UP TO TEMP, INSPECTED FOR LEAKS AND REPAIRED AS NEEDED, INSTALLED ANY PREVIOUS ITEMs NOT INSTALLED

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.00	LABOR 1-0	REPLACE CYLINDER HEAD		
1.00	SHOP	UNFORSEEN DEFICIENCIES UPON DISASSEMBLY		
1.00	103D/DDE A4720162020	C/HD GSKT KT		
1.00	103D/DDE A4711420180	SEAL (METAL		
1.00	103D/DDE A4711420280	SEAL (METAL		
1.00	103D/DDE A4712030680	GASKET - WATER MANIFOLD		
1.00	103D/DDE A4712030780	GASKET - WATER MANIFOLD		
1.00	103D/DDE A4722000154	COUPLING - WATER MANIFOLD		
1.00	103D/DDE A0019950502	CLAMP - EGR PIPE		
1.00	103D/DDE A4710780510	FUEL LINE KT		
1.00	103D/DDE A4710960380	METAL SEAL		
1.00	103D/DDE RA4710108420	CYLINDER HEAD		
1.00	103D/DDE RA4710108420-CORE	CYLINDER HEAD		
27.00	LABOR 077	REPLACE CYLINDER HEAD		
6.00	103D/DDE A4720980080	MOUNTING SEAL, INTAKE MANIFOLD		
1.00	103D/DDE A4712031180	GASKET - OUTLET, WATER		
1.00	103D/DDE A0309979045	O-RING, CYLINDER HEAD CLOSING		

Sold Operations (Cont.)

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
2.00	103D/DDE N000000001071	SEALING RING - GENERAL USE		
38.00	103D/DDE A4710160069	MOUNTING BOLT, CYLINDER HEAD		
1.00	103D/DDE A4711403046	PULL ROD		
1.00	103D/DDE A0049908450	HEX NUT, ML		
4.00	103D/DDE A0219901101	MOUNTING BOLT, TURBOCHARGER		
2.00	103D/DDE N000000001069	SEALING RING, M14		
2.00	103D/DDE N000000001069	SEALING RING, M14		
1.00	103D/03-35804-000	ISOLATOR-AIR CLEANER,FRONT		
10.00	103D/GRO 85 6021	STANDARD TIE WRAP, 11 3/4In *D		
5.00	103D/GRO 85 6029	HEAVY DUTY TIE WRAP, 15 1/4 *D		
12.00	103X/74050	3.78 50/50 LONG LIFE COR-GAURD		
1.00	103D/BRZ CT 9416	CLAMP		
2.00	103X/DG	DEGREASER		
-1.00	103D/DDE RA4710108420-CORE	CYLINDER HEAD		

JOB #11 23U-0000 DEF LINE REPAIR OR REPLACE

COMPLAINT REPLACE DEF TANK COOLANT SUPPLY LINES
CAUSE DEF COOLANT LINES PASSED SERVICE LIFE
CORRECTION 3302
-WITH COOLANT DRAINED, REMOVED ALL P-CLAMPS AND ZIP TIES FROM THE BACK OF THE ENGINE AND TOP OF THE TRANSMISSION, REMOVED OLD LINES, RAN NEW LINES FOLLOWING THE PROPER ROUTE, SECURED LINES WITH P-CLAMPS AND CONNECTED ENDS

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.00	103D/A04-31528-461	TUBE ASSY-COOLANT DD13 RETURN		
1.00	103D/A04-31291-472	TUBE ASSY-COOLANT DD13 SUPPLY		
10.00	103D/TYC DCT110HIR	TIE STRAP		
7.10	LABOR 23U-0000T	REPLACE DEF TANK COOLANT SUPPLY LINES		
5.00	103D/GRO 85 6029	HEAVY DUTY TIE WRAP, 15 1/4 *D		

JOB #12 154 ELECTRICAL AND ELECTRONIC SYSTEM REPAIRS

COMPLAINT INSTALL 3-4G CONVERTER KIT
CAUSE CUSTOMER REQUEST
CORRECTION 2024-06-14 10:38:46
3317 - LOCATED ZONAR INSIDE DASH
-MOUNTED THALES 4G CONVERTER BESIDE ZONAR
-FOLLOWED INSTRUCTIONS ON HOW TO INSTALL CONVERTER
-MOUNTED ANTENNAS AT LEAST 8 INCHES APART FROM EACH OTHER
-CONNECTED CONVERTER TO THE ZONAR BOX
-TESTED AND BOTH ZONAR AND CONVERTER LIGHT UP

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
2.40	LABOR 154	INSTALL 3-4G CONVERTER KIT		383.88

Prepay: $0.00 Parts: $0.00 Labor: $383.88 Misc: $0.00 Sublet: $0.00 $383.88

NEW WEST TRUCK CENTRES

SERVICE ORDER: R103006528
ESTIMATE: E103002639

Sold Operations (Cont.)

JOB #13 182 WINDSHIELD OR WIPER AND WASHER SYSTEM REPAIR

COMPLAINT REPAIR WIPER LINKAGE (DAMAGED DUE TO MALFUNCTIONING HOIST)
CAUSE DAMAGED WIPER ARM DUE TO CRANE FAILURE
CORRECTION 3302
-REMOVED OLD WIPER LINKGE, SWAPPED OVER WIPER ARM MOTOR AND MOUNTED NEW LINKAGE

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
0.90	LABOR 182	REPAIR WIPER LINKAGE (DAMAGED DUE TO MALFUN		
1.00	103D/TRI F91625 597	LINKAGE ASSEMBLY LESS MOTOR		

JOB #14 939-6040 ROAD TEST/REPAIR VALIDATION

COMPLAINT PERFORM ROAD TEST FOR REPAIR VERIFICATION
CAUSE REPAIR VERIFICATION
CORRECTION PERFORM PRETRIP AND EXTENDED ROAD TEST MONITORING ENGINE FUNCTIONS

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1.30	LABOR 939-6040A	PERFORM ROAD TEST FOR REPAIR VERIFICATION		

Sold Operations Totals **Prepay: $0.00 Parts: $15,432.67 Labor: $1,663.48 Misc: $25.00 Sublet: $0.00** **$17,121.15**

Authorization of Repairs & Warranty

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I herby grant you and/or your employees' permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. The dealership is not responsible for damages from freezing due to lack of antifreeze.

I agree that any warranty coverage noted on this statement of account is based solely on New West Truck Centres estimate of warranty coverage and that I remain responsible for any portion of the charges incurred which is shown as being covered by warranty if the warranty coverage is not accepted by the manufacturer and I agree that such rejected amount should be charged to my account and that I will promptly pay such amount.

PRINTED NAME _____ SIGNATURE _____

Pre-Work Disclaimer

I agree to receive New West Truck Centres newsletter containing news, updates and promotions regarding New West Truck Centres products. You can withdraw your consent at any time. Please refer to our Privacy Policy or contact us for more details.

X _____

Emissions Disclaimer

I agree this vehicle emissions system has not been defeated, modified or deleted. New West Truck Centres assumes no responsibility for damage to any aftermarket or modified component as a result of our diagnostics or repairs.

Do you authorize New West Truck Centres to undertake any no charge outstanding recalls, field service modifications or campaigns recommended by the manufacturer to the chassis or engine.

X _____

	ESTIMATED	BILLED
LABOR		$1,663.48
PARTS		$15,432.67
MISC		$25.00
SUBLET		$0.00
DEPOSIT		$0.00
SUBTOTAL		**$17,121.15**
SHOP SUPPLIES		$158.03
MISC SUPPLIES		$0.00
TAX		$863.96
TOTAL		**$18,143.14**

Please Remit Payment To:
New West Freightliner Inc.
5925 79 Ave SE
Calgary, AB T2C 5K3
GST#: 100731173