



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

DOI-68
NOV

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
REPRINT		
Date	Time	Page
04/04/25	23:04:31 (B)	01
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00707
Ship Via	Purchase Order	
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20	
	S790	1350	PCS161B965365		1750

Have you heard about MyDealer yet? We have a great new way to help you stay connected to your equipment. Either mobile or laptop - look up parts, order them online, view past purchases, or book a service appointment, you are in control. Ask a parts or service member about MyDealer today!

SEGMENT# 1 C 9673 FIELDREADY 11/19/24 02/25/25
SALES CERTIFIED USED PROGRAM - FIELD READY INSPECTION 22.00 HRS

*ONCE CHECKLIST IS COMPLETED PLEASE GO OVER WITH SALES FOR APPROVAL OF REPAIRS TO BE DONE.

*CONSULT SALES REGARDING SERVICES THAT HAVE BEEN COMPLETED ON COMBINE (EX. FILTERS, DAMAGED COMPONENTS,)

*CLEANING, PAINTING, AND ANY SERVICES ALL TO BE DONE ON SEPARATE W/O SEGMENTS

*BE SURE TO ATTACH COMPLETE CHECKLIST TO WORK ORDER

-INSTALL A BAG OF THE MOUSE FRAGRANCE TO THE CAB TO DETER RODENT INFESTATION

(See Horizon Ag & Turf Combine Certification document for full details on coverage that comes with this certification,

***** TECHNICIANS COMMENTS *****

*

*Completed Greenlight inspection. Noted all worn and

*damaged items. Submitted to service office.

*

LABOR 2999.00

16001001

SEGMENT TOTAL==> 2999.00


SEGMENT# 2 C 9670 10-000-003 11/19/24 03/11/25
TRADE COMBINE- CLEAN AND WASH EXTERIOR TIN WORK ONLY

5.00 HRS

CONTINUED ON PAGE 02

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing. Items left for 30 days after completion date will be subject to storage fees.

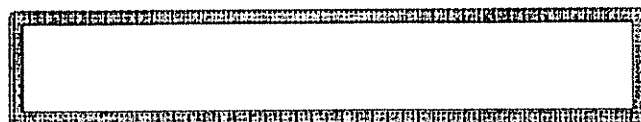

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
04/04/25	23:04:31 (B)	02
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00707
Ship Via	Purchase Order	
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20	
	S790	1350	PCS161B965365		1750

TOUCH UP PAINT ON COMBINE
LUBE ALL CHAINS
GREASE MACHINE ENTIRELY AFTER WASH
PARK IN LINE UP
DETAIL AS NEEDED

***** TECHNICIANS COMMENTS *****
*
*Cleaned as required.
*

SEGMENT# 3 C 9670 NA	03/03/25 03/04/25	
ENGINE ROTARY SCREEN:		2.50 HRS

ENGINE ROTARY SCREEN JACKSHAFT BEARINGS DRY
-REMOVE SHAFT AND REPLACE BEARINGS
ENGINE ROTARY SCREEN DRIVE BELT IDLER PULLEY SOUNDS DRY
-REMOVE AND REPLACE BEARINGS IN PULLEY

***** TECHNICIANS COMMENTS *****
*
*Removed rotary screen jack-shaft from in front of the
*cooling pack. R&R jack-shaft assembly with new bearings.
*Replaced bearing in drive belt tensioner pulley.
*Reinstalled rotary screen jack-shaft into unit. Reinstalled
*both belts.
*

AXE70716	Bearing With Ho	2 N	133.75	267.50
	Bearing With Housing			
JD8535	BEARING	1	10.34	10.34
			PARTS	277.84

CONTINUED ON PAGE 03

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

 INTERNAL CUSTOMER
 Horizon Ag & Turf
 Lloydminster AB T9V 3A2

Branch			
ST. PAUL			
Date	Time	Page	
04/04/25	23:04:31 (B)	03	
Account No.	Phone No.	Invoice No.	
INTER01A	7808754471	W00707	
Ship Via		Purchase Order	
		Salesperson	
		KK	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20	
	S790	1350	PCS161B965365		1750
				LABOR	450.00
	16001001			SEGMENT TOTAL==>	727.84

SEGMENT# 4 C 9670 NA 03/03/25 03/04/25 3.00 HRS

OVERSHOT GEARCASE:

OVERSHOT GEARCASE INPUT SEAL LEAKING

-REMOVE AND RESEAL GEARCASE.

OVERSHOT GEARCASE ISOLATOR POUNDED OUT

-REMOVE AND REPLACE ISOLATOR

***** TECHNICIANS COMMENTS *****

*
 *Removed pulley off of the overshot gearcase. Removed bolt
 *and retainer from end of discharge beater shaft. Removed
 *overshot gearcase isolator and removed gearcase from unit.
 *Washed oil and dirt residue from the gearcase. Replaced all
 *gearcase shaft seals and refilled gearcase with HD-460 gear
 *oil. Reinstalled overshot gearcase with new isolator.
 *Installed retainer and shaft nut. Reinstalled pulley onto
 *the gearcase and installed drive belt.
 *

DE20531	Seal	1 N	48.28	48.28
R35643	OIL SEAL	2	53.81	107.62
T41770	Isolator	1	74.16	74.16
	PARTS			230.06
	LABOR			540.00
	16001001		SEGMENT TOTAL==>	770.06

SEGMENT# 5 C 9670 NA 03/03/25 03/04/25


PRE CLEANER LOUVERS WORN OUT

4.00 HRS

CONTINUED ON PAGE 04

**A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
 (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.**

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,

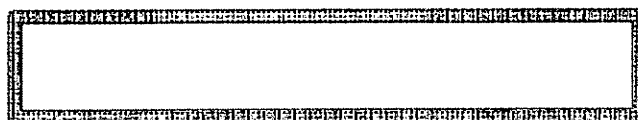

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

 INTERNAL CUSTOMER
 Horizon Ag & Turf
 Lloydminster AB T9V 3A2

Branch		ST. PAUL	
Date	Time	Page	
04/04/25	23:04:31 (B)	04	
Account No.	Phone No.	Invoice No.	
INTER01A	7808754471	W00707	
Ship Via		Purchase Order	
		Salesperson	
		KK	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20	
	S790	1350	PCS161B965365		1750

AND RHS INNER LOUVERS FALLING OUT

-REMOVE AND REPLACE ALL PRECLEANER SECTIONS (KIT).

***** TECHNICIANS COMMENTS *****

*

*Replaced damaged pre-cleaner elements with new ones from

*pre-cleaner kit. Set pre-cleaner louver gap.

*

BXE10692	Chaf. Adj.front	1 N	1810.31	1810.31
			PARTS	1810.31
			LABOR	720.00
16001001	SEGMENT TOTAL==>			2530.31

SEGMENT# 6 C 9670 NA 03/03/25 03/04/25

BELTS: 2.50 HRS

UPPER CHOPPER BELT CRACKED

-REPLACE BELT

INNER LOWER CHOPPER BELT CRACKED

-REPLACE BELT

VACUUM FAN BELT CRACKED

-REPLACE FAN BELT

***** TECHNICIANS COMMENTS *****

*

*Replaced upper chopper belt as required. Replaced inner

*lower chopper belt as required. Replaced vacuum fan drive

*belt. Reinstalled and tensioned all other belts on unit


*

HXE124868	BELT 3HC	1	692.07	692.07
HXE124869	V-Belt	1	692.86	692.86

CONTINUED ON PAGE 05

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
 (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

 INTERNAL CUSTOMER
 Horizon Ag & Turf
 Lloydminster AB T9V 3A2

Branch			
ST. PAUL			
Date	Time	Page	
04/04/25	23:04:31 (B)	05	
Account No.	Phone No.	Invoice No.	
INTER01A	7808754471	W00707	
Ship Via		Purchase Order	
		Salesperson	
		KK	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20	
	S790	1350	PCS161B965365		1750
HXE38073	VACUUM FAN BELT	1		30.78	30.78
				PARTS	1415.71
				LABOR	450.00
16001001			SEGMENT TOTAL==>		1865.71

SEGMENT# 7 C 9670 NA 03/03/25 03/11/25 3.00 HRS

HYDRAULIC LEAKS:

- REPLACE BRAKE SUPPLY HOSE LEAKING LHS AT MAIN VALVE BLOCK
- HYDRAULIC PUMP STARTING TO SWEAT FROM WEAP HOLE-WOULD LEAVE FOR NOW.
- REMOVE AND REPLACE PRESSURE LINE FROM HYDRAULIC PUMP LEAKING AT CRIMP
- TIGHTEN CLAMP ON SWEATING LOW PRESSURE MAIN LINE ON BOTTOM OF HYDRAULIC TANK


***** TECHNICIANS COMMENTS *****

- *Removed all P-clamps from break supply line. Disconnected
- *break supply line from valve block and break valve and
- *removed it from unit. Had a new line built. Routed new
- *break supply line and connected fittings. Reinstalled
- *P-clamps and tied up any loose sections of line. Set vacuum
- *up on hydraulic reservoir to limit oil loss. Removed
- *flanged from hydraulic pump and removed fitting off of main
- *valve block. Removed pump pressure line from unit.
- *Installed new line and connected fitting to main valve
- *block. Installed and tightened flanged on hydraulic pump.
- *Removed and put the vacuum away. Tightened all hose clamps
- *on supply lines from reservoir.

CONTINUED ON PAGE 06

 A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
 (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing. Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO

Branch		ST. PAUL	
Date	04/04/25	Time	23:04:31 (B)
Account No.	7808754471	Invoice No.	W00707
Ship Via		Purchase Order	
Salesperson		KK	

JD S790 PERSELY TRD - (805449) INTERNAL CUSTOMER Horizon Ag & Turf Lloydminster AB T9V 3A2

SERVICE INVOICE

STK#/FLEET#

JOHN DEERE S790

HRS PIN/EIN

WARRANTY DATE

HRS

S790

1350 PCS161B965365

10/03/20

1750

INST	4.00	4	16.00
T76938	4.68	1	4.68
T78313	10.16	1	10.16
X1J543-16-12	76.65	1	76.65
X1J543-6-8	27.70	1	27.70
X1J143-10-8	49.52	1	49.52
X11943-16-12	86.78	1 M	86.78
X487TC-12-RT	114.84	6	114.84
X487TC-8-RT	155.55	17	155.55
PARTS	541.88		541.88
LABOR	540.00		540.00
SEGMENT TOTAL==>	1081.88		1081.88

SEGMENT# 8 C 9670 NA

03/03/25 03/04/25

SOFTWARE AVAILABLE:

ARMREST, CAB, DISPLAY, GIM, LCL, LC2, PDU, PTP, RCL

-DOWNLOAD AND UPDATE SOFTWARE AS REQUIRED

***** TECHNICIANS COMMENTS *****

* * * * *

*Downloaded and updated software as required.

* * * * *

LABOR	270.00
SEGMENT TOTAL==>	270.00

SEGMENT# 9 C 9670 NA

03/03/25 03/04/25

CHAINS:

-REMOVE HALF LINK AND ADJUST TENSION OF FEEDER HOUSE DRIVE

-ADJUST CLEAN GRAIN ELEVATOR CHAIN

CONTINUED ON PAGE 07

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH

(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing. Inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing. Items left for 30 days after completion date will be subject to storage fees.

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch			
ST. PAUL			
Date	Time	Page	
04/04/25	23:04:31 (B)	07	
Account No.	Phone No.	Invoice No.	
INTER01A	7808754471	W00707	
Ship Via		Purchase Order	
		Salesperson	
		KK	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20	
	S790	1350	PCS161B965365		1750
-ADJUST TAILINGS ELEVATOR CHAIN					
-REPLACE TAILINGS DRIVE CHAIN					
-REMOVE LINK OR OFFSET/ADJUST UNLOAD AUGER DRIVE CHAIN					
***** TECHNICIANS COMMENTS *****					
* Adjusted and tensioned feeder house drive chain. Adjusted					
* clean grain elevator chain. Adjusted tailings elevator					
* chain. Replaced and tensioned tailings drive chain.					
* Adjusted and tensioned unload auger drive chain.					

AXE54619	CHAIN 60X114L	1	255.09	255.09	
11M7009	COTTER PIN	1	.32	.32	
11M7032	COTTER-3/16X2"	1	1.18	1.18	
	PARTS		256.59		
	LABOR		720.00		
16001001	SEGMENT TOTAL==>		976.59		


SEGMENT#10 C 9670 NA	03/03/25 03/06/25	
ROTOR BELT NEEDS ADJUSTING	1.50 HRS	
-ADJUST ROTOR SHEAVE GAP		
***** TECHNICIANS COMMENTS *****		
* Adjusted rotor belt sheave gap as required.		
* Note: Belt is nearing end of adjustment.		

	LABOR	270.00
16001001	SEGMENT TOTAL==>	270.00

CONTINUED ON PAGE 08

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing. Items left for 30 days after completion date will be subject to storage fees.



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

 INTERNAL CUSTOMER
 Horizon Ag & Turf
 Lloydminster AB T9V 3A2

Branch			
ST. PAUL			
Date	Time	Page	
04/04/25	23:04:31 (B)	08	
Account No.	Phone No.	Invoice No.	
INTER01A	7808754471	W00707	
Ship Via		Purchase Order	
		Salesperson	
		KK	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20	
	S790	1350	PCS161B965365		1750

SEGMENT#11 C 9670 NA 03/03/25 03/10/25
 SUNNYBROOK CONCAVE ELEMENTS PUSHED OUT 4.00 HRS
 -POUND BACK IN AND INSTALL CONCAVES
 -LEVEL AND ZERO

***** TECHNICIANS COMMENTS *****

*
 *Installed concaves back into unit. Followed leveling
 *procedure to level and zero concaves. Performed threshing
 *clearance calibration. Reinstalled shielding and separator
 *grates in unit.
 *

	LABOR	720.00
16001001	SEGMENT TOTAL==>	720.00

SEGMENT#12 C 9670 NA 03/03/25 03/06/25
 TORQUE REAR AXLE HARDWARE 1.00 HRS

***** TECHNICIANS COMMENTS *****

*
 *Torqued all rear axle hardware.
 *

	LABOR	180.00
16001001	SEGMENT TOTAL==>	180.00

SEGMENT#13 C 9673 NA 03/03/25 03/04/25
 ELEVATOR JACKSHAFT DRIVE BELT IDLER SOUNDS ROUGH 1.00 HRS
 -REPLACE IDLER


***** TECHNICIANS COMMENTS *****

*
 *

CONTINUED ON PAGE 09

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
 (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, it is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, items left for 30 days after completion date will be subject to storage fees,

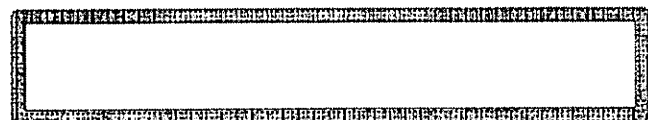

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

 INTERNAL CUSTOMER
 Horizon Ag & Turf
 Lloydminster AB T9V 3A2

Branch			
ST. PAUL			
Date	Time	Page	
04/04/25	23:04:31 (B)	09	
Account No.	Phone No.	Invoice No.	
INTER01A	7808754471	W00707	
Ship Via		Purchase Order	
		Salesperson	
		KK	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20	
	S790	1350	PCS161B965365		1750
*Replaced elevator jack-shaft drive belt tensioner pulley. *					

AH97031	IDLER PULLEY	1		76.86	76.86
				PARTS	76.86
				LABOR	180.00
16001001			SEGMENT TOTAL==>		256.86

SEGMENT#14 C 9670 NA		03/03/25 03/04/25			
TAILINGS ELEVATOR DRIVE CHAIN IDLER SPROCKET SOUNDS ROUGH				1.00	HRS
-REPLACE SPROCKET					
***** TECHNICIANS COMMENTS *****					
*Replaced idler sprockets. *					


AXE23133	Idler Sprocket	2		70.36	140.72
				PARTS	140.72
				LABOR	180.00
16001001			SEGMENT TOTAL==>		320.72

SEGMENT#15 C 9670 NA		03/03/25 03/04/25			
ENGINE DEBRIS MANAGEMENT DRIVE BELT TENSIONER SOUNDS DRY				1.00	HRS
-REPLACE TENSIONER					
***** TECHNICIANS COMMENTS *****					
*Replaced debris management drive belt tensioner. *					

AXE64513	Belt Tensioner	1		368.18	368.18
CONTINUED ON PAGE 10					

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE
 RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

 INTERNAL CUSTOMER
 Horizon Ag & Turf
 Lloydminster AB T9V 3A2

Branch			
ST. PAUL			
Date	Time	Page	
04/04/25	23:04:31 (B)	10	
Account No.	Phone No.	Invoice No.	
INTER01A	7808754471	W00707	
Ship Via		Purchase Order	
		Salesperson	
		KK	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20	
	S790	1350	PCS161B965365		1750
				PARTS	368.18
				LABOR	90.00
	16001001		SEGMENT TOTAL==>		458.18

SEGMENT#16 C 9670 NA	03/03/25 03/04/25			
WINDSHIELD WIPER RUBBER PEELING OFF			.50 HRS	
-REPLACE WIPER BLADE				
***** TECHNICIANS COMMENTS *****				
*			*	
*Replaced windshield wiper blade.			*	
*			*	

AL204404	Wiper Blade	1 N	128.33	128.33
			PARTS	128.33
			LABOR	90.00
	16001001		SEGMENT TOTAL==>	218.33

SEGMENT#17 C 9670 NA	03/03/25 03/04/25			
BLOW OUT COOLING PACKAGE AS REQUIRED			4.00 HRS	
TIGHTEN ALL RADIATOR HOSES				
TOP UP COOLANT				
***** TECHNICIANS COMMENTS *****				
*			*	
*Tightened all rad hose clamps. Pulled unit outside and			*	
*blew out cooling package. Topped up coolant.			*	
*			*	

TY26575	COOLGARDII PMIX	1	24.37	24.37
			PARTS	24.37
			LABOR	720.00
CONTINUED ON PAGE 11				

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing. Items left for 30 days after completion date will be subject to storage fees.



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

 INTERNAL CUSTOMER
 Horizon Ag & Turf
 Lloydminster AB T9V 3A2

Branch			
ST. PAUL			
Date	Time	Page	
04/04/25	23:04:31 (B)	11	
Account No.	Phone No.	Invoice No.	
INTER01A	7808754471	W00707	
Ship Via		Purchase Order	
		Salesperson	
		KK	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20	
	S790	1350	PCS161B965365		1750
	16001001			SEGMENT TOTAL==>	744.37

SEGMENT#18 C 9676 NA 03/03/25 03/04/25

SERVICE:

8.00 HRS

- ENGINE OIL AND FILTER
- FUEL FILTERS
- ENGINE AIR FILTERS
- CAB AIR FILTERS
- ENGINE DEBRIS MANAGEMENT AIR FILTERS
- PRIMARY GEARCASE OIL
- REVERSER GEARCASE OIL
- ROTOR GEARCASE OIL
- FINAL DRIVE OILS
- DEF DOSING FILTER
- REPLACE STRAP FOR HEADER CLUTCH BRUSH MODULE

***** TECHNICIANS COMMENTS *****

*
 *Replaced inside and outside cab air filters. Replaced
 *engine air filter. Replaced debris management air filters.
 *Replaced fuel filters. Drained oil from engine. Replaced
 *oil filter. Filled engine with oil. Replaced DEF dosing
 *filter. Topped up coolant. Started combine and checked
 *level. Changed primary gearcase oil. Changed reverser gear
 *case oil. Changed rotor gear case oil. Changed final drive
 *oils.
 *

AXE42065	DEBRIS FIL.#2	1	139.41	139.41
AXE42066	DEBRIS FIL.#1	1	218.29	218.29
DZ112918	SEC.FUEL FIL.	1	222.42	222.42

CONTINUED ON PAGE 12

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
 (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

 INTERNAL CUSTOMER
 Horizon Ag & Turf
 Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
04/04/25	23:04:31 (B)	12
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00707
Ship Via		Purchase Order
		Salesperson
		KK

SERVICE INVOICE


STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20	
	S790	1350	PCS161B965365		1750
DZ114640			FILTER KIT	1	240.59
DZ130550			PRIM FUEL FILT	1	218.91
ENV0114			OIL ENVIRO FEE	2	1.14
ENV06			OIL ENVIRO FEE	11	.06
ENV10			ENVIRO CHARGE	16	.10
ENV100			ENVIRO CHARGE	3	1.25
ENV12			CONTAIN ENV FEE	11	.12
ENV227			CONTAIN ENV FEE	2	2.27
ENV23			OIL ENVIRO FEE	2	.23
ENV46			CONTAIN ENV FEE	2	.46
ENV50			ENVIRO CHARGE	1	.55
GL5			GL5 - 85W140	16	11.75
HXE11090			AIR FILTER PRM.	1	435.34
HXE11091			AIR FILTER SEC.	1	307.18
H134773			STRAP	1	8.92
L214634			CAB REC. FILTER	1	47.23
RE572785			ENG OIL FILTER	1	142.78
TA32591			Air Filter	1	114.77
TY26408			HD460 SYN.G.OIL	11	44.63
TY26673			15W40+50II 3.8L	2	34.15
	Plus-50 II Oil		15W40 CK4/SN		
TY26679			15W40+50II 19L	2	154.45
	Plus-50 II Oil		15W40 CK4/SN		
			PARTS		3168.05
			LABOR		1440.00
			SEGMENT TOTAL==>		4608.05

16001001

***** WORK ORDER TOTALS *****
 CONTINUED ON PAGE 13

**A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
 (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.**

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing. Items left for 30 days after completion date will be subject to storage fees.

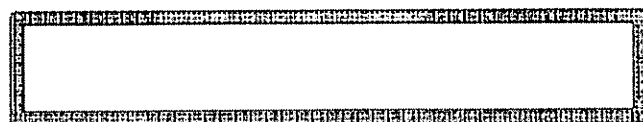

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
 Box 1488 St Paul, AB T0A 3A0
 Tel: 780.645.4437 Fax:780.645.4016
 www.horizonagturf.com

Ship to:

JD S790 PERSELY TRD - (805449)

Invoice to:

INTERNAL CUSTOMER
 Horizon Ag & Turf
 Lloydminster AB T9V 3A2


Branch		ST. PAUL	
Date	Time	Page	
04/04/25	23:04:31 (B)	13	
Account No.	Phone No.	Invoice No.	
INTER01A	7808754471	W00707	
Ship Via		Purchase Order	
		Salesperson	
		KK	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS	
034026A	JOHN DEERE S790	1875	1H0S790SEKT805449	10/03/20		
	S790	1350	PCS161B965365		1750	
					INTERNAL	CUSTOMER
				PARTS	8438.90	
				LABOR	10559.00	
				Shop Supplies	250.00	
				INTERNAL TOTAL	19247.90	

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO