



Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

J28-1
Nov

10/02/2026

Invoice #

6318

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 1013671

VIN: 1NPXT4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Engine light.

Engine light illuminated, diagnose, Turbo charger vain sticking, pull actuator and check, confirmed. Remove and replace turbo, run and test, no codes, turbo actuator moving as it should.

Part Number	Description	Quantity	Sale	Extended
2882112RX / 5458503RTURBOCHARGER ISX, NEW		1.00	\$4,606.16	\$4,606.16
FRIEGHT	INCOMING FRIEGHT	1.00	\$103.75	\$103.75
CUM3695041	GASKET, TURBOCHARGER	1.00	\$19.83	\$19.83
CUM4298975	NUT, LOCK	4.00	\$21.75	\$87.00
CUM4298242	STUD, M11	4.00	\$38.10	\$152.40
CUM5264570	GASKET, DRAIN OIL	1.00	\$9.76	\$9.76
CUM4934279	WASHER, SEALING	6.00	\$7.14	\$42.84
CUM3627695	SEAL, O-RING	2.00	\$11.56	\$23.12
CUM3949708	SEAL, O-RING	1.00	\$8.08	\$8.08
CUM3949781	O-RING	1.00	\$11.66	\$11.66
CUM3678912	SEAL, O-RING	1.00	\$15.63	\$15.63
CUM3684284	WASHER, SEALING	2.00	\$10.96	\$21.92
CUM4934278	WASHER, SEALING	2.00	\$8.86	\$17.72
CUM3957131	O-RING	1.00	\$5.98	\$5.98
CUM3922794	SEAL, O-RING	1.00	\$7.98	\$7.98
CUM3678786	SEAL, O-RING	1.00	\$9.14	\$9.14
CUM3102802	SEAL, O-RING	1.00	\$10.75	\$10.75
CUM4966441	GASKET, EXHAUST	1.00	\$34.91	\$34.91
4966454CUM	CLAMP, V BAND	1.00	\$124.99	\$124.99

Labor: \$1,320.00

Hrs: 8.00

Parts: \$5,313.62

Sublet:\$0.00

Job Total: \$6,633.62





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

10/02/2026

Invoice #
6318

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 1013671

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Continued From Previous Page

Service Advisor: ,

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 km whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Customer is to ensure that a re torque of all wheel lugs are done by qualified technician within 100km of travel.

All Balances are due upon Receipt, interest charged at 2% per month, storage charges will apply. Not responsible for loss or damage to or articles left in vehicle in case of fire, theft or any other cause.

Labor Total:	\$1,320.00
Parts Total:	\$5,313.62
Technology Charges:	\$105.60
HazMat:	\$0.00

Sub Total:	\$6,739.22
Tax Total:	\$336.96
Grand Total:	\$7,076.18
Balance Due:	\$7,076.18



SIGNATURE.....

Date.....





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

09/28/2026

Invoice #
6285

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 101894

VIN: 1NP7X4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Coolant leak.

Radiator leaking, bottom tank is split from core. Remove condenser, coolers and radiator, change over rad surround to new rad and install, wash out coolers and condenser as they were plugged with garbage. install new mounting bushings old ones were wore and nothing left of them. Re fill cooling system and attach all hood cables and lines. Run and test. Top off coolant.

Part Number	Description	Quantity	Sale	Extended
RADS10301TRP	RAD-PB/KW 08-24 365/367/5	1.00	\$1,199.99	\$1,199.99
07-03286	BUSHING, LOWER RAD SUPPORT	4.00	\$82.49	\$329.96
N4751001	BUSHING KIT,CHARGE AIR COOLER MOUNT KIT (KIT OF 4)	1.00	\$249.99	\$249.99
FRIEGHT	INCOMING FRIEGHT	1.00	\$103.75	\$103.75
8T-4778	LOCKNUT, M16	4.00	\$7.66	\$30.64
80927	LOCKNUT, 1/4-20 Top Lock Nut Grade C Zinc/Wax	4.00	\$0.34	\$1.36
COOLANT HD RED 50/50	COOLANT, HD EXPERT EXTENDED LIFE 50/50 (PER L)	8.00	\$7.00	\$56.00
Labor: \$1,015.00		Hrs: 7.00	Parts: \$1,971.69	Sublet:\$0.00
				Job Total: \$2,986.69

Service Advisor: ,

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 km whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Customer is to ensure that a re torque of all wheel lugs are done by qualified technician within 100km of travel.

All Balances are due upon Receipt, interest charged at 2% per month, storage charges will apply. Not responsible for loss or damage to or articles left in vehicle in case of fire, theft or any other cause.

Labor Total:	\$1,015.00
Parts Total:	\$1,971.69
Technology Charges:	\$81.20
HazMat:	\$0.00

Sub Total:	\$3,067.89
Tax Total:	\$153.39
Grand Total:	\$3,221.28
Balance Due:	\$3,221.28



SIGNATURE.....

Date.....





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

08/10/2026

Invoice #
6013

GST: 791934508

Core Projects inc.

2013 Peterbilt 367 White

Odometer In: 991652

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

VIN: 1NPXT4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Exhaust manifold.

Drain coolant, pull turbo, pull exhaust manifold. Inspect and clean up. Gasket blown out on #6 and #4, Install existing exhaust manifold with new gaskets and hardware, torque 44ft/lbs. Install turbo, torque to 20ft/lbs. Inter cooler boot tore when pulling apart exhaust manifold, replace boot. Refill coolant, replaced coolant drain (broken). Run and check for leaks, no exhaust leaks present.

Part Number	Description	Quantity	Sale	Extended
5486657CUM	GASKET, EXHAUST MANIFOLD	4.00	\$43.91	\$175.64
3682940CUM	GASKET, EXHAUST MANIFOLD GASKET DOUBLE	1.00	\$48.50	\$48.50
4965968CUM	SCREW	12.00	\$18.11	\$217.32
4965512CUM	SPACER	12.00	\$28.11	\$337.32
5264570CUM	GASKET, OIL DRAIN	1.00	\$7.75	\$7.75
3627695CUM	O-RING, MAIN USE 5.9 BS3	2.00	\$16.16	\$32.32
3684284CUM	WASHER SEALING	2.00	\$16.73	\$33.46
4934278CUM	WASHER, SEALING	2.00	\$10.93	\$21.86
4934279CUM	WASHER, SEALING	6.00	\$10.63	\$63.78
3949781CUM	O-RING	1.00	\$12.33	\$12.33
3957131CUM	O-RING	1.00	\$7.98	\$7.98
3695041CUM	GASKET TURBOCHARGER	1.00	\$36.34	\$36.34
4298975CUM	NUT, TURBO	4.00	\$19.61	\$78.44
4298242	STUD, HIGH TEMP	4.00	\$38.13	\$152.52
4966441CUM	GASKET, EXHAUST OUTLET CONNECT	1.00	\$41.85	\$41.85
562.U856636	DPF GASKET 4 INCH, CUMMINS	1.00	\$19.99	\$19.99
240-C	DRAIN COCK	1.00	\$7.98	\$7.98
561.75639	CAC HUMP HOSE, HOT SIDE	1.00	\$49.99	\$49.99
Coolant	No Ext Life 50/50 Coolant	4.00	\$5.60	\$22.40
94613	Zip Ties	6.00	\$1.10	\$6.60

Labor: \$1,305.00

Hrs: 9.00

Parts: \$1,374.37

Sublet: \$0.00

Job Total: \$2,679.37

Fuel pump.

Engine light illuminated when truck is under load, road test with driver with computer hooked up, found that fuel pressure is fluctuating over and under required pressure, Bring into shop to further diagnose, remove fuel water separator bowl, found multiple shavings from fuel pump failing, remove old high pressure pump, install new high pressure pump with new fuel filters. Upgraded pump had to change out support brackets and lines to do upgrade, supply lines are both back ordered. Build lines to work for time being, ordered factory upgrade lines. Run and road test unit, Pressures are good, no engine light.

Part Number	Description	Quantity	Sale	Extended
CUM5491785	FUEL PUMP, NEW	1.00	\$11,954.02	\$11,954.02
3687065CUM	SUPPORT FUEL PUMP	1.00	\$82.31	\$82.31
4330977CUM	TUBE FUEL DRAIN	1.00	\$122.49	\$122.49
5414049CUM	GASKET, FUEL PUMP	1.00	\$57.83	\$57.83
3687025CUM	SUPPORT FUEL PUMP	1.00	\$109.03	\$109.03
3687030CUM	TUBE FUEL TRANSFER	1.00	\$110.51	\$110.51
3687073CUM	SUPPORT FUEL PUMP	1.00	\$109.99	\$109.99
3685611CUM	CLIP	1.00	\$14.99	\$14.99





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

08/10/2026

Invoice #
6013

GST: 791934508

Core Projects inc.

2013 Peterbilt 367 White

Odometer In: 991652

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Continued From Previous Page

3093932CUM	SCREW, HEX FLANGE HEAD CAP	4.00	\$9.13	\$36.52
3093807CUM	SCREW, HEX FLANGE HEAD CAP	10.00	\$6.75	\$67.50
3900629CUM	SCREW HEX	8.00	\$6.81	\$54.48
3685612CUM	CLIP	4.00	\$15.44	\$61.76
3963990CUM	WASHER SEALING	4.00	\$7.59	\$30.36
3963988CUM	SEALING WASHER	8.00	\$10.86	\$86.88
3963991CUM	WASHER SEALING	4.00	\$15.36	\$61.44
4940181CUM	SCREW, BANJO CONNECTOR	2.00	\$31.24	\$62.48
4988280CUM	GASKET HYDRAULIC PUMP	1.00	\$12.49	\$12.49
3687065CUM	SUPPORT FUEL PUMP	1.00	\$82.49	\$82.49
FRIEGHT	INCOMING FRIEGHT	1.00	\$103.75	\$103.75
3069-06-14	METRIC BANJO X MJIC	2.00	\$14.99	\$29.98
3059-06-06	JIC/BSP BANJO	2.00	\$18.38	\$36.76
1AA6FJC6	CPLG 90FJIC	3.00	\$43.06	\$129.18
1AA6FJA6	#6 FJIC 45 #6 HOSE	1.00	\$31.94	\$31.94
HOSE1	FUEL LINE	1.00	\$112.49	\$112.49
82-2207	ATC FUSE HOLDER	1.00	\$7.54	\$7.54
84789	FUSE, AUTO ATO BLUE 15A	1.00	\$2.36	\$2.36
WIRE 14R	WIRE, 14GA RED	5.00	\$0.94	\$4.70
LOOM	WIRE LOOM	4.00	\$1.58	\$6.32
94613	Zip Ties	9.00	\$1.10	\$9.90
3685612CUM	CLIP	2.00	\$17.99	\$35.98

Labor: \$1,450.00	Hrs: 10.00	Parts: \$13,628.47	Sublet: \$0.00	Job Total: \$15,078.47
--------------------------	-------------------	---------------------------	-----------------------	-------------------------------

Brake chamber.

Unit pulling hard to right when applying brakes. Diagnose, found left brake chamber on steer axle to not be working. Threads are damaged at clevis and not applying brakes. Install new brake chamber. Test.

Part Number	Description	Quantity	Sale	Extended
F30SC	BRAKE CHAMBER TYPE 30	1.00	\$73.74	\$73.74
80933	LOCKNUT, 5/8-11 Top Lock Nut Grade C Zinc/Wax	2.00	\$2.54	\$5.08
88441	WASHER, 5/8 Thru-Hardened Steel Flat Washer SAE	2.00	\$2.04	\$4.08

Labor: \$145.00	Hrs: 1.00	Parts: \$82.90	Sublet: \$0.00	Job Total: \$227.90
------------------------	------------------	-----------------------	-----------------------	----------------------------





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

08/10/2026

Invoice #
6013

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 991652

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Continued From Previous Page

Service Advisor: ,

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 km whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Customer is to ensure that a re torque of all wheel lugs are done by qualified technician within 100km of travel.

All Balances are due upon Receipt, interest charged at 2% per month, storage charges will apply. Not responsible for loss or damage to or articles left in vehicle in case of fire, theft or any other cause.

Labor Total: \$2,900.00
Parts Total: \$15,085.74

Technology Charges: \$232.00
HazMat: \$0.00

Sub Total: \$18,217.74
Tax Total: \$910.89
Grand Total: \$19,128.63
Balance Due: \$19,128.63



SIGNATURE.....

Date.....





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

07/16/2026

Invoice #
5851

GST: 791934508

Core Projects inc.

2013 Peterbilt 367 White

Odometer In: 984220

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM225C

Unit #: 621

Description Of Services

CVIP.

Finish cvip repairs, complete paperwork. top off coolant.

Part Number	Description	Quantity	Sale	Extended
Coolant	No Ext Life 50/50 Coolant	4.00	\$5.60	\$22.40

Vehicle Memo

ENGINE#: 79553437

FAMILY: CCEXH0912XAR

MODEL: ISX15 550

Labor: \$660.00 Hrs: 4.00 Parts: \$22.40

Sublet: \$0.00

Job Total: \$682.40

Windshield.

Install new Drivers windshield.

Part Number	Description	Quantity	Sale	Extended
DW1037	WINDSHIELD LH INSTALLED	1.00	\$343.75	\$343.75

Labor: \$0.00 Hrs: 0.00 Parts: \$343.75

Sublet: \$0.00

Job Total: \$343.75

Steering box.

Remove and replace right hand steering box, lots of play in output shaft. Chang out one power steering line, leaking at crimp. Fill oil and bleed system.

Part Number	Description	Quantity	Sale	Extended
RCH60003	GEAR BOX	1.00	\$1,062.49	\$1,062.49
RCH6003CORE	GEAR BOX CORE	1.00	\$1,000.00	\$1,000.00
HFB70PAB	PITMAN ARM BOLT	1.00	\$16.24	\$16.24
HWC06120	BOLT HEX 3/4 - 16FX4-1/2G	1.00	\$38.75	\$38.75
ATF4	TRANSMISSION FLUID	3.00	\$15.28	\$45.84
R5-8-BLUE	REUSABLE HOSE, -8 BLUE HI-TEMP	4.00	\$9.99	\$39.96
4411-8	FJIC X COTTON CVR	2.00	\$31.94	\$63.88

Labor: \$507.50 Hrs: 3.50 Parts: \$2,267.16

Sublet: \$0.00

Job Total: \$2,774.66

Steering shaft.

Replace two wore out u joints on steering shaft.

Part Number	Description	Quantity	Sale	Extended
SK000283	KIT-U-JOINT	2.00	\$94.99	\$189.98

Labor: \$145.00 Hrs: 1.00 Parts: \$189.98

Sublet: \$0.00

Job Total: \$334.98

Lights.

Diving lights, cab lights, Change out three center cab lights burnt out, replace bumper driving lights (burnt out).

Part Number	Description	Quantity	Sale	Extended
38313	LIGHT, LED BEEHIVE, GRAKON 1000 AMBER	3.00	\$14.99	\$44.97
87671	Blue Butt Connector 16-14 Ga	14.00	\$2.78	\$38.92
83-8001	LOOM 1/2"	2.00	\$1.58	\$3.16
94613	Zip Ties	8.00	\$1.10	\$8.80
FUSE30	30 AMP FUSE	2.00	\$3.56	\$7.12





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

07/16/2026

Invoice #
5851

GST: 791934508

Core Projects inc.

2013 Peterbilt 367 White

Odometer In: 984220

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM225C

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

Unit #: 621

Description Of Services

Continued From Previous Page

123-33044XW	DUAL HALOGEN XTRAWHITE 4X6	2.00	\$93.74	\$187.48
Labor: \$290.00	Hrs: 2.00	Parts: \$290.45	Sublet: \$0.00	Job Total: \$580.45

Mirrors.

Drivers side mirror is shorted out, engine code for ambient air temp sensor which is in mirror harness, replace mirror assembly with harness. Engine code cleared, heated mirror is working.

Part Number	Description	Quantity	Sale	Extended
R59-6053-102	MIRROR-MOTO W/ OAT SENSOR	1.00	\$1,739.99	\$1,739.99
FRIEGHT	INCOMING FRIEGHT	1.00	\$103.75	\$103.75
Labor: \$290.00	Hrs: 2.00	Parts: \$1,843.74	Sublet: \$0.00	Job Total: \$2,133.74

Supply hose.

Supply driver with spare hose from bulkhead to trailer, wrap hose in spiral wrap and install butterfly end.

Part Number	Description	Quantity	Sale	Extended
P20W2-16	WING QD FEMALE, 1"WING Q.D. FEMALE	1.00	\$130.89	\$130.89
824SPR	SPIRAL WRAP, 1-1/2" ID	13.00	\$7.98	\$103.74
HOSE 1	14FT -16 MNPT X JICFEM	1.00	\$362.49	\$362.49
Labor: \$72.50	Hrs: 0.50	Parts: \$597.12	Sublet: \$0.00	Job Total: \$669.62

Service Advisor: Hilliar, Donovan

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 km whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Customer is to ensure that a re torque of all wheel lugs are done by qualified technician within 100km of travel.

All Balances are due upon Receipt, interest charged at 2% per month, storage charges will apply. Not responsible for loss or damage to or articles left in vehicle in case of fire, theft or any other cause.

Labor Total:	\$1,965.00
Parts Total:	\$5,554.60

Technology Charges:	\$157.20
HazMat:	\$0.00

Sub Total:	\$7,676.80
Tax Total:	\$383.84
Grand Total:	\$8,060.64
Balance Due:	\$8,060.64



SIGNATURE.....Date.....





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

07/03/2026

Invoice #
5823

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 977725

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

- King pins starting to have play.
- spring spins steer axle have small amount of play.

CVIP (PRE INSPECTION)

Complete cvip checklist, perform most repairs, unit will have to come back for final repairs and sticker.

Driveline.

Forward rear diff, output shaft bearing failure, houseing is wrecked from shaft wearing into housing. Replace axle housing, install new u bolts and used top plates. Install output shaft and yoke with new bearings (old output shaft wore from moving around, bearings were gone, yoke splines are damaged). install new u joint at inter axle output. Install new strap kits. Re install hubs and fill with oil.

Part Number	Description	Quantity	Sale	Extended
3243271ETN USED	USED AXLE HOUSING.	1.00	\$2,940.00	\$2,940.00
M822	TOP PLATE STEEL USED	2.00	\$187.50	\$375.00
75W90	75W90 Gear Oil Synthetic	20.00	\$12.61	\$252.20
504060ETN	KIT-OUTPUT SHAFT BEARING, D170	1.00	\$312.49	\$312.49
UBK01-4015	U BOLT KIT	2.00	\$151.25	\$302.50
131451K	YOKE KIT	1.00	\$747.50	\$747.50
Grease	Grease	1.00	\$11.44	\$11.44
210737	OIL SEAL, OUTPUT Size: 2.94ID 4.06OD 0.47TH	1.00	\$88.41	\$88.41
512894ETN	OUTPUT SHAFT KIT	1.00	\$662.50	\$662.50
SPL170-4X	U JOINT KIT SPL170	1.00	\$200.30	\$200.30
250-70-18X	U-JOINT STRAP KIT SPL250	2.00	\$41.24	\$82.48
170-70-18X	U-JOINT STRAP KIT	2.00	\$41.24	\$82.48
FA88441	WASHER, 5/8 Thru Hardened Steel Flat Washer SAE	12.00	\$1.98	\$23.76
FA68107	BOLT, 5/8-11x4-1/2 Hex Cap Screw Grade 8 YZ	2.00	\$8.02	\$16.04
80933	LOCKNUT, 5/8-11 Top Lock Nut Grade C Zinc/Wax	6.00	\$2.54	\$15.24
FA68110	BOLT, 5/8-11x6 Hex Cap Screw Grade 8 YZ	4.00	\$7.62	\$30.48
FRIEGHT	INCOMING FRIEGHT	2.00	\$103.75	\$207.50

Labor: \$1,885.00

Hrs: 13.00

Parts: \$6,350.32

Sublet: \$0.00

Job Total: \$8,235.32

Lights.

Bulbs burnt out at both forward driving lights. Rear right lower bunk lamp not working. Left quarter fender light needs tightened. Left light, second from rear bunk lamp not working. Right cab lamp not working. Forward RH lower both lights not working properly, signals work but no running lights. Both lights signaling, should only be outside light. Diagnose / repair lights.

Part Number	Description	Quantity	Sale	Extended
LED2000-10AP	LIGHT, 2" ROUND LED AMBER	5.00	\$7.85	\$39.25
16-2011	CONTINUOUS 2 WIRE PIGTAIL	2.00	\$4.58	\$9.16
HST316	HEAT SHRINK TUBING (ROLL, PER INCH)	14.00	\$0.60	\$8.40
HST18	HEAT SHRINK TUBING (ROLL, PER INCH)	8.00	\$0.60	\$4.80
87670	RED BUTT CONNECTOR, HEAT SHRINK	2.00	\$1.78	\$3.56
1006B	NON INSULATED CONNECTORS, 22-16,16-14,12-10	6.00	\$1.92	\$11.52
WIRE 14BR	WIRE, 14GA BROWN	1.00	\$0.94	\$0.94
67001	PIGTAIL, 2 PIN DOUBLE SEAL	1.00	\$4.66	\$4.66

Labor: \$290.00

Hrs: 2.00

Parts: \$82.29

Sublet: \$0.00

Job Total: \$372.29





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

07/03/2026

Invoice #

5823

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 977725

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Continued From Previous Page

Brakes.

Major heat cracking in steer brake drums, shoes worn. Remove and replace front brake shoes / drums. Oil contaminated left shoes from leaking wheel seal.

Part Number	Description	Quantity	Sale	Extended
4709	4709 BRAKE SHOES	2.00	\$118.96	\$237.92
151.6718BA	BRAKE DRUM 16.500IN X 7.000I	2.00	\$310.13	\$620.26
Labor: \$145.00 Hrs: 1.00 Parts: \$858.18		Sublet:\$0.00	Job Total: \$1,003.18	

S-Cams.

Diff #1 both side S-cams loose at bushings. Diff #2, right side S-cam loose at bushings. Replace three s-cams and bushings. Replace one slack adjuster was ceased to s cam had to cut. Install new wheel seals and axle gaskets. Top off oil.

Part Number	Description	Quantity	Sale	Extended
817636N	CAMSHAFT10SPL-1-1/2 17-5/8 L	1.00	\$147.50	\$147.50
817637N	CAMSHAFT 10SPL-1-1/2 17.815 R	2.00	\$147.50	\$295.00
40010143	SLACK ADJUSTER, 1.5-10SPL 5.5"	1.00	\$118.75	\$118.75
392-9131	WHEEL SEAL	3.00	\$89.71	\$269.13
330-3111	GASKET, 8 HOLE AXLE	3.00	\$8.66	\$25.98
75W90	75W90 Gear Oil Synthetic	1.00	\$12.61	\$12.61
45210125	REC BUSHING	1.00	\$6.66	\$6.66
CAMREPAIR	S CAM REPAIR KIT	3.00	\$48.75	\$146.25
Labor: \$652.50 Hrs: 4.50 Parts: \$1,021.88		Sublet:\$0.00	Job Total: \$1,674.38	

Wheel seal.

Steer axle left wheel seal leaking. Remove and replace wheel seal, gasket, top off hubs with oil.

Part Number	Description	Quantity	Sale	Extended
382-8064	WHEEL SEAL	1.00	\$91.39	\$91.39
330-3009	GASKET	1.00	\$4.78	\$4.78
75W90	75W90 Gear Oil Synthetic	1.00	\$12.61	\$12.61
97166	NUT, 5/8 NF STOVER NUT	6.00	\$1.92	\$11.52
HN114	WASHER-KEYED	1.00	\$19.44	\$19.44
303-4009	Hubcap W/3009 GSKT	1.00	\$28.46	\$28.46
Labor: \$181.25 Hrs: 1.25 Parts: \$168.20		Sublet:\$0.00	Job Total: \$349.45	

Dustshields.

Three drive axle dust shields missing, install three dustshields.

Part Number	Description	Quantity	Sale	Extended
075-485	HEX HD CAP SCREW 3/8X.5	12.00	\$0.86	\$10.32
973953	DUSTSHIELD	3.00	\$123.75	\$371.25
Labor: \$217.50 Hrs: 1.50 Parts: \$381.57		Sublet:\$0.00	Job Total: \$599.07	

Brake chamber.

Diff #1, left brake chamber has broken bolt. Right brake chamber mounting bracket broken on diff #2. Repair brake chambers and brake chamber mounting bracket. Replace two brake chambers and repair mounting bracket.





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

07/03/2026

Invoice #
5823

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 977725

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Continued From Previous Page

Part Number	Description	Quantity	Sale	Extended
F3030	BRAKE POT, SHORT STROKE BRAKE CHAMBER	2.00	\$87.49	\$174.98
80933	LOCKNUT, 5/8-11 Top Lock Nut Grade C Zinc/Wax	4.00	\$2.54	\$10.16
FA88441	WASHER, 5/8 Thru Hardened Steel Flat Washer SAE	4.00	\$1.98	\$7.92
Labor: \$435.00		Hrs: 3.00	Parts: \$193.06	Sublet:\$0.00
				Job Total: \$628.06

Loose wiring.

Wires rubbing onto drive shaft. Secure loose wires to unit to prevent further damage.

Part Number	Description	Quantity	Sale	Extended
94613	Zip Ties	6.00	\$1.10	\$6.60
Labor: \$36.25		Hrs: 0.25	Parts: \$6.60	Sublet:\$0.00
				Job Total: \$42.85

Exhaust.

Install new band clamp to flex pipe above transmission (Clamp broken)

Part Number	Description	Quantity	Sale	Extended
562.U3105SS	CLAMP, 5" EXHAUST BAND CLAMP	1.00	\$23.63	\$23.63
Labor: \$36.25		Hrs: 0.25	Parts: \$23.63	Sublet:\$0.00
				Job Total: \$59.88

Tires.

Steer tire right side low, flat repair tire, Tire is split unable to repair, change out right steer tire. Diff # 1 right side tires past wear bars, lots of cuts in face, replace two drive tires.

Part Number	Description	Quantity	Sale	Extended
11R24.5	DRIVE TIRE IRONHEAD W/CHANGE OVER W/VALVE	2.00	\$534.66	\$1,069.32
385/65R22.5	MICHELIN XZY 3 WB W/CHANGE OVER W/VALVE STEM	1.00	\$1,353.60	\$1,353.60
Labor: \$0.00		Hrs: 0.00	Parts: \$2,422.92	Sublet:\$0.00
				Job Total: \$2,422.92

Herd Bumper.

Replace Bolt at bumper wore out.

Part Number	Description	Quantity	Sale	Extended
FA68119	BOLT, 3/4-10x3 Hex Cap Screw Grade 8 YZ	1.00	\$6.98	\$6.98
80934	LOCKNUT, 3/4-10 Top Lock Nut Grade C Zinc/Wax	1.00	\$2.90	\$2.90
88442	WASHER, 3/4 THRU HARDENED STEEL USS FLAT WASHER	2.00	\$1.78	\$3.56
Labor: \$14.50		Hrs: 0.10	Parts: \$13.44	Sublet:\$0.00
				Job Total: \$27.94

Fifth wheel.

Replace pins and cushions.

Part Number	Description	Quantity	Sale	Extended
RK-10605	KIT ILS BRACKET PINS AND CUSH	1.00	\$132.26	\$132.26
Labor: \$72.50		Hrs: 0.50	Parts: \$132.26	Sublet:\$0.00
				Job Total: \$204.76





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

07/03/2026

Invoice #
5823

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 977725

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Continued From Previous Page

Service Advisor: ,

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 km whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Customer is to ensure that a re torque of all wheel lugs are done by qualified technician within 100km of travel.

All Balances are due upon Receipt, interest charged at 2% per month, storage charges will apply. Not responsible for loss or damage to or articles left in vehicle in case of fire, theft or any other cause.

Labor Total:	\$3,965.75
Parts Total:	\$11,654.35
Technology Charges:	\$317.26
HazMat:	\$0.00

Sub Total:	\$15,937.36
Tax Total:	\$796.87
Grand Total:	\$16,734.23
Balance Due:	\$16,734.23



SIGNATURE.....

Date.....





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

06/11/2026

Invoice #
5726

GST: 791934508

Core Projects inc.

2013 Peterbilt 367 White

Odometer In: 970499

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

A/C

No A/C, Diagnose, found Ac line from compressor to condensor is loose at compressor, compressor housing is worn, remove and replace compressor and a/c line, attempt to vacuum system, not holding vacuum. Condenser is rubbed through from grill. Remove and replace condenser. Charge system, run and test, check pressures. Tie up all lines from rubbing

Part Number	Description	Quantity	Sale	Extended
LF4376	COMPRESSOR	1.00	\$531.25	\$531.25
F50-6242-1475	A/C DISCHARGE LINE, COMPRESSOR TO CONDENSOR	1.00	\$249.99	\$249.99
830.41087	RECIEVER DRYER	1.00	\$74.11	\$74.11
171295-12	CONDENSER	1.00	\$541.24	\$541.24
PAG Oil	Pag Oil - Air Conditioning	4.00	\$8.94	\$35.76
24661	A/C O-RING	1.00	\$5.98	\$5.98
24670	A/C O-RING	4.00	\$5.98	\$23.92
94613	Zip Ties	6.00	\$1.10	\$6.60
R134A	Refridgerant	4.40	\$51.54	\$226.78
24606	A/C O-RING	1.00	\$5.98	\$5.98
FRIEGHT	INCOMING FRIEGHT	1.00	\$103.75	\$103.75
Labor: \$580.00		Hrs: 4.00	Parts: \$1,805.36	Sublet:\$0.00
				Job Total: \$2,385.36

ABS.

Light illuminated, diagnose, Right rear abs sensor wire is ripped. Remove wheels, remove drum, found that brake shoe spring is broken, shoes are damaged. remove, and replace brake shoes. install new speed sensor and tie up wiring.

Part Number	Description	Quantity	Sale	Extended
4410309092	ABS SENSOR KIT, 90 DEG	1.00	\$128.74	\$128.74
4709	4709 BRAKE SHOES	1.00	\$118.96	\$118.96
Labor: \$290.00		Hrs: 2.00	Parts: \$247.70	Sublet:\$0.00
				Job Total: \$537.70

Cruise control

Cuts in and out, diagnose, Clutch pedal switch out of adjustment, adjust switch.

Labor: \$145.00		Hrs: 1.00	Parts: \$0.00	Sublet:\$0.00	Job Total: \$145.00
------------------------	--	------------------	----------------------	----------------------	----------------------------

Clutch brake.

Clutch brake wore out, remove and replace, set clutch freeplay.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sale</u>	<u>Extended</u>
SB200	CLUTCH BRAKE, 2 PIECE CLUTCH BRAKE	1.00	\$84.00	\$84.00
Labor: \$145.00		Hrs: 1.00	Parts: \$84.00	Sublet:\$0.00
			Job Total: \$229.00	

Top off engine oil.

engine oil low.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sale</u>	<u>Extended</u>
5W40	5W40 Engine Oil	4.00	\$8.98	\$35.92
Labor: \$14.50		Hrs: 0.10	Parts: \$35.92	Sublet:\$0.00
			Job Total: \$50.42	





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

06/11/2026

Invoice #
5726

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 970499

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Continued From Previous Page

Service Advisor: Hilliar, Donovan

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 km whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Customer is to ensure that a re torque of all wheel lugs are done by qualified technician within 100km of travel.

All Balances are due upon Receipt, interest charged at 2% per month, storage charges will apply. Not responsible for loss or damage to or articles left in vehicle in case of fire, theft or any other cause.

Labor Total:	\$1,174.50
Parts Total:	\$2,172.98

Technology Charges:	\$93.96
HazMat:	\$0.00

Sub Total:	\$3,441.44
Tax Total:	\$172.07
Grand Total:	\$3,613.51
Balance Due:	\$3,613.51



SIGNATURE.....

Date.....





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

05/25/2026

Invoice #
5625

GST: 791934508

Core Projects inc.

2013 Peterbilt 367 White

Odometer In: 961781

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250

Unit #: 621

Description Of Services

WIPER MOTOR AND GEAR BOX

REPLACE MOTOR AND REPAIR LINAGE

Part Number	Description	Quantity	Sale	Extended
E006-185	MOTOR-WIPER ASSEMBLY	1.00	\$709.74	\$709.74
HLK7070	WIPER LINKAGE ASSY	1.00	\$374.99	\$374.99
FRIEGHT	INCOMING FRIEGHT	1.00	\$103.75	\$103.75
Labor: \$507.50 Hrs: 3.50 Parts: \$1,188.48		Sublet: \$0.00	Job Total: \$1,695.98	

Service.

DO INSPECTION

Part Number	Description	Quantity	Sale	Extended
P550849	FILTER, FUEL WATER SEPARATOR FILTER CARTRIDGE	1.00	\$41.24	\$41.24
P555776	FILTER, FUEL SPIN ON	1.00	\$106.24	\$106.24
P559000	FILTER, OIL	1.00	\$95.28	\$95.28
Labor: \$362.50 Hrs: 2.50 Parts: \$242.76		Sublet: \$0.00	Job Total: \$605.26	

Mutli function switch.

HIGH BEAMS NOT WORKING, SIGNAL LIGHT QUITTS, REPLACE SIGNAL STAT CONTROL, WIPERS ONLY HAVE LOW

Part Number	Description	Quantity	Sale	Extended
P27-1067	SWITCH, TURN SIGNAL	1.00	\$499.99	\$499.99
SB200	CLUTCH BRAKE, 2 PIECE CLUTCH BRAKE	1.00	\$84.00	\$84.00
Labor: \$181.25 Hrs: 1.25 Parts: \$583.99		Sublet: \$0.00	Job Total: \$765.24	

Front diff output

Output is loose. REMOVE YOKE AND CLEAN UP, REPLACE NUT AND TORQUE TO SPEC

Part Number	Description	Quantity	Sale	Extended
40X1233	PINION NUT	1.00	\$22.83	\$22.83
SPL170-4X	U JOINT KIT SPL170	1.00	\$200.30	\$200.30
75W90	75W90 Gear Oil Synthetic	3.00	\$12.61	\$37.83
170-70-18X	UJOINT STRAP KIT	1.00	\$41.24	\$41.24
Labor: \$217.50 Hrs: 1.50 Parts: \$302.20		Sublet: \$0.00	Job Total: \$519.70	

Shock .BROKEN

NEW LEFT MIDDLE AXLE SHOCK

Part Number	Description	Quantity	Sale	Extended
M85311	SHOCK ENBS	1.00	\$84.58	\$84.58
40226	LOCKNUT, 5/8-11 GR8 Nylon Insert Lock Nut	2.00	\$2.40	\$4.80
FA68107	BOLT, 5/8-11x4-1/2 Hex Cap Screw Grade 8 YZ	2.00	\$8.02	\$16.04
Labor: \$72.50 Hrs: 0.50 Parts: \$105.42		Sublet: \$0.00	Job Total: \$177.92	

Light.

Part Number	Description	Quantity	Sale	Extended
LED2000-10AP	LIGHT, 2" ROUND LED AMBER	1.00	\$7.85	\$7.85





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

05/25/2026

Invoice #
5625

GST: 791934508

Core Projects inc.

2013 Peterbilt 367 White

Odometer In: 961781

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250

Unit #: 621

Description Of Services

Continued From Previous Page

67001	PIGTAIL, 2 PIN DOUBLE SEAL	1.00	\$4.66	\$4.66
Labor: \$0.00	Hrs: 0.00 Parts: \$12.51	Sublet: \$0.00	Job Total: \$12.51	

Low coolant light on.

Low coolant sensor missing, replace sensor and replace missing connector.

Part Number	Description	Quantity	Sale	Extended
SS5950	COOLANT LEVEL SENSOR	1.00	\$61.23	\$61.23
PAC12124075L	TERMINAL FEM. 18AWG	1.00	\$1.34	\$1.34
PAC12110293	CONNECTOR, 3 PIN METRI PAK CONNECTOR	1.00	\$28.63	\$28.63
Labor: \$181.25	Hrs: 1.25 Parts: \$91.20	Sublet: \$0.00	Job Total: \$272.45	

Brake line., brake pots

change front driver side brake pot, debris in pot, missing plug, replace middle pass side brake pot, no maxi, spring broken

Part Number	Description	Quantity	Sale	Extended
HAB-8-REEL	AIR BRAKE HOSE, 1/2" ID	4.00	\$9.04	\$36.16
1656	ARB HOSE CONNECTOR, 3/8ID HOSE X 1/2 PIPE MALE DOT	2.00	\$11.14	\$22.28
F3030LS	BRAKE CHAMBER	2.00	\$93.74	\$187.48
WWG2ZKG2	CLEVIS ZINC	2.00	\$12.35	\$24.70
45210129	CLEVIS BUSHING SLACK ADJUSTER	1.00	\$6.66	\$6.66
Labor: \$362.50	Hrs: 2.50 Parts: \$277.28	Sublet: \$0.00	Job Total: \$639.78	

Service Advisor: ,

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 km whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Customer is to ensure that a re torque of all wheel lugs are done by qualified technician within 100km of travel.

All Balances are due upon Receipt, interest charged at 2% per month, storage charges will apply. Not responsible for loss or damage to or articles left in vehicle in case of fire, theft or any other cause.

Labor Total:	\$1,885.00
Parts Total:	\$2,803.84

Technology Charges:	\$150.80
HazMat:	\$0.00

Sub Total:	\$4,839.64
Tax Total:	\$241.98
Grand Total:	\$5,081.62
Balance Due:	\$5,081.62



SIGNATURE.....Date.....



TRUCK/TRACTOR MAINTENANCE INSPECTION

Inspection Type:

☐ A = DRY

☒ B = WET

☐ C = CVIP (ANNUAL)

Interval:

250 Hours or 90 Days

500 Hours or 180 Days

Unit Number: 621

Location: Bonnyville

Date: May 22nd 2026

Date of last PMCVI: 07/20/25

Odometer Reading:

961 781

Engine Hours (Mandatory-must also be entered in ARI work order):

15796 hrs

Code: ☒ = OK

X = Needs Repair

A = Adjusted

Repair Order Number: 5625

Cab Check	A	B	Attached Body	A	B	Fifth Wheel	A	B
Instruments & Gauges		✓	Check Interior		✓	Check Fifth Wheel		✓
Starting and Charging		✓	Check Tie Bars & Lights		✓	Grease Fifth Wheel		✓
Vehicle Noises or Air Leaks		✓	Check Condition of Roof		✓	Engine		✓
Interior & Dash Lights		✓	Check Condition of Scuff Liner		✓	Check Filter Gasket for Leaks		✓
Heater and A/C, Cab & Bunk		✓	Check Condition of Hinges		✓	Compressor, Mounting Bolts		✓
Cigarette Lighter & Radio		✓	Check Condition of Rollers		✓	Wiper Arm Tension		✓
Horn - Electric & Air		✓	Lubricate Door(s)		✓	Air Cleaner, Restriction Gauge		✓
Window Lifts		✓	Check Operation of Tailgate		✓	Air Filter: Last change date _____		✓
Door Latches		✓	Lubricate Tailgate		✓	Gasket, Lines		✓
Seat Belts, Cushions		✓	Check Placards and Holders		✓	Air Cleaner Duct		✓
Wiper / Washer Operation		✓	Check Condition of Bulkheads		✓	Fuel Lines & Injector Pump		✓
Air Compressor Operation		✓	Tank Condition		✓	Drain Fuel / Water Separator		✓
Governor Cycle Cut-Out		✓	Tank Mounts and Bolts		✓	Lube Clutch & Throttle Linkage		✓
Cruise Control Operation		✓	Undercarriage		✓	Starter & Solenoid Connection		✓
Engine Brake Operation		✓	Inspect front brakes		✓	Exhaust System/Turbo		✓
Elect. Brake System		✓	Record brake stroke measurements		✓	Block Heater (Seasonal)		✓
Clutch Pedal Freeplay		✓	Front Bearings, King Pin		✓	Fan Shroud & Fan for Cracks		✓
Transmission Shifting		✓	Steering Linkage & Fluid level		✓	Fan Hub Bearings Brackets		✓
Speedometer and Tachometer		✓	Front Springs U-Bolts		✓	Pressure Test Cooling		✓
Oil Pressure		✓	Leaking Wheel Seals		✓	System (check for leaks)		✓
Record Max RPM		✓	Lower Radiator & Mount		✓	Water Pump Bearing		✓
Steering Wheel Play & Centering		✓	Lower Engine & Mount		✓	Coolant Level		✓
Brake Pedal		✓	Drain Crankcase		✓	Antifreeze Strength & Adjust		✓
Circle Checks		✓	Trans. & Bell Housing Mounts		✓	All Belts for Adjustment & Wear		✓
Daytime Lights		✓	Transmission Oil Level		✓	Check Engine Oil Level		✓
Headlamps		✓	Trans Shaft Rear Bearing/ Brake		✓	Top Up Windshield Washer		✓
All Exterior Lights <i>slight out</i>	A	✓	Check Exhaust		✓	Electrical		✓
Lube Door Latches		✓	Cab Mounts		✓	Inspect Case and Battery Cover		✓
Scan for Body Damage		✓	Cross Members/Frame		✓	Clean Battery and Terminals		✓
Wiper Blades		✓	Universal Joints/Drive Line <i>no disc present</i>		✓	Wheels and Tires		✓
Windshield		✓	Rear Susp. / Mounting Brackets		✓	Wheel Bearing Reservoir		✓
Mirrors and Heaters		✓	Clean Axle Breathers		✓	Axle Flange Nuts		✓
Fuel Tanks & Straps		✓	Differential Oil Level		✓	Wheels, Nuts, Studs		✓
Exhaust Stack / Guard		✓	Differential Housing Bolts		✓	Irregular Tire Wear		✓
License Plate Mud Flaps		✓	Inspect Slack Adjustment		✓	Record Tire Pressure & Adjust		✓
Trailer Air Hoses		✓	Inspect rear brakes		✓	Record Tire Depth		✓
Test Light Cords / Plugs		✓	Inspect Parking Brake Chamber <i>2 Broken</i>		✓	Completion		✓
Glad-hands / Rubbers		✓	Replace Oil & Fuel Filter		✓	Install new inspection decal		✓
Drain Air Tanks		✓	Oil - Record No. of Litres: <u>38</u>		✓	Torque Wheels After PM		✓
Safety Equipment		✓	While Lubing: Check All Air Lines,		✓	Requires Road Test		✓
Fire Extinguisher - sign & date tag		✓	Fittings & Bolts		✓	Road Test Completed		✓
Triangle Reflectors, Flag Kit		✓	Lube PTO/ Pump /Blower /Crane		✓			
First Aid Kit, Eye Wash Bottle		✓	Inspect Air Dryer		✓			
Spill Kit		✓	Rear Impact Guard		✓			
			Grease Hose Reel/Lube Chain		✓			

Tire and Brake Measurements on next page:



Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

04/07/2026

Invoice #
5401

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 943184

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Hydraulic leak.

PTO pump Leaking at gaskets when under load. Replace PTO pump.

Part Number	Description	Quantity	Sale	Extended
748-6325-268	PUMP Serial # E24422TV	1.00	\$3,114.00	\$3,114.00
CTNS	BREAK IN TEST	1.00	\$202.50	\$202.50
4J0524	SEAL, XT3	2.00	\$6.99	\$13.98
FRIEGHT	INCOMING FRIEGHT	1.00	\$123.75	\$123.75
Labor: \$435.00		Hrs: 3.00	Parts: \$3,454.23	Sublet:\$0.00
				Job Total: \$3,889.23

Service Advisor: Hilliar, Donovan

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 km whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Customer is to ensure that a re torque of all wheel lugs are done by qualified technician within 100km of travel.

All Balances are due upon Receipt, interest charged at 2% per month, storage charges will apply. Not responsible for loss or damage to or articles left in vehicle in case of fire, theft or any other cause.

Labor Total:	\$435.00
Parts Total:	\$3,454.23
Technology Charges:	\$34.80
HazMat:	\$0.00

Sub Total:	\$3,924.03
Tax Total:	\$196.20
Grand Total:	\$4,120.23
Balance Due:	\$4,120.23



SIGNATURE.....

Date.....





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

04/23/2026

Invoice #
5466

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 950469

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Fan clutch.

Fan clutch is wore, not engaging, diagnose, relay valve is working but clutches are wore, remove engine belts, fan blade, rad support, remove fan clutch and rebuild. Re install fan clutch assembly, Change out cracked belts and one bent idler pulley for A/C belt. Install new hump hose at right side of cooler, wore through almost from rubbing. Re install remaining components. Run and test functions.

Part Number	Description	Quantity	Sale	Extended
HOR-2S-DP	FAN CLUTCH REPAIR KIT, TWO-SPEED	1.00	\$1,251.96	\$1,251.96
D84-1000-6122180	BELT-POLY 12 RIBS X 2180 END/PLYSTR	1.00	\$207.49	\$207.49
25-060637	BELT, A/C	1.00	\$53.74	\$53.74
3689465CUM	PULLEY IDLER	1.00	\$222.96	\$222.96
561.406406RK	CAC HOSE CLAMP KIT, RED	1.00	\$82.49	\$82.49
3033247CUM	SEAL O-RING	1.00	\$23.80	\$23.80
Labor: \$797.50		Hrs: 5.50	Parts: \$1,842.44	Sublet:\$0.00
				Job Total: \$2,639.94

Windshield washer.

Pigtail corroded, broken at plug. Replace pigtail.

Part Number	Description	Quantity	Sale	Extended
577.75546H	HARNES WASHER FLUID PUMP	1.00	\$7.90	\$7.90
94613	Zip Ties	6.00	\$1.10	\$6.60
Labor: \$14.50		Hrs: 0.10	Parts: \$14.50	Sublet:\$0.00
				Job Total: \$29.00

Service Advisor: ,

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 km whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Customer is to ensure that a re torque of all wheel lugs are done by qualified technician within 100km of travel.

All Balances are due upon Receipt, interest charged at 2% per month, storage charges will apply. Not responsible for loss or damage to or articles left in vehicle in case of fire, theft or any other cause.

Labor Total:	\$812.00
Parts Total:	\$1,856.94
Technology Charges:	\$64.96
HazMat:	\$0.00

Sub Total:	\$2,733.90
Tax Total:	\$136.70
Grand Total:	\$2,870.60
Balance Due:	\$2,870.60



SIGNATURE.....

Date.....





Bonnie's Equipment Services Ltd.

Box 6113 61329 Range Road 455
Bonnyville, AB T9N 2G7
Phone: 780-573-7901

03/25/2026

Invoice #
5337

GST: 791934508

Core Projects inc.

PO BOX 428 STN MAIN
COLD LAKE, AB T9M1P1

2013 Peterbilt 367 White

Odometer In: 939409

VIN: 1NPTX4TX9DD171295

Eng: Cummins ISX15 CM2250 6

Unit #: 621

Description Of Services

Fifth Wheel.

Fifth wheel plate bent, Risers cracked. Unbolt assembly in install new complete assembly.

Part Number	Description	Quantity	Sale	Extended
HOL-FW35J948XL00	FIFTH WHEEL ASSEMBLY	1.00	\$5,341.50	\$5,341.50
FA68098	BOLT, 5/8-11x2 Hex Cap Screw Grade 8 YZ	24.00	\$4.70	\$112.80
FA88440	WASHER, 9/16 Thru-Hardened Steel Flat Washer SAE	48.00	\$0.78	\$37.44
80932	LOCKNUT, 9/16-12 Top Lock Nut Grade C Zinc/Wax	24.00	\$1.94	\$46.56
FA68100	BOLT, 5/8-11x2-1/2 Hex Cap Screw Grade 8 YZ	4.00	\$6.48	\$25.92
FA68033	BOLT, 3/8-16x1-1/4 Hex Cap Screw Grade 8 YZ	2.00	\$1.00	\$2.00
FA88437	WASHER, 3/8 Thru-Hardened Steel Flat Washer SAE	4.00	\$0.68	\$2.72
80929	LOCKNUT, 3/8-16 Top Lock Nut Grade C	2.00	\$0.62	\$1.24
Grease	Grease	1.00	\$11.44	\$11.44
FRIEGHT	INCOMING FRIEGHT	1.00	\$312.50	\$312.50
Labor: \$725.00		Hrs: 5.00	Parts: \$5,894.12	Sublet:\$0.00
				Job Total: \$6,619.12

Service Advisor: ,

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 km whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Customer is to ensure that a re torque of all wheel lugs are done by qualified technician within 100km of travel.

All Balances are due upon Receipt, interest charged at 2% per month, storage charges will apply. Not responsible for loss or damage to or articles left in vehicle in case of fire, theft or any other cause.

Labor Total:	\$725.00
Parts Total:	\$5,894.12
Technology Charges:	\$58.00
HazMat:	\$0.00

Sub Total:	\$6,677.12
Tax Total:	\$333.86
Grand Total:	\$7,010.98
Balance Due:	\$7,010.98



SIGNATURE.....

Date.....



G.B. Truck and Diesel

Truck Specialists Since 1973

"Your Cummins Engine Dealer"

16808-113 Avenue NW
Edmonton, Alberta T5M 2X3
Phone: (780) 483-8314 Fax: (780) 483-8498
Email: gbtruck@gbtruck.ca



Page 1 of 4

Invoice Number: 27576
Invoice Date: 04/18/2023
Invoice Time: 8:23 am
R/O: 17866
Customer:
Warehouse: GB

Billing

Customer: CORE PROJECTS INC.
BOX 248
COLD LAKE, AB T9M-1P1

Owning

Customer: CORE PROJECTS INC.
BOX 248
COLD LAKE, AB T9M-1P1

Phone: Fax: Customer P/O:

Unit Number: 621 Year: 2013
Meter Reading: 624,252 Kilometers Manufacturer: PETERBILT
Model: 367
VIN: 1NPTX4TX9DD171295

Comments: RADIATOR CORE LEAKING AT TANK SEAM.

CUSTOMER DECLINED REPLACEMENT (\$1183 quote), WILL FIND THEIR OWN AND SEND OVER.

Comments: LINERS SWAPPED TO O/S

Comments: INSTALLED USED DELETED ECM / NO WARRANTY/ 6 MONTHS WARRANTY ON AFTERMARKET TURBO/ PARTS ONLY

NO WARRANTY ON USED INSTALLED PARTS /ALL GENUINE PARTS ARE COVERED BY CUMMINS WARRANTY FOR A PERIOD OF 1 YEAR FROM DATE OF PURCHASE. DELETING MAY EFFECT WARRANTY COVERAGE AS DETERMINED BY CUMMINS IF A FAILURE OCCURS.

Job: 1 Dept: Service ENGINE 10 OVERHAUL ENGINE

Correction: ENGINE OVERHAUL/ OUT OF CHASSIS/

CUSTOMER BLOCK AND CRANK NOT USABLE/ /MACHINE USED BLOCK FOR .020 SHIMS/

INSTALL POLISHED CRANK WITH NEW MAIN BRGS. AND TORQUE TO SPEC [110 FT LBS + FRONT STRUCTURE AND TORQUE/ INSTALL NEW FRONT CRANK SEAL/ INSTALL REAR STRUCTURE AND TORQUE/ INSTALL NEW REAR CRANK SEAL/INSTALL NEW LINERS AND CHECK PROTRUSION ALL IN SPEC .0125/ INSTALL NEW PISTONS ON CON RODS AND INSTALL NEW RINGS/ INSTALL PISTON ASSEMBLY WITH NEW BRGS AND TORQUE [52 FTLBS+60 DEGREES/ INSTALL PISTON COOLING NOZZLES/INSTALL NEW HEAD GASKET AND INSTALL HEAD TORQUE TO SPEC [300 FTLBS + 90 DEGREES] INSTALL CAMSHAFT / INSTALL GEARS SET TIMING TO SPEC AND SET BACKLASH/TORQUE GEARS / INSTALL LOWER FRONT COVER AND NEW CRANK SEAL /INSTALL NEW COOLANT THERMOSAT /INJECTORS AND TORQUE [59 FTLBS] INSTALL ROCKER ASSEMBLIES AND TORQUE[22 FTLBS + 60 DEGREES] SET VALVES, JAKES / INSTALL UPPER FRONT GEAR COVER AND TORQUE[21 FTLBS] / AND AIR COMPRESSOR/INSTALL BLOCK STIFFNER PLATE /INSTALL RX LUBE PUMP AND TORQUE/ INSTALL OIL PAN / CLEAN OILCOOLER / AND INSTALL NEW BUNDLE AND THERMOSTAT/ PRESSURE TEST COOLER / GOOD / INSTALL NEW VIBRATION DAMPNER AND TORQUE / INSTALL FRONT ENGINE MOUNT / INSTALL AND TORQUE OILCOLLER / INSTALL EGR COOLER/INSTALL EXHAUST MANIFOLD AND TORQUE/ [44 FTLBS] / INSTALL TURBO / HOOK UP /

1

Part/Labor	Description/Reference	Unit of Measure	Quantity	Price	Extended Price
15V40	15V40 VALVOLINE ENGINE OIL - CUMI	EA	48.00	\$5.46	\$262.08
2872513	GASKET,FUEL PUMP	EA	1.00	\$38.02	\$38.02
2872717	SEAL,INJECTOR	EA	1.00	\$6.53	\$6.53
3089025	SEAL,O RING	EA	1.00	\$18.54	\$18.54

G.B. Truck and Diesel

Truck Specialists Since 1973

"Your Cummins Engine Dealer"

16808-113 Avenue NW
Edmonton, Alberta T5M 2X3
Phone: (780) 483-8314 Fax: (780) 483-8498
Email: gbtruck@gbtruck.ca



Page 2 of 4

Invoice Number: 27576

Invoice Date: 04/18/2023

Invoice Time: 8:23 am

R/O: 17866

Customer:

Warehouse: GB


Part/Labor	Description/Reference	Unit of Measure	Quantity	Price	Extended Price
3102109	SEAL,O RING	EA	2.00	\$7.10	\$14.20
3103015	SEAL,GROMMET	EA	2.00	\$5.16	\$10.32
3104119	GASKET,COVER PLATE	EA	1.00	\$23.42	\$23.42
3104229	GASKET,EXH GAS RCN VALVE	EA	1.00	\$74.60	\$74.60
3163075	PAINT	EA	2.00	\$39.94	\$79.88
3347939	SEAL,O RING	EA	1.00	\$4.78	\$4.78
3678724	SEAL,O RING	EA	1.00	\$5.82	\$5.82
3680882	SCREW,CAPTIVE WASHER CAP	EA	13.00	\$10.31	\$134.03
3682673	GASKET,THM HOUSING COVER	EA	1.00	\$38.96	\$38.96
3684338	GASKET,CONNECTION	EA	1.00	\$37.03	\$37.03
3685173	SEAL,OIL	EA	1.00	\$102.73	\$102.73
3685556	GASKET,ADAPTER	EA	1.00	\$18.95	\$18.95
3685701	SEAL,O RING	EA	1.00	\$15.55	\$15.55
3686525	SEAL,ELECTRICIAL CONNECTO	EA	1.00	\$48.90	\$48.90
3688012	TUBE, CV OIL DRAIN TUBE	EA	1.00	\$64.24	\$64.24
3689567	GASKET,CYLINDER HEAD	EA	1.00	\$557.42	\$557.42
3689755	GASKET,LUB OIL CLR HSG	EA	1.00	\$138.65	\$138.65
3963990	WASHER,SEALING	EA	8.00	\$5.13	\$41.04
3963991	WASHER,SEALING	EA	4.00	\$8.58	\$34.32
4032194	KIT,MOUNTING	EA	1.00	\$273.12	\$273.12
4059172	SEAL,O RING	EA	1.00	\$11.41	\$11.41
4298975	NUT,LOCK	EA	4.00	\$13.43	\$53.72
4374074	SCREW,TWELVE POINT CAP	EA	3.00	\$3.29	\$9.87
4393089	GASKET,GEAR HOUSING	EA	1.00	\$115.36	\$115.36
4393176	GASKET,FLYWHEEL HOUSING	EA	1.00	\$135.84	\$135.84
4952629	THERMOSTAT	EA	1.00	\$170.07	\$170.07
4955831	KIT,OIL COOLER	EA	1.00	\$745.51	\$745.51
4965569	KIT,SEAL	EA	1.00	\$161.39	\$161.39
4984152	SEAL,O RING	EA	6.00	\$4.57	\$27.42
4988280	GASKET,HYDRAULIC PUMP	EA	1.00	\$6.05	\$6.05
5298565	SHIM	EA	6.00	\$202.31	\$1,213.86
5414049	GASKET,FUEL PUMP	EA	1.00	\$40.17	\$40.17
5440813	GASKET,ACC DRIVE SUPPORT	EA	1.00	\$23.85	\$23.85
5473000	KIT,LINER	EA	6.00	\$430.57	\$2,583.42
5658302RX	HEAD,CYLINDER	EA	1.00	\$9,620.86	\$9,620.86
5658302RX-C	HEAD,CYLINDER	RET EA	-1.00	\$907.56	-\$907.56
5658302RX-C	HEAD, CYLINDER ISX (CORE)4298235CHG	EA	1.00	\$907.56	\$907.56
5680039RX	PUMP,LUBRICATING OIL	EA	1.00	\$1,117.66	\$1,117.66
5680039RX-C	PUMP,LUBRICATING OIL	RET EA	-1.00	\$165.01	-\$165.01
5680039RX-C	PUMP,LUBRICATING OIL (CORE) 3685CHG	EA	1.00	\$165.01	\$165.01
5693706	KIT,LINER	EA	-6.00	\$451.15	-\$2,706.90
5693737	KIT,OVERHAUL	EA	1.00	\$11,384.10	\$11,384.10
SUB RODS	CON RODS CHECKED/TESTED - EACH	EA	6.00	\$100.00	\$600.00
4993120RXU	USED ECM	EA	1.00	\$3,500.00	\$3,500.00
4993120RXU-C	USED ECM (CORE)4298265D	CHG EA	1.00	\$800.00	\$800.00
4060638	BELT - CUMMINS A/C	EA	1.00	\$43.68	\$43.68
52139	NEG BATTERY JUMPER POST	EA	1.00	\$55.51	\$55.51
GD3000	50/50 LONGLIFE COOLANT	EA	14.00	\$13.86	\$194.04
5502825CN	AFTERMARKET TURBOCHARGER, HE	EA	1.00	\$4,600.00	\$4,600.00
DYNO	DYNO BREAK IN	EA	1.00	\$729.76	\$729.76

G.B. Truck and Diesel

Truck Specialists Since 1973

"Your Cummins Engine Dealer"

16808-113 Avenue NW
Edmonton, Alberta T5M 2X3
Phone: (780) 483-8314 Fax: (780) 483-8498
Email: gbtruck@gbtruck.ca

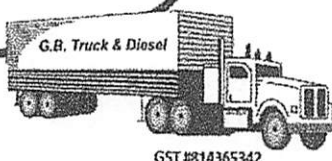

Page 3 of 4

Invoice Number: 27576

Invoice Date: 04/18/2023

Invoice Time: 8:23 am

R/O: 17866

Customer:

Warehouse: GB

Part/Labor	Description/Reference	Unit of Measure	Quantity	Price	Extended Price
ISX BLOCK CUT	ISX BLOCK-CLEANED,MAG,ALIGN BOI	EA	1.00	\$3,900.00	\$3,900.00
ISX CRANK POLISHED	ISX CRANK	EA	1.00	\$3,900.00	\$3,900.00
Labor Summary			55.00	\$150.00	\$8,250.00

Job: 2 Dept: Service ENGINE 12 REMOVE AND INSTALL

Correction: UNHOOK AND REMOVE HOOD/ DRAIN COOLANT AND REMOVE RAD, CAC AND AC
CONDENSOR/ SEND FOR TESTING / RAD FAILED / CUSTOMER SUPPLIED NEW RAD/
REMOVE OLD RAD FROM FRAME AND INSTALL NEW RAD//UNHOOK TRANNY/ UNHOOK
ENGINE AND REMOVE / / INSTALL CLUTCH / / INSTALL ENGINE / HOOK UP ALL
REMAINING COMPONENTS / INSPECT DRIVELINE FOR DYNO / / REMOVE REAR DRIVE
SHAFT TO DYNOINSTALL OIL AND COOLANT/
AND HOOK UP / INSTALL AND HOOK UP TRANNY/ INSTALL ALL OTHER COMPONENTS /
INSTALL RAD AND CAC /
PRELUBE ENGINE / RUN AND CHECK / INSTALL HOOD //CHARGE A/C/ REMOVE AND
REPLACE AIR FILTERS
RUN AND CHECK / ROAD TEST UNIT /
SEND FOR DYNO BREAK IN/ GOOD / INSTALL REAR DRIVESHAFT

2

Part/Labor	Description/Reference	Unit of Measure	Quantity	Price	Extended Price
0011	A/C O/ R#6	EA	1.00	\$0.65	\$0.65
0013	A/C O/R #8	EA	1.00	\$0.57	\$0.57
0015	A/C O/R #10	EA	1.00	\$0.72	\$0.72
3/4X2-1/2NC	3/4X2-1/2" NC GR8 BOLT	EA	2.00	\$2.37	\$4.74
3600015	BLOCK HEATER CORD	EA	1.00	\$37.42	\$37.42
38-0371	4.00"-4.31" T-BOLT SP CLAMP	EA	1.00	\$18.13	\$18.13
52138	POS BATTERY JUMPER POST	EA	1.00	\$55.51	\$55.51
561244	22-18GA BUTT CONNECTOR PINK	EA	2.00	\$0.84	\$1.68
62032NSL	BALL BEARING IDLER/TENSIONER	EA	1.00	\$7.24	\$7.24
6306-2NSL	PILOT BEARING	EA	1.00	\$20.26	\$20.26
6306-2NSL	PILOT BEARING	EA	1.00	\$20.26	\$20.26
806ST	LOOM 3/8	FT	5.00	\$0.45	\$2.25
8WS-075	3/4 GR8 PLATED WASHER	EA	2.00	\$0.56	\$1.12
9007292	.56 ID SUPPORT CLAMP	EA	1.00	\$2.86	\$2.86
ATF-1	LITRE ATF	L	2.00	\$8.68	\$17.36
SUB	FLYWHEEL SURFACE	EA	1.00	\$143.00	\$143.00
SUB	FLYWHEEL SURFACE	EA	1.00	\$143.00	\$143.00
108925-25AM	CLUTCH 15.5-2050TQ-7S10F-ET6	EA	1.00	\$1,205.10	\$1,205.10
SB200	CLUTCH BRAKE	EA	1.00	\$48.71	\$48.71
1610BL	1/8 ZERK	EA	1.00	\$0.75	\$0.75
223924	BULKHEAD	EA	1.00	\$14.08	\$14.08
24704N604WHD	FITTING-SAE 45 STL FSTRSWV	EA	2.00	\$18.46	\$36.92
AP3380	SAE45 ADAPTOR	EA	1.00	\$3.82	\$3.82
H06904250RWHD	HOSE-HYD/AIR 3/16	EA	6.00	\$6.45	\$38.70
SUB-AIR COOL	FLUSH/REPAIR CHARGE AIR COOLER	EA	1.00	\$171.60	\$171.60
Labor Summary			55.00	\$150.00	\$8,250.00

G.B. Truck and Diesel

Truck Specialists Since 1973

"Your Cummins Engine Dealer"

16808-113 Avenue NW
Edmonton, Alberta T5M 2X3
Phone: (780) 483-8314 Fax: (780) 483-8498
Email: gbtruck@gbtruck.ca



GST #R14365342

Page 4 of 4

Invoice Number: 27576
Invoice Date: 04/18/2023
Invoice Time: 8:23 am
R/O: 17866
Customer:
Warehouse: GB

Job Subtotals	
Parts:	\$1,996.45
Core Charges:	\$0.00
Core Returns:	\$0.00
Labor:	\$8,250.00
Miscellaneous:	\$0.00
Shop Supplies:	\$660.00
EPA Charge:	\$4.50
Job Subtotals	\$10,910.95

Detail Tax Information
\$3,245.26 GST

Total Parts:	\$46,276.23
Total Core Charges:	\$1,872.57
Total Core Returns:	-\$1,072.57
Total Labor:	\$16,500.00
Total Miscellaneous:	\$0.00
Total Shop Supplies:	\$1,320.00
Total Environmental Charge:	\$9.00
Invoice Subtotal:	\$64,905.23
Total Tax:	\$3,245.26

Payment Terms: Net 30 Days

Sale Type: ON ACC

Invoice Total: \$68,150.49

NET 30 DAYS, DEBIT/CC WILL BE CHARGED 3% AFTER DELIVERY DATE. 2% PER MONTH ADDED AFTER 30 DAYS. THIS IS THE ONLY ITEMIZED ACCOUNT RENDERED. G.B. TRUCK & DIESEL IS A DIVISION OF SETHI GROUP OF COMPANIES INC.

Drivers responsibility to retorque wheels after 100 KM if wheels have been removed for any reason.

O U T	I hereby acknowledge my indebtedness in the amount of \$_____	
	being the total amount owing or balance owing as shown hereon.	
	Date _____	Signature _____

VISA MC AMEX OTHER	Card No.	Exp.
☐ ☐ ☐ ☐		

NORTRUX INC.

DYNAMOMETER SPECIFICATION SHEET

Dyno #: _____

Date: 04/14/23

Model - Serial #: _____

Engine/Model: ISX15RO #: 111486Oil Psi: Idle/HI: 20/40Miles/Km: 624229Customer Name: Seth groupFull RPM: 2000Hours: 9410Rated H.P.: 550

ITEM/MAST/TAQ	2400	2000	1800	1600	1400	1200	1000	800	600	400	200	100	50
MPH/KMH			5				90	85	80	75	70		
BRP							420	442	460	419	397		
FUEL PRESS													
ENGINE TIMING													
INTAKE MANIFOLD													
EXHAUST													
COOLANT TEMP							200	205	205	200	205		
CRANK PRESS													

Corrections and Comments: _____

Service Technician's Signature: 879