

a02-220

PATTISON AGRICULTURE LIMITED

Hwy 14 West, Box 599
 Unity, SK S0K 4L0
 Phone: (306) 228-2696
 Fax: (306) 228-2776
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3324248 Invoice Date: 2/5/2025 Location: 06 Work Order Number: 478196 Payment Type: Page: 1 of 15
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	

JGLC JD X SERIES ALL**COMPLAINT:**

01 X9 SERIES COMBINE VALUEMAX GREEN LIGHT SERVICE INSPECTION CHECKOVER

CORRECTION:

VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST

 HEADER SERIAL # _____
 ENGINE HOURS 593
 SEPARATOR HOURS 419.5

DOES THIS UNIT GET A VALUEMAX STICKER X YES NO
 HAS THE STICKER BEEN INSTALLED X YES NO
 THIS UNIT HAS HAD THE CAB CLEANED MS
 THIS UNIT HAS HAD A FINAL CHECKOVER BS
 THIS UNIT HAS HAD A COMPLETE GREASE JOB BS

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26859	INSPECTION+ 3 FLUID TEST KIT	1.00	84.87	84.87	\$84.87	N
TY6341	SD POLYUREA GREASE	1.00	10.80	10.80	\$10.80	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
LABDIS	LAB DISC CUST	-1.00	1,290.00	1,290.00	(\$1,290.00)	N

Labor: \$6,150.00 Parts: \$95.67 OL&M: \$0.00 Misc: (\$1,290.00) Sub-Total: \$3,955.67

JELECDIAG6 JD ALL**COMPLAINT:**

02 DIAGNOSE MULTIPLE CHOPPER ACTUATOR CODES

- HAD 517845.03
 - HAD 517845.04

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 14 West, Box 599
 Unity, SK S0K 4L0
 Phone: (306) 228-2696
 Fax: (306) 228-2776
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3324248
		Invoice Date:	2/5/2025
		Location:	06
		Work Order Number:	478196
		Payment Type:	
		Page:	2 of 15

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	

JELECDIAG6 JD ALL


CHECKED MACHINE FOR CODES
 NO ACTIVE CODES CAME UP
 MOVED CHOPPER UP AND DOWN
 CHECKED ACTUATORS
 CHECKED FOR CODES AGAIN ON RUN UP
 NO CODES CAME UP DURING OR AFTER RUN UP

Labor: \$250.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$250.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JSOFTWARE JD X9 1000

COMPLAINT:
 03 UPDATE ALL CONTROLLER SOFTWARE

CORRECTION:
 UPDATED SOFTWARE
 FED CONTROLLER
 DISPLAY
 COREOS-GEN4OS AUTOMATED SAR
 HAD CONTROLLER

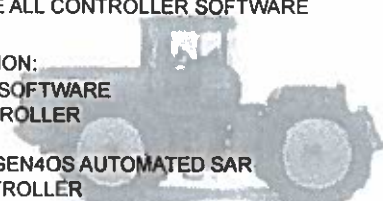

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JGEN04-

COMPLAINT:
 04 MISC REPAIRS
 - REPLACE MULTI COUPLER SHEAR BOLT BROKEN
 - INSTALL NEW SPARE SHEAR BOLT
 - INSTALL RUBBER/LOOM ON FEED ACCELERATOR SPEED CABLE
 - ATTACH HARNESS ON TOP OF LEFT HAND GULL WING DOOR

CORRECTION:
 INSTALLED NEW SHEAR BOLT ON MULTI COUPLER
 INSTALLED NEW SPARE SHEAR BOLT
 ATTACHED GULL WING DOOR HARNESS TO RAIL
 INSTALLED PIECE OF HOSE AROUND CABLE TO PROTECT FROM RUBBING

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 14 West, Box 599
 Unity, SK S0K 4L0
 Phone: (306) 228-2696
 Fax: (306) 228-2776
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3324248 Invoice Date: 2/5/2025 Location: 06 Work Order Number: 478196 Payment Type: Page: 3 of 15
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
-------------	--------	----------------	--------	-----------

JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113
--------------------	-----	-------------------	--------

JGEN04-

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7264	M4-0.75 NYLOCK NUT	2.00	0.54	0.54	\$1.08	N
19M9326	M4x30 HEXSOC 12.9 BOLT	2.00	2.22	2.22	\$4.44	N
H77698	Tie Band 16" 30/pk	4.00	1.47	1.47	\$5.88	N
R44302	Tie Band 8" 100/pk	2.00	0.68	0.68	\$1.36	N

Labor: \$300.00	Parts: \$12.76	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$312.76
-----------------	----------------	--------------	--------------	---------------------

J06171003 JD X9 1000**COMPLAINT:**

05 ADJUST FEEDERHOUSE DRIVE CHAIN.

CORRECTION:

REMOVED FULL LINK
 INSERTED CONNECTION
 TENSIONED CHAIN



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
SW80HC0US	80H CONNECTOR LINK	1.00	13.44	13.44	\$13.44	N

Labor: \$100.00	Parts: \$13.44	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$113.44
-----------------	----------------	--------------	--------------	---------------------

J06001040 JD X9 1000**COMPLAINT:**

06 REMOVE HALF LINK AND ADJUST FEEDERHOUSE CONVEYOR CHAIN TENSION.

CORRECTION:

REMOVE TENSION OFF FEEDER HOUSE CONVEYOR CHAIN
 REMOVED HALF LINK
 SET PROPER CHAIN TENSION

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 14 West, Box 599
 Unity, SK S0K 4L0
 Phone: (306) 228-2696
 Fax: (306) 228-2776
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number:	3324248
Invoice Date:	2/5/2025
Location:	06
Work Order Number:	478196
Payment Type:	
Page:	4 of 15

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
-------------	--------	----------------	--------	-----------

JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	
--------------------	-----	-------------------	--------	--

J06001040 JD X9 1000

Labor: \$300.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$300.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000073760**COMPLAINT:**

07 Feeder House Conveyor Chain Slat, Remove and Replace
 - REPLACE 1 BENT SLAT

CORRECTION:

LOOSENED AND REMOVED BENT SLAT
 BOLT BROKE WHEN TIGHTENING NEW SLAT
 INSTALL NEW HARDWARE WITH NEW SLAT

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7517	M10-1.5 NYLOCK NUT	4.00	2.38	2.38	\$9.52	N
19M7402	M10x25 HH 10.9 BOLT	4.00	2.30	2.30	\$9.20	N
HXE113327	X9 FEEDER CHAIN SLAT	1.00	67.52	67.52	\$67.52	N

Labor: \$126.00	Parts: \$86.24	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$212.24
------------------------	-----------------------	-------------------------	---------------------	----------------------------

JWELD3 JD ALL**COMPLAINT:**

08 REPAIR BENT CONCAVES
 - LEFT HAND FRONT BENT
 - RIGHT HAND FRONT AND REAR BENT

CORRECTION:

HEATED BENDS
 STRAIGHTENED
 WELDED CRACKS

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 14 West, Box 599
Unity, SK S0K 4L0
Phone: (306) 228-2696
Fax: (306) 228-2776
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeseville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: **3324248**
Invoice Date: **2/5/2025**
Location: **06**
Work Order Number: **478196**
Payment Type:
Page: **5 of 15**

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	

J06180269 JD X9 1000

COMPLAINT:

09 R&R, CONCAVES, LEVEL AND CALIBRATE.
- MISSING HARDWARE

CORRECTION:

REMOVE CONCAVES.
INSTALLED CONCAVES (ENSURE THAT THE CONCAVES ARE TIGHT TO ONE ANOTHER AND THERE IS ADEQUATE BULKHEAD CLEARANCE)
REPLACED MISSING CONCAVE HARDWARE
LEVELED CONCAVES AS PER SERVICE ADVISOR.
PERFORMED CONCAVE CALIBRATION

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7199	M12x35 CB 8.8 SN	3.00	2.61	2.61	\$7.83	N
03M7676	M8x30 CB 10.9 SN	3.00	0.98	0.98	\$2.94	N
11M7030	M5x40 COTTER PIN	1.00	1.06	1.06	\$1.06	N
14M7298	M8-1.25 FLG NUT	3.00	1.55	1.55	\$4.65	N
14M7299	M12-1.75 FLG NUT	3.00	2.92	2.92	\$8.76	N
19M7789	M12x30 FLG 10.9 BOLT	2.00	2.59	2.59	\$5.18	N
24M7024	WASHER M9 x 28	3.00	2.07	2.07	\$6.21	N
Labor: \$1,200.00		Parts: \$36.63	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,236.63	

JGEN10-

COMPLAINI:

10 INSTALL NEW PADDLE AND HARDWARE ON TAILINGS ELEVATOR CHAIN

CORRECTION:

REMOVED TAILING BELT
SPUN TAILING PADDLE CHAIN UNTIL MISSING PADDLE WAS FOUND
INSTALLED NEW PADDLE AND HARDWARE
RE INSTALLED BELT
SET BELT TENSION TO SPEC

PATTISON AGRICULTURE LIMITED
Hwy 14 West, Box 599
Unity, SK S0K 4L0
Phone: (306) 228-2696
Fax: (306) 228-2776
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3324248
		Invoice Date:	2/5/2025
		Location:	06
		Work Order Number:	478196
		Payment Type:	
		Page:	6 of 15

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	

JGEN10-

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7867	M8x25 FLG 10.9 BOLT	2.00	1.81	1.81	\$3.62	N
E64256	M8 LOCK NUT	2.00	2.30	2.30	\$4.60	N
H144667	Paddle	1.00	12.28	12.28	\$12.28	N
H168578	WASHER	2.00	6.11	6.11	\$12.22	N

Labor: \$280.00 Parts: \$32.72 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$312.72

JGEN11-

COMPLAINT:

11 REPLACE PLASTIC HINGE COVER ON RIGHT HAND GRAIN TANK COVER

CORRECTION:

REMOVE BROKEN SEAL
INSTALL NEW SEAL



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H154370	Rivnut M10 deep hex	1.00	3.52	3.52	\$3.52	N
HXE166125	RH Grain Door Hinge Cover	1.00	315.94	315.94	\$315.94	N

Labor: \$100.00 Parts: \$319.46 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$419.46

J10030100 JD X9 1000

COMPLAINT:

12 REPLACE ENGINE FUEL FILTERS.
- CLEAN FUEL STRAINER

* MARK HOURS ON FILTER*

CORRECTION:

PATTISON AGRICULTURE LIMITED
Hwy 14 West, Box 599
Unity, SK S0K 4L0
Phone: (306) 228-2696
Fax: (306) 228-2776
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: **3324248**
Invoice Date: 2/5/2025
Location: 06
Work Order Number: 478196
Payment Type:
Page: 7 of 15

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	

J10030100 JD X9 1000
REPLACED PRIMARY AND SECONDARY FUEL FILTERS.
REMOVED AND CLEANED FUEL STRAINER.
BLED FUEL SYSTEM.
FUNCTION AND LEAK CHECKED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ124761	Primary Fuel Filter 13.6L	1.00	163.69	163.69	\$163.69	N
DZ124786	Secondary Fuel Filter 13.6L	1.00	157.26	157.26	\$157.26	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	2.00	1.25	1.25	\$2.50	N

Labor: \$160.00 Parts: \$320.95 OL&M: \$0.00 Misc: \$2.50 Sub-Total: \$483.45

JENGAIREFILT JD X9 10
COMPLAINT:
13 REPLACE PRIMARY AND SECONDARY ENGINE AIR FILTERS

CORRECTION:
REMOVED OLD FILTERS
CLEANED HOUSING
INSTALLED NEW FILTERS
MARKED DATE ON FILTERS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE11090	Primary Engine Air Filter	1.00	463.00	463.00	\$463.00	N
HXE11091	Secondary EngAir Filter	1.00	326.70	326.70	\$326.70	N

Labor: \$100.00 Parts: \$789.70 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$889.70

J06001009 JD X9 1000
COMPLAINT:
14 TWO SPEED CHOPPER GEARCASE OIL, REPLACE

CORRECTION:

PATTISON AGRICULTURE LIMITED
Hwy 14 West, Box 599
Unity, SK S0K 4L0
Phone: (306) 228-2696
Fax: (306) 228-2776
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3324248 Invoice Date: 2/5/2025 Location: 06 Work Order Number: 478196 Payment Type: Page: 8 of 15
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	

J06001009 JD X9 1000

Remove drain plug.
 Allow oil to drain.
 Install the drain plug and torque to specification. 30 N·m (22 lb·ft)
 Refill with Hy-Gard until visible in the sight glass.
 Shift lever to opposite speed.
 Run the separator for one minute.
 Let the machine sit for five minutes.
 Re-check oil level.
 Torque the fill plug to specification. 30 N·m (22 lb·ft)
 Shift lever back to original speed.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY22062	HY-GARD J20C 9.46L	1.00	85.28	85.28	\$85.28	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF150	ENVIRO FEE	1.00	1.50	1.50	\$1.50	N
<hr/>						
Labor: \$60.00	Parts: \$85.28	OL&M: \$0.00	Misc: \$1.50	Sub-Total: \$146.78		

JCABFILTER JD X9 10

COMPLAINT:
 15 REPLACE CAB AIR FILTERS

CORRECTION:
 REMOVED OLD CAB AIR FILTERS
 CLEANED FILTER HOUSING
 INSTALLED NEW AIR FILTERS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE70605	CAB RECIRC AIR FILTER	1.00	39.23	39.23	\$39.23	N
RE284091	Cab Air Filter	1.00	122.07	122.07	\$122.07	N
<hr/>						
Labor: \$100.00	Parts: \$161.30	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$261.30		

JENGDIAG1 JD ALL
 COMPLAINT:



PATTISON AGRICULTURE LIMITED
Hwy 14 West, Box 599
Unity, SK S0K 4L0
Phone: (306) 228-2696
Fax: (306) 228-2776
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3324248
		Invoice Date:	2/5/2025
		Location:	06
		Work Order Number:	478196
		Payment Type:	
		Page:	9 of 15

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	

JENGDIAG1 JD ALL

16 REPLACE BENT RADIATOR PROPELLER BOLT

CORRECTION:

REMOVED SHIELDS AROUND TOP OF FAN SHROUD IN ENGINE BAY
REMOVED TOP OF FAN SHROUD
REMOVED BOLT FOR PROPELLER
REPLACE BOLT
REINSTALLED ALL SHIELDS AND HARDWARE
CHECKED PROPELLER BEARING
FLIPPED PROPELLER AND NO CHANGE
REMOVE PROPELLER AND ADJUST
REINSTALLED PROPELLER
SPUN PROPELLER AND CLOSED BRUSH SCREEN DOOR
PROPELLER NO LONGER HITTING

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE12956	BOLT	1.00	14.21	14.21	\$14.21	N
Labor: \$188.00		Parts: \$14.21	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$202.21	

JHYDDIAG6 JD ALL

COMPLAINT:

17 TIGHTEN CLAMPS ON LEAKING HOSE UNDER MAIN ENGINE GEAR CASE

CORRECTION:

TIGHTENED HOSE CLAMPS ON HOSES BENEATH MAIN ENGINE GEARCASE
CHECK FOR LEAKAGE ON RUN UP

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
-----------------	---------------	--------------	--------------	---------------------

J06001201 JD X9 1000

COMPLAINT:

18 ADJUST CLEAN GRAIN ELEVATOR PADDLE CHAIN AND REMOVE HALF LINK.

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 14 West, Box 599
 Unity, SK S0K 4L0
 Phone: (306) 228-2696
 Fax: (306) 228-2776
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No: _____

Deliver To: _____

Bus Phone: _____ Prv Phone: _____	Bus Phone: _____ Prv Phone: _____	Invoice Number: 3324248 Invoice Date: 2/5/2025 Location: 06 Work Order Number: 478196 Payment Type: _____ Page: 10 of 15
--------------------------------------	--------------------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
-------------	--------	----------------	--------	-----------

JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	
--------------------	-----	-------------------	--------	--

J06001201 JD X9 1000
 ATTEMPTED TO ADJUST
 NEEDED HALF LINK REMOVED
 SET PROPER CHAIN TENSION

Labor: \$100.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$100.00
-----------------	---------------	--------------	--------------	---------------------

JHYDDIAG5 JD ALL**COMPLAINT:**

19 DIAGNOSE AND REPAIR FEED ACCELERATOR GEAR CASE LEAK

CORRECTION:

CLEANED UP DIRT OIL MESS ON GEARCASE
 SEEN OIL MESS WAS COMING FROM GEARCASE SHIFT SHAFT SEAL
 REMOVED SEAL
 INSTALLED NEW SEAL
 CHECKED GEARCASE OIL LEVEL
 RAN SEPARATOR
 CHECKED FOR LEAKS AROUND SEAL LOCATION
 RECHECKED GEARCASE OIL LEVEL
 NO LEAKS WERE FOUND AFTER RUN UP



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AT12820	SEAL	1.00	29.37	29.37	\$29.37	N

Labor: \$400.00	Parts: \$29.37	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$429.37
-----------------	----------------	--------------	--------------	---------------------

JHYDDIAG4 JD ALL**COMPLAINT:**

20 REPAIR OIL LEAK ON HOSE BEHIND TAILING ELEVATOR

CORRECTION:

TIGHTEN HOSE
 CHECK LEAK, OKAY

CONTINUED ON NEXT PAGE->

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 663-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2107
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2049
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



SERVICE INVOICE

Deliver To:

Bus Phone:	Bus Phone:	Invoice Number:	3324248
Prv Phone:	Prv Phone:	Invoice Date:	2/5/2025
		Location:	06
		Work Order Number:	478196
		Payment Type:	
		Page:	11 of 15

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	

JHYDDIAG4 JD ALL

Labor: \$220.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$220.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JADJCHAFSIEV JD X910

COMPLAINT:

21 FACTORY CALIBRATION OF SIEVE AND CHAFFER
- REPAIR 2 BENT LOUVERS ON CHAFFER

CORRECTION:

REPAIRED BENT LOUVERS

PREFORMED SIEVE POSITION CALIBRATION AS PER SERVICE ADVISOR

PREFORMED CHAFFER CALIBRATION AS PER SERVICE ADVISOR

Labor: \$250.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$250.00
-----------------	---------------	--------------	--------------	---------------------

JENGOILCHNG JD X9 10

COMPLAINT:

22 REPLACE ENGINE OIL AND FILTER

*** MARK HOURS ON FILTERS***

CORRECTION:

DRAIN ENGINE OIL AND REMOVE FILTER

CLEAN AREA.

INSTALL NEW OIL AND FILTER.

RUN UNIT AND LEAK CHECK

ADJUST OIL LEVEL AS REQUIRED.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
RE572785	ENGINE OIL FILTER	1.00	151.85	151.85	\$151.85	N
TY26679	PLUS-50 II 15W-40 CK4/SN 18.9L PAIL	3.00	170.86	170.86	\$512.58	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 14 West, Box 599
Unity, SK S0K 4L0
Phone: (306) 228-2696
Fax: (306) 228-2776
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeseville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3324248 Invoice Date: 2/5/2025 Location: 06 Work Order Number: 478196 Payment Type: Page: 12 of 15
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	

JENGOILCHNG JD X9 10

EF300	ENVIRO FEE	3.00	3.00	3.00	\$9.00	N
-------	------------	------	------	------	--------	---

Labor: \$250.00	Parts: \$664.43	OL&M: \$0.00	Misc: \$10.25	Sub-Total: \$924.68
------------------------	------------------------	-------------------------	----------------------	----------------------------

J06001004 JD X9 1000

COMPLAINT:

23 MAIN ENGINE GEARCASE/ROTOR FILTER, REPLACE

* MARK HOURS ON FILTER*

CORRECTION:

REMOVED OLD FILTER

CLEANED AREA

INSTALLED NEW FILTER

MARKED HOURS AND DATE ON NEW FILTER

CHECKED FOR LEAKS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE577250	HYDRAULIC OIL FILTER	1.00	156.71	156.71	\$156.71	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$60.00	Parts: \$156.71	OL&M: \$0.00	Misc: \$1.25	Sub-Total: \$217.96
-----------------------	------------------------	-------------------------	---------------------	----------------------------

J06070003 JD X9 1000

COMPLAINT:

24 TRANSMISSION RETURN FILTER, REPLACE

* MARK HOURS ON FILTER*

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
Hwy 14 West, Box 599
Unity, SK S0K 4L0
Phone: (306) 228-2696
Fax: (306) 228-2776
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Beicarras, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3324248 Invoice Date: 2/5/2025 Location: 06 Work Order Number: 478196 Payment Type: Page: 13 of 15
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	593	1H0X910XAP0825296	176113	

J06070003 JD X9 1000

REMOVED OLD FILTER
CLEANED AREA
INSTALLED NEW FILTER
MARKED HOURS AND DATE ON FILTER
CHECKED FOR LEAKS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R567277	RING	1.00	18.20	18.20	\$18.20	N
RE577250	HYDRAULIC OIL FILTER	1.00	156.71	156.71	\$156.71	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EF100	ENVIRO FEE	1.00	1.25	1.25	\$1.25	N

Labor: \$90.00 Parts: \$174.91 OL&M: \$0.00 Misc: \$1.25 Sub-Total: \$266.16

J06070005 JD X9 1000

COMPLAINT:
25 TRANSMISSION FILTER, REPLACE

* MARK HOURS ON FILTER*

CORRECTION:

REMOVED OLD FILTER
REMOVED OLD O RING
CLEANED AREA
INSTALLED NEW FILTER AND O RING
CHECKED FOR LEAKS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE103407	HYDRAULIC	1.00	168.03	168.03	\$168.03	N
R567277	RING	1.00	18.20	18.20	\$18.20	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

Hwy 14 West, Box 599
 Unity, SK S0K 4L0
 Phone: (306) 228-2696
 Fax: (306) 228-2776
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number:	3324248
Invoice Date:	2/5/2025
Location:	06
Work Order Number:	478196
Payment Type:	
Page:	14 of 15

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE X9 1000

593

1H0X910XAP0825296

176113

J06070005 JD X9 1000

EF100

ENVIRO FEE

1.00

1.25

1.25

\$1.25

N

Labor: \$90.00**Parts: \$186.23****OL&M: \$0.00****Misc: \$1.25****Sub-Total: \$277.48****JWASH JD X9****COMPLAINT:**

26 WASH USED X9 COMBINE. READY FOR DISPLAY.

CORRECTION:**INCLUDES THE FOLLOWING:**

- BLOW OFF ALL CHAFF.
- WASHING OUT RADIATOR AND ALL COOLERS.
- CLEAN OUT GRAIN TANK AND UNLOADING AUGER.
- WASH EXTERIOR PANELS AND ALL SHIELDS.
- VACUUM CAB AND WASH FLOOR MAT
- CLEAN WINDOWS



CONTINUED ON NEXT PAGE->

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Regina, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4668	Kamsack, SK	(306) 642-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

Received by: Date: