

000-00

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3411271 Invoice Date: 7/10/2025 Location: 01 Work Order Number: 482119 Payment Type: Page: 1 of 9
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	553	1H0X910XCP0825327	176267	

EXPERT-1000000143717

COMPLAINT:

01 X9-Series Combine ValueMax Inspection Job

CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26859	INSPECTION+ 3 FLUID TEST KIT	1.00	85.83	0.00	\$0.00	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DISI	LAB DISC INTERN	-1.00	1,290.00	1,290.00	(\$1,290.00)	N
Labor: \$5,150.00		Parts: \$0.00	OL&M: \$0.00	Misc: (\$1,290.00)	Sub-Total: \$3,860.00	

JGEN03-

COMPLAINT:

04 Diagnose and Repair Flasher Light Fault Code

CORRECTION:



PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3411271
		Invoice Date:	7/10/2025
		Location:	01
		Work Order Number:	482119
		Payment Type:	
		Page:	2 of 9

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	553	1H0X910XCP0825327	176267	

JGEN03-

Tuesday, July 1, 2025 2:15 PM -

MOVED OVER TO MACHINE
 TURNED ON POWER SWITCH
 CHECKED OPERATION
 FOUND THAT BATTERIES ARE LOW
 REMOVE CABLES AND CHECKED, 2 BATTERIES HAD 11.5V AND ONE HAD 9.23V,
 NOT ENOUGH TIME IN THE DAY FOR CHARGING,

Wednesday, July 2, 2025 8:46 AM -

HOOKED UP TWO BATTERY CHARGERS,
 ONE CHARGER HAD DAMAGE TO THE POSITIVE LEAD, GAVE TO SHOP HELP TO REPAIR,
 WILL LOAD TEST BATTERIES AFTER THEY HAVE BEEN CHARGED.

Friday, July 4, 2025 10:44 AM -

CHECKED FOR CODES AFTER BATTERIES WERE CHARGED UP
 CODE WAS STILL ACTIVE
 DISCONNECTED BATTERIES AND TESTED THEM
 ALL 3 TESTED GOOD
 REMOVED F302 AND INSTALLED A NEW ONE
 TURNED KEY ON AND DISCONNECTED ALL CONNECTORS FROM THE POD CONTROLLER AND LEFT IT
 PLUGGED BACK IN AND STILL HAD THE CODE
 FOLLOWED DIAGNOSTIC STEPS FOR CODE (517931.04)
 CHECKED FOR POWER AT THE POWER CONNECTOR AT THE CONTROLLER, HAD 12 VOLTS
 CHECKED GROUNDS FOR THE CONTROLLER AND THEY WERE ALL GOOD
 DOWNLOADED POD SOFTWARE AND PUSHED IT TO THE CONTROLLER
 CODE WAS GONE
 CYCLED KEY AND RAN ENGINE, CODE DID NOT RETURN

Tuesday, July 8, 2025 8:51 AM -

LOOKED INTO WHY THE RIGHT HAND SIGNAL ARM WAS NOT WORKING
 CHECKED FOR ANY DAMAGED COMPONENTS
 CHECKED ON DTAC FOR SOLUTIONS
 LOOKED INTO THE SCHEMATIC
 FOLLOWED THE WIRES
 CHECKED THE AND CLEANED THE CONNECTORS
 HOOKED EVERYTHING BACK UP AND THE LIGHTS WERE WORKING
 MUST HAVE BEEN A LOOSE OR DIRTY CONNECTOR

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3411271 Invoice Date: 7/10/2025 Location: 01 Work Order Number: 482119 Payment Type: Page: 3 of 9
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	553	1H0X910XCP0825327	176267	

JGEN03-

HXE139177	40a Fuse ZCASE	1.00	213.32	213.32	\$213.32	N
Labor: \$850.00		Parts: \$213.32	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,063.32	

J06171003 JD X9 1000

COMPLAINT:

06 ADJUST FEEDERHOUSE DRIVE CHAIN.

Lubricate Chain

CAUSE:

chain was wore out

CORRECTION:

LOOSENED OFF DRIVE CHAIN TENSIONER.
 REMOVED MASTER LINK AND SPLIT CHAIN.
 CUT OUT A FULL LINK AND INSTALLED AN OFFSET LINK.
 REATTACHED CHAIN AND TENSION TO SPEC.
 RAN FEEDERHOUSE AND RECHECKED TENSION.

-chain was wore out and was a continuous chain so had to take sprocket off and the 2 bolts bulled chain off and installed new chain and reinstalled sprocket because it was still good and put the bolts back in and tightened to manual spec and ran it and everything is good

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE90399	X9 FEEDER CHAIN DRIVE 80H BSN 83000	1.00	1,108.41	1,108.41	\$1,108.41	N
Labor: \$100.00		Parts: \$1,108.41	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,208.41	

JGEN06-

COMPLAINT:

07 Adjust Bottom Lateral Tilt, Wear Pads

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3411271
		Invoice Date:	7/10/2025
		Location:	01
		Work Order Number:	482119
		Payment Type:	
		Page:	4 of 9

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	553	1H0X910XCP0825327	176267	

JGEN06-

Labor: \$500.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$500.00
-----------------	---------------	--------------	--------------	---------------------

JGEN07-

COMPLAINT:

08 Repair Feeder House Reverser Gearcase Leak.

CAUSE:

leak coming from back of gearcase

CORRECTION:

- removed shields
- lifted feederhouse and locked rams
- unbolted hydraulic lines and capped them
- took pump off shaft assembly
- unbolted the gearcase and took it off
- took off dust cap and removed seal cleaned and inspected everything
- reinstalled new seal
- went to install dust cap seal and noticed the face of it is gouged so waiting to see what to do next on it or if it will seal
- cleaned it up put dust seal in
- put gear case onto mounting brackets torqued to (120ftlb)
- installed return lines (37ftlb) all orings were good
- install pump line splines up put 2 socket head screws in and torque to 55ftlb
- install hoses
- assemble pully over gearcase and torque bolts to (26ftlb) -but belt on and tighten to spec
- ran checked for leaks was good

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
48M7054	SEAL	1.00	37.29	37.29	\$37.29	N
DE32118	SEAL	1.00	41.59	41.59	\$41.59	N
H223849	Quad Ring	1.00	13.57	13.57	\$13.57	N

Labor: \$1,000.00	Parts: \$92.45	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,092.45
-------------------	----------------	--------------	--------------	-----------------------

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No

Deliver To:

Bus Phone:
 Prv Phone:

Bus Phone:
 Prv Phone:

Invoice Number: **3411271**
 Invoice Date: 7/10/2025
 Location: 01
 Work Order Number: 482119
 Payment Type:
 Page: 5 of 9

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	553	1H0X910XCP0825327	176267	

J06180021 JD X9 1000

COMPLAINT:

12 CONCAVE REPAIR 1.0 HRS PER CONCAVE

Left Hand Front Concave Needs Repaired.
 Right Hand Front Concave Needs Repairs.

CAUSE:


concave wires and bars were bent and broke.

CORRECTION:

REPAIR CONCAVES AS NEEDED.
 (STRAIGHTENING AND WELDING)

six concaves required new nails and some welding
 removed bent nails by clamping vice grip on head of nail and pulling one out at a time. installed new nail by putting very slight bend on tip of nail and pushed through holes.

removed all concave nails for welding.
 used torch to heat nail housing and bent back straight.
 tack welded pieces that were cracked.
 installed nails

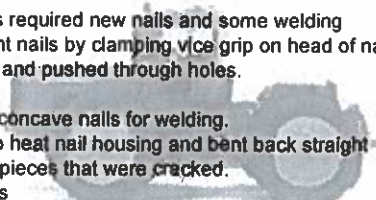

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE142914	Small Wire Nail X9	37.00	12.80	12.80	\$473.60	N
Labor: \$565.00		Parts: \$473.60	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,038.60	

JGEN13-

COMPLAINT:

14 Active Tailings Repairs.

- Seal up between Rethresher and Upper Tailings Elevator (silicone)
- Replace Tailings Camera Seal

CAUSE:

seal on camera was split,

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: **3411271**
 Invoice Date: 7/10/2025
 Location: 01
 Work Order Number: 482119
 Payment Type:
 Page: 6 of 9

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	553	1H0X910XCP0825327	176267	

JGEN13-

CORRECTION:

remove old seal from camera and clean surface. install new seal.

looked for the spot that required sealed up and could not find. asked for foreman to look to see if they knew of common spots that leak. foreman did not find any spot that required sealing. tech that did the inspection was not here to ask where he thought required resealing.

caused segment to be ran higher than time was given for.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE141213	GASKET	1.00	19.19	19.19	\$19.19	N
544412	ClearRTV 300ml	1.00	15.44	15.44	\$15.44	N
Labor: \$140.00		Parts: \$34.63		OL&M: \$0.00		Misc: \$0.00
				Sub-Total: \$174.63		

JGEN15-

COMPLAINT:

16 Diagnose and Repair Chopper Gearcase Oil Leak.

- Replace with new oil after leak fixed

CAUSE:

gear case rear seal leaking

CORRECTION:

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3411271 Invoice Date: 7/10/2025 Location: 01 Work Order Number: 482119 Payment Type: Page: 7 of 9
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	553	1H0X910XCP0825327	176267	

JGEN15-

removed covers and hydraulic lines took off pulley assembly with shims and locking cap screw and big nut holding it on and a snap ring

- had to use a puller to to get gearcase off checked gearcase and bearings everything was in good shape
- lubed seal and installed and also installed snap ring
- gear case with big nut and washer and torqued to (73ftlb)
- turned clockwise 4 complete turns and torqued to (184ftlb) with chopper in nutural and spin clockwise 4 times and re tighten to (295ftlb)
- install chopper gearcase cover and put in new rubber o ring and torqued to (73ftlb)
- installed snap ring
- installed 4 shims as i took them off
- then put pulley back on and but the @ shims back on on the outside

- installed cap screws and torqued to(94ftlb)
- re tightened drain plug and filled gearcase with hy gaurd reinstalled belt and then finished hooking up all connections cant run test until the combine is put together
- ran it and tested and no leaks works good

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DE32457	SEAL SKF 70 90 10	1.00	92.89	92.89	\$92.89	N
R110708	O-RING	1.00	6.91	6.91	\$6.91	N
Labor: \$1,050.00		Parts: \$99.80	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,149.80	

JGEN27-

COMPLAINT:

28 Replace Grain Tank Loading Auger.

CAUSE:

auger was in very bad shape and required changing

CORRECTION:

attached sling to auger mount and crane. lowered fountain auger to a 45 degree angle,
 removed six carriage head bolts
 pulled old auger out
 installed in reverse order

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4365		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: 3411271 Invoice Date: 7/10/2025 Location: 01 Work Order Number: 482119 Payment Type: Page: 8 of 9
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	553	1H0X910XCP0825327	176267	

JGEN27-

19M7815	M12x60 FLG 10.9 BOLT	1.00	6.69	6.69	\$6.69	N
AXE85993	Bearing With Housing	1.00	223.46	223.46	\$223.46	N
AXE89023	X9 LOADING AUGER EXT WEAR	1.00	4,076.32	4,076.32	\$4,076.32	N
HXE142368	Washer	1.00	36.20	36.20	\$36.20	N
HXE165698	Deflector	1.00	27.38	27.38	\$27.38	N

Labor: \$540.00	Parts: \$4,370.05	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$4,910.05
------------------------	--------------------------	-------------------------	---------------------	------------------------------

J06180268 JD X9 1000

COMPLAINT:

33 INSTALL CONCAVES, LEVEL AND CALIBRATE.

CORRECTION:

INSTALLED CONCAVES (ENSURE THAT THE CONCAVES ARE TIGHT TO ONE ANOTHER AND THERE IS ADEQUATE BULKHEAD CLEARANCE)
 LEVELED CONCAVES AS PER SERVICE ADVISOR.
 PERFORMED CONCAVE CALIBRATION.



Labor: \$800.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$800.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

JSOFTWARE JD X9 1000

COMPLAINT:

36 UPDATE ALL CONTROLLER SOFTWARE

UPDATED SOFTWARE ON _____ CONTROLLERS.
 HAD TO PERFORM THE FOLLOWING CALIBRATIONS.

CAUSE:

software needed updated

CORRECTION:

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 2777 North Service Road West
 Swift Current, SK S9H 5M1
 Phone: (306) 773-9351
 Fax: (306) 773-2045
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	3411271
		Invoice Date:	7/10/2025
		Location:	01
		Work Order Number:	482119
		Payment Type:	
		Page:	9 of 9

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	553	1H0X910XCP0825327	176267	

JSOFTWARE JD X9 1000

UPDATED SOFTWARE ON _____ CONTROLLERS.
 HAD TO PERFORM THE FOLLOWING CALIBRATIONS.
 display
 HAD
 FED
 DEFHEADER

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
-----------------	---------------	--------------	--------------	---------------------

INVOICE CONTAINS \$85.83 DISCOUNT

Miscellaneous Charges:

SERVICE ACCESSORIES

\$150.00

Customer PO No:

Tax Exempt No:

Advisor:

Labor: \$11,095.00

Parts: \$6,392.26

OL&M: \$0.00

Misc: (\$1,140.00)

Grand Total: \$16,347.26

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: