



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 1 of 19
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

GEN42- Internal

COMPLAINT:

03 REPLACE M8 NUT FOR SIDE OF ENGINE ACCESS LADDER, MISSING

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
14M7298	Flange Nut M8	1.00	1.53	1.53	\$1.53	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	1.12	1.12	\$1.12	N
Labor: \$18.60		Parts: \$1.53	OL&M: \$0.00	Misc: \$1.12	Sub-Total: \$21.25	

GEN43- Internal

COMPLAINT:

04 DIAGNOSE AND REPAIR VIBRATION IN THE FEED ACCELERATOR

CORRECTION:

FOUND FEED ACCELERATOR HAD SOME DIRT IN IT CAUSING A SLIGHT VIBRATION WHEN RUNNING IN FULL SPEED.
 CLEANED OUT DIRT AND RE ASSEMBLED

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N
Labor: \$186.00		Parts: \$0.00	OL&M: \$0.00	Misc: \$11.16	Sub-Total: \$197.16	

/10180250AX9 1100 Internal

COMPLAINT:

05 CONCAVE LEVEL, ADJUST, AND CALIBRATE (WITH ACI), REPEAT PROCEDURE ON OPPOSITE SIDE

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
----------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Invoice Number: [REDACTED]	Invoice Date: 10/27/2025	Location: [REDACTED]	Work Order Number: [REDACTED]
Bus Phone:	Bus Phone:	Payment Type: [REDACTED]	Page: 2 of 19
Prv Phone:	Prv Phone:		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

/10180250AX9 1100 Internal						
SERVACCESS	SERVICE ACCESSORIES	1.00	50.22	50.22	\$50.22	N
Labor: \$837.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$50.22	Sub-Total: \$887.22		

/15126X91100 Internal
 COMPLAINT:
 06 CALIBRATE ALL FUNCTIONS, FORE/ AFT IS ONLY GOING TO -3 AND 8

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N
Labor: \$186.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$11.16	Sub-Total: \$197.16		


/110176X9 1100 Internal
 COMPLAINT:
 07 CHECK OUT ALL CODES FOUND ON GREENLIGHT

ECU 3517.12 ACTIVE
 HAD 517804.06

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N
Labor: \$186.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$11.16	Sub-Total: \$197.16		

GEN45- Internal
 COMPLAINT:
 10 DIAGNOSE AND REPAIR DOOR CINCH IS NOT WORKING

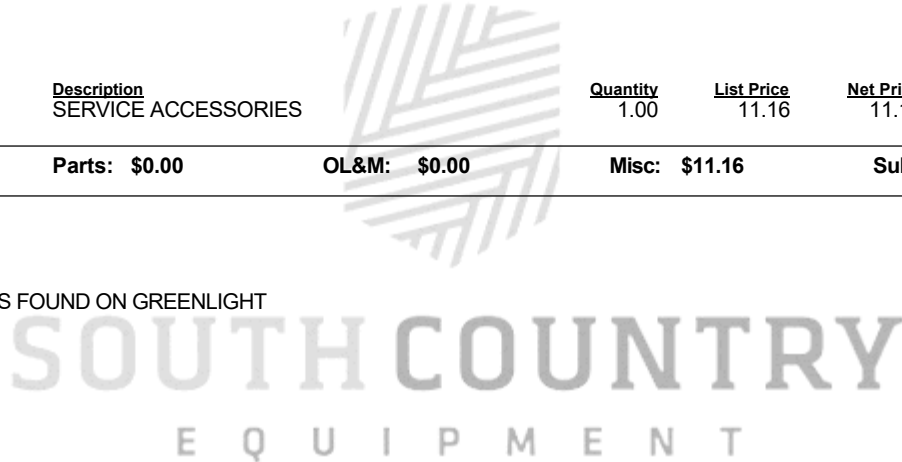



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 3 of 19
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

GEN45- Internal

CORRECTION:

TESTED DOOR CINCH, NOT WORKING. CHECKED CONNECTOR FOR BROKEN PINS, GOOD. TESTED WIRES BACK TO CONTROLLER, GOOD. CLEANED CONNECTION AND GROUND, RETESTED, GOOD.

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N
Labor: \$186.00		Parts: \$0.00	OL&M: \$0.00	Misc: \$11.16	Sub-Total: \$197.16	

/140968AX9 1100 Internal

COMPLAINT:

11 UPDATE ALL MACHINE CONTROLLERS SOFTWARE

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	27.90	27.90	\$27.90	N
Labor: \$465.00		Parts: \$0.00	OL&M: \$0.00	Misc: \$27.90	Sub-Total: \$492.90	

/110312X9 1100 Internal

COMPLAINT:

12 REMOVE CUSTOMER DATA/ SOFTWARE

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	2.79	2.79	\$2.79	N
Labor: \$46.50		Parts: \$0.00	OL&M: \$0.00	Misc: \$2.79	Sub-Total: \$49.29	



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 4 of 19
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

/142375X9 1100 Internal

COMPLAINT:
 13 REPLACE LH REAR EXTREMITY FLASHER, LED LIGHT ON ARM

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
RE592939	Lamp	1.00	110.47	110.47	\$110.47	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	2.79	2.79	\$2.79	N
Labor: \$46.50		Parts: \$110.47	OL&M: \$0.00	Misc: \$2.79	Sub-Total: \$159.76	

GEN46- Internal

COMPLAINT:
 14 ADJUST UNLOADING AUGER IN CRADLE. WHEN UNLOADING AUGER IS SWUNG IN IT CODES HAD 522468.18. IT IS HITTING THE CRADLE AND THEN HAS TO WORK TO CLIMB INTO THE CRADLE.

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N
Labor: \$186.00		Parts: \$0.00	OL&M: \$0.00	Misc: \$11.16	Sub-Total: \$197.16	

/510004X9 1100 Internal

COMPLAINT:
 15 REPLACE FEEDER HOUSE DRIVE CHAIN

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
--------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 5 of 19
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

/510004X9 1100 Internal

AXE90399	X9 FH Drive Chain #80H	1.00	1,147.68	1,147.68	\$1,147.68	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	5.02	5.02	\$5.02	N
Labor: \$83.70		Parts: \$1,147.68		OL&M: \$0.00		Misc: \$5.02
Sub-Total: \$1,236.40						

/170380X9 1100 Internal

COMPLAINT:
 16 REMOVE HALF LINK FROM FEEDER HOUSE CONVEYOR CHAIN AND ADJUST

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N
Labor: \$186.00		Parts: \$0.00		OL&M: \$0.00		Misc: \$11.16
Sub-Total: \$197.16						

GEN47- Internal

COMPLAINT:
 17 DIAGNOSE AND REPAIR OIL LEAK AROUND FRONT END GEARCASE

CORRECTION:
 WASHED OFF AND RAN, OIL WAS COMING OUT BREATHER. CHECKED AND ADJUSTED OIL LEVEL

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	5.58	5.58	\$5.58	N
Labor: \$93.00		Parts: \$0.00		OL&M: \$0.00		Misc: \$5.58
Sub-Total: \$98.58						

GEN48- Internal

COMPLAINT:
 18 SHEER BOLT FOR THE UNLOADING AUGER IS BROKEN OFF IN THE HUB



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 6 of 19
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

GEN48- Internal

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	8.37	8.37	\$8.37	N
Labor: \$139.50		Parts: \$0.00	OL&M: \$0.00	Misc: \$8.37	Sub-Total: \$147.87	

/110143X9 1100 Internal

COMPLAINT:

19 STRAIGHTEN CHAFFER ELEMENT LOUVERS, BENT UP AT THE FRONT OF THE CHAFFER ELEMENT

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	4.46	4.46	\$4.46	N
Labor: \$74.40		Parts: \$0.00	OL&M: \$0.00	Misc: \$4.46	Sub-Total: \$78.86	

GEN49- Internal

COMPLAINT:

21 ALIGN FRONT END DRIVE BELT, RUNNING AGAINST THE EDGE OF THE IDLER PULLEY

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N
Labor: \$186.00		Parts: \$0.00	OL&M: \$0.00	Misc: \$11.16	Sub-Total: \$197.16	

GEN50- Internal

COMPLAINT:



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 10/27/2025 Location: Work Order Number: Payment Type: Page: 7 of 19
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

GEN50- Internal

23 REPLACE BOTH ENDS OF CONNECTOR ABOVE THE TAILINGS HOUSING, RUBBING ON A PULLEY

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
57M14979	Elec. Connector Accessory	1.00	92.23	92.23	\$92.23	N
57M15493	Elec. Connector Accessory	1.00	6.22	6.22	\$6.22	N
57M9817	Elec. Connector	1.00	8.29	8.29	\$8.29	N
57M9821	Elec. Connector Housing	1.00	39.32	39.32	\$39.32	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N
Labor: \$186.00		Parts: \$146.06		OL&M: \$0.00		Misc: \$11.16
						Sub-Total: \$343.22

/170531AX9 1100 Internal

COMPLAINT:

24 REPLACE ACTIVE VISION CAMERA DESSICANT CARTRIDGE ON BOTH TAILINGS AND CLEAN GRAIN CAMERAS. INCLUDES CLEAN CAMERA LENSES (400 HR SERVICE)

*LEAVE IN CAB, TO BE INSTALLED BEFORE NEXT HARVEST

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
KXE10744	Desiccant	2.00	358.72	358.72	\$717.44	N
Labor: \$0.00		Parts: \$717.44		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$717.44

/10180010X9 1100 Internal

COMPLAINT:

28 R&R ROTOR DRIVE BELT, CRACKED



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 10/27/2025 Location: Work Order Number: Payment Type: Page: 8 of 19
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

/10180010X9 1100 Internal

CORRECTION:
 TURN EYE BOLTS THREADS SEIZED, HAD TO CUT OFF AND REPLACE. ROTOR GEAR WAS DIFFICULT TO SLIDE OVER ENOUGH TO INSTALL NEW EYE BOLT

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7291	Flange Nut M16	1.00	4.80	4.80	\$4.80	N
H152450	EYEBOLT	1.00	84.75	84.75	\$84.75	N
HXE107859	X9 Rotor Belt	1.00	1,646.15	1,646.15	\$1,646.15	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
SERVACCESS	SERVICE ACCESSORIES	1.00	41.16	41.16	\$41.16	N
Labor: \$651.00		Parts: \$1,735.70		OL&M: \$0.00		Misc: \$41.16
						Sub-Total: \$2,427.86

GEN53- Internal

COMPLAINT:
 29 ALIGN UNLOADING AUGER DRIVE BELT, RUNNING AGAINST THE SIDE OF THE SMOOTH IDLER ON THE TOP OF THE TAILINGS HOUSING

CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
24H1373	WASHER	2.00	4.62	4.62	\$9.24	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
SERVACCESS	SERVICE ACCESSORIES	1.00	8.37	8.37	\$8.37	N
Labor: \$139.50		Parts: \$9.24		OL&M: \$0.00		Misc: \$8.37
						Sub-Total: \$157.11

/172606X9 1100 Internal

COMPLAINT:
 36 REPLACE FILTERS FOR DEF PUMP AND TANK



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 10/27/2025 Location: Work Order Number: Payment Type: Page: 9 of 19
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

/172606X9 1100 Internal

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
DZ114640	DEF Injection Pump Filter Kit	1.00	236.82	236.82	\$236.82	N
DZ124403	FILTER KIT, DEF INLINE SERVICE KIT	1.00	152.29	152.29	\$152.29	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.00	1.00	\$1.00	N
SERVACCESS	SERVICE ACCESSORIES	1.00	25.11	25.11	\$25.11	N
Labor: \$277.25		Parts: \$389.11		OL&M: \$0.00		Misc: \$26.11
						Sub-Total: \$692.47

/142855X9 1100 Internal

COMPLAINT:
 37 CHANGE OIL IN FEED ACCELERATOR GEARCASE

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
TY26408	946ML HD460 SYNTHETIC	2.00	49.37	49.37	\$98.74	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF15	ENVIRO FEE	2.00	0.15	0.15	\$0.30	N
SERVACCESS	SERVICE ACCESSORIES	1.00	8.37	8.37	\$8.37	N
Labor: \$139.50		Parts: \$98.74		OL&M: \$0.00		Misc: \$8.67
						Sub-Total: \$246.91

/142856X9 1100 Internal

COMPLAINT:
 38 CHANGE OIL IN CLEANING FAN VARIABLE SPEED DRIVEN SHEAVE



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 10/27/2025 Location: Work Order Number: Payment Type: Page: 10 of 19
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

/142856X9 1100 Internal
 CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26408	946ML HD460 SYNTHETIC	1.00	49.37	49.37	\$49.37	N
<u>Miscellaneous</u> EF15	<u>Description</u> ENVIRO FEE	<u>Quantity</u> 1.00	<u>List Price</u> 0.15	<u>Net Price</u> 0.15	<u>Extended Price</u> \$0.15	<u>Taxed Ind</u> N
SERVACCESS	SERVICE ACCESSORIES	1.00	8.37	8.37	\$8.37	N
Labor: \$139.50		Parts: \$49.37		OL&M: \$0.00		Misc: \$8.52
						Sub-Total: \$197.39

GEN55- Internal

COMPLAINT:

40 REMOVE STRAW CHOPPER GEAR CASE. RESEAL AND CHANGE OIL

THE CHAFF HAS WORN THE EDGE OF THE GEAR CASE DOWN SO FAR, THE FILL PLUG IS LEAKING. SWAP OUTER HOUSING WITH A USED WARRANTY HOUSING.

CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
CE35632	Ball Bearing	1.00	258.37	258.37	\$258.37	N
CE35633	Ball Bearing	1.00	141.38	141.38	\$141.38	N
DE31548	SEAL	1.00	18.02	18.02	\$18.02	N
DE32457	SEAL	1.00	93.22	93.22	\$93.22	N
DE32460	SEAL	1.00	157.71	157.71	\$157.71	N
DE32519	SEAL	2.00	41.26	41.26	\$82.52	N
R110708	O-RING	1.00	8.61	8.61	\$8.61	N
R28961	WASHER	1.00	4.11	4.11	\$4.11	N
R530785	O-RING	1.00	11.22	11.22	\$11.22	N



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 10/27/2025 Location: Work Order Number: Payment Type: Page: 11 of 19
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

GEN55- Internal

TY6354	3.78L HYGARD HYD/TRANS OIL J20C	1.00	35.64	35.64	\$35.64	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF50	ENVIRO FEE	1.00	0.50	0.50	\$0.50	N
SERVACCESS	SERVICE ACCESSORIES	1.00	96.00	96.00	\$96.00	N

Labor: \$1,860.00 Parts: \$810.80 OL&M: \$0.00 Misc: \$96.50 Sub-Total: \$2,767.30

/142377X9 1100 Internal

COMPLAINT:
 41 REPLACE RESIDUE SPREADER DRIVE BELT, CRACKING AND DE LAMINATED

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
HXE176243	Spreader Belt Fine/Extra Fine Cut	1.00	183.50	183.50	\$183.50	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N

Labor: \$186.00 Parts: \$183.50 OL&M: \$0.00 Misc: \$11.16 Sub-Total: \$380.66

/140326X9 1100 Internal

COMPLAINT:
 42 FLIP STRAW CHOPPER HAMMERS

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
HXE118760	LOCK NUT	62.00	2.72	2.72	\$168.64	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
FREIGHT	FREIGHT	1.00	20.00	20.00	\$20.00	N



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 12 of 19
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

/140326X9 1100 Internal						
SERVACCESS	SERVICE ACCESSORIES	1.00	33.48	33.48	\$33.48	N
Labor: \$558.00		Parts: \$168.64		OL&M: \$0.00		Misc: \$53.48
					Sub-Total: \$780.12	

/140854X9 1100 Internal
 COMPLAINT:
 43 TURN STRAW CHOPPER STATIONARY KNIVES

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	8.37	8.37	\$8.37	N
Labor: \$139.50		Parts: \$0.00		OL&M: \$0.00		Misc: \$8.37
					Sub-Total: \$147.87	

/142858X9 1100 Internal
 COMPLAINT:
 44 TOP UP OIL IN BOTH SPREADER GEARCASES

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
TY22062	9.46L HYGARD HYD/TRANS OIL J20C	1.00	85.28	85.28	\$85.28	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF100	ENVIRO FEE	1.00	1.00	1.00	\$1.00	N
SERVACCESS	SERVICE ACCESSORIES	1.00	6.70	6.70	\$6.70	N
Labor: \$111.60		Parts: \$85.28		OL&M: \$0.00		Misc: \$7.70
					Sub-Total: \$204.58	

/110072X9 1100 Internal
 COMPLAINT:



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 10/27/2025 Location: Work Order Number: Payment Type: Page: 13 of 19
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

/110072X9 1100 Internal
 46 CLEAN FUEL SEDIMENT BOWL

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	4.46	4.46	\$4.46	N
Labor: \$74.40		Parts: \$0.00	OL&M: \$0.00	Misc: \$4.46	Sub-Total: \$78.86	

/110071X9 1100 Internal
 COMPLAINT:
 50 REMOVE HALF LINK FROM CLEAN GRAIN PADDLE CHAIN AND ADJUST

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	5.58	5.58	\$5.58	N
Labor: \$93.00		Parts: \$0.00	OL&M: \$0.00	Misc: \$5.58	Sub-Total: \$98.58	

/170208X9 1100 Internal
 COMPLAINT:
 52 TOP UP COOLANT, TIGHTEN LOOSE RADIATOR HOSE

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
TY26575	3.78L COOL-GARD PREMIX	1.00	26.65	26.65	\$26.65	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF91	ENVIRO FEE	1.00	0.91	0.91	\$0.91	N



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 14 of 19
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

/170208X9 1100 Internal									
SERVACCESS	SERVICE ACCESSORIES	1.00	2.23	2.23	\$2.23	N			
Labor: \$37.20		Parts: \$26.65		OL&M: \$0.00		Misc: \$3.14		Sub-Total: \$66.99	

GEN60- Internal
 COMPLAINT:
 53 REPLACE ROTARY SCREEN IDLER ON TENSION ARM BEARING, NOISY

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>			
AH140497	Idler Pulley	1.00	62.53	62.53	\$62.53	N			
Miscellaneous	SERVACCESS	1.00	5.58	5.58	\$5.58	N			
Labor: \$93.00		Parts: \$62.53		OL&M: \$0.00		Misc: \$5.58		Sub-Total: \$161.11	

GEN61- Internal
 COMPLAINT:
 55 REPAIR LEAK AT DEF TANK LID, GASKET LEAK

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>			
R539112	O-Ring	1.00	77.18	77.18	\$77.18	N			
R539113	O-Ring	1.00	62.60	62.60	\$62.60	N			
Miscellaneous	SERVACCESS	1.00	4.46	4.46	\$4.46	N			
Labor: \$74.40		Parts: \$139.78		OL&M: \$0.00		Misc: \$4.46		Sub-Total: \$218.64	



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 15 of 19
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

GEN62- Internal

COMPLAINT:

57 DRAIN OIL FROM BOTH LOADING AUGER GEAR CASES, OVER FULL

CORRECTION:

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
SERVACCESS	SERVICE ACCESSORIES	1.00	5.58	5.58	\$5.58	N
Labor: \$93.00		Parts: \$0.00		OL&M: \$0.00		Misc: \$5.58
						Sub-Total: \$98.58

/120014X9 1100 Internal

COMPLAINT:

59 GREASE COMBINE

CORRECTION:

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6341	SD POLYUREA GREASE	1.00	10.87	10.87	\$10.87	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N
Labor: \$186.00		Parts: \$10.87		OL&M: \$0.00		Misc: \$11.16
						Sub-Total: \$208.03

/140486X9 1100 Internal

COMPLAINT:

60 ADJUST ALL BELT AND CHAIN TENSION

CORRECTION:

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
---------------	-------------	----------	------------	-----------	----------------	-----------



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 10/27/2025 Location: Work Order Number: Payment Type: Page: 16 of 19
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

/140486X9 1100 Internal							
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N	
Labor: \$186.00		Parts: \$0.00		OL&M: \$0.00		Misc: \$11.16	
				Sub-Total: \$197.16			

GEN63- Internal
 COMPLAINT:
 61 REPLACE RUBBER DUST FLAPS ON FEEDER HOUSE OPENING, RH SIDE ONLY

CORRECTION:
 WAS GIVEN WRONG FLAP.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>	
HXE138024	Seal	1.00	51.16	51.16	\$51.16	N	
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>	
SERVACCESS	SERVICE ACCESSORIES	1.00	4.46	4.46	\$4.46	N	
Labor: \$74.40		Parts: \$51.16		OL&M: \$0.00		Misc: \$4.46	
				Sub-Total: \$130.02			

/110259X9 1100 Internal
 COMPLAINT:
 63 WELD AND REPAIR CONCAVE AS NEEDED (WHEN OUT), 1 CONCAVE

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>	
SERVACCESS	SERVICE ACCESSORIES	1.00	16.74	16.74	\$16.74	N	
Labor: \$279.00		Parts: \$0.00		OL&M: \$0.00		Misc: \$16.74	
				Sub-Total: \$295.74			

/GLOPCLEANX9 1100 Internal
 COMPLAINT:
 64 GREENLIGHT/RECONDITIONING CLEANING CHECKLIST



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: Invoice Date: 10/27/2025 Location: Work Order Number: Payment Type: Page: 17 of 19
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

/GLOPCLEANX9 1100 Internal

CORRECTION:

Labor: \$0.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$0.00
----------------------	----------------------	-------------------------	---------------------	--------------------------

/110377X9 1100 Internal

COMPLAINT:
 65 RERUN AFTER REPAIRS

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N
Labor: \$186.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$11.16	Sub-Total: \$197.16		

GEN66- Internal

COMPLAINT:
 66 REPAIR FEED ACCELERATOR VIBRATION

CORRECTION:

FOLLOWED DTAC 219898 MADE SURE THERE WAS NO BENT OR MISSING WINGS ALL LOOKED GOOD. AS PER THE DTAC INSTRUCTIONS I LOOSENED THE 6 BOLTS THAT HOLD EACH OF THE CHEVRON FLIGHTING WING AND CLEANED EVERY THING OUT AND RE TORQUED AS PER INSTRUCTED. CAN COMBINE AND HAD NO VIBRATION

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
19M7786	Flange Head Cap Screw M10 X 30 GR10.9	1.00	2.46	2.46	\$2.46	N
L215374	Carriage Bolt M12 x 35	1.00	4.77	4.77	\$4.77	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>



#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 18 of 19
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

GEN66- Internal								
SERVACCESS	SERVICE ACCESSORIES	1.00	41.29	41.29	\$41.29	N		
Labor: \$684.11		Parts: \$7.23	OL&M: \$0.00	Misc: \$41.29	Sub-Total: \$732.63			

GEN79- Internal
 COMPLAINT:
 67 RESEAL REVERSER MOTOR, LEAKING

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AA46577	Seal Kit	1.00	432.90	432.90	\$432.90	N

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
----------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------





#8 South Plains Road West
 Emerald Park, SK S4L 1C6
 Phone: 306-721-5050
 www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/27/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 19 of 19
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2021 JOHN DEERE X9 1100	917	1H0X911XJME815148	1H0X911XJME815148*	

GEN79- Internal								
SERVACCESS	SERVICE ACCESSORIES	1.00	50.22	50.22	\$50.22			N
Labor: \$837.00		Parts: \$432.90		OL&M: \$0.00		Misc: \$50.22		Sub-Total: \$1,320.12

Customer PO No:	[REDACTED]
Tax Exempt No:	[REDACTED]
Advisor:	[REDACTED]

Labor:	\$10,391.56
Parts:	\$6,384.68
OL&M:	\$0.00
Misc:	\$642.56
Grand Total:	<u>\$17,418.80</u>

*** DOCUMENT COPY ***

GST Registration No: 897357802

G/L Entries	Br	Dpt	Acct	Sub	Ref	Description
	00	00	160	1	147614	USED AG EQUIPMENT
	04	40	382	1	6156	INTERNAL LABOR-AG
	00	00	178	14	6156	WORK IN PROCESS PARTS -MJ
	04	40	482	1	6156	COS INTERNAL LABOR-AG
	04	30	366	2	6156	JD PARTS-COUNTER
	00	00	166	4	6156	JD PARTS-MOOSE JAW
	04	40	544	1	6156	SUPPLIES EXPENSE
	04	30	375	3	6156	PARTS SPECIAL HANDLING
	04	30	375	1	6156	PARTS SPECIAL HANDLING
	04	30	466	2	6156	JD PARTS-COUNTER

TERMS AND CONDITIONS

Terms: Cash, Visa, Mastercard, AgriCard, John Deere Financial.
 I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate the above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control.

Received by:Date: