



ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026

Service Estimate

Customer

Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

Windshield Washer Fluid, Top Up

Customer Response : Undecided

(EXPERT-1000000107835)

Steps : 1. Fill reservoir.

Parts	Part #	Part Name	Quantity	Units
	TY27865	Fluid	1.00	EACH

Est Labor \$19.84

Parts \$8.43

Recommended \$28.27

Diagnose air seat

Customer Response : Undecided

(AD_HOC-1000000345871)

Steps : Air seat lowers but does not raise. Diagnose air seat. Yellow

Est Labor \$297.60

Parts \$0.00

Recommended \$297.60

Controller Software, Update

Customer Response : Undecided

(EXPERT-1000000038626)

Description : Update controller software
(Includes AMS)
Provide customer with Engine load profile

Steps : 1. Download and install all controller software updates, (Includes AMS).
2. Provide customer with Engine load profile.

Display, ecu and nzc have available updates. Don't install software if ecu has been tuned and deleted.

Est Labor \$277.76

Parts \$0.00

Recommended \$277.76



ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026

Service Estimate

Customer



Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

Review tired codes

Customer Response : Undecided

(AD_HOC-1000000345874)

Steps : Review stored codes and see if the code with high counts should be looked into more and if so quoted diagnostics.
Green

Est Labor \$148.80

Parts \$0.00

Recommended \$148.80

Wheel Bolt Hardware, Re-Torque

Customer Response : Undecided

(EXPERT-1000000039112)

Steps : 1. Re-torque all wheel hardware.
2. Use crisscrossing pattern for evenly torque.

Retorque annually as spayers often have tire changed. Yellow

Est Labor \$198.40

Parts \$0.00

Recommended \$198.40

Service battery connections

Customer Response : Undecided

(AD_HOC-1000000345883)

Steps : Service barriers and connections of unit. Green

Est Labor \$158.72

Parts \$0.00

Recommended \$158.72



ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026

Service Estimate

Customer

Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

Wiring Harness, Repair

Customer Response : Undecided

(EXPERT-1000000192949)



View Images from Inspection

Steps : 1. Repair damage to wiring harness.

LHS boom harness fix. Can terminators use missing on outer boom section. Repair wires. Red

Parts need terminator and the connector and pins for the wire.

Parts	Part #	Part Name	Quantity	Units
	57M9813	Elec. Connector Terminal	2.00	EACH
	57M9776	Elec. Connector Housing	1.00	EACH
	57M11134	Elec. Connector Housing	1.00	EACH

Est Labor \$198.40

Parts \$37.03

Recommended \$235.43

Wiring Harness, Repair

Customer Response : Undecided

(EXPERT-1000000192949)



View Images from Inspection

Steps : 1. Repair damage to wiring harness.

Rhs center boom connector is breaking from pressure of the solution line pushing on it chain connector. Green

Parts needed connector.

Parts	Part #	Part Name	Quantity	Units
	57M11749	Elec. Connector Housing	1.00	EACH

Est Labor \$198.40

Parts \$139.03

Recommended \$337.43



ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026

Service Estimate

Customer

Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

Front Wheel Motor Forward Propel Hose, Remove and Replace

Customer Response : Undecided

(EXPERT-1000000043203)



View images from inspection

- Steps :**
1. Remove old propel hose.
 2. Remove and replace front wheel motor forward propel hose.
 3. Assemble in reverse order.
 4. Replace oil, as necessary.

Front rhs wheel motor hrydostat line is starting to leak at the crimp at the end of the hose by the frame. Class 1 leak.
Yellow

Parts	Part #	Part Name	Quantity	Units
	AKK33874	Hydraulic Hose	2.00	EACH
	T78313	O-Ring	2.00	EACH
	T59014	O-Ring	2.00	EACH
Est Labor \$432.51			Parts \$1,777.22	Recommended \$2,209.73

Replace wheel motor drive hose oring

Customer Response : Undecided

(AD_HOC-10000000345948)



View images from inspection

- Steps :** Right rear drive motor has a class 1 leak on the bottom hyd hose. Replace oring. Green

Parts	Part #	Part Name	Quantity	Units
	T78313	O-Ring	1.00	EACH
Est Labor \$99.20			Parts \$9.18	Recommended \$108.38



ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026

Service Estimate



Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

Rear Wheel Motor Forward Propel Hose, Remove and Replace

Customer Response : Undecided

(EXPERT-1000000043173)



View Images from Inspection

- Steps :**
1. Relieve hydraulic pressure.
 2. Install vacuum pump on reservoir.
 3. Remove drive motor shield.
 4. Disconnect case drain hose from drive motor and union fitting.
 5. Remove and replace rear wheel motor forward propel hose.
 6. Assemble in reverse order.

Rear right wheel motor has hydrostat line has a class 2 leak. Change line. Yellow

Parts	Part #	Part Name	Quantity	Units
	AKK33877	Hydraulic Hose	2.00	EACH
	T59014	O-Ring	8.00	EACH
	T78313	O-Ring	4.00	EACH
Est Labor \$432.51			Parts \$2,275.72	Recommended \$2,708.23

Replace hyd hose

Customer Response : Undecided

(AD_HOC-1000000347172)



View Images from Inspection

- Steps :** Hyd hose is leaking from the crimp class 2 leak on the LHS hydrostat lines. Replace line. Yellow

Parts	Part #	Part Name	Quantity	Units
	AKK28996	Hydraulic Hose	1.00	EACH
	T59014	O-Ring	1.00	EACH
	T78393	O-Ring	1.00	EACH
Est Labor \$436.48			Parts \$422.04	Recommended \$858.52



ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026

Service Estimate

Customer

Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

Air Dryer Cartridge, Remove and Replace

Customer Response : Undecided

(EXPERT-1000000042716)

- Steps :**
1. Relieve air system pressure.
 2. Turn cartridge counterclockwise.
 3. Remove and replace air drier cartridge.
 4. Assemble in reverse order.

Replace cartridge yearly. Green

Parts	Part #	Part Name	Quantity	Units
	AKK11031	Filter	1.00	EACH

Est Labor \$109.12

Parts \$304.81

Recommended \$413.93

Outer boom section replace

Customer Response : Undecided

(AD_HOC-1000000348894)



View images from inspection

- Steps :** Outer boom second is damaged. The boom and rear brace are damaged as well as the fence row nozzle is also missing.

Parts needed. Rhs boom yellow guard. Fence row nozzle brackets and nozzle

Parts	Part #	Part Name	Quantity	Units
	AKK17746	Adapter Fitting	1.00	EACH
	KK42311	Bracket	1.00	EACH
	AKK38784	Wing Frame	1.00	EACH
	KK25951	Spring Washer	1.00	EACH
	KK54805	Nut	1.00	EACH
	AKK19630	Rivet	4.00	EACH
	AKK19387	Cap	1.00	EACH

Est Labor \$1,190.40

Parts \$11,714.51

Recommended \$12,904.91



ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026

Service Estimate

Customer

Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

Diagnose nozzle body's

Customer Response : Undecided

(AD_HOC-1000000347425)

Steps : 2 nozzle bodies were red when compelling the winterized. Nozzles 9 and 23. Diagnose what is wrong with the nozzle body's. red

Est Labor \$595.20

Parts \$0.00

Recommended \$595.20

Rinse Tank Sight Gauge Hose, Remove and Replace

Customer Response : Undecided

(EXPERT-1000000038425)

Steps :

1. Loosen clamps.
2. Remove and replace the rinse tank sight gauge hose.
3. Assemble in reverse order.

Rinse tank solution sight glass is cloudy. Green

Parts	Part #	Part Name	Quantity	Units
	AN205159	Hose Clamp	2.00	EACH
	PMK010-1216	Bulk Hose	3.00	EACH

Est Labor \$73.41

Parts \$26.40

Recommended \$99.81



ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026

Service Estimate

Customer

Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

Solution Tank Sight Gauge Hose, Remove and Replace

Customer Response : Undecided

(EXPERT-1000000038424)

- Steps :**
1. Loosen clamps, Replace if needed.
 2. Remove and replace the tank level sight gauge hose.
 3. Assemble in reverse order.

2 solution tank sight glasses are dirty. Front of tank and front of cab. Green

Parts	Part #	Part Name	Quantity	Units
	PMK010-1216	Bulk Hose	6.00	EACH
	AN205159	Hose Clamp	1.00	EACH
		Est Labor \$99.20	Parts \$28.59	Recommended \$127.79

ServiceGard Maintenance Package

Customer Response : Undecided

(EXPERT-1000000099954)

- Steps :**
1. Engine oil and filter change.
 2. Cab and engine air filter replacement, (Cleaning filters will be an additional charge)
 3. Fuel filter change, (main fuel filter only does not include water separator or strainer)
 4. Drive hub oil change.
 5. Hydraulic oil and filters change.

Parts	Part #	Part Name	Quantity	Units
	MAINTPKGS	Spray Maint Pck	1.00	EACH
	PRY			
		Est Labor \$925.70	Parts \$-526.70	Recommended \$399.00



ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026

Service Estimate

Customer
J [REDACTED]

Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

Certified ServiceGard Maintenance Parts Only

Customer Response : Undecided

(EXPERT-1000000099964)

Parts	Part #	Part Name	Quantity	Units
	RE509672	Filter Element	1.00	EACH
	TY26372	Lubricant	10.00	EACH
	AN403919	Air Filter	1.00	EACH
	AN403918	Air Filter	1.00	EACH
	AT318160	Oil Filter	1.00	EACH
	RE539465	Filter Element	1.00	EACH
	TY26671	Plus-50 II Oil 10W30 CK4/SN	5.00	EACH
	TY27384	15-40	31.00	EACH
	DZ112918	Filter Element	1.00	EACH
	RE333569	Air Filter	1.00	EACH
	RE333567	Air Filter	1.00	EACH

Est Labor \$0.00

Parts \$4,279.25

Recommended \$4,279.25

Estimate Summary:

Price Type	Recommended	Accepted	Declined	Undecided
Est Labor	\$5,891.65	\$0.00	\$0.00	\$5,891.65
Parts	\$20,495.51	\$0.00	\$0.00	\$20,495.51
Total	\$26,387.16	\$0.00	\$0.00	\$26,387.16



ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026

Service Estimate

Customer


Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

Appendix :

Wiring Harness, Repair

Wiring Harness, Repair

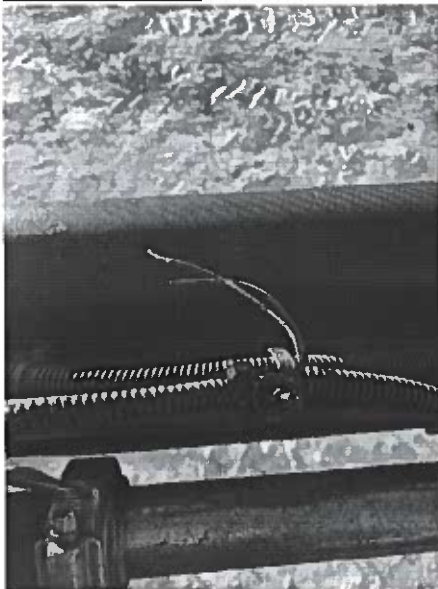



ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026

Service Estimate

Customer

Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

Replace hyd hose

Rear Wheel Motor Forward Propel Hose, Remove and Replace

Front Wheel Motor Forward Propel Hose, Remove and Replace

Replace wheel motor drive hose oring





ENNS BROTHERS LTD.
65154 Road 41 West
Portage La Prairie,
(204)857-3451



Estimate Expires
02-22-2026


Service Estimate

Customer



Equipment
John Deere R4060
Serial# 1N04060REK0207136
Meter Reading : 1208.50 Hours

Estimate Details
Estimate# 360191
Created Date: 01-23-2026
Created By: Alex Amend
Work Order# T35140

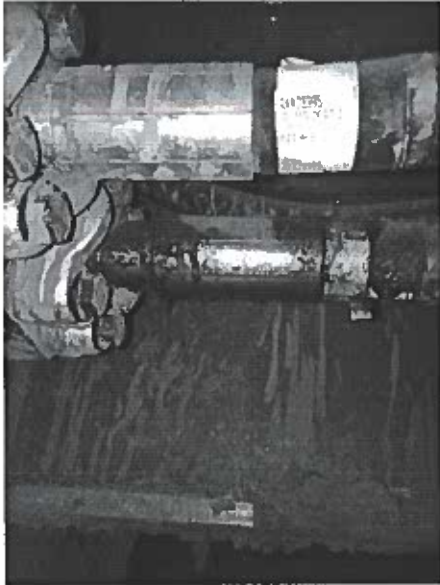

Outer boom section replace





www.ennsbrothers.com
info@ennsbrothers.com

Enns Brothers Support Center
310 - 400 Fort Whyte Way
Oak Bluff, MB R4G 0B1

Phone: 204-475-3667
Fax: 204-487-3574
Business (GST) No. 85969 7633

Arborg
204-376-5946

Oak Bluff
204-895-0212

Brandon
204-728-7043

Portage
204-857-3451

Melita
204-522-3341

Steinbach
204-326-1305

Morris
204-746-6777

Shoal Lake
204-759-2065

Neepawa
204-476-3413

Ship to:

[Redacted]

Invoice to:

[Redacted]

Branch		
Portage		
REPRINT		
Date	Time	Page
02/17/26	23:05:24 (B)	01
Account No.	Phone No.	Invoice No.
[Redacted]	[Redacted]	T35286
Ship Via		Purchase Order
		INSP REPAIRS
Agline		Salesperson
		P19

DESCRIPTION

STK#/FLEET#	HRS	PIN/EIN	WARRANTY DATE	HRS
D941529	R4060	SELF-PROPELL	X 1N04060REK0207136	07/01/21
024242	R4060		RG6090U078614	07/01/23 2000 P

SEGMENT# 1 C 01547 30590726 02/03/26 02/04/26

Diagnose air seat

CORRECTION:

- Verified that the seat would not raise.
- Removed the rubber skirt from the bottom of the seat and disconnected the compressor wires to check for voltage; no voltage was present.
- Applied battery power directly to the compressor to raise the seat; the seat lifted normally and the compressor operated correctly.
- Reviewed the wiring schematic and tested all fuses and relays related to the system; all tested good.
- Checked for power at connector XA0067 and confirmed voltage was present there.
- Checked power through the jumper harness leading into the seat; no power was present on the harness.
- Removed the harness from the unit for inspection.
- Found a section of the harness that had been squished, resulting in two broken wires.
- Reported findings to Service, then went to Parts to obtain a part number for quoting a replacement harness.
- While Parts searched for the harness, the damaged section was shown to Garrett for direction; due to difficulty locating the part, Garrett contacted the customer for repair approval
- Customer approved to repair harness 2/4/2026.
- Removed old loom from harness
- Repaired two broken wires
- Installed new loom on harness

CONTINUED ON PAGE 02

TERMS: CASH CREDIT CARD CHEQUE AGLINE

NO CREDIT CARD REFUNDS AFTER 90 DAYS FROM DATE OF PURCHASE.

I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT OF THAT BUSINESS.

I HEREBY AUTHORIZE THE ABOVE WORK TO BE DONE ALONG WITH THE USE OF NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE MACHINE FOR THE PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. I AGREE TO PAY CASH ON DELIVERY OF MACHINE OR ON TERMS SATISFACTORY WITH YOU AND UNTIL PAID IN FULL. AN EXPRESS MECHANICS LIEN IS ACKNOWLEDGED ON ABOVE MACHINE TO SECURE THE AMOUNT OF REPAIRS THERETO. IT IS UNDERSTOOD THAT THIS COMPANY ASSUMES NO RESPONSIBILITY FOR LOSS OR DAMAGE BY THEFT OR FIRE TO MACHINE PLACED WITH THEM FOR STORAGE, SALE, REPAIR, OR WHILE FIELD TESTING.



www.ennsbrothers.com
info@ennsbrothers.com

Enns Brothers Support Center
310 - 400 Fort Whyte Way
Oak Bluff, MB R4G 0B1

Phone: 204-475-3667
Fax: 204-487-3574
Business (GST) No. 85969 7633

Arborg
204-376-5946

Oak Bluff
204-895-0212

Brandon
204-728-7043

Portage
204-857-3451

Melita
204-522-3341

Steinbach
204-326-1305

Morris
204-746-6777

Shoal Lake
204-759-2065

Neepawa
204-476-3413

Ship to:

[Redacted]

Invoice to:

[Redacted]

Branch		
Portage		
Date	Time	Page
02/17/26	23:05:24 (B)	02
Account No.	Phone No.	Invoice No.
[Redacted]	[Redacted]	T35286
Ship Via		Purchase Order
		INSP REPAIRS
Agline		Salesperson
		P19

DESCRIPTION

STK#/FLEET#	HRS	PIN/EIN	WARRANTY DATE	HRS
D941529 R4060 SELF-PROPELL	X	1N04060REK0207136	07/01/21	
024242 R4060		RG6090U078614	07/01/23	2000 P

- Reinstalled and properly routed harness on unit
- Seat functions restored
- All modes operating correctly

ADDITIONAL DESCRIPTION:

HRS

1. Diagnose air seat (30590726) 1.50
Air seat lowers but does not raise. Diagnose air seat.
Yellow

Quantity

=====
x1
=====
1.50

10104003

LABOR 591.23
SEGMENT TOTAL==> 591.23

SEGMENT# 2 C 01547 30591448 02/03/26 02/03/26
Controller Software, Update

CORRECTION:

Updated all new software payloads to the current version.

ADDITIONAL DESCRIPTION:

HRS

1. Controller Software, Update (30591448) 1.40
Download and install all controller software updates,
(Includes AMS).
Provide customer with Engine load profile.

Quantity

=====
x1
=====

CONTINUED ON PAGE 03

TERMS: CASH CREDIT CARD CHEQUE AGLINE

NO CREDIT CARD REFUNDS AFTER 90 DAYS FROM DATE OF PURCHASE.

I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT OF THAT BUSINESS.

I HEREBY AUTHORIZE THE ABOVE WORK TO BE DONE ALONG WITH THE USE OF NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE MACHINE FOR THE PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. I AGREE TO PAY CASH ON DELIVERY OF MACHINE OR ON TERMS SATISFACTORY WITH YOU AND UNTIL PAID IN FULL, AN EXPRESS MECHANICS LIEN IS ACKNOWLEDGED ON ABOVE MACHINE TO SECURE THE AMOUNT OF REPAIRS THERETO.
IT IS UNDERSTOOD THAT THIS COMPANY ASSUMES NO RESPONSIBILITY FOR LOSS OR DAMAGE BY THEFT OR FIRE TO MACHINE PLACED WITH THEM FOR STORAGE, SALE, REPAIR, OR WHILE FIELD TESTING.



www.ennsbrothers.com
info@ennsbrothers.com

Enns Brothers Support Center
310 - 400 Fort Whyte Way
Oak Bluff, MB R4G 0B1

Phone: 204-475-3667
Fax: 204-487-3574
Business (GST) No. 85969 7633

Arborg
204-376-5946

Oak Bluff
204-895-0212

Brandon
204-728-7043

Portage
204-857-3451

Melita
204-522-3341

Steinbach
204-326-1305

Morris
204-746-6777

Shoal Lake
204-759-2065

Neepawa
204-476-3413

Ship to:

[Redacted]

Invoice to:

[Redacted]

Branch		
Portage		
Date	Time	Page
02/17/26	23:05:24 (B)	03
Account No.	Phone No.	Invoice No.
[Redacted]	[Redacted]	T35286
Ship Via	Purchase Order	
	INSP REPAIRS	
Agline	Salesperson	
	P19	

DESCRIPTION

STK#/FLEET#	HRS	PIN/EIN	WARRANTY DATE	HRS
D941529	R4060 SELF-PROPELL	X 1N04060REX0207136	07/01/21	
024242	R4060	RG6090U078614	07/01/23	2000 P
		1.40		
		LABOR		277.76
10104003		SEGMENT TOTAL==>		277.76

SEGMENT# 3 C 01547 30867626 02/03/26 02/03/26

Wiring Harness, Repair

CORRECTION:

Found missing can bus terminator wires.
Installed new pins to each wire, installed each wire into connector.
Installed 120 ohm resister to connector.
Tapped up wires and zip tied to make it look cleaner and not get caught on anything.

ADDITIONAL DESCRIPTION:

HRS

1. Wiring Harness, Repair (30867626) 0.50
Repair damage to wiring harness.

Quantity

=====
x1
=====
0.50

57M11134	Elec. Connector	1
	Elec. Connector Housing	
57M9776	ELEC. CONNECTOR	1
	Elec. Connector Housing	
57M9813	Elec. Connector	2
	Elec. Connector Terminal	

PARTS	37.03
LABOR	198.40
SEGMENT TOTAL==>	235.43

10104003

CONTINUED ON PAGE 04

TERMS: CASH CREDIT CARD CHEQUE AGLINE
NO CREDIT CARD REFUNDS AFTER 90 DAYS FROM DATE OF PURCHASE.

I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT OF THAT BUSINESS.

I HEREBY AUTHORIZE THE ABOVE WORK TO BE DONE ALONG WITH THE USE OF NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE MACHINE FOR THE PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. I AGREE TO PAY CASH ON DELIVERY OF MACHINE OR ON TERMS SATISFACTORY WITH YOU AND UNTIL PAID IN FULL, AN EXPRESS MECHANICS LIEN IS ACKNOWLEDGED ON ABOVE MACHINE TO SECURE THE AMOUNT OF REPAIRS THERETO.
IT IS UNDERSTOOD THAT THIS COMPANY ASSUMES NO RESPONSIBILITY FOR LOSS OR DAMAGE BY THEFT OR FIRE TO MACHINE PLACED WITH THEM FOR STORAGE, SALE, REPAIR, OR WHILE FIELD TESTING.



www.ennsbrothers.com
info@ennsbrothers.com

Enns Brothers Support Center
310 - 400 Fort Whyte Way
Oak Bluff, MB R4G 0B1

Phone: 204-475-3667
Fax: 204-487-3574
Business (GST) No. 85969 7633

Arborg
204-376-5946

Oak Bluff
204-895-0212

Brandon
204-728-7043

Portage
204-857-3451

Melita
204-522-3341

Steinbach
204-326-1305

Morris
204-746-6777

Shoal Lake
204-759-2065

Neepawa
204-476-3413

Ship to:

[Redacted]

Invoice to:

[Redacted]

Branch		
Portage		
Date	Time	Page
02/17/26	23:05:24 (B)	04
Account No.	Phone No.	Invoice No.
[Redacted]	[Redacted]	T35286
Ship Via		Purchase Order
		INSP REPAIRS
Agline		Salesperson
		P19

DESCRIPTION

STK#/FLEET#	HRS	PIN/EIN	WARRANTY DATE	HRS
D941529 R4060 SELF-PROPELL	X	1N04060REK0207136	07/01/21	
024242 R4060		RG6090U078614	07/01/23	2000 P

SEGMENT# 4 C 01547 30867633 02/03/26 02/04/26

Wiring Harness, Repair

CORRECTION:

- Checked with Parts on connector status; incorrect connector arrived.
- Consulted with Garrett, who contacted JP; JP requested connector replacement once correct part arrived.
- Ordered correct connector from Parts.
- After receiving correct connector, attempted to unpin old connector; tool could not fit due to thick wires.
- Cut wires from old connector, installed new pins, and repinned into new connector.
- Connected harness and discovered mating connector had a broken locking tab.
- Reported issue to Dowire was too thick and tech was not able to get pinning
- tool into connector, tech cut all wires from old connector then installed new pins to each wire and installed into new connector.
- Tech then connected the harness, tech found that one of the e codes.
- Confirmed all functions operating correctly after repair.

ADDITIONAL DESCRIPTION:

Right center boom connector is breaking from pressure of the solution line pushing on it's chain connector.

1. Wiring Harness, Repair (30867633)
Repair damage to wiring harness.

0.50

=====

x1

CONTINUED ON PAGE 05

TERMS: CASH CREDIT CARD CHEQUE AGLINE

NO CREDIT CARD REFUNDS AFTER 90 DAYS FROM DATE OF PURCHASE.

I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT OF THAT BUSINESS.

I HEREBY AUTHORIZE THE ABOVE WORK TO BE DONE ALONG WITH THE USE OF NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE MACHINE FOR THE PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. I AGREE TO PAY CASH ON DELIVERY OF MACHINE OR ON TERMS SATISFACTORY WITH YOU AND UNTIL PAID IN FULL, AN EXPRESS MECHANICS LIEN IS ACKNOWLEDGED ON ABOVE MACHINE TO SECURE THE AMOUNT OF REPAIRS THERETO.
IT IS UNDERSTOOD THAT THIS COMPANY ASSUMES NO RESPONSIBILITY FOR LOSS OR DAMAGE BY THEFT OR FIRE TO MACHINE PLACED WITH THEM FOR STORAGE, SALE, REPAIR, OR WHILE FIELD TESTING.



www.ennsbrothers.com
info@ennsbrothers.com

Enns Brothers Support Center
310 - 400 Fort Whyte Way
Oak Bluff, MB R4G 0B1

Phone: 204-475-3667
Fax: 204-487-3574
Business (GST) No. 85069 7633

Arborg
204-376-5946

Oak Bluff
204-895-0212

Brandon
204-728-7043

Portage
204-857-3451

Melita
204-522-3341

Steinbach
204-326-1305

Morris
204-746-6777

Shoal Lake
204-759-2065

Neepawa
204-476-3413

Ship to:

[Redacted]

Invoice to:

[Redacted]

Branch		
Portage		
Date	Time	Page
02/17/26	23:05:24 (B)	05
Account No.	Phone No.	Invoice No.
[Redacted]	[Redacted]	T35286
Ship Via		Purchase Order
		INSP REPAIRS
Agline		Salesperson
		P19

DESCRIPTION

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
D941529	R4060 SELF-PROPELL	X	1N04060REK0207136	07/01/21	
024242	R4060		RG6090U078614	07/01/23	2000 P
=====					
				0.50	
R78067	SOCKET #12	8	3.56		28.48
	Elec. Connector Terminal				
R78068	PIN #12	8	2.96		23.68
	Elec. Connector Terminal				
57M13572	Elec. Connector	1 N	119.64		119.64
57M13573	Elec. Connector	1 A	108.77		108.77
	PARTS				280.57
	LABOR				521.79
10104003	SEGMENT TOTAL==>				802.36

SEGMENT# 5 C 01547 30597157 02/03/26 02/03/26

Replace wheel motor drive hose oring

CORRECTION:

RHS motor was not leaking, Tech talked with Alex; Alex confirms that it was the LHS rear that was leaking. Tech removed LHS rear plastic shield then removed the 4 18mm bolts that was holding line on.

Tech then swapped out the o rings then reinstalled and O‑rings on the line.

- Reinstalled and tightened the bolts.
- Cleaned the surrounding area.
- Will verify that no leaks are present when the unit is taken out of the shop.

ADDITIONAL DESCRIPTION:

HRS

1. Replace wheel motor drive hose oring (30597157) 0.50
Right rear drive motor has a class 1 leak on the bottom hyd

CONTINUED ON PAGE 06

TERMS: CASH CREDIT CARD CHEQUE AGLINE

NO CREDIT CARD REFUNDS AFTER 90 DAYS FROM DATE OF PURCHASE.

I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT OF THAT BUSINESS.

I HEREBY AUTHORIZE THE ABOVE WORK TO BE DONE ALONG WITH THE USE OF NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE MACHINE FOR THE PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. I AGREE TO PAY CASH ON DELIVERY OF MACHINE OR ON TERMS SATISFACTORY WITH YOU AND UNTIL PAID IN FULL, AN EXPRESS MECHANICS LIEN IS ACKNOWLEDGED ON ABOVE MACHINE TO SECURE THE AMOUNT OF REPAIRS THERETO. IT IS UNDERSTOOD THAT THIS COMPANY ASSUMES NO RESPONSIBILITY FOR LOSS OR DAMAGE BY THEFT OR FIRE TO MACHINE PLACED WITH THEM FOR STORAGE, SALE, REPAIR, OR WHILE FIELD TESTING.



www.ennsbrothers.com
info@ennsbrothers.com

Enns Brothers Support Center
310 - 400 Fort Whyte Way
Oak Bluff, MB R4G 0B1

Phone: 204-475-3667
Fax: 204-487-3574
Business (GST) No. 85969 7633

Arborg
204-376-5946

Oak Bluff
204-895-0212

Brandon
204-728-7043

Portage
204-857-3451

Melita
204-522-3341

Steinbach
204-326-1305

Morris
204-746-6777

Shoal Lake
204-759-2065

Neepawa
204-476-3413

Ship to:

[Redacted]

Invoice to:

[Redacted]

Branch		
Portage		
Date	Time	Page
02/17/26	23:05:24 (B)	06
Account No.	Phone No.	Invoice No.
[Redacted]	[Redacted]	T35286
Ship Via	Purchase Order	
	INSP REPAIRS	
Agline	Salesperson	
	P19	

DESCRIPTION

STK#/FLEET#	HRS	PIN/EIN	WARRANTY DATE	HRS
D941529 R4060 SELF-PROPELL	X	1N04060REK0207136	07/01/21	
024242 R4060		RG6090U078614	07/01/23	2000 P
hose. Replace oring. Green				
Quantity			=====	x1
			=====	0.50
T78313	O-RING		1	
		PARTS		9.18
		LABOR		99.20
10104003		SEGMENT TOTAL==>		108.38

***** WORK ORDER TOTALS *****

PARTS	326.78
LABOR	1688.38
Supplies&Enviro	151.95
SUB TOTAL==>	2167.11
GST# 859697633RT0001	108.35
Card Total	2275.46

06699G XXXXXXXXXXXXX2349

I agree to pay above total amount according to card issuer agreement
(Merchant agreement if credit voucher).

TERMS: CASH CREDIT CARD CHEQUE AGLINE
NO CREDIT CARD REFUNDS AFTER 90 DAYS FROM DATE OF PURCHASE.

I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT
THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT
OF THAT BUSINESS.

I HEREBY AUTHORIZE THE ABOVE WORK TO BE DONE ALONG WITH THE USE OF NECESSARY
MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE MACHINE FOR THE PURPOSES
OF TESTING, INSPECTION OR DELIVERY AT MY RISK. I AGREE TO PAY CASH ON DELIVERY OF
MACHINE OR ON TERMS SATISFACTORY WITH YOU AND UNTIL PAID IN FULL, AN EXPRESS
MECHANICS LIEN IS ACKNOWLEDGED ON ABOVE MACHINE TO SECURE THE AMOUNT OF
REPAIRS THERETO.
IT IS UNDERSTOOD THAT THIS COMPANY ASSUMES NO RESPONSIBILITY FOR LOSS OR DAMAGE
BY THEFT OR FIRE TO MACHINE PLACED WITH THEM FOR STORAGE, SALE, REPAIR, OR WHILE
FIELD TESTING.