



Mound Services Inc.

Box 240
129 Publow Ave.
Pilot Mound, Manitoba R0G 1P0
Canada
moundinc@gmail.com


INVOICE

Date: Sep 30, 2024

Ship Date:

Page: 1

Re: Order No.

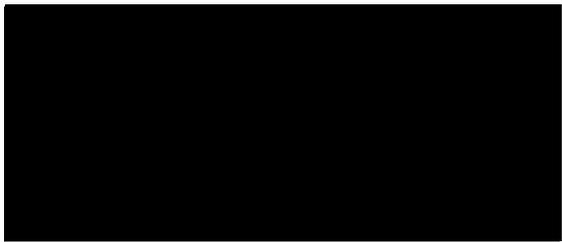

2004 Freightliner Trans Replaced

Business No.: 122895295RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
Labour		0.5	Blue Freightliner Customer Complaint: Not Shifting - Blown Transmission - Customer called back in August for a service call with shifting issues, got the service truck all ready and went to leave town, customer called back and cancelled the service call.	GP	105.00	52.50
Labour		0.5	- Truck was then brought to shop with broken gear, inspect unit and source and tried to order new automatic transmission, was unable to find one. Have to send in for repair.	GP	105.00	52.50
Labour		2.0	- Lowered drive shaft and PTO shaft, drained transmission fluid. Unhooked all electrical lines and airlines. Supported, unbolted from bell housing and removed trans from unit.	GP	105.00	210.00
Labour		2.0	- Removed flywheel and clutch. Prep flywheel for resurface, sent to Pride's for machining.	GP	105.00	210.00
Labour		2.0	- Removed components off of transmission and prep to send away for rebuild.	GP	105.00	210.00
Labour		3.5	- Got flywheel back and installed onto unit. Installed new clutch and torqued to spec.	GP	105.00	367.50
Labour		5.0	- Received transmission back, hooked up all components that had been removed. Installed transmission back into unit.	GP	105.00	525.00
Labour		3.0	- Hooked up PTO onto bottom of transmission, had to wait for new hanger bearing. Installed drive shaft and torqued all fasteners to spec.	GP	105.00	315.00
Labour		2.0	- Filled up transmission with new oil and took it for a test drive, confirm repairs.	GP	105.00	210.00
Labour		1.5	- Once hanger bearing was received, installed PTO drive shaft. Ran unit and aired it up, found front drive left side air bag leaking. Replaced air bag with new one.	GP	105.00	157.50
N2520892525		1.0	Clutch	GP	1,150.00	1,150.00
26242		1.0	Red High Strength	GP	57.19	57.19
NTN_6306LLUC3/ EM		1.0	Ball Bearing	GP	47.79	47.79

Labour 2258

Terms: Net 15. Due Oct 15, 2024.

Comment: 25% RESTOCKING ON ALL RETURNED PARTS (*RETORQUE ALL REMOVED WHEELS WITHIN 100 KM)

Continue...



Mound Services Inc.

Box 240
129 Publow Ave.
Pilot Mound, Manitoba R0G 1P0
Canada
moundinc@gmail.com

INVOICE

Invoice No.:

Date:

Ship Date:

Page: 2

Re: Order No.

Business No.: 122895295RP0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
127200		1.0	Clutch Brake	GP	98.85	98.85
KL-TF4080*		1.0	Full Synthetic Trans Oil SAE 50	GP	356.55	356.55
1R12-603		1.0	Air Bag	GP	310.66	310.66
6056		1.0	Center Support Bearing	GP	29.73	29.73
1575-BP		1.0	Test Leads	GP	11.26	11.26
OML		1.0	Transmission Rebuild	GP	4,400.00	4,400.00
		2.0	Freight IN & OUT	GP	130.00	260.00
OLM		1.0	Flywheel Resurface	GP	250.00	250.00
		1.0	Shop Supplies	GP	65.00	65.00
			Subtotal:			9,347.03
			GP - GST 5%, PST 7%			
			GST			467.37
			PST			654.32

Buttr
7036

Mound Services Inc. GST: #R122895295
Mound Services Inc. PST: #PST#147767-6

Shipped By: Tracking Number:

Terms: Net 15. Due Oct 15, 2024.

Comment: 25% RESTOCKING ON ALL RETURNED PARTS (*RETORQUE ALL REMOVED WHEELS WITHIN 100 KM)

Sold By:

Total Amount	10,468.72
Amount Paid	0.00
Amount Owing	10,468.72