



1731 Main Street N.
 Moose Jaw, SK S6J 1L6
 Phone: 306-692-2371
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/22/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 1 of 4
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
BRANDT 2021 BRANDT 1345AHP AUGER	287	14208421	14208421	

Gen1- Internal

COMPLAINT:
 01 RECONDITIONING INSPECTION

CORRECTION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
19H1905	Hex Bolt 5/16" X 1" GR5 NC	1.00	1.23	1.23	\$1.23	N
Labor: \$372.00		Parts: \$1.23		OL&M: \$0.00		Misc: \$0.00
Sub-Total: \$373.23						

Gen3- Internal

COMPLAINT:
 03 REINSTALL THE FIRST PTO SHAFT COVER

CORRECTION:
 RE-INSTALLED COVER

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
A44990	LATCH	2.00	12.25	12.25	\$24.50	N
2078709	"GRATE,CUT,SAFETY,HOPPER,UTR,BL"	1.00	114.55	114.55	\$114.55	N
B0210993	SPRING EXT 1.47inx5inx.148in	1.00	20.78	20.78	\$20.78	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	2.32	2.32	\$2.32	N
Labor: \$37.20		Parts: \$159.83		OL&M: \$0.00		Misc: \$2.32
Sub-Total: \$199.35						

Gen6- Internal

COMPLAINT:
 06 REPAIR FOR THROTTLE CABLE STUCK OR BROKEN

CORRECTION:



1731 Main Street N.
 Moose Jaw, SK S6J 1L6
 Phone: 306-692-2371
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

Invoice To Account No: 0

Deliver To:

SERVICE INVOICE

Invoice Number: [REDACTED]	Invoice Date: 10/22/2025	Location: [REDACTED]	Work Order Number: [REDACTED]
Bus Phone:	Bus Phone:	Payment Type: [REDACTED]	Page: 2 of 4
Prv Phone:	Prv Phone:		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
BRANDT 2021 BRANDT 1345AHP AUGER	287	14208421	14208421	

Gen6- Internal
 REPLACED THROTTLE CABLE AND RE ROUTED

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
H77698	TIE BAND 15"	5.00	1.00	1.00	\$5.00	N
8020727	"CABLE,THROTTLE,LOCKING,180.00"	1.00	296.32	296.32	\$296.32	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	11.16	11.16	\$11.16	N
Labor: \$186.00		Parts: \$301.32	OL&M: \$0.00	Misc: \$11.16	Sub-Total: \$498.48	

GEN7- Internal
 COMPLAINT:
 07 TIGHTEN DRIVE CHAIN ON TOP END

** tensioner appears to be seized - pricing out tensioner parts

CORRECTION:
 THERE IS NO CHAIN TENSION ADJUSTMENT IT IS AN AUTOMATIC TENSIONER
 BOLT HOLDING ON TENSIONER ARM WAS DISCOVER TO BE TO TIGHT WHILE TAKING THE DRIVE GEARS OFF WHICH IS WHY THE TENSION WAS TO LOSE. WAS ORIGINALLY THOUGHT TO BE SIZED. ORDERED NEW SPRING AND INSTALLED AUGER DRIVE GEAR HAD A SNAPPED OFF SET SCREW AND HAD TO WELD WASHER AND NUT ONTO GEAR TO REMOVE BROKEN SET SCREW
 WHILE RE-INSTALLING HARDWARE AND GEARS IT WAS FOUND THAT THERE WAS ADDITIONAL HARDWARE THAT WAS NOT SUPPOSED TO BE THERE AS WELL AS SOME MISSING HARDWARE REMOVED AND ADDED HARDWARE ACCORDINGLY
 RE-INSTALLED GEARS AND ALIGNED, THEN HAD TO DO A SECOND TIME AS SPACING FROM TENSIONER SPRING WAS TO CLOSE TO GEARS
 RE-INSTALLED CHAIN AND RAN MACHINE TO SEE EVERYTHING RUM SMOOTHLY AND SPACING WAS CORRECT
 PUT A CASE OF GREASE IN HOUSING AS IT RUNS IN A GREASE BATH AND WAS MISSING GREASE

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
19H2993	Hex Bolt 1/2" X 1 1/2" GR8 NC	1.00	4.08	4.08	\$4.08	N
24H1136	Washer	3.00	0.69	0.69	\$2.07	N



1731 Main Street N.
 Moose Jaw, SK S6J 1L6
 Phone: 306-692-2371
www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number: [REDACTED] Invoice Date: 10/22/2025 Location: [REDACTED] Work Order Number: [REDACTED] Payment Type: [REDACTED] Page: 3 of 4
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
BRANDT 2021 BRANDT 1345AHP AUGER	287	14208421	14208421	

GEN7- Internal

TY24416	HD LITHIUM COMPLEX GREASE	10.00	9.46	9.46	\$94.60	N
C412164	"KEY, 3/8in X 1 1/2in"	1.00	15.72	15.72	\$15.72	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
FREIGHT	FREIGHT	1.00	25.00	25.00	\$25.00	N
SERVACCESS	SERVICE ACCESSORIES	1.00	33.48	33.48	\$33.48	N

Labor: \$558.00 Parts: \$116.47 OL&M: \$0.00 Misc: \$58.48 Sub-Total: \$732.95


GEN9- Internal

COMPLAINT:
 09 REPAIR FOR CLUTCH HARNESS WIRE PULLED OUT OF CONNECTOR

CORRECTION:
 REPLACED PIN AND RE-INSTALLED, WHILE RE CONNECTING OTHER WIRE FELL OUT OF PIN, INSTALLED 2 NEW PINS INTO CONNECTOR AND CONFIRMED FUNCTION

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
24H1370	WASHER	1.00	2.76	2.76	\$2.76	N
57M8810	Elec. Connector	2.00	1.81	1.81	\$3.62	N

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
----------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------

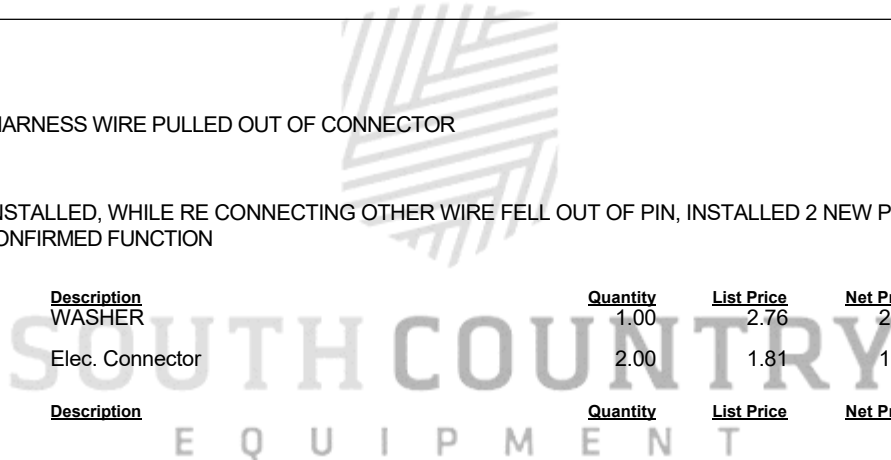



1731 Main Street N.
 Moose Jaw, SK S6J 1L6
 Phone: 306-692-2371
 www.southcountry.ca

Moose Jaw, SK 306-692-2371
 Mossbank, SK 306-354-2411
 Assiniboia, SK 306-642-3366
 Emerald Park, SK 306-721-5050
 Weyburn, SK 306-842-4686
 Southey, SK 306-726-2155
 Raymore, SK 306-746-2110
 Montmartre, SK 306-424-2212



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 0

Deliver To:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number:
 Invoice Date: 10/22/2025
 Location:
 Work Order Number:
 Payment Type:
 Page: 4 of 4

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
BRANDT 2021 BRANDT 1345AHP AUGER	287	14208421	14208421	

GEN9- Internal								
SERVACCESS	SERVICE ACCESSORIES	1.00	6.13	6.13	\$6.13	N		
Labor: \$102.24	Parts: \$6.38	OL&M: \$0.00	Misc: \$6.13	Sub-Total: \$114.75				

Customer PO No:
 Tax Exempt No:
 Advisor:

Labor:	\$1,255.44
Parts:	\$585.23
OL&M:	\$0.00
Misc:	\$78.09
Grand Total:	\$1,918.76

*** DOCUMENT COPY ***

GST Registration No: 897357802

G/L Entries	Br	Dpt	Acct	Sub	Ref	Description
00 00	160	1	148674			USED AG EQUIPMENT
01 40	382	1	898370			INTERNAL LABOR-AG
00 00	178	11	898370			WORK IN PROCESS PARTS -MJ
01 40	482	1	898370			COS INTERNAL LABOR-AG
01 30	366	2	898370			JD PARTS-COUNTER
00 00	166	1	898370			JD PARTS-MOOSE JAW
01 40	544	1	898370			SUPPLIES EXPENSE
01 30	372	2	898370			OTHER MFR PARTS-CNTR
00 00	172	1	898370			OTHER PARTS-MOOSE JAW
01 30	375	1	898370			PARTS SPECIAL HANDLING
01 30	466	2	898370			JD PARTS-COUNTER
01 30	472	2	898370			OTHER MFR PARTS-CNTR

TERMS AND CONDITIONS

Terms: Cash, Visa, Mastercard, AgriCard, John Deere Financial.

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate the above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control.

Received by:Date: