

INVOICEInvoice Number:
Invoice Date:INV-1562
14 Feb 2025(306) 768-3783
GST # 70754 8210 RT0001

To:

Reference:

QSL 9 Cummins

Terms:

Due on receipt

A01-11

Quantity	Description	Rate	Amount
	eng. s/n 60331333 CPL 8641 original eng. s/n for machine 72375135 870C TigerCat buncher s/n 87012338 Machine hours 18,036		
3.50	Service call to job site to diagnose engine knock - found #4 conrod bearing failed - 2nd service call to replace #4 conrod bearing - test run engine - sounds good - #4 conrod bearing again after an hour of operation	140.00	490.00
53.75	service call to job site to diagnose failed #4 rod bearing, replace bearing and test, runs good, #4 bearing failed after 1 hour Customer removed engine and brought to shop, rebuild engine - replace crankshaft, head, #4 conrod - take block to Northeast Engine to cut counterbores and resurface block - replace sleeves, pistons, gaskets, front & rear seals, head bolts - check sleeve protrusion, all sleeves 0.0045 - 0.0050" - replace oil pump & cooler - replace camshaft & followers - replace injectors & cross-tubes - replace turbo charger - adjust tappet clearance as per repair manual - paint engine, paint supplied by customer	135.00	7,256.25
1.00	OEM used crankshaft, polished	1,932.00	1,932.00
1.00	3969722VS, cylinder head	3,840.00	3,840.00
1.00	PAIISL103-026, engine kit	3,600.00	3,600.00
6.00	0986435522, injector	588.00	3,528.00
1.00	Inbound freight	35.00	35.00
6.00	F00RC00647, cross tube	91.156	546.94
1.00	resurface block & recut counterbores ref # NE16120	1,452.804	1,452.80
1.00	freight to Yorkton, ref # 335244139317	111.04	111.04
1.00	GCL2839423H, reman turbo	3,120.00	3,120.00
1.00	CUM5449240, OEM oil pump	714.00	714.00
1.00	PAI191866, camshaft	564.00	564.00
12.00	PAI191857, lifter	43.80	525.60
1.00	CUM5284362, oil cooler	474.00	474.00
1.00	CUM4933670, New connecting rod	384.00	384.00

Thank You For Your Business!

INVOICE

Invoice Number: INV-1562
Invoice Date: 14 Feb 2025

(306) 768-3783

GST # 70754 8210 RT0001

26.00	PAI040036, head bolt	7.995	207.87
1.00	CUM6305290, thermostat	174.00	174.00
7.00	PAI151509, cam bushings	12.00	84.00
1.00	CUM3901969, expansion plug	21.00	21.00
1.00	freight into Yorkton	160.00	160.00
5.00	replace wrist-pin bushing	86.40	432.00
	inspect rods & check for size		
5.00	DSG4944137, pin bushing	21.60	108.00
1.00	A77808AM, front seal, n/c supplied by customer	0.00	0.00
8.00	3959799, isolator	18.083	144.66
1.00	Inbound freight	35.00	35.00
20.00	TY26663, JD break-in oil, L	12.688	253.76
	Reconciliation		
	- Original estimate 16-20,000		
	Plus the following not included in estimate		
	- turbo 3120.00		
	- injectors and tubes 4074		
	- Northeast Eng. machine block 1452.00		
	- oil pump 714.00		
	- camshaft & lifters 1089.00		
	- oil cooler 474.00		
	- head bolts 207.00		
	Completed job (less taxes) 30193.92		

Subtotal	30,193.92
Total GST 5%	1,509.69
Amount Due	0.00

- Send E-transfers to accounting@reimerenterprise.com
- **NEW** Online bill payments at your Credit Union
Your account number is your 7 digit cell number

Thank You For Your Business!

Reimer

ENTERPRISE

REIMER ENTERPRISE WARRANTY

Mission Statement

Reimer Enterprise is committed to provide quality workmanship and parts that make for customer satisfaction

Date of original repairs - Feb 14/2025

Invoice number of original repairs - #1562

Make - Machine 870C Tigercat

Model -- engine - QSL9 Cummins

Serial Number - 60331333 CPL 8641


Hours - 18,036.0

Details of Reimer Enterprise Warranty are as follows

1. This warranty applies in the event of failure with in the first year or season or 1000 hours after original repairs. Whichever comes first
2. Reimer Enterprise will be notified of any concern as soon as possible
3. Reimer Enterprise warranty covers labor when failure is due to substandard workmanship on original repairs
4. Reimer Enterprise will pass on to the owner all parts supplier warranties
5. Reimer Enterprise warranty only applies to repairs as listed on original repair invoice
6. In the event of failure all diagnostics will be done by Reimer Enterprise personal
7. In the event of failure all repairs will be done by Reimer Enterprise personal
8. Reimer Enterprise warranty does not apply to failures due to operator neglect or error

Reimer Enterprise

Signed

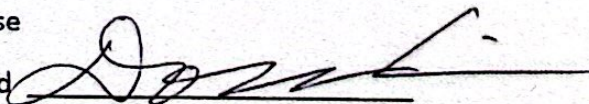

Customer Satisfaction Is Important to us at Reimer Enterprise