

T-206-817

Data 2025-06-02

[illegible]

WORK DONE

Replace All 6 Shocks,
Replace ABS Sensors on Axle #1 RH Side, Axle #2 Both Side's, and Axle #3 LH Side,
Replace ABS Wire From Fire Wall to ABS Sensor on Axle #2 RH Side,
Replace Brake Chamber on Axle #2 LH Side,
Replace Dust Shield on Axle #2 LH Side,
Replace Both Belts,
Replace Torque Arm Bushings on Axle #3,
Replace Purge Valve,
Replace Air Dryer Cartridge,
Replace Air Filters, Fuel Filters, and Diff. Filter,
Reseal Both Diff's,
Change Oil in Both Diff's,

2014 Kenworth Winch Tractor Tandem

MILEAGE 900287 HOURS 15149

WORK REQUESTED

21/3

MECHANIC	isaac, Jacob,	DATE	2025-06-02	DRIVER	Isaac Klassen	DATE	2025-06-02
----------	---------------	------	------------	--------	---------------	------	------------



T-206-814


Date 2025-02-06

[illegible][illegible]

HOURS 15115

[illegible]

DATE 2025-02-06

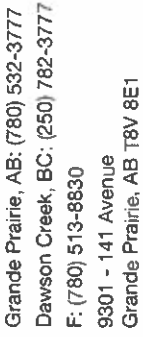

T-206-805

Date 2025-01-31

2014 Kenworth Winch Tractor Tandem
UNIT NO. T-206
MILEAGE 897607 HOURS 15047

WORK REQUESTED

[illegible]DATE 2025-01-31

DATE 2025-01-31



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

Driver Name Ryan Cowan Date 2024-12-30

WORK DONE

Kyle found broken brake pot.

[illegible]

WORK REQUESTED


Kyle found broken brake pot.

[illegible]

MECHANIC	DATE	DRIVER	DATE
Kyle Kooyman	2025-01-03	Ryan Cowan	2024-12-30

DATE 2024-12-30


DRIVER Ryan Cowan

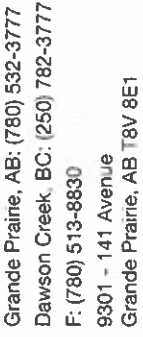

T-206-775

Date 2024-12-21

[illegible]DATE 2024-12-21

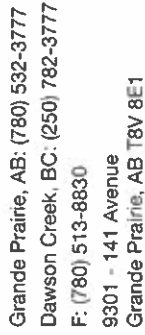

WORK ORDER

T-206-766

Driver Name Ryan Cowan Date 2024-12-16

[illegible]

WORK DONE

[illegible]UNIT NO. 2014 Kenworth Winch Tractor Tandem T-206

MILEAGE _____ HOURS _____

WORK REQUESTED

[illegible]

MECHANIC	DATE	DRIVER	DATE
Isaac Klassen	2024-12-17	Ryan Cowan	2024-12-16

DATE 2024-12-16

DRIVER Ryan Cowan



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1


Driver Name Ryan Cowan Date 2024-12-02

2014 Kenworth Winch Tractor Tandem
UNIT NO. T-206
MILEAGE 874324 HOURS 14445

WORK REQUESTED

[illegible]

DRIVER Ryan Cowan DATE 2024-12-02

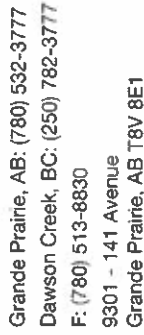

T-206-736

Date 2024-12-01

[illegible]

WORK DONE

Replace Air Bag on Axle #2 LH Side,

[illegible]

2014 Kenworth Winch Tractor Tandem

UNIT NO. T-206

MILEAGE	874324	HOURS	1445
---------	--------	-------	------


WORK REQUESTED

Front left airbag leaking or close to it.

100 hr service due.

MECHANIC	Jacob Wiebe	DATE	2024-12-03	DRIVER	Ryan Cowan	DATE	2024-12-01
----------	-------------	------	------------	--------	------------	------	------------

DATE 2024-12-01

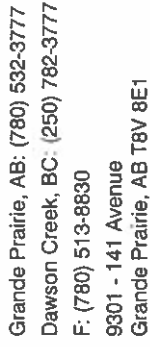

8092

Date _____

[illegible]

WORK REQUESTED

MILEAGE	873698	HOURS	14332
---------	--------	-------	-------

DATE	DRIVER	DATE	DRIVER
1500c	Mike	Nov 8/24	



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

7971

Customer _____ Date _____

MAKE Kennworth YEAR 2014 UNIT NO. T-206

MILEAGE 863716 HOURS 14114

WORK REQUESTED

WORK DONE

- Pulled Auxiliary Box From Trans.
- Found Nothing wrong, Replace Gaskets, and Seals, Replace Aux.
- Weld New Bracket on Axle Housing For Torque Arm.
- Replace Torque Arm Bushings.
- Replace Front Diff. Input Shaft Seal, and Yoke.
- Replace Seal on PTO.

MECHANIC Isaac Jacob-Jake DATE Sept. 16/24 DRIVER _____ DATE _____



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

8587

Customer _____ Date _____

MAKE Kenworth YEAR 2014 UNIT NO. 7-206

MILEAGE 837679 HOURS 13506

WORK REQUESTED

WORK DONE

CVIP

- Replace Front Diff. out seal and Yoke,
- Replace Air Filters, Fuel Filters, and Diff. Filter,
- Replace Purge Valve, and Dryer Filter,
- Replace Front Cap on Front Diff.
- Replace Wheel Hub seals on Axle #1 LH Side, and Axle #2 RH Side,
- Replace Dustshield on Axle #1 LH Side,
- Replace ABS Sensor on Axle #3 RH Side,
- Replace clutch linkages Bearings,
- Replace All Brake Drums,
- Replace Windshield RH Side,

MECHANIC Isaac Jacob Jake DATE June 20/24

DRIVER _____

DATE _____



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

8416

Customer _____

Date _____

MAKE Kawasaki

YEAR 2014

UNIT NO. T206

MILEAGE 836485

HOURS 13470

WORK DONE

- Replace A/C Condensor,
- Pass leak Test
- Recharge A/C,
- Replace Heater Hose To water Valve,


WORK REQUESTED

A/C NOT WORKING SENT PIC TO FOX,
HEATER LINES LEAKING / COOLANT FORDS
FLUXWATERING / ADD JOL A DAY. SENT PIC
AGAIN AS WELL
AIR TANK ON PASS SIDE PEROS A AIR
RELEASE CORD.

MECHANIC Isaac Jacob DATE June 10/24

DRIVER A Jacob

DATE 06/09/24

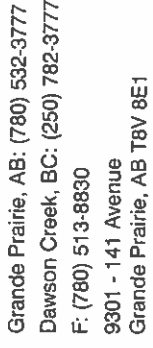

8541

Date _____

MILEAGE	823.01	HOURS	13.40
---------	--------	-------	-------

WORK REQUESTED

MECHANIC	DATE	DRIVER	DATE
John	May 30, 24		

7-256

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



WORK ORDER

8411

Customer _____ Date May 10/24

MAKE Kenworth YEAR 2014 UNIT NO. T-206

MILEAGE _____ HOURS _____

WORK REQUESTED

Truck working at 90km - 100 km/hr
AC Blowing Hot
Left side inside load mirror broken
Left side hood signal
~~Left side windshield crack~~ crack causing glare in eyes from sun.

WORK DONE

Checked suspension everything seemed good
Replaced A/C
Replaced mirror
Replaced signal light
~~Replaced windshield with Reptec soon.~~
Changed Driver side windshield

MECHANIC Trace Klesner DATE May 10/24 DRIVER Kyle Klesner DATE 05/10/24



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

8448

Customer

Date

[illegible]

WORK DONE

- Straiten Fifth wheel Lock Bar,
- Weld Hook For sling LH side,
- Cube stack Bushings,
- Replace stop Bolts RH side,
- Replace A/C Pump, Recharge A/C,
- Tied up ABS wire,
- change Brake light LH side,
- oil change service,

WORK REQUESTED

WILL WHITE LOCK BENT.
LEFT SIDE HEADACHE RACK LOOK BROKE OFF
FOR SEING HANGER.
STACK BUSHINGS SINKING. SOUNDS LIKE
DRIVER SIDE BUT NOT 100%.
PASSENGER SIDE STEP MARKETING BAD LIKE.
A/C PUMP FULLY.
ABS CERO'S HAVING AFTER GOT WASHED
Brake light out on Headache Rack

MECHANIC Baoc Jaks DATE March 19/24

DRIVER John Owen

DATE _____

03434

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



Customer _____ Date _____

MAKE Kenworth YEAR 2014 UNIT NO. T-206
MILEAGE 793681 HOURS 12535

WORK REQUESTED

WISH BONE BOLT
REAR DRIVE SHAFT
FRONT NEEDS TO A LUGGED AT WAS
RUNNING AT BACK AUGIE NO. 1'S ARE : ARE
F. 5. 1.

WORK DONE

- Replace Torque Arm Bolt,
- Replace stub shaft, and U Joints,
- Replace strap kit on front diff.
input shaft yoke,

MECHANIC Isaac, Jacob DATE Feb. 13/24

DRIVER _____

DATE C

7-206

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



WORK ORDER

8107

Customer _____ Date _____

MAKE KIA YEAR 2014 UNIT NO. 7-206

MILEAGE 782904 HOURS 12285

WORK REQUESTED

FIFTH WHEEL LOCK HANDLE BROKEN
AGAIN

WORK DONE

- Weld Fifth wheel handle,
- Replace Brake Relay Valve,
and Both Rear ABS Valves,

MECHANIC Isaac, Jacob DATE Jan. 18/24 DRIVER Ryan Conner DATE 01/11/24



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

8265

Customer _____ Date _____

MAKE Kia Niro YEAR 2014 UNIT NO. 226

MILEAGE 776834 HOURS 12141

WORK DONE

- Replace Lug Nut covers,
- Replace LH Rear Air Bag,

WORK REQUESTED

WELD HANDLES WELDED ONTO CHAIN HOOKS
FINCH BACK EVERYTIME I PULL THEM OUT

HIT DEER FRONT LEFT STEER LAST HUP
CAP BOTH SIDES AND SIX STUD COVERS

REAR LEFT AIRBAG ISAKING

MECHANIC Isaac DATE Dec 13/23 DRIVER Kan Conan DATE 12/10/23



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

8197

Customer _____ Date _____

MAKE Kenworth YEAR 2014 UNIT NO. T-206

MILEAGE 767099 HOURS 11910

WORK DONE

- Replace Alt
- checked winch Brake,
- Fix wiring
- Grease Service,

WORK REQUESTED

WINCH BRAKE NEEDS TO BE ADJUSTED
WILL NOT ~~STOP~~ HOLD BACK SHACK AT
ALL.

CHANGED ALTERNATOR WORK NEEDS
TO BE GONK OVER. DID NOT REATTACH
CAR BOLT TO BRACKET.

MECHANIC Isaac

DATE Nov. 21/23

DRIVER

Ryan Goss

DATE 11/21/23



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

8142

Customer _____ Date _____

MAKE Kennworth YEAR 2011 UNIT NO. T-206

MILEAGE 722600 HOURS 11593


WORK REQUESTED

- L/S Tool Box Busted up

WORK DONE

- Replace L/S ~~Back~~ Back TOOL BOX

MECHANIC Isaac/Kyle DATE Oct 16/23 DRIVER Ryan DATE Oct 13/23

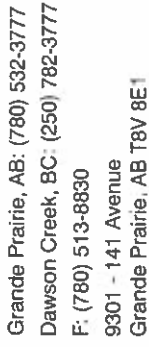

6018

Date _____

Customer _____

[illegible]

WORK DONE

Replaced mud hoses + clamps

Replaced D/S steer wheel seal

Made up a new mudflap

Serviced / Greased unit

WORK REQUESTED

MAKE

2023-11-17

YEAR 2014

UNIT NO. _____

MILEA

1050

HOURS 11:49

MECHANIC

Kyle

DATE _____

39.26173

DRIVER

44

DATE _____

092363

T 206

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



WORK ORDER

766

Customer _____ Date _____

MAKE Kenworth YEAR 2015 UNIT NO. 4-206

MILEAGE 743017 HOURS 11360

WORK REQUESTED

WOBBLE IN DRIVER SEAT AT 70km
AND AGAIN AT 100km

ABS Light

A/C Pulley Seized

WORK DONE

Replaced R.F. ABS sensor on drive tires

Replaced A/C belt tensioner

Replaced R.F. Steer hub races/bearings

Oil Change / Service

MECHANIC Kyle / Isaac DATE Sep. 13/23 DRIVER Paul Connors DATE 09/12/23



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

7688

Customer _____ Date _____

MAKE Kenworth YEAR 2014 UNIT NO. T206

MILEAGE 736689 HOURS 11221

WORK REQUESTED

✓ Air fitting leaking on air drier

✓ ABS not working properly

✓ Fire wall Corroded Shift off Valve

WORK DONE

- Replace SA R/S WSS

- AA R/S Abs wiring corroded - Repaired

- DA R/S ABS wiring corroded - Repaired

- Replace 4 weeping air fittings on air drier

- Found corroded heater valve plug, cleaned up corrosion & fixed

MECHANIC Tyson DATE Aug 30/23 DRIVER Ryan DATE Aug 30/2022

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



WORK ORDER

7362

Customer

Date _____

[illegible]

WORK DONE

- Replace Clutch Brake and Grease.
- Check coars found #1 injected code
- Solenoid Driver not responding
- ERASED CODES
- Replace R/S Windshield
- Replace R/S Front Air bag
- ECR Bypass tube
- Grease / oil
- charge 4 batteries
- Chicago P/S flexdrive slotted

WORK REQUESTED

MAKE Kawasaki YEAR 2014 MILEAGE 72712
MODEL T-800 UNIT NO. T-206 HOURS 10998

TRIANGLE WASHINGTON LIGHT ON AGRIC

✓ COOLANT FLUCTUATES UP AND DOWN
LIGHT COMES ON BY THE TIME IT GETS FULL
OVER IT GOES OUT. LEAK LOW IN MORNING
ADD COOLANT. CHECK IN AFTERNOON AND THE
RESERVOIR IS FULL TO TOP

~~R.F.~~ drive airbag leaking on top base
Small air leak at air dryer quick coupler

RIS WIND SHIELD ROCK IN T.

- full service div

MECHANIC Tjss / Isaac DATE July 27/23

DRIVER

Kyau (own)

DATE _____

123

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



WORK ORDER

6813

Customer _____ Date _____

MAKE Kenworth YEAR 2014 MILEAGE 106664
MODEL T-800 UNIT NO. T2010 HOURS 769584

WORK REQUESTED

- Do a Complete CUP on unit.
- Pull all wheels and Drums to make Brake and Drum Measurements
- R/S Front Drive axle wheel seal leaking
- R/S Front Brake shoes need Replacing
- Replace Rear Axle V-Arm Bushings
- Set Brakes
- Torque tires

WORK DONE

- Do a Complete CUP on Unit.
- Pull all wheels to make Brake/ Drum Measurements
- Replace R/S Front Diff Wheel Seal
- Replace R/S Front Diff Brake Shoes
- Replace Rear Axle V-Arm Bushings
- Set Brakes
- Torque Tires

MECHANIC u an DATE June 14 23 DRIVER Ma. Triver DATE ---



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

7547

Customer _____ Date _____

MAKE KELVINATH YEAR 2014 MILEAGE 706064
MODEL T-800 UNIT NO. T-206 HOURS 10580

WORK DONE

- Replace Tie Rod Tube Assembly
- Adjust Tow in
- Replace Front Diff Top Torque arm
- Grease unit

WORK REQUESTED

- FRONT RIGHT TIRE METAL SHOWER
- PULLING HARD TO THE RIGHT
- RIS TIE ROD END HAS PLAY.
- Drain Trans / Diff oils check for leaks
- Front Diff top Torque arm worn out

MECHANIC _____

DATE _____

DRIVER R. S. S.

DATE 06/01/23

7-200

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



WORK ORDER

7560

Customer _____ Date _____

QTY.	PARTS NO.	DESCRIPTION	PER	AMOUNT
Active	1139	Inj solenoid Driverly	1	
Inactive	2346	Turbo intake temp		
Inactive	1443	Ambient air density		
		Drive Axle Right	USS	

WORK DONE


- Replace belts
- Replace A/C belt Idler
- Replace L13 sleeper door hatch
- tighten hose clamps
pull Pull EGR pipe - found coolant
- Replace Rear EGR Gasket & block it off
- block off both connections on cross over EGR tube
Service Unit
Km: 702635 HB3: 10510

WORK REQUESTED

✓ COOLANT LEAK
✓ EXHAUST LEAK
✓ C/O AIR NOT CIRCULATING TO BUICK
✓ ENGINE REALLY SQUEAKING / SOUNDS LIKE A PUMP
✓ TYPICAL HAS LOOKED
✓ Drivers side Cubby back Broken, Tongue fell out.
✓ Fuel Gauge Don't Work

MECHANIC [Signature] DATE May 26 123

DRIVER [Signature] DATE 05/16/23

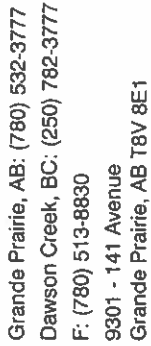

WORK ORDE

744

[illegible]

WORK DONE

- Grease / oil change
- Tighten Hyd filter
- Repair marker wiring under hood
- Replace wiper blades
- Replace Coolant tank
- Swap steering side to side

Customer	Date
1	1/1/2020
2	1/1/2020
3	1/1/2020
4	1/1/2020
5	1/1/2020
6	1/1/2020
7	1/1/2020
8	1/1/2020
9	1/1/2020
10	1/1/2020
11	1/1/2020
12	1/1/2020
13	1/1/2020
14	1/1/2020
15	1/1/2020
16	1/1/2020
17	1/1/2020
18	1/1/2020
19	1/1/2020
20	1/1/2020
21	1/1/2020
22	1/1/2020
23	1/1/2020
24	1/1/2020
25	1/1/2020
26	1/1/2020
27	1/1/2020
28	1/1/2020
29	1/1/2020
30	1/1/2020
31	1/1/2020
32	1/1/2020
33	1/1/2020
34	1/1/2020
35	1/1/2020
36	1/1/2020
37	1/1/2020
38	1/1/2020
39	1/1/2020
40	1/1/2020
41	1/1/2020
42	1/1/2020
43	1/1/2020
44	1/1/2020
45	1/1/2020
46	1/1/2020
47	1/1/2020
48	1/1/2020
49	1/1/2020
50	1/1/2020
51	1/1/2020
52	1/1/2020
53	1/1/2020
54	1/1/2020
55	1/1/2020
56	1/1/2020
57	1/1/2020
58	1/1/2020
59	1/1/2020
60	1/1/2020
61	1/1/2020
62	1/1/2020
63	1/1/2020
64	1/1/2020
65	1/1/2020
66	1/1/2020
67	1/1/2020
68	1/1/2020
69	1/1/2020
70	1/1/2020
71	1/1/2020
72	1/1/2020
73	1/1/2020
74	1/1/2020
75	1/1/2020
76	1/1/2020
77	1/1/2020
78	1/1/2020
79	1/1/2020
80	1/1/2020
81	1/1/2020
82	1/1/2020
83	1/1/2020
84	1/1/2020
85	1/1/2020
86	1/1/2020
87	1/1/2020
88	1/1/2020
89	1/1/2020
90	1/1/2020
91	1/1/2020
92	1/1/2020
93	1/1/2020
94	1/1/2020
95	1/1/2020
96	1/1/2020
97	1/1/2020
98	1/1/2020
99	1/1/2020
100	1/1/2020

MAKE	YEAR	MILEAGE
1971 Oldsmobile	1971	9200

MODEL T800 UNIT NO. 556 HOURS 10137
Km 697423 H 10370

WORK REQUESTED

COOLING LAMP REFLECTOR (PAX SIDE)
THE MOTOR IN MORNING RESERVATION
WAS WITH THE LAMP.

15 fender marker not on

thank order

MECHANIC Tyson Kelle DATE May 9 1983 DRIVER Mike Smith DATE 05/09/83



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

6731

Customer _____ Date _____

MAKE Kenworth YEAR 2014 MILEAGE 682334

MODEL T800 UNIT NO. T206 HOURS 10051 hrs

WORK REQUESTED

☒ #4 Connecting Rod went ~~through~~ Through side of Block.

☒ Do a complete engine swap with engine bought @ S+J.

☒ Had to swap wire harness to a 2350 from 2250.

☒ Had to replace #1 knock sensor to match harness.

☒ Reused old clutch.

WORK DONE

Engine Swap

MECHANIC Tyson/Dan DATE MAR 10/2023 DRIVER SHOP DATE MAR 10/2023

Door handle / ~~door~~ AIR LEAK T-2



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDE
7317

Customer _____ Date _____

MAKE Kenworth YEAR 2014 MILEAGE 67138
MODEL T-800 UNIT NO. T-206 HOURS 15881.6

WORK REQUESTED

DRIVER STOP PER TASK SMALL LINE LEAKAGE
HAS 2 COUPLERS ON TOO CLOSE COULD NOT GET
AIR TO STOP, NEED TO CHANGE OUT THE LINE. *

DRIVER DOOR HANDLE LOCK. IN AND OUT DOOR LOCKS
DOES NOT SEAL. (ON ORDER)

Need to adjust F/F wheel.

DRIVERS SIDE WINDSHIELD Big Rock in it

Design Slow to Come up / NEED TO REMOVE
air lines and Put air in Cylinder.

ABS Light on

WORK DONE

Repair Small air leak.

Standard auto came and Replaced Windshield

Replace Driver Door handle

Replace Design air ram

unplug front left ABS and plug back in
light vent away

Replace Foot rebuild kit

MECHANIC Kyle DATE Fri 24/12 DRIVER Ken Conn DATE 01/26/23

T206

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



WORK ORDE

6617

Customer _____ Date Jan 3/23

MAKE _____ YEAR _____ MILEAGE 66279
MODEL _____ UNIT NO. T206 HOURS 15531

WORK REQUESTED

Air leak when Pressing on Brake Pedal.
L/S motor mount Bolts Broken

WORK DONE

Replace front Right drive axle ABS Mod valve
-Drill out Broken Motor mount Bolts in
L/S Rear ~~Hub~~ / Install new Motor Mount
Bolts

MECHANIC Don / Tyson DATE Jan 3/2023 DRIVER _____ DATE _____



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

7265

Customer _____ Date _____

MAKE Cummins YEAR 2014 MILEAGE 663100

MODEL _____ UNIT NO. 1-206 HOURS 18450.3

WORK REQUESTED

PURCHASE 290 OUT OF PATTEN, GR. RD
OPERATED AGAIN POWERED UP DOWN
SO IT RESET, AND CONTINUES ON.
BUTTON FOR OIL SIGN PASSES AIR WHEN
SIGNS IS UP
-need to perform Injector Performance test.
Fuel Connectors Tubes loose/
Bad Injector.
Fuel Pump

WORK DONE

-Run unit and add cylinder cut out/Found
#2 injector seemed to be over fueling.
-Pull #2 injector and install used injector
and new connecting Tube.
-Pull #6 injector and put used injector
in.
-Run Unit Seems Better, will have
To Run unit to see if it shuts down.

MECHANIC Don DATE Dec 20/22 DRIVER Don Can. Av. DATE 12/17/22

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



WORK ORDE

6667

Customer _____ Date _____

MAKE _____ YEAR _____ MILEAGE 649041

MODEL _____ UNIT NO. T-206 HOURS 15120

WORK REQUESTED

- Starter needs Replaced

- Due for oil change

- R/S Rear Axle needs Dustshield

WORK DONE

- Replace Starter

- Replace R/S Rear Axle Dustshield

- Do a Complete oil change on unit

- Check engine codes / Hi intake temp

MECHANIC D. A. S. DATE Nov 11 / 2022 DRIVER _____ DATE _____

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



WORK ORDER

7076

Customer _____ Date _____

MAKE _____ YEAR _____ MILEAGE 631082

MODEL _____ UNIT NO. T-206 HOURS 14697

WORK REQUESTED

- Unit had Engine Codes.
- Ecm had Turbo Actuator Codes

WORK DONE

- Replace Turbo / we Bought
from S-J truck.

MECHANIC [Signature] DATE Sept 26/22 DRIVER _____ DATE _____

T-20

Grande Prairie, AB: (780) 532-3777
 Dawson Creek, BC: (250) 782-3777
 F: (780) 513-8830
 9301 - 141 Avenue
 Grande Prairie, AB T8V 8E1



WORK ORDER

7158

Customer

Date

MAKE KenworthYEAR 14MILEAGE 490254

MODEL

UNIT NO. T-206HOURS 14673.8


WORK DONE

- Plug in Computer Found Exhaust Gas Pressure Reading improper 30-35" supposed to be 27.4.
- Replace Exhaust Gas Pressure Sensor
- Lights switch for Bottom headache Rack. Lights are on Winch Console
- Test Air Cleaner and under Cab lights all seem OK, cant find short anywhere
- Replace L/S wiper arm Assembly.
- Replace R/S wiper Blade.
- Grease unit.

WORK REQUESTED

BLACK SECT FILM EXHAUST ON BUNK
 BLOWING PUFFS OF BLACK SMOKE.
 DEBATED WOULD NOT BUYLO PART 1200 FOR
 ATR 150K UNDER CAB
 WIPER BLADES NEED TO BE CHANGED PWS STD
 IS BROKEN.
 BUMPER SIGNAL LIGHTS KEEP PULLING OUT WITH
 HOOD DEGS
 BOTTOM BACK UP LIGHTS NOT WORKING UNDER
 THE NOT HITTIAL REAR SWITCH
 NEED TO ADJUST Fifth wheel.

MECHANIC Dan LmDATE Sept 23/22DRIVER Dan LmDATE 09/21/22

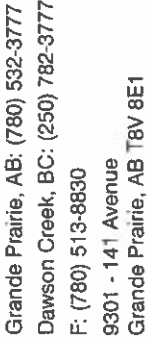

7180

Aug 27/27

[illegible]

WORK DONE

- Remove Transmission and Replace Clutch

- Replaced Rear Motor: Moulds when Transmission was out.

- Tighten loose Exhaust Clamp on
DPF F, /ter

- Install new Clamps and Gaskets on Exhaust Elbows

-Repair Hydraulic Pump

- Replace PFO output / shaft

MAKE

YEAR

MILEAGE 623958

MODEL

UNIT NO.

HOURS 16546

WORK REQUESTED

Clutch 2 placed.

- large clamps that hold DPF filter in place loose.

- Couple exhaust Clamps Loose

-Pto Drive splines worn out.

- Hydraulic Pump ~~the~~ Drives plines worn

MECHANIC Don Song DATE Sept 1/22

DRIVER

DATE _____

sep 1/22.

DATE _____

7a

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



WORK ORDER
6560

Customer _____ Date _____

MAKE _____ YEAR _____ MILEAGE 60745
MODEL _____ UNIT NO. T206 HOURS 14320

WORK REQUESTED

Starter won't engage sometimes
Possibly needs a starter
Need to Replace Hood Hinge
assembly
Coolant leak in Bunk Heater Somewh.
Crank case Filter Drain tube leaking
One Screw for Hood Pivot assembly
Broke off, need to Drill and tap new
threads and install new screw

QTY.	PARTS NO.	DESCRIPTION	PER	AMOUNT

WORK DONE

-Repair Coolant leak in Bunk Heater
To Replace Electronic actuator Valve
assembly For Bunk Heater
-Replace Hood Pivot Assembly
-Replace Crank Case Filter Drain
Tube
-Clean Connection on Starter Cables

MECHANIC Dan Soper DATE July 28/22 DRIVER _____ DATE _____

Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1



WORK ORDER

6960

Customer _____ Date June 21/22

MAKE _____ YEAR _____ MILEAGE 60226
MODEL _____ UNIT NO. T-206 HOURS 14117

WORK REQUESTED

✓ Do a Complete CUIP on Unit
✓ Need to pull wheels To make Proper measurements
✓ Need to WIRE in Driving Lights and Tie up wiring.
✓ Need to Rotate Rear Tires.
✓ Put new Frame Clampson Air Compressor discharge line.
✓ Need to Replace Front Diff V Bar Bushings
✓ Need to Replace Rear Diff V Bar Bushings.
✓ Need to remove Steer tire and in rear
✓ Front Diff Banto housing leaking
- Need to Reseal windshield / standard on
✓ ABS Light on Glass

WORK DONE

- Do a Complete CUIP on Unit.
- Pull Rear wheels and measure.
- Install new Brake Shoes on Rear.
- Wire in Driving lights.
- Rotate Rear tires.
- Install new Frame Clamps on Air Comp Discharge line.
- Replace Front Diff V Bar Bushings.
- Replace Rear Diff V Bar Bushings.
- Repair ABS Sensor wiring.
- Replace Steer axle Brake Shoes and Drums

MECHANIC _____ DATE _____ DRIVER _____ DATE _____



Grande Prairie, AB: (780) 532-3777
Dawson Creek, BC: (250) 782-3777
F: (780) 513-8830
9301 - 141 Avenue
Grande Prairie, AB T8V 8E1

WORK ORDER

6584

Customer Date

[illegible]

WORK DONE


- Load test Batteries, Found Front 2 Batteries Weak / Replace Front 2 Batteries
- Clean Battery Connections
- Tie up Battery Cables Better
- Replace Bottom Exhaust Bottom Clamp
- Tighten Front Diff and pd yoke
- Replace Fan Hub
- Replace high Pressure A/C Hose
- Replace Cab air Filter
- ~~Replace~~ Recharge A/C Hose

WORK REQUESTED

MAKE _____ YEAR _____ MILEAGE 602366

MODEL	UNIT NO.	HOURS
	206	14117.

MECHANIC _____ DATE _____ DRIVER MARK DATE JUNE 15, 2

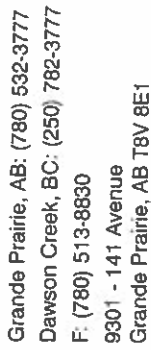

WORK ORDER

629

Customer _____ Date _____

MAKE _____ YEAR _____ MILEAGE 546285

MODEL _____ UNIT NO. 306 HOURS 12888

WORK REQUESTED

- Due to Grease
- Leaking air Unless when Cold
- P/S bumper + fender light not working
- Front diff small leak
- Front diff output U-Joint needs new grease nipple
- P/S hood mud flap
- Steer shocks

[illegible]

WORK DONE

Passenger side bumper signal light
Passenger side fender signal light
Replaced Front steer shocks
Replaced U-Joint grease nipple
Replaced both bumper mudflaps
Serviced Unit

MECHANIC Kyle DATE Jan. 6th/22 DRIVER Brian DATE Jan 6 / 2022