



Freddas Diesel & Hire - Service & Inspection -TRUCKS - TRAILERS

17 Dec 2024

Items Checked - 24

Items Okay at this Time - 16


Items for Future Action - 1


Items For Immediate Action - 2


Items Replaced - 5


Date: 12 Dec 2024
Customer Name: ETC GROUP
Make: Hino
Model: Rego: XV26WI - 2022 Hino Tipper
KILOMETRES: 154200


Components


Lights:  Okay at this time


Wiper blades:  Okay at this time


Windscreen:  Okay at this time


Washer Fluid:  Okay at this time

Belts/hoses:  Okay at this time


Batteries/ clean / check clamps :  Okay at this time


Air filter:  Replaced


Cabin filter:  Okay at this time

Engine oil/level:  Replaced

Comments: 15W40 - 36 Litres

GEARBOX OIL/LEVEL:  Okay at this time

Oil filter/s:  Replaced

Fuel filter/s:  Replaced

Coolant/level:	<div></div> Okay at this time
KING PINS/SUSPENSION BUSHES	<div></div> Requires immediate attention
Comments	Please See Notes
DIFF OIL / LEVEL	<div></div> Okay at this time
TYRE	<div></div> May require future attention
Comments	RHS Steer Tyre has a nail/bolt imbedded in it. Front drive tyres on Indicators
BRAKE CONDITION	<div></div> Okay at this time
POWER STEERING OIL/LEVEL	<div></div> Okay at this time
WHEEL BEARINGS	<div></div> Okay at this time
DRIVELINE - TAILSHAFT - JACKSHAFT - UNI JOINTS	<div></div> Okay at this time
MIRROR CONDITION - REFLECTORS - SEAT BELT CONDITION	<div></div> Okay at this time
clean radiator	<div></div> Okay at this time
HORN OPERATION	<div></div> Okay at this time
Lubricate all grease points:	<div></div> Requires immediate attention
Comments	Auto Greaser needs to be topped up
Service sticker:	<div></div> Replaced
Comments	Next Service is Due at 174,200 kms
Additional Comments	Mechanics Comments:- Front Drive Shocks need urgent attention Torque Rod Bushes need urgent attention Rear I- Bushes need to be monitored Rear Engine Mounts are starting to crack - monitor Air Dryer Kit is currently blowing out oil - needs to be replaced sooner rather than later Brakes are ok
Items Checked	24 / 28
Items Okay at this Time	16 / 28
Items for Immediate Attention	2 / 28
Items for Future Action	1 / 28
Items Replaced	5 / 28

ASSOCIATED COLD TREAD TYRES

NSMA PTY LTD - ABN: 25 125 460 399
82-86 DOURO STREET
P O BOX 447
NORTH GEELONG 3215
Phone: 03 5278 5533

accounts@coldtread.com.au

EARTEC

13/06/24
10:57a
Page 1 of 1

EARTH TECH CIVILS PTY LTD
office@earthtechcivils.com

Deliver To:
EARTH TECH CIVILS

ORIGINAL TAX INVOICE 377076

Salesperson GAVIN MEANEY
Customer PO No: 1191
Registration No. XV26WI
Odometer: 134480

Product	Description	Qty	Price	Amount
## PLEASE NOTE CHANGE OF BANKING DETAILS ## BSB: 083-646 ACCOUNT: 52-548-8045				
JOB SHEET NO :A90341 11.06.24 JOB LOCATION :ACTT WHEEL POSITION :9-12 NUT CHECK CARD #:55108				
STSTEP22511SR828	11R22.5 STEP RISING SR828 MIXED	4	370.00	1480.00
TYRES OFF	:XB66424.XB66425.XB66426			
Z365	DISP TRUCK LARGE 19.5 TO 22.5	1	26.00	26.00

DIRECT BANKING DETAILS:PLEASE QUOTE CUSTOMER CODE.

BSB: 083-646 ACCOUNT: 52-548-8045

Includes GST of \$136.91

TOTAL \$	1506.00
-----------------	----------------

ASSOCIATED COLD TREAD TYRES

NSMA PTY LTD - ABN: 25 125 460 399
82-86 DOURO STREET
P O BOX 447
NORTH GEELONG 3215
Phone: 03 5278 5533

accounts@coldtread.com.au

EARTEC

13/06/24
10:57a
Page 1 of 1

EARTH TECH CIVILS PTY LTD
office@earthtechcivils.com

Deliver To:
EARTH TECH CIVILS

ORIGINAL TAX INVOICE 377076

Salesperson GAVIN MEANEY
Customer PO No: 1191
Registration No. XV26WI
Odometer: 134480

Product	Description	Qty	Price	Amount
## PLEASE NOTE CHANGE OF BANKING DETAILS ## BSB: 083-646 ACCOUNT: 52-548-8045				
JOB SHEET NO :A90341 11.06.24 JOB LOCATION :ACTT WHEEL POSITION :9-12 NUT CHECK CARD #:55108				
STSTEP22511SR828	11R22.5 STEP RISING SR828 MIXED	4	370.00	1480.00
TYRES OFF	:XB66424.XB66425.XB66426			
Z365	DISP TRUCK LARGE 19.5 TO 22.5	1	26.00	26.00

DIRECT BANKING DETAILS:PLEASE QUOTE CUSTOMER CODE.

BSB: 083-646 ACCOUNT: 52-548-8045

Includes GST of \$136.91

TOTAL \$	1506.00
-----------------	----------------

ASSOCIATED COLD TREAD TYRES

NSMA PTY LTD - ABN: 25 125 460 399
82-86 DOURO STREET
P O BOX 447
NORTH GEELONG 3215
Phone: 03 5278 5533

accounts@coldtread.com.au

EARTEC

20/03/24
11:19a
Page 1 of 1

EARTH TECH CIVILS PTY LTD
office@earthtechcivils.com

Deliver To:
EARTH TECH CIVILS

ORIGINAL TAX INVOICE 372494

Salesperson GAVIN MEANEY
Customer PO No: 1084
Registration No. XV26WI
Odometer: 113624

Product	Description	Qty	Price	Amount
	## PLEASE NOTE CHANGE OF BANKING DETAILS ## BSB: 083-646 ACCOUNT: 52-548-8045			
	JOB SHEET NO :A86903 01.03.24 JOB LOCATION :ACTT COLAC WHEEL POSITION :1.2 NUT CHECK CARD #:48020			
ZSERVICE	SERVICE PROVIDED - OTHER REMARK: 2X 295/80R22.5 R154 B\STONES BALANCE POWER + DISPOSALS	1	1792.00	1792.00

DIRECT BANKING DETAILS:PLEASE QUOTE CUSTOMER CODE.

BSB: 083-646 ACCOUNT: 52-548-8045

Includes GST of \$162.91

TOTAL \$ 1792.00



www.bigwheels.net.au

ABN:

MJS DIESEL PTY LTD T/AS
Big Wheels Truck Alignment Geelong
9-11 Rodney Road
North Geelong 3215
ABN: 18 622 679 716

Phone 03 52722 460
FAX
Mobile 0419 583 686
geelong@bigwheels.net.au

Page 1 of Inv. 10884

Date 13/06/24

Tax Invoice

No. **GE-10884**

Customer

Earth tech Civil

No. 1

Bill to

Earth tech Civil

Rego. No. XV26WI
Fleet No.
Make HINO
Model No FS1E
Year 1/ 2022
Odometer 154534
VIN JHDFS1ELKXXX12371

Terms: 30 days.

* - Non-GST Item

Ph. 0424 954 959

Description	Quantity	Cost	Per	Total
U-BOLT	4.0000	33.25		133.00
NUT 7/8" DEEP	8.0000	2.98		23.84
Remove rear ubolts make new centre bolts				640.00
S&R				110.00
Inspect Vehicle inline with Customer advice. carry out inspection of all Steering, Suspension & Underbody Components. - advise customer of inspection results.				
.				
1st Axle Wheel Alignment				195.00
Move Vehicle into Wheel Alignment bay and connect Wheel Alignment Equipment.				
Carry out Wheel Alignment check and record results.				
Carry out adjustments as required, reassembled and check settings & record results,				
Check and tension components as required for the purpose of carrying out the Wheel Alignment.				
Fully reassemble and roadtest. check steering wheel for straightness.				
Advise customer if there is any concerns with vehicle steering due to worn components, uneven wear of tyres or any associated component or characteristic of the vehicle.				
.				
Workshop Supplies	1.0000	27.50	Ea.	27.50
Supply of Workshop Consumables utilised in the provision of services, these include grease, cloth rags, hand cleaner, seat covers, gloves, split pins, grease nipples, specialised tooling and many other ancilliary items that are used.				
.				



Like us on Facebook

TRADING TERMS AND CONDITIONS - VISIT WWW.BIGWHEELS.NET.AU

BIG WHEELS TRUCK ALIGNMENT - STEERING AUSTRALIA IN THE RIGHT DIRECTION



www.bigwheels.net.au

ABN:

MJS DIESEL PTY LTD T/AS
Big Wheels Truck Alignment Geelong
9-11 Rodney Road
North Geelong 3215
ABN: 18 622 679 716

Phone 03 52722 460
FAX
Mobile 0419 583 686
geelong@bigwheels.net.au

Page 2 of Inv. 10884

Environmental Levy	1.0000	15.00 Ea.	15.00
---------------------------	--------	-----------	-------

This Levy is to cover disposal of all waste items (excluding tyres and tyre casing). it is for disposal of old parts, rags, seat covers, old grease, old fluid, packaging and many other ancillary items.

Drive Axle Alignment			310.00
-----------------------------	--	--	--------

Inspected Drive Axle and all associated components for the purpose of performing a Wheel Alignment.

Recorded initial readings obtained from the vehicle and investigated cause if out of specification.

Carried out APP Inspection for Safety and Compliance, notified client of findings if required.

Carried out vehicle adjustments as necessary and reset Drive Alignment. reassembled and tensioned as necessary. recorded secondary after adjustment readings.

Advised client the vehicle requires retensioning of components within 100km/s or one week of completion.

Roadtested and checked now all ok.

Drive Alignment Shims,	2.0000	30.00 Ea.	60.00
-------------------------------	--------	-----------	-------

Supply and Install Drive Alignment Shims as necessary to adjust Drive Axle.

Reassemble and check after repair now all ok.

Axle Set Back			70.00
----------------------	--	--	-------

Inspect measure and adjust axle set back to Australian standards

CASTOR WEDGE 75mm X 2dg	2.0000	30.00	60.00
--------------------------------	--------	-------	-------

SUBTOTAL	\$	1,644.34
-----------------	----	----------

GST		164.43
------------	--	--------

Invoice Payment Details

Bank: NAB

BSB:083653

Account #: 987616478

Thank You From Matt & Jacquee Swan

Email remittance advice to geelong@bigwheels.net.au

N:B:

1) Wheels Nuts require retensioning after 50km/s have been travelled after repairs completed

2) U Bolts require retensioning after 500km/s from date of repair

TOTAL PRICE includes GST	\$	1,808.77
---------------------------------	----	----------



Like us on Facebook

TRADING TERMS AND CONDITIONS - VISIT WWW.BIGWHEELS.NET.AU

BIG WHEELS TRUCK ALIGNMENT - STEERING AUSTRALIA IN THE RIGHT DIRECTION



www.bigwheels.net.au

ABN:

MJS DIESEL PTY LTD T/AS
Big Wheels Truck Alignment Geelong
9-11 Rodney Road
North Geelong 3215
ABN: 18 622 679 716

Phone 03 52722 460
FAX
Mobile 0419 583 686
geelong@bigwheels.net.au

Page 3 of Inv. 10884

- 3) Check and retension suspension eye bolts after 500 km or call back in in 1 week for checking
- 3) Check and retensioning all suspension eye bolt after 500km/s



Like us on Facebook

TRADING TERMS AND CONDITIONS - VISIT WWW.BIGWHEELS.NET.AU

BIG WHEELS TRUCK ALIGNMENT - STEERING AUSTRALIA IN THE RIGHT DIRECTION

**Freddas Diesel & Hire**

☰ PROCEDURE

Service Doc**28 / 64**

Fields completed

Date::

13/06/2024

Filled by matthew fredericks on 16/06/2024, 12:25

Customer name::

ETC GROUP

Filled by matthew fredericks on 16/06/2024, 12:57

Make::

HINO

Filled by matthew fredericks on 16/06/2024, 12:57

Model::

No value given.

Registration::

XV26WI

Filled by matthew fredericks on 16/06/2024, 12:57

Kilometres::

133XXX

*Filled by matthew fredericks on 16/06/2024, 12:57***Components**

Lights:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 25/05/2024, 07:27

Comments:

No value given.

Wiper blades:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 02/02/2024, 11:54

Comments:

No value given.

Windscreen:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 26/09/2023, 08:31

Comment:

No value given.

Washer fluid:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 16/04/2024, 16:01

Comments:

No value given.

Belts/hoses:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 19/05/2024, 15:17

Comments:

No value given.

Batteries:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 16/06/2024, 12:57

Comments:

No value given.

Air filter:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 16/06/2024, 12:57

Comments:

No value given.

Cabin filter:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 16/04/2024, 16:01

Comments:

No value given.

Clutch pedal free-play:

- ☐ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Comments:

No value given.

Engine oil/level:

- ☐ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☒ Replaced

Filled by matthew fredericks on 26/09/2023, 08:31

Comments:

No value given.

Oil filter/s:

- ☐ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☒ Replaced

Filled by matthew fredericks on 26/09/2023, 08:31

Comments:

No value given.

PCV filter:

- ☐ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Comments:

No value given.

Fuel filter/s:

- ☐ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☒ Replaced

Filled by matthew fredericks on 01/12/2023, 15:45

Comments:

No value given.

P/s fluid/level:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 25/05/2024, 07:28

Comments:

No value given.

Brake/clutch fluid/leve:

- ☐ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Comments:

No value given.

Coolant/level:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 25/05/2024, 07:28

Comments:

No value given.

Transmission oil/level :

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 16/04/2024, 16:01

Comments:

No value given.

Transfer case oil/ level:

- ☐ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Comments:

No value given.

Diff oil/ level :

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 20/03/2024, 14:54

Comments:

No value given.

King pins:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 16/06/2024, 12:56

Comments:

No value given.

suspension/drive line:

- ☐ Okay at this time
- ☒ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 25/05/2024, 07:29

Comments:

No value given.

Turntable:

- ☐ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Comments:

No value given.

Ring feeder:

- ☐ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Comments:

No value given.

Body:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 26/09/2023, 08:31

Comments:

No value given.

Tyres:

- ☐ Okay at this time
- ☒ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 16/06/2024, 12:56

Comments:

No value given.

Wheel bearings :

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 26/09/2023, 08:31

Comments:

No value given.

Check and adjust Brakes:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 17/10/2023, 08:54

Comments:

No value given.

Lubricate all grease points:

- ☒ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☐ Replaced

Filled by matthew fredericks on 26/09/2023, 08:31

Comments:

No value given.

Service sticker:

- ☐ Okay at this time
- ☐ May require future attention
- ☐ Requires immediate attention
- ☒ Replaced

Filled by matthew fredericks on 27/09/2023, 07:34

Comments:


No value given.

 COMMENTS

COOLANT OVERFLOW LOW
OIL LEVEL WAS LESS THEN HALF
LH STEER TYRE ON INDICATOR
COOLANT LEAK AROUND TRANS COOLER
PIPE (TIGHTENED CLAMP)
WRONG AIR FILTERS SUPPLIED
LHF DRIVE BOOSTER MOUNT/SCAM TUBE
BENT
REAR OF FRONT SHACKLE PINS BUSHES
DRIVE SIDE KING PIN NEED ATT CANT
GREASE LOWER SIDE NEEDS RE SEALING

Commented by matthew fredericks on 26/06/2023, 13:34

DATE: 11/1/24
UNIT NO.: ETC-02
REGO: XV-26WI
KMS: 105731

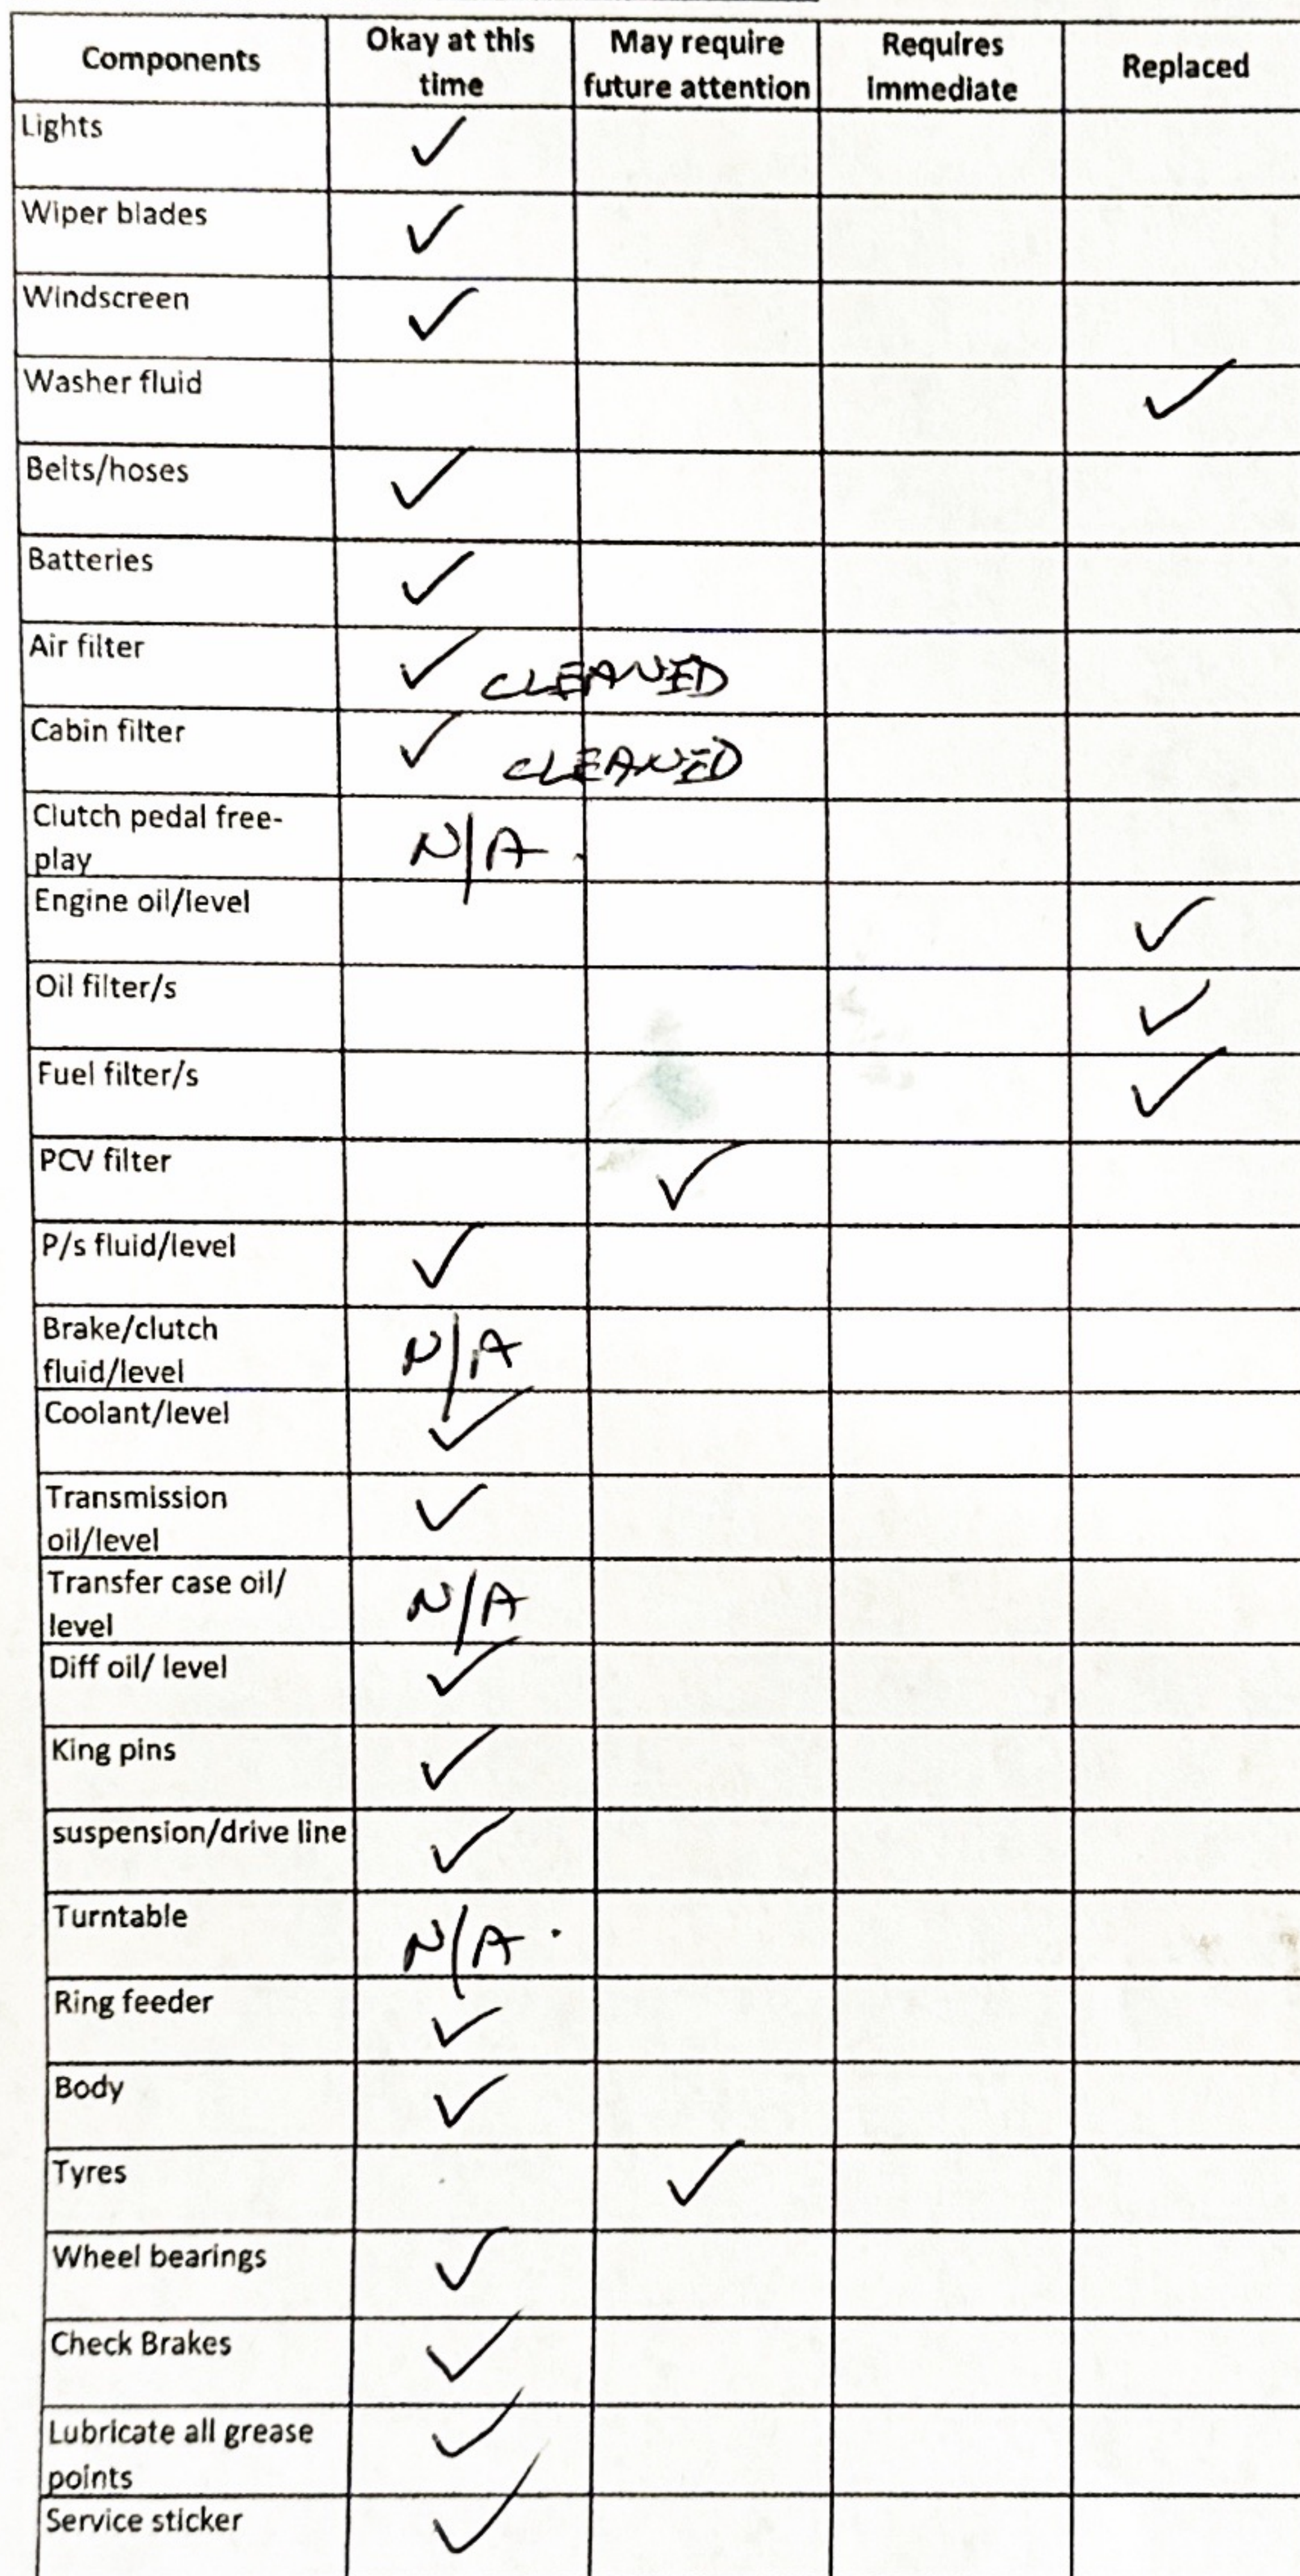

Comments

FRONT TYRES SCRUBING
FEA - WHEN WE CHANGE TYRE

FREDDAS HIRE PTY LTD

1/14-16 enmore street
north geelong VIC 3215
+61 409582067
admin@freddas.com
freddashire.com.au



Tax Invoice

INVOICE TO
Earth-Tech Civils
ETC GROUP

INVOICE 1582
DATE 17/12/2024
TERMS 14 days
DUE DATE 31/12/2024

DATE		DESCRIPTION	GST	QTY	RATE	AMOUNT
12/12/2024	Services	Rego: XV26WI 2022 Hino Tipper ODO: 154,200 kms Next Service will be due at 174,200 kms Carried out Minor Service Removed and Replaced Lube Filter Fuel Filter Oil Filter Air Cleaner (Please Note: Air Cleaner/Air Filter is a Genuine Hino Air Cleaner. The install date has been marked on the air cleaner, and is covered by Hino under a 3 year Warranty. Please ensure that the Air Cleaner is checked at least once a week by driver conducting Pre-Start. The filter will be cleaned, not changed during the next service intervals.) Drained and Replaced Engine Oil - 36 Litres Inspected all other Fluid Levels - All ok Inspected and Checked Over Tipper. Please Refer to the notes listed on the Inspection and Service Report, which is attached.	GST	5	120.00	600.00
12/12/2024	Parts	Lube Filter x1 Oil Filter x1	GST	1	798.33	798.33

ETC02
PO #1341

Fuel Filter x1
Air Cleaner x1

Engine Oil - 15W40 - 36 Litres

Grease/Consumables/Waste

We appreciate your business and look forward to hearing from you soon.

SUBTOTAL	1,398.33
GST TOTAL	139.83
TOTAL	1,538.16
<hr/>	
BALANCE DUE	A\$1,538.16

FREDDAS HIRE PTY LTD
BSB: 083-543
ACC: 389063789



TILL HINO

1300 446 663

Till Automotive Group Pty Ltd ACN 620 672 611
ATF Till Automotive Group Unit Trust
ABN 81 952 343 665 LMCT: 0011771
11-13 Industrial Pl, Breakwater VIC 3219

Email: service@tillhino.com.au
Visit us online: www.tillhino.com.au

Vehicle ID XV26WI		Description HINO 700 FS 2848 AMT AIR 4288		Key Tag	Service Tax Invoice Number 1457430	
Series 2848		Model FS1ELKH-FSAPEAC		Page 1 of 2	Date 14/07/2023	
Colour	Engine	Trans	VIN JHDFS1ELKXXX12371	Engine No.	Fuel Type	
Paint Code	Radio Pin	Manufactured Date	Compliance Date	Manufacturer ID	Date First Registered	Stock Number
Account 74827	Order Number	Deal No.	Salesperson	Dealer	Warranty Expiry	Ext Warranty Expiry
Driver Name		Time In 07:30	Time Out 17:00	Date Out 08/06/2023	Odometer 78020	
						Phone 0457297172 s

Booking: Bradb - Bernie
Advisor: Bradb - Bernie
Costing: hockm - Mason
Finalised: tream - Myles
RO: 1321289

Earth-tech Civils Pty Ltd
40 Breamlea Road
CONNEWARRE VIC 3227
Australia

Copy

Job No	B/Code	Description	Units	Amount	
1	R	Customer complaint of Axle shifting and has air leaking from rear of truck, checked truck and found air brake chamber has hit the spring and brken, first drive leaf spring was broken, all rebound rollers missing, carried out warranty tech report, submitted pictures for warranty, Claim not approved (repair is customer charge) replaced all rebound rollers, replaced broken spring, replaced shocks, replaced damaged air brake chamber, checked and tightened all U bolts, inspected suspension after all repairs, all slipper pads are there, all rebound rollers are there, springs are all ok, shocks are all ok U bolts are all tight (vehicle requires tyres) Customer needs to check vehicle suspension and replace any missing parts or broken parts ASAP.			
Labour				\$725.00	
Parts	Make	Part Item Code	Part Description	Quantity	Price Tax Excl.
	HINO	59193-000	Z SPRING	1	\$719.70
	HINO	59067-002-H	LEAF	1	\$716.10
	HINO	49175-014-2P	REBOUND KIT (PK-2)	2	\$113.70
	HINO	60670-005L	SHOCK ABSORBER	4	\$406.00
	HINO	S49U0E0E60	CHAMBER ASSY, BRAKE	1	\$1,287.65
Service Sundries	Description		Quantity	Price Tax Excl.	
	Shop Supplies		1	\$25.85	
Summary For Job 1					
Job 1 Total (Excluding GST)				\$3,994.00	
Job 1 Total (Including GST)				\$4,393.41	
2	W	Carry out AATS0 Campaign as required,			
Labour				\$0.00	
Parts	Make	Part Item Code	Part Description	Quantity	Price Tax Excl.
	HINO	4738537010	NUT BRAKE TUBE CLMAP	1	
Summary For Job 2					
Job 2 Total (Excluding GST)				\$0.00	
Job 2 Total (Including GST)				Not Applicable	



TILL HINO

1300 446 663

Till Automotive Group Pty Ltd ACN 620 672 611
ATF Till Automotive Group Unit Trust
ABN 81 952 343 665 LMCT: 0011771
11-13 Industrial Pl, Breakwater VIC 3219

Email: service@tillhino.com.au
Visit us online: www.tillhino.com.au

Vehicle ID XV26WI		Description HINO 700 FS 2848 AMT AIR 4288		Key Tag	Service Tax Invoice Number 1457430		
Series 2848		Model FS1ELKH-FSAPEAC		Page 2 of 2	Date 14/07/2023		
Colour	Engine	Trans	VIN JHDFS1ELKXXX12371	Engine No.	Fuel Type		
Paint Code	Radio Pin	Manufactured Date	Compliance Date	Manufacturer ID	Date First Registered	Stock Number	
Account 74827	Order Number	Deal No.	Salesperson	Dealer	Warranty Expiry	Ext Warranty Expiry	
Driver Name		Time In 07:30	Time Out 17:00	Date Out 08/06/2023	Odometer 78020		
					Phone 0457297172 s		

Booking: Bradb - Bernie
Advisor: Bradb - Bernie
Costing: hockm - Mason
Finalised: tream - Myles
RO: 1321289

Earth-tech Civils Pty Ltd
40 Breamlea Road
CONNEWARRE VIC 3227
Australia

Copy

Job No	B/Code	Description	Units	Amount
--------	--------	-------------	-------	--------

I (or where applicable "We") authorise the Company (Till Automotive Group Pty Ltd) to complete the service and/or repair items listed above and understand that all tests carried out on the vehicle will be at my own risk. I agree to pay this Service Tax Invoice in full to the Company upon completion of the work requested and/or return of my vehicle (or within the agreed trading terms if an approved Credit account with the Company). I agree that if I fail to pay the Company within these agreed terms the Company will have the right charge me/us interest at the current Standard Default Contract Rate from the date of the invoice until cleared funds are received by the Company. I also agree that if the total debt owing by me/us is forwarded to a collection agency I will be liable for all costs incurred by the Company including any agency fees, solicitor fees, or any other costs or expensed incurred in recovering the outstanding amount.

Invoice Total

Total Labour	\$725.00
Total Parts	\$3,243.15
Total Part Sundries	\$0.00
Total Service Sundries	\$25.85
Invoice Total (Excluding GST)	\$3,994.00
GST	\$399.41
Invoice Total (Including GST)	\$4,393.41

Direct Bank Payment Details

Account Name: Till Automotive Group Pty Ltd

Bank: WBC

BSB: 033226

Account: 540721

Our goods come with guarantees that cannot be excluded under the Australian Consumer Law. You are entitled to a replacement or refund for a major failure and for compensation for any other reasonably foreseeable loss or damage. You are also entitled to have the goods repaired or replaced if the goods fail to be of acceptable quality and the failure does not amount to a major failure.