CM Diesel Pty Ltd

Phone: 0403 675 780 c.mdiesel@outlook.com ABN: 17 662 228 766

Tax invoice

Invoice number 00000563 Issue date 12/01/2024 Due date 19/01/2024

Bill to

Hi-Tech Heavy Haulage

Description		Units	Unit price (\$) excluding tax	Тах	Amount (\$) excluding tax
	HOUR	4	115.00	GST	460.00
	HOOK		121.62	GST	243.24
Thermostat			4.52	GST	4.52
Gasket		1	11.31	GST	11,31
Gasket		2	31.24	GST	62.48
Seal		2			
			Subtotal (exc. tax)		\$781.55
			Tax		\$78.16
		Total A	Amount (inc. tax)		\$859.71
found current over heating faults	, ran engine up to temp,		Total paid		\$0.00
ats not opening, drained coolant, i ostat housing, removed and repla sing, installed housing, installed in	ced thermostats with new, take pipes, filled with coolant,	В	alance due		\$859.71
	Thermostat Gasket Gasket Seal , found current over heating faults ats not opening, drained coolant, in the coolant of the coo	Thermostat Gasket Gasket Seal , found current over heating faults, ran engine up to temp, ats not opening, drained coolant, removed intake pipes, extet housing, removed and replaced thermostats with new,	Description HOUR 4 Thermostat Gasket Gasket Seal Total found current over heating faults, ran engine up to temp, ats not opening, drained coolant, removed intake pipes, ostat housing, removed and replaced thermostats with new, sing, installed housing, installed intake pipes, filled with coolant,	Description HOUR HOUR HOUR HOUR HOUR 115.00 2 121.62 1 4.52 Gasket 1 1.31 Seal Subtotal (exc. tax) Tax Total Amount (inc. tax) Total paid at so not opening, drained coolant, removed intake pipes, estat housing, removed and replaced thermostats with new, sing installed housing, installed intake pipes, filled with coolant, Balance due	Description HOUR HOUR HOUR 4 115.00 GST 2 121.62 GST 4.52 GST 4.52 GST Gasket 1 1.31 GST Seal Subtotal (exc. tax) Tax Total Amount (inc. tax) Total paid stan ot opening, drained coolant, removed intake pipes, eats not opening, drained coolant, removed intake pipes, sing installed housing, removed and replaced thermostats with new, sing installed housing, installed intake pipes, filled with coolant, removed intake pipes, filled with coolant, removed intake pipes, sing installed housing, installed intake pipes, filled with coolant, removed intake pipes, filled with coolant, removed intake pipes, filled with coolant, removed intake pipes, sing installed housing, installed intake pipes, filled with coolant, removed intake pipes, fill

View your invoice online

Click here to view

How to pay

Due date: 19/01/2024

start checked, ran up to operating temp, checked fan operation all ok

paid 15-1-2024

BPAY®



Telephone & Internet Banking — BPAY®
Contact your bank or financial institution to make this
payment from your cheque, savings, debit, credit card
or transaction account. More info: www.bpay.com.au

Any payment must be for the exact amount of this involce and be made by the due date. Otherwise, any amount paid will not be accepted and will be returned.

Pay Online

Scan the QR code or click the link to view this invoice online.



Pay now

Bank deposit via EFT

Bank ANZ


Name CHRISTOPHER MAGUIRE

BSB 013017 AC# 646839382

Ref# 00000563

Invoice no: 00000563

Page 1 of 1

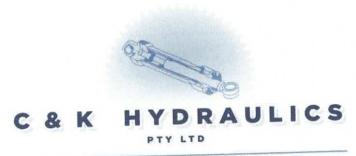

ACN 065 638 691

C & K Hydraulics Pty Ltd

ABN 26 065 638 691 Unit 3/14-16 Smith Street EMU PLAINS NSW 2750 AUSTRALIA

Tel: 02 4735 1665 Fax: 02 4735 1868

Email: ckhydraulics@bigpond.com

HI-TECH HEAVY HAULAGE

TAX INVOICE

Invoice Date 13 Apr 2024

Invoice Number 12346

Reference SLIDE BED

Description	Quantity	Unit Price	GST	Amount AUD
Strip cylinder hone barrel modify piston reseal machine 2 x pins	1.00	1,880.00	10.00%	1,880.00
			Subtotal	1,880.00
			Total GST 10%	188.00
	_	Inv	oice Total AUD	2,068.00
		Total Net	Payments AUD	0.00
	-	Amo	unt Due AUD	2,068.00

PAYMENT ADVICE

C & K Hydraulics Pty Ltd Unit 3/14-16 Smith Street EMU PLAINS NSW 2750 AUSTRALIA Customer

HI-TECH HEAVY HAULAGE

DIRECT DEPOSIT:

CBA Penrith Plaza

Total Due

BSB: 062 445

ACCOUNT: 1000 1979

2,068.00

Amount Enclosed

Enter the amount you are paying above

HI-TOROUF
Truck Spares (Aust) Pty Ltd

ACN: 003 168 545 As trustee for Hi-Torque Unit Trust ABN: 52 783 278 774

SPARES: 11 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9725 1818

SERVICE: 8 Toohev Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9756 5175 P.O. Box 6287, Wetherill Park NSW 2164

Invoice To:

HI-TECH HEAVY HAULAGE PTY LTD PO BOX 564 **RIVERSTONE NSW 2765**

TAX INVOICE		
Invoice	715164	
Account	3780	
Date	19/06/24	

Deliver To:

MR JOHN CHURCHILL LOT 4 **CNR WINDSOR RD & VICTORIA ST** RIVERSTONE NSW 2765

Service Order: S239136 PG

Customer Order No: AV-97-CF

Terms: 30 days

Reg No: AV-97-CF

Make: FREIGHTLINER

Model: ARGOSY

KLM/HR: 742,569

Fleet No:

Chassis No: 1FVMAWAV47L997979

Product

Description

Quantity

Price

Extended

HI TECH ARGOSY - CHECK OPERATION OF AIR BAGS WHEN LOWERING LIFT AXLE.

CHECK OPERATION OF LIFT AXLE. RAISE AIR BAGS AND CHECK FOR DAMAGE TO AIR BAGS.

REPLACE R/S 3RD AXLE AIR BAG.

MEASURE HEIGHT OF CHANGE WHEN LIFT AXLE IS LOWERED.

FOUND HEIGHT CHANGE IS ONLY 20MM HIGHER WHEN AXLE IS LOWERED.

AS108C CON₂

AIR SPRING FREIGHTLINER

CONSUMABLES

1.00 1.00 229.77 25.00 229.77 25.00

Goods cannot be returned for credit after 30 days. Full credit to 7 days then 10% handling charge to 30 days. Non-stock goods procured will not be accepted for return. Banking Details BSB: 012 468 Account: 8373 66178

Subtotal 254.77 Labour 740.00 GST 99.48

Invoice Total

1,094.25

Page 1 of 1

INV 715329 749-632 paid Direct 4-7-24 1843-88

HI-TORQUE

Truck Spares (Aust) Pty Ltd

ACN: 003 168 545 As trustee for Hi-Torque Unit Trust ABN: 52 783 278 774

SPARES: 11 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9725 1818

SERVICE: 8 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9756 5175 P.O. Box 6287, Wetherill Park NSW 2164 Email: accounts@hi-torque.com.au

 STATEMENT

 Date
 31/05/24

 Account
 3780

Page 1 of 1

To:

HI-TECH HEAVY HAULAGE PTY LTD P O BOX 564 RIVERSTONE NSW 2765

Date	Invoice No	Description	Reference	Debit	Credit
23/05/24	714649	Invoice	BF15KL	1,967.11	
29/05/24	714649	Receipt Cash			-1,967.11
24/05/24	714684	Invoice	AV-97-CF	814.00	1,007711

Current	30 Days	60 Days	90 Days	120 Days +	Total
814.00	0.00	0.00	0.00	0.00	814.00

----- Please Cut Off and Return With Your Payment

Hi-Torque Truck Spares (Aust)

nt: 3780		HI-TECH HEAVY HAULAGE PTY LTD		31/05/2	
Current	30 Days	60 Days	90 Days	120 Days +	Total
814.00	0.00	0.00	0.00	0.00	814.00

	A	The Continue of the Continue o
Amount Enclosed	Amount	814.00
	l Due	014.00

HI-TOROUF
Truck Spares (Aust) Pty Ltd

ACN: 003 168 545 As trustee for Hi-Torque Unit Trust ABN: 52 783 278 774

SPARES: 11 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9725 1818

SERVICE: 8 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9756 5175 P.O. Box 6287, Wetherill Park NSW 2164

Invoice To:

HI-TECH HEAVY HAULAGE PTY LTD P O BOX 564

RIVERSTONE NSW 2765

TAX	NVOICE
Invoice	714684
Account	3780
Date	24/05/24

Deliver To:

MR JOHN CHURCHILL

CNR WINDSOR RD & VICTORIA ST

RIVERSTONE NSW 2765

Service Order: S238880 PG

Customer Order No: AV-97-CF

Terms: 30 days

Reg No: AV-97-CF

Make: FREIGHTLINER

KLWHR: 740,379

Fleet No:

Model: ARGOSY

Chassis No: 1FVMAWAV47L997979

Product

Description

Quantity

Price

Extended

HI-TECH - RECTIFY BROKEN GEARSTICK

REMOVE BROKEN GEARSTICK FROM INSIDE CAB. CARRY OUT WELDING REPAIR TO GEARSTICK AND REFIT TO VEHICLE.

- REPLACE GEARSTICK BOOT, UNABLE TO OBTAIN, EX.USA.

REPAIR BOOT AND FIT TO VEHICLE.

- ADJUST BRAKES
- ADJUST CLUTCH

CON₃

CONSUMABLES

1.00

35.00

35.00

Goods cannot be returned for credit after 30 days. Full credit to 7 days then 10% handling charge to 30 days. Non-stock goods procured will not be accepted for return. Banking Details BSB: 012 468 Account: 8373 66178

Invoice Total	814.00
GST	74.00
Labour	705.00
Subtotal	35.00

Page 1 of 1

paid 29-5-24 \$ 1,987-11

HI-TORQUE

Truck Spares (Aust) Pty Ltd

ACN: 003 168 545 As trustee for Hi-Torque Unit Trust ABN: 52 783 278 774

SPARES: 11 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9725 1818

SERVICE: 8 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9756 5175 P.O. Box 6287, Wetherill Park NSW 2164

Invoice To:

HI-TECH HEAVY HAULAGE PTY L[']TD P O BOX 564 RIVERSTONE NSW 2765

TAX INVOICE					
Invoice	713856				
Account	3780				
Date	10/04/24				

Deliver To:

MR JOHN CHURCHILL LOT 4 CNR WINDSOR RD & VICTORIA ST RIVERSTONE NSW 2765

Service Order: S238471 PG

Customer Order No: AV-97-CF

Terms: 30 days

Reg No: AV-97-CF

Make: FREIGHTLINER

Model: ARGOSY

KLM/HR: 733,013

Fleet No:

Chassis No: 1FVMAWAV47L997979

Product

Description

Quantity

Price

Extended

HI TECH - ADJUST BRAKES AND GREASE VEHICLE

- CHECK VEHICLE OVER FOR REGO
- CHECK FOR POSSIBLE DRIVE HUB SEAL OIL LEAK

REMOVE L/H/S 2ND STEER WHEEL AND HUB. CLEAN COMPONENTRY.

REFIT HUB WITH NEW HUB SEAL. REASSEMBLE AND ADJUST BRAKES

VEHICLE RETURNED WITH THE FOLLOWING DEFECTS

- ADR35 SYSTEM FAULT. WHEN 1 TANK DRAINS, MAXIS APPLY.
- BRAKE SYSTEM AIR LEAK BETWEEN AXLES 3 AND 4.

SUPPLY AND FIT NEW MAXI BRAKE RELAY VALVE. CHECK OPERATION OF ADR35. REMOVE AND REPLACE3 CHECK VALVE. RECHECK ADR35 - OK.

- FUEL/FLUID LEAK AT FUEL FILTER AREA AT SIDE OF ENGINE. INSPECT TO FIND OIL LEAK AT COMPRESSOR PLATE. REMOVE AND RESEAL PLATE. WASH DOWN AREA. ALSO WASH DOWN R/H/S OF ENGINE WHICK ALSO HAD AN OIL LEAK.
- AXLE 2 L/H/S BRAKE LININGS CONTAMINATED WITH OIL.

WASH DOWN AREA.

CLEAR RMS DEFECT NOTICE.

35066	SEAL OIL	1.00	55.26	55.26
450755S	GASKET HUBCAP	1.00	6.34	6.34
800373R	CHECK VALVE 3/8" X 3/8" SC3	1.00	41.36	41.36
1469.10.6	ELBOW MALE	1.00	16.09	16.09
801329R	SPRING BRAKE MODULATING VALVE SR7	1.00	557.40	557.40
DC3	DEFECT CLEARANCE - GST FREE	1.00	43.00	43.00
CON2	CONSUMABLES	1.00	25.00	25.00

Goods cannot be returned for credit after 30 days. Full credit to 7 days then 10% handling charge to 30 days. Non-stock goods procured will not be accepted for return. Banking Details BSB: 012 468 Account: 8373 66178

Invoice Total	2,385.95
GST	213.00
Labour	1,428.50
Subtotal	744.45

Page 1 of 1

paid Dinect 26-4. 2024

0/1

HI-TOROUE
Truck Spares (Aust) Pty Ltd

ACN: 003 168 545 As trustee for Hi-Torque Unit Trust ABN: 52 783 278 774

SPARES: 11 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9725 1818

SERVICE: 8 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9756 5175 P.O. Box 6287, Wetherill Park NSW 2164

Invoice To:

HI-TECH HEAVY HAULAGE PTY LTD P O BOX 564

RIVERSTONE NSW 2765

TAX INVOICE	
Invoice	713078
Account	3780
Date	28/02/24

Deliver To:

MR JOHN CHURCHILL

CNR WINDSOR RD & VICTORIA ST

RIVERSTONE NSW 2765

Service Order: S238096 MC

Customer Order No: AV97CF

Terms: 30 days

Reg No: AV-97-CF

Make: FREIGHTLINER

Model: ARGOSY

KLM/HR: 725,887

Fleet No:

Chassis No: 1FVMAWAV47L997979

Product

Description

Quantity

Price

Extended

HI TECH - DROP AXLE PUMPING TOO HIGH

- GREASE AND ADJUST BRAKES

CHECK DROP AXLE HEIGHTS. ADJUST HEIGHT AND RECHECK OPERATION.

GREASE ENTIRE VEHICLE AND BRAKES ON ALL WHEELS.

LIP220.450G

GREASE LIPLEX 450G REFILL WORKSHOP

2.00

15.06

30.12

CON₂

CONSUMABLES

1.00

25.00

25.00

Goods cannot be returned for credit after 30 days. Full credit to 7 days then 10% handling charge to 30 days. Non-stock goods procured will not be accepted for return. Banking Details BSB: 012 468 Account: 8373 66178

Subtotal	55.12
Labour	415.50
GST	47.06
Invoice Total	517.68

paid Direct 14-3-24

Page 1 of 1

AVGYCE

CROWHURST AUTO ELECTRICAL PTY LTD

MVRL25661/ARC AU 12119

A.B.N. 37 002 569 235

A.C.N. 002 569 235

6 HIGHGATE ST

AUBURN

NSW 2144

02 9748-0488 Phone:

Fax: 02 9748-0949

TAX INVOICE 284660

Invoice Date

: 31/01/2024

Job Description : SERVICE

Payment Terms : C.O.D.

HITE01

HI-TECH HEAVY HAULAGE P/L

P 0 BOX 564 RIVERSTONE

NSW

2765

AV97CF

Make: FREIGHTLINER FREIGHTLINER

Tran No: 536857

JobNo: 394575

Stock Code Description-Text

Qtv UnitPrice Per Disc

Amount

Deliver To : 1a Atkins St Rydalmere

Contact Phone

*JOB DESCRIPTION

SERVICE CALL TO VINEYARD DEPOT. CHECK VEHICLE FOR CAUSE OF NOT STARTING. FOUND NO IGNITION SUPPLY. CHECK FUSES. CHECK RELAYS AND WIRING. LOCATE FAULTY IGNITION POWER RELAY. PICK UP A NEW RELAY. SUPPLY AND FIT A NEW RELAY. RECHECK STARTING.

> Total Labour [C] TOTAL COST OF PARTS

1.00

20.00

580.00

20.00

BANK: ANZ

BSB: 012 432 ACCOUNT NO. 231 616 494

Total Excluding GST

600.00

Total GST

60.00

Payable To CROWHURST AUTO ELECTRICAL PTY LTD

INVOICE TOTAL

\$660.00

AV GYCF

HI-TOROUF
Truck Spares (Aust) Pty Ltd

ACN: 003 168 545 As trustee for Hi-Torque Unit Trust ABN: 52 783 278 774

SPARES: 11 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9725 1818

SERVICE: 8 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9756 5175 P.O. Box 6287, Wetherill Park NSW 2164

Invoice To:

HI-TECH HEAVY HAULAGE PTY LTD

P O BOX 564

RIVERSTONE NSW 2765

	TAX INVOICE		
	Invoice	710899	
d	Account	3780	
	Date	27/10/23	

Deliver To:

MR JOHN CHURCHILL

LOT 4

CNR WINDSOR RD & VICTORIA ST

RIVERSTONE NSW 2765

Service Order: S236986 MC

Customer Order No: AV97CF

Terms: 30 days

Reg No: AV-97-CF

Make: FREIGHTLINER

Model: ARGOSY

KLWHR: 714.896

Fleet No:

Chassis No: 1FVMAWAV47L997979

Product

Description

Quantity

Price

Extended

HI TECH - AIR BAG HEIGHTS TOO HIGH WHEN LAZY AXLE IS DOWN

- CHECK P/STEERING LINES USING POWER STEERING OIL.
- ADJUST BRAKES
- ADJUST CLUTCH
- GREASE VEHICLE
- CROSS LOCK LIGHT STUCK ON
- CHECK STEERING VIBRATES AT 90 KPH.

CHECK OPERATION OF DIFF AXLE LOCK. FOUND SWITCH SENDER TO BE FAULTY.

REMOVE AND REPLACE AXLE LOCK SWITCH ON DIFF. RECHECK.

CARRY OUT BRAKE ADJUSTMENT.

CARRY OUT CLUTCH ADJUSTMENT.

GREASE ENTIRE VEHICLE.

CHECK POWER STEERING LEAK, FOUND FEED HOSE FROM POWER STEERING RESERVIOUR TO BE LEAKING. RETENSION LOOSE CLAMP AND WASH. RECHECK FOR LEAKS AFTER ROAD TEST.

FOUND POWER STEERING PUMP TO BE CAVITATING. REMOVE LINE TO POWER STEERING PUMP. DRAIN FLUID AND REMOVE PUMP FROM ENGINE. CLEAN AND RESEAL GEAR HOUSING. SUPPLY AND FIT NEW PUMP AND REFIT COMPONENTRY. FILL WITH NEW FLUID AND BLEED STEERING SYSTEM. ROAD TEST VEHICLE.

5007261 SUB.CON	M/MULTIPURPOSE ATF 1L SUBLET CONTRACTING POWER STEERING PUMP	2.00 1.00	8.19 1,289.61	16.38 1,289.61
87904M	FILTER POWER STEERING	1.00	44.69	44.69
5007244 CON2	M/MULTIPURPOSE ATF 4L	1.00	48.66	48.66
EPA	CONSUMABLES	1.00	25.00	25.00
LFA	EPA LEVY	1.00	15.00	15.00

Goods cannot be returned for credit after 30 days. Full credit to 7 days then 10% handling charge to 30 days. Non-stock goods procured will not be accepted for return. Banking Details BSB: 012 468 Account: 8373 66178

Invoice Total	5,300.73
GST	481.89
Labour	3,379.50
Subtotal	1,439.34

paid Direct 13-11-23

Page 1 of 1

HI-TOROUF
Truck Spares (Aust) Pty Ltd

ACN: 003 168 545 As trustee for Hi-Torque Unit Trust ABN: 52 783 278 774

SPARES: 11 Toohev Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9725 1818

SERVICE: 8 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9756 5175 P.O. Box 6287, Wetherill Park NSW 2164

Invoice To:

HI-TECH HEAVY HAULAGE PTY LTD P O BOX 564

RIVERSTONE NSW 2765

TAX INVOICE		
	Invoice	708685
	Account	3780
	Date	06/07/23

Deliver To:

MR JOHN CHURCHILL

LOT 4

CNR WINDSOR RD & VICTORIA ST

RIVERSTONE NSW 2765

Service Order: S236135 PG

Customer Order No: AV-97-CF

Terms: 30 days

Reg No: AV-97-CF

Make: FREIGHTLINER

Model: ARGOSY

KLM/HR: 698,269

Fleet No:

Chassis No: 1FVMAWAV47L997979

Product

Description

Quantity

Price

Extended

HI TECH - RECTIFY AIR LEAK AT DRIVE AXLE

CHECK FOR AIR LEAK AT REAR OF VEHICLE. FOUND SERVICE BRAKE VALVE LEAKING OUT OF EXHAUST PORT.

REMOVE PLUG AND AIR LINES AT VALVE ASSEMBLY.

REMOVE FITTINGS AND VALVES FROM SERVICE BRAKE VALVE.

SUPPLY NEW SERVICE BRAKE VALVE AND TRANSFER FITTINGS AND VALVES TO NEW VALVE.

REFIT VALVE ASSEMBLY TO VEHICLE AND REFIT AIRLINES AND PLUG. RECHECK FOR LEAKS.

S9730119212R

CON2

VALVE RELAY CONSUMABLES

1.00

1.00

247.37

247.37 25.00

25.00

Goods cannot be returned for credit after 30 days. Full credit to 7 days then 10% handling charge to 30 days. Non-stock goods procured will not be accepted for return. Banking Details BSB: 012 468 Account: 8373 66178

Subtotal	272.37
Labour	217.50
GST	48.99
Invoice Total	538.86
	555.55

HI-TORQUE

Truck Spares (Aust) Pty Ltd

ACN: 003 168 545 As trustee for Hi-Torque Unit Trust ABN: 52 783 278 774

SPARES: 11 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9725 1818

SERVICE: 8 Toohey Road, Wetherill Park NSW 2164

Phone: 02 9756 3444 Fax: 02 9756 5175 P.O. Box 6287, Wetherill Park NSW 2164

Invoice To:

HI-TECH HEAVY HAULAGE PTY LTD P O BOX 564

RIVERSTONE NSW 2765

TAX INVOICE		
Invoice	705541	
Account	3780	
Date	08/02/23	

Deliver To:

MR JOHN CHURCHILL

OT 4

CNR WINDSOR RD & VICTORIA ST

RIVERSTONE NSW 2765

Service Order: S234708 PG

Customer Order No: AV-97-CF

Terms: 30 days

Reg No: AV-97-CF

Make: FREIGHTLINER

Model: ARGOSY

KLM/HR: 0

Fleet No:

Chassis No: 1FVMAWAV47L997979

Product

Description

Quantity

Price

Extended

HI TECH - REMOVE DRIVELINE AND REPAIR

INSPECT TO FIND CENTRE BEARING YOKE ON FRONT SHAFT SPINNING, CAUSING VEHICLE TO LOSE DRIVE. REMOVE ALL 3 TAILSHAFTS FROM VEHICLE AND INSPECT.

SHAFT NO.1 - SUPPLY AND FIT NEW UNIVERSAL JOINT, CENTRE BEARING, MIDSHIP STUB AND CENTRE BEARING YOKE. BALANCE SHAFT ON COMPLETION.

SHAFT NO.2 - SUPPLY AND FIT NEW UNIVERSAL JOINT, CENTRE BEARING, MIDSHIP STUB AND CENTRE BEARING YOKE. BALANCE SHAFT ON COMPLETION.

SHAFT NO.3 - SUPPLY AND FIT NEW SLIP YOKE, STUB AND 2 X UNIVERSAL JOINTS. BALANCE SHAFT ON COMPLETION. REMOVE AND REPLACE FRONT DIFF YOKE, SEAL AND NUT.

CHECK DIFF BREATHER AND OIL LEVEL.

REFIT ALL 3 X SHAFTS TO VEHICLE.

CARRY OUT CLUTCH ADJUSTMENT

CARRY OUT BRAKE ADJUSTMENT AND BRAKETEST VEHICLE.

NOTE - FRONT DIFF WILL HAVE TO BE REMOVED AND RESEALED TO RECTIFY OIL LEAK.

REAR DIFF HAS CRACKED DIF HOUSING. CUSTOMER TO MONITER

- INSPECT AND REPORT ON DIFF LEAK, POSSIBLE CRACKED DIFF HOUSING.

25RLS481A1S	SLIP YOKE RPL25	1.00	449.41	449.41
6.5.40.191	STUBSHAFT 1810	1.00	159.98	159.98
6.5.53.171	STUB SHAFT CENTRE BEARING 46 SPLINE	2.00	186.34	372.68
25WYSC38.11	CENTRE BEARING YOKE RPL25 SERIES	2.00	459.33	918.66
10094142	CENTRE BEARING ASSY 60MM SELF ALIGNING	2.00	202.80	405.60
230123.6	WASHER	2.00	11.75	23.50
1227Z936	NUT	2.00	18.76	37.52
CP25RPLS	UNIVERSAL JOINT RPL25	4.00	273.84	1,095.36
KIT2638	NUT & WASHER	1.00	50.22	50.22
A1205R2592	SEAL OIL	1.00	105.32	105.32
25WYS38.13A	END YOKE RPL25 46 SPLINE	1.00	503.70	503.70
DLCON	DRIVELINE COMSUMABLES	1.00	30.00	30.00

Goods cannot be returned for credit after 30 days. Full credit to 7 days then 10% handling charge to 30 days. Non-stock goods procured will not be accepted for return. Banking Details BSB: 012 468 Account: 8373 66178

Subtotal	4,151.95
Labour	2,728.25
GST	688.03
Invoice Total	7,568.23

AV94CF

CROWHURST AUTO ELECTRICAL PTY LTD

MVRL25661/ARC AU 12119

37 002 569 235 A.B.N.

A.C.N. 002 569 235

6 HIGHGATE ST

AUBURN

NSW 2144

Phone: 02 9748-0488

Fax: 02 9748-0949

Payment Terms : C.O.D.

Invoice Date

: 17/03/2023

HITE01

HI-TECH HEAVY HAULAGE P/L

P 0 BOX 564 RIVERSTONE

NSW

TAX INVOICE 283137

Job Description : REAR LIGHTS

2765

AV97CF

Make: FREIGHTLINER

Tran No: 531659

JobNo: 393026

Stock Code Description-Text

Qty UnitPrice Per Disc

Amount

Deliver To: 1a Atkins St Rydalmere

Contact

Phone

*JOB DESCRIPTION

REMOVE REAR LIGHTS. FIT AND WIRE UP NEW REAR LIGHTS (SUPPLIED). CHECK OPERATION.

> Total Labour [C] SUNDRIES

1.00

22.00

168.75

22.00

BANK: ANZ

BSB: 012 432 ACCOUNT NO. 231 616 494

Total Excluding GST

190.75

Total GST

19.08

Payable To CROWHURST AUTO ELECTRICAL PTY LTD

INVOICE TOTAL

\$209.83

ServiceMaster ®

paid 6-4-23 with other

PAGE -

CROWHURST AUTO ELECTRICAL PTY LTD

MVRL25661/ARC AU 12119 ,

37 002 569 235 002 569 235 A.B.N. A.C.N.

5 HIGHGATE ST AUBURN

2144 NSW

Phone: 02 9748-0488

Fax : 02 9748-0949

TAX INVOICE 283235

Invoice Date

6/04/2023

Job Description : SLUGGISH STARTING

Payment Terms . C.O.D.

HITE01

HI-TECH HEAVY HAULAGE P/L

P 0 BOX 564 RIVERSTONE

NSW

2765

AV97CF

Make: FREIGHTLINER

Jabko 393111

Stock Code

Description-Text

Tran No. 532038

Oty UnitPrice Per Disc Amount

Deliver To : 1a Atkins St Rydalmere

Contact Phone

*JOB DESCRIPTION.

CHECK FOR CAUSE OF VEHICLE SLUGGISH STARTING CHECK BATTERIES AND CABLES. CHECK STARTER MOTOR AND WIRING. LOCATE AND REMOVE FAULTY STARTER MOTOR. SUPPLY AND FIT NEW STARTER MOTOR. RECHECK STARTING

> Total Labour (C) 405.00 STARTER 1.00 750.00 750 00 SUNDRIES 1.00 16.00 16 00

BANK: ANZ

BSB: 012 432 ACCOUNT NO. 231 616 494

Total Excluding GST

1.171.00

Total GST

117.10

Pavable To CROWHURST AUTO ELECTRICAL PTY LTD

INVOICE TOTAL

11.288.10

ServiceMaster #

PAGE · 1

paid 20- 4-23

AVGYCF

CROWHURST AUTO ELECTRICAL PTY LTD

MVRL25661/ARC AU 12119

A.B.N. 37 002 569 235 A.C.N.

002 569 235

6 HIGHGATE ST

AUBURN NSW 2144

Phone: 02 9748-0488

Fax: 02 9748-0949

TAX INVOICE 283595 Invoice Date : 14/06/2023

Job Description: LIGHTS

Payment Terms :

HITE01

HI-TECH HEAVY HAULAGE P/L

P 0 BOX 564 RIVERSTONE

NSW

2765

AV97CF

Make: FREIGHTLINER FREIGHTLINER

Tran No: 533138

JobNo: 393450

Stock Code Description-Text

Qty UnitPrice Per Disc Amount

*JOB DESCRIPTION

SERVICE CALL TO DEPOT. CHECK LIGHTS FOR CAUSE OF NOT WORKING. CHECK FUSES AND CIRCUIT BREAKERS. FOUND FAULTY CIRCUIT BREAKER AND REMOVE. REPLACE WITH FUSE. CHECK OPERATION.

Total Labour [C]

101.25

BANK: ANZ

BSB: 012 432 ACCOUNT NO. 231 616 494

Total Excluding GST

101.25

Total GST

10.13

Payable To CROWHURST AUTO ELECTRICAL PTY LTD

INVOICE TOTAL

8111.38

CROWHURST AUTO ELECTRICAL PTY LTD

MVRL25661/ARC AU 12119

A.B.N. 37 002 569 235

A.C.N. 002 569 235

6 HIGHGATE ST

AUBURN NSW 2144

Phone: 02 9748-0488

Fax : 02 9748-0949

TAX INVOICE 285439

Invoice Date : 19/06/2024

Job Description : GAUGES AND AERIAL

Payment Terms : C.O.D.

HITE01

HI-TECH HEAVY HAULAGE P/L

P 0 BOX 564

RIVERSTONE

NSW

2765

AV97CF

Make: FREIGHTLINER FREIGHTLINER

Tran No: 539576

JobNo: 395403

Stock Code Description-Text

Qtv

UnitPrice Per

Disc Amount

Deliver To : 1a Atkins St Rydalmere

Contact Phone

*JOB DESCRIPTION

SERVICE CALL TO DEPOT. CHECK FOR CAUSE OF GAUGES NOT OPERATING. REMOVE PANEL. CHECK GAUGES AND WIRING. LOCATE PLUG NOT IN A GAUGE CORRECTLY. CONNECT GAUGE CORRECTLY. CHECK OPERATION. REFIT PANEL. REMOVE DAMAGED AERIAL. SUPPLY AND FIT A NEW AERIAL. CHECK OPERATION.

Total Labour [C]

187.50

BANK: ANZ

BSB: 012 432 ACCOUNT NO. 231 616 494

Total Excluding GST

187.50

Total GST

18.75

Payable To CROWHURST AUTO ELECTRICAL PTY LTD

INVOICE TOTAL

\$ 206.25

ServiceMaster @

PAGE -

paid 5-7.24