

J20-16
(LEAD)

4/11/22, 10:12 AM

Pressure Tests » eStandard Solutions

Pressure Tests - 5HTDL4035E5G26839 - 2022-04-11

Authoring Information

Created By Shane Arps
17808753459

Facility Fusion Tank Services
780-875-3459
6007 52nd ave
Lloydminster, AB
T9V 2S7

Created 2022-04-11 10:10:28
Updated 2022-04-11 10:10:28

Client

Company Torq Trucking 2015 Ltd.
1810-250 6Ave SW
Calgary, AB
T2P3H7

Contact Torq Trucking Ltd.
7808759693

Tank Data

Ser. No. 5HTDL4035E5G26839

Unit Number LARSON 310009 (LEAD)

TC Spec. DOT 407

Service Type Vacuum Load

Date of mfr. 2013-08

Cert. date 2013-08

VIN 5HTDL4035E5G26839

Tank mfr. Heil

Assembler Heil

TCRN or CRN N/A

MDIN N/A

CTMV Orig. Test Date 2013-08

CTMV Cert Date 2013-08

MAWP 35 psi

Test P. 52.5 psi

Mfd. head thick .375 in

Min. head thick .325 in

Mfd. shell thick .250 in

Min. shell thick .216 in

Exposed Surface 697 ft2

Cap. 8635 gallons

Lining Sherglass FF

Original Test Date 2013-08

Pressure Test

Inspection Date 2022-04-11

4/11/22, 10:12 AM

Pressure Tests » eStandard Solutions

Inspection Expiry 2027-04-11
Date

Test Medium Air

No. of 1

Compartments

Compartment 1	Start (psi)	End (psi)	Hold Time
	52.5	52.5	60

Test Results When venting devices are removed, they are bench tested and meet the requirements for the tank
Pass

Product piping with all valves and accessories in place and operative must be pressure tested at not less than 80% MAWP

Pass

When removed from the pressure supply, the test pressure is retained for the specified time for the pneumatic or hydrostatic test

Pass

Inspect the entire area of the head, shell and welds for leaks or deformation. If defects found note the location on the report

Pass

Defects No defects found.


PRV List

Type of PRV	Manufacturer	PRV Criteria	Discharge Pressure	Opening Pressure	Reseating Pressure	Disposition
# 1						
PRESSURE/VACCUM	GIRARD	psi	484718 SCFH @ 52.5 psi	42 psi 10 HG	42 psi 10 HG	Reinstalled


Tank Disposition

Current Disposition Passed / No Defects Found

Approval

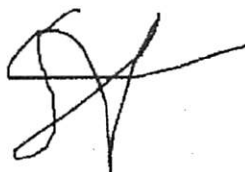

Inspector
Shane Arps

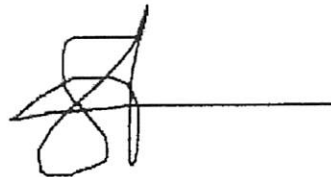

Tester
Shane Arps

Service provided by eStandard Solutions.



Upper Coupler Inspections - 5HTDL4035E5G26839 - 2022-04-11

Authoring Information

Created By Shane Arps
17808753459

Facility Fusion Tank Services
780-875-3459
6007 52nd ave
Lloydminster, AB
T9V 2S7

Created 2022-04-11 10:11:29

Updated 2022-04-11 10:11:29

Client

Company Torq Trucking 2015 Ltd.
1810-250 6Ave SW
Calgary, AB
T2P3H7

Contact Torq Trucking Ltd.
7808759693

Tank Data

Ser. No. 5HTDL4035E5G26839

Unit Number LARSON 310009 (LEAD)

TC Spec. DOT 407

Service Type Vacuum Load

Date of mfr. 2013-08

Cert. date 2013-08

VIN 5HTDL4035E5G26839

Tank mfr. Heil

Assembler Heil

TCRN or CRN N/A

MDIN N/A

CTMV Orig. Test Date 2013-08

CTMV Cert Date 2013-08

MAWP 35 psi

Test P. 52.5 psi

Mfd. head thick .375 in

Min. head thick .325 in

Mfd. shell thick .250 in

Min. shell thick .216 in

Exposed Surface 697 ft2

Cap. 8635 gallons

Lining Sherglass FF

Original Test Date 2013-08

Upper Coupler Inspection

Inspection Date 2022-04-11

4/11/22, 10:13 AM

Upper Coupler Inspections » eStandard Solutions

Inspection Expiry Date 2027-04-11

Inspection
Corroded or abraded areas
Pass
Cracks or defects in welds
Pass
Dents or distortions
Pass

Defects No defects found.



PRV List

Type of PRV	Manufacturer	PRV Criteria	Discharge Pressure	Opening Pressure	Reseating Pressure	Disposition
# 1						

Tank Disposition

Current Disposition Passed / No Defects Found

Approval

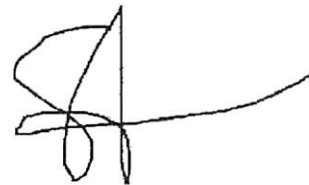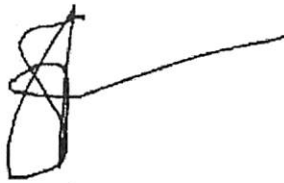

Inspector
Shane Arps

Tester
Shane Arps

Service provided by eStandard Solutions.

J20-17
(PuP)

4/21/22, 7:13 AM

Pressure Tests » eStandard Solutions



Pressure Tests - 5HTDL2920E5F26842 - 2022-04-21

Authoring Information

Created By Shane Arps
17808753459

Facility Fusion Tank Services
780-875-3459
6007 52nd ave
Lloydminster, AB
T9V 2S7

Created 2022-04-21 07:10:55

Updated 2022-04-21 07:10:55

Client

Company Torq Trucking 2015 Ltd.
1810-250 6Ave SW
Calgary, AB
T2P3H7

Contact Torq Trucking Ltd.
7808759693

Tank Data

Ser. No. 5HTDL2920E5F26842

Unit Number Larson 310010

TC Spec. DOT 407

Date of mfr. 2013-08

Cert. date 2013-08

VIN 5HTDL2920E5F26842

Tank mfr. Heil

MAWP 35 psi

Test P. 52.5 psi

Mfd. head thick .375 in

Min. head thick .309 in

Mfd. shell thick .250 in

Min. shell thick .220 in

Exposed Surface 622 ft2

Cap. 7270 gallons

Lining Sherglass FF

Original Test Date 2013-08

Pressure Test

Inspection Date 2022-04-21

Inspection Expiry Date 2027-04-21

Test Medium Air

No. of 1

Compartments

Compartment 1	Start (psi)	End (psi)	Hold Time
	52.5	52.5	60

4/21/22, 7:13 AM

Pressure Tests » eStandard Solutions

Test Results

When venting devices are removed, they are bench tested and meet the requirements for the tank

Pass

Product piping with all valves and accessories in place and operative must be pressure tested at not less than 80% MAWP

Pass

When removed from the pressure supply, the test pressure is retained for the specified time for the pneumatic or hydrostatic test

Pass

Inspect the entire area of the head, shell and welds for leaks or deformation. If defects found note the location on the report

Pass

Defects

No defects found.


PRV List

Type of PRV	Manufacturer	PRV Criteria	Discharge Pressure	Opening Pressure	Reseating Pressure	Disposition
# 1						
PRESSURE/VACCUM	GIRARD	psi	484718 SCFH @ 52.5 psi	42 psi 10 HG	42 psi 10 HG	Reinstalled


Tank Disposition

Current Disposition Passed / No Defects Found

Approval

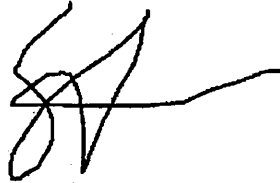

Inspector
Shane Arps

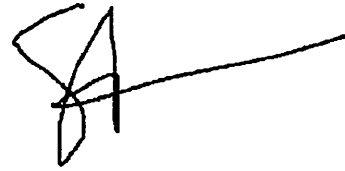

Tester
Shane Arps

Service provided by eStandard Solutions.



Upper Coupler Inspections - 5HTDL2920E5F26842 - 2022-04-21

Authoring Information

Created By Shane Arps
17808753459

Facility **Fusion Tank Services**
780-875-3459
6007 52nd ave
Lloydminster, AB
T9V 2S7

Created 2022-04-21 07:12:35

Updated 2022-04-21 07:12:35

Client

Company **Torq Trucking 2015 Ltd.**
1810-250 6Ave SW
Calgary, AB
T2P3H7

Contact Torq Trucking Ltd.
7808759693

Tank Data

Ser. No. 5HTDL2920E5F26842

Unit Number Larson 310010

TC Spec. DOT 407

Date of mfr. 2013-08

Cert. date 2013-08

VIN 5HTDL2920E5F26842

Tank mfr. Heil

MAWP 35 psi

Test P. 52.5 psi

Mfd. head thick .375 in

Min. head thick .309 in

Mfd. shell thick .250 in

Min. shell thick .220 in

Exposed Surface 622 ft2

Cap. 7270 gallons

Lining Sherglass FF

Original Test Date 2013-08

Upper Coupler Inspection

Inspection Date 2022-04-21

Inspection Expiry 2027-04-21

Date

4/21/22, 7:14 AM

Upper Coupler Inspections » eStandard Solutions

Inspection

Corroded or abraded areas

Pass

Cracks or defects in welds

Pass

Dents or distortions

Pass

Defects

Welds-Structure

-new plate

PRV List

Type of PRV	Manufacturer	PRV Criteria	Discharge Pressure	Opening Pressure	Reseating Pressure	Disposition
# 1						

Tank Disposition

Current Disposition Passed / No Defects Found

Approval



Inspector

Shane Arps

Tester

Shane Arps

Service provided by eStandard Solutions.