



Swamp Donkey Oilfield Services Inc.  
#41 Collins Rd,  
Dawson Creek, British Columbia  
V1G 4H4  
(250) 219-8370

## Work Order Form

### Information

☐ Heavy Truck > 148

☐ Shop

☐ Monday, January 13th 2025, 9:10 PM (MST -07:00)

### Unit Information

Date

☐ January 10, 2025

Unit

☒ Heavy Truck ▶ 148

Kms

= 451961

Hours

= 12708

Cry Sheet Form #

= Na

### Repairs to Complete

List here:

☐ Paul West Brown suspension bushings were shot. Power divider was not working.

### Work Completed

Service

☒ No Response

### Repairs Completed

☒ No Response

Description of Additional Repairs

☐ Replaced you joints both got new hardware Change differential centre axle replace both wheel seal centre axle replace spring brake valve fix air leaks on air dryer and underneath cab replace all three torque arm bushings, also known as wishbones with new hardware, replace two wings and rear most crossmember. Also all new hardware weld and repair cross members 45 and six number two differential wild tabs on top that were cracked replaced brake shoes and brake drums put wheels back on and torque to 500 foot pounds place to re-torque tag in the cab adjusted all brakes. Let it sit overnight and recheck the fluid level.

Description of Parts Installed

☐ Three wishbones  
One differential  
Middle axle set of brakes, pads, and drums  
Spring break valve

Quarter Inch brush push poles  
Centre actual driveshaft both used joints SPL 170

Repair Hours:

# 21

**Mechanics**




Repairs Completed by:

 Seth Lindberg, Joseph Fearon

Date Completed:


 January 13, 2025


**Additional Photos**

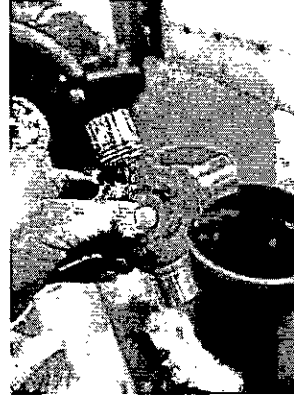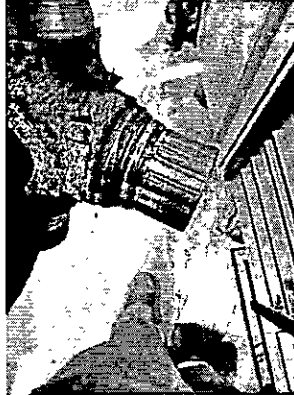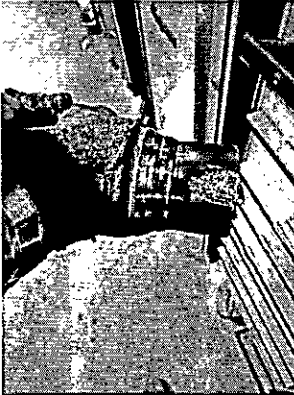

**Signatures**

**Seth Lindberg, Mechanic**

 January 13th 2025, 9:10 PM (MST -07:00)

 55.7491152, -120.1921857

SL





Swamp Donkey Oilfield Services Inc.  
#41 Collins Rd,  
Dawson Creek, British Columbia  
V1G 4H4  
(250) 219-8370

## Work Order Form

### Information

 148

 Shop

 Saturday, May 18th 2024, 3:55 PM (MST -07:00)

### Unit Information

Date

 May 9, 2024

Unit

 148

Kms


= 405987

Hours

= 11406

### Repairs to Complete

List here:

-  replace trans
- replace clutch
- resurface flywheel
- reseal and bearing pto set back lash to .009
- replace trans cooler

### Work Completed

#### Mechanics

Repairs Completed by:


 Mike Bishop

Date Completed:

 May 9, 2024

### Signatures

Mike Bishop, *Mechanic*

 May 18th 2024, 3:55 PM (MST -07:00)







Swamp Donkey Oilfield Services Inc.  
#41 Collins Rd,  
Dawson Creek, British Columbia  
V1G 4H4  
(250) 219-8370

## Work Order Form

### Information

 148

 Shop

 Sunday, April 16th 2023, 10:38 AM (MST -07:00)

### Unit Information

Date

 April 16, 2023

Unit

 148

Kms

= 357,659

Hours

= 9,994

### Work Completed


Service

 No Response


Repairs Completed

 replace rad

Description of Additional Repairs

-  Rad has pin hole on left side near top. Remove hood and disassemble front end, AC condenser, Air to Air, remove old rad. Cut most Air to Air clamps as T bolts were sized. Installed new rad (TRP rad) from Inland KW. Reassembled unit. AC had no charge, will further inspect and diagnose.

Description of Parts Installed

-  new Air to Air clamps X4
- new Rad
- shop supplies
- See Inland Kw invoice #148

### Mechanics

Repairs Completed by

 Brandon Bolivar

## Signatures

**Brandon Bolivar**, *Mechanic*



April 16th 2023, 10:38 AM (MST -07:00)

B. B.