



BLACK GOLD VACUUM SERVICES

BOX 230, RED EARTH CREEK, AB T0G 1X0
CENTRAL DISPATCH: 780-649-3448 FAX: 780-649-3694
EMERGENCY CONTACTS: 780-649-3448



2510-15

WORK ORDER 4318

UNIT # 723

Date	July 6 2023	Hours	6735	Licence No.	U-91475
Kilometers	893117	CVIP		Make	Kennecott
Serial #	INDEX HEX R998043				
				Model	78000

REPAIRS PERFORMED

REPAIRS PERFORMED	HRS	QTY	PART NUMBER
Replace fuel pre-filter.		1	WFF2203- Fuel Filter.
Root connection in both beacons Take apart and clean contacts. solder lights & test.		2	Beacon light bulbs.
hook up scan tool. trouble-shoot codes. Test coolant circuit found issues with harness. clean contacts. needs new harness from ECM to sensor. works internally		4	12v batteries
Code 434. ECM loses power when starting. load test batteries. Replace all 4 batteries. Clean connections. Add make new positive wire. replace 2 ring terminals. Clear code and test. clean and fix connections on 12v adaptors in car.		3	Re-logix Battery Mountainer
Grease truck.		1	VER022626 - car to car boot clamp
Tie up main harness			ATM3611540080 - car to car boot
Top up lub oil.			
found hole in air to car boot - replace with spare.			
-change air to air test			
-grease truck & inspect			
-found car air bags leaking (Rats on order.)			

TOTAL HOURS

Performed by _____

Approved by _____



BLACK GOLD VACUUM SERVICES

BOX 230, RED EARTH CREEK, AB T0G 1X0
CENTRAL DISPATCH: 780-649-3448 FAX: 780-649-3694
EMERGENCY CONTACTS: 780-649-3448



WORK ORDER 4304

UNIT # 723

Date	Hours	Licence No.
May 23 2023		V-91475
Kilometers	CVIP	Make
		Wendurth
Serial #	998043	
	Model	T900B

REPAIRS PERFORMED

CVIP Inspection.

Install 14 new lower Cab marker lights.

Replace R-12 Relay valve.

Replace quick release valve #3 axle

Replace hi Spool wheel seal

Replace #2 LH air bag.

Replace 1 vacuum bulb

Replace tank drain 3/8"

Replace serpentine Belt

HRS

QTY

MATERIALS AND PARTS

PART NUMBER

14 212123415 amber marker lights

1 mirror light WED

1 Quick release air valve 1030101

1 382-8864 wheel seal

1 Air spring #2 LH.

1 vacuum light ~~to~~ bulb

1 3/8" drain code.

1 Dodge 55466410 serpentine Belt

TOTAL HOURS

Performed by _____

Approved by _____



UNIT # 723 Winch Tractor	
Date	Aug 31 2021
Kilometers	889699
Serial #	
Hours	6438.6
CVIP	07/22
Licence No.	U91475
Make	Kennworth
Model	N900

[illegible]


Performed by Teris Kennedy

TOTAL HOURS



BLACK GOLD VACUUM SERVICES

BOX 230, RED EARTH CREEK, AB T0G 1X0
CENTRAL DISPATCH: 780-649-3448 FAX: 780-649-3694
EMERGENCY CONTACTS: 780-649-3448

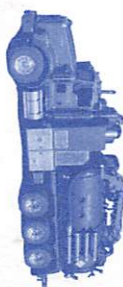

WORK ORDER 3028

UNIT # 723

Date	Aug 20/21	Hours	64.92	Licence No	0-91475
Kilometers	887463	CVIP	01/22	Make	KW
Serial #	998043			Model	1-800

REPAIRS PERFORMED

- Replace firt shocks,
- Axle #1 Seal Replacement
And Scan bushings replacement
- Install two new tires
- Needs firt wheel seals
 - Remove inspect firt brakes
 - oil sealed bushings empty bearings OK
 - install brakes scan bushings
 - seals, set brakes
 - torque wheel studs to 500ft/lbs
- Install new exhaust bracket RH
- Air bag and tanks loose air as
person as truck is shift off no
air leak can be heard, trucks needs
wash underneath to soap test
- suspected air big leak

HRS

QTY

PART NUMBER

MATERIALS AND PARTS

- 2 Road Choice firt
shocks PA-
RC-S45070
- 2 Linglong 385/65R225
firt tires
- 2 Valve stems
- 2 #8064 stemco wheel
seals
- 2 6"x16.5" brake shoe
sets
- 2 Bendix #314146N
brake hardware kits
- 2 Scan bushing kits
- 2 hub resurface gaskets
- 1 562-V591005R
top exhaust stack 5"
mounting bracket

TOTAL HOURS

Performed by

Paul Cake


Approved by

Tech Lic # 0169444NQ



BLACK GOLD VACUUM SERVICES

BOX 230, RED EARTH CREEK, AB T0G 1X0
CENTRAL DISPATCH: 780-649-3448 FAX: 780-649-3694
EMERGENCY CONTACTS: 780-649-3448

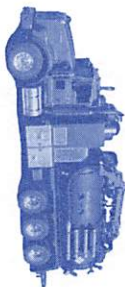

WORK ORDER **2582**

UNIT # 723

Date	Oct 22 / 2019.	Hours	5703 hrs.	Licence No.	BKH-P218
Kilometers	54537 Km.	CVP	7 / 2020	Make	Kenworth.
Serial #	998043			Model	T-800.

REPAIRS PERFORMED

REPAIRS PERFORMED	HRS	QTY	MATERIALS AND PARTS
- grease unit SP.	2		PART NUMBER
- drain oil SP.	1	1	Donaldson P559000 Filter (oil)
- Fill oil system instal		40L	15-40 Oil
- Tighten crossover fuel line fitting SP		1	Redwin JF7766 Fitor (Fuel)
- check oil level in all differential (all good.) SP		2	2 1/2" AMBER CLEARANCE LIGHTS
- change out broken master tire Driverside deck. SP	2		2 1/2" RUBBERS
- fix broken wire in master junction box under deck. CK.			LED AMBER OVAL SLEEPER LIGHTS.
- adjust air in all tires 100 PSI.			
- top up front drive and wheel bearing dumps ceps.			

TOTAL HOURS


Performed by Shane Passavage & Collin.

Approved by



BLACK GOLD VACUUM SERVICES

BOX 230, RED EARTH CREEK, AB T0G 1X0
CENTRAL DISPATCH: 780-649-3448 FAX: 780-649-3694
EMERGENCY CONTACTS: 780-649-3448

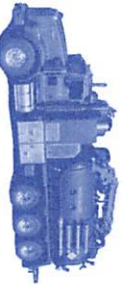

WORK ORDER 2653

UNIT # 723 TRIDRIVE WINCH TRACTOR

Date	July 15/19	Hours		Licence No.	BXH 8218
Kilometers	854439	CVIP		Make	KENWORTH
Serial #	998043			Model	T800H

REPAIRS PERFORMED

CVIP INSPECTION

WHEELS OFF INSPECTION

INSTALL NEW LED LOW BEAM/HIGH BEAM HEADLAMPS
REPLACE 2 OVAL LED TAILLIGHTS - MISSING SOME DIODES
REPAIR SMALL FUEL LEAK ON FUEL TANK CROSSOVER


TOTAL HOURS

Performed by PAUL
Approved by



BLACK GOLD VACUUM SERVICES

BOX 230, RED EARTH CREEK, AB T0G 1X0
CENTRAL DISPATCH: 780-649-3448 FAX: 780-649-3694
EMERGENCY CONTACTS: 780-649-3448

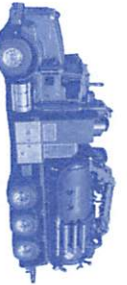

WORK ORDER 2398

UNIT # 723

Date	Feb 9 2019	Hours		Licence No.	
Kilometers		CVIP		Make	FW
Serial #				Model	T-800

REPAIRS PERFORMED

- Replace LH window motor
- Replace license plate light housing
- Possible cause of short circuit in tail light circuit
- All lights functioning as normal

HRS	QTY	MATERIALS AND PARTS
		PART NUMBER

TOTAL HOURS

Performed by Paul Cate

Approved by

Oct. 19. 2018 7:12AM

No. 4827 P. 1

HEAVY EQUIPMENT REPAIR LTD.

INVOICE
100-123658

Box 2343, 404 Balsam Road N.E.
 Slave Lake, Alberta T0G 2A0
 Phone (780) 849-3768 FAX (780) 849-4453
 www.heavyequipmentrepair.ca

BILL TO 000347 DDD		SHIP TO 000347 DDD		PG 1 OF 1 *WORK ORDER*	
BLACK GOLD ANCHORS LTD. P.O. BOX 230 RED EARTH, AB T0G 1X0		BLACK GOLD ANCHORS LTD. P.O. BOX 230 RED EARTH, AB T0G 1X0		(780) 649-3450	
HEAVY EQUIPMENT REPAIR LTD.				GST Number 12155-3671 RT	REFERENCE NUMBER 100-123658
MTH. DAY YR.	WRITER	ORDER NO.	CUSTOMER P.O. NUMBER	TERMS	SHIP VIA
10/12/18	JLL	10/09/18 123658	UNIT 105-723	NET 30	SHOP
QUANTITY ORDERED	QUANTITY SHIPPED	BACK ORDERED	PART NUMBER AND DESCRIPTION	CODE	PRICE (LIST & SELL)
IN SERVICE: ENGINE YEAR MAKE MODEL ODO IN ODO OUT UNIT # COLOR VIN: 1NKDX4EXX7R998043 2006 KENWORTH T800 844879 844879 105 BLACK 61500KG					
REQUEST 1: CHECK AND REPAIR DRIVE LINE ACTION 1: PUSH UNIT INTO SHOP DRAINED AUXILIARY TRANSMISSION. REMOVED DRIVELINES, REMOVED TRANSMISSION. DISASSEMBLED TRANSMISSION, CLEANED AND INSPECTED PARTS. REPLACED OUTPUT SHAFT, BEARINGS, SEAL, YOKE, SPEED SENSOR. REASSEMBLED AND INSTALLED TRANSMISSION, FILLED WITH OIL. INSTALLED AND GREASED DRIVELINES. ROAD TESTED, CHECKED FOR LEAKS, OK. [CUSTOMER SUPPLIED PARTS]					
1	1		FRE SAA85920008	MAGNETIC SPEED SENSOR WITH PIGTAIL/WEATHERPACK	TG 67.060 67.06
2	2		FAS NN8SF050	1/2 GR8 NF NYLON LK NUT	TG .371 .74
1	1		RRR DW316BK3	3" PC 3/16 DUAL WALL TUBIN	TG .930 .93
1	1	BYO	FUL K1479	GASKET KIT	TG 31.660 31.66
1	1	BYO	FUL 17415	GASKET	TG 4.580 4.58
1	1	BYO	FUL K1552	ORING	TG 56.910 56.91
1	1		FUL 4300186	RANGE SECTION GASKET	TG .880 .88
1	1		FAS CS8SC056175	9/16 X 1-3/4 GR8 PL NC BLM	TG .952 .95
1	1		FAS CS8SC056200	9/16 X 2 GR8 PL NC BOLT	TG 1.015 1.02
2	2		FAS NN8SF050	1/2 GR8 NF NYLON LK NUT	TG .371 .74
6	6		SHL SYN50BULK	SPIRAX GSX50 SYN BULK	TG 19.340 116.04
6	6		*** EHC205	QT./LITRE CONTAINER E.H.C.	TG .050 .30
16.20	16.20		LAB TRUCKSHOP	LABOUR CHARGE	TG 141.000 2284.20
				SHOP SUPPLIES	50.00
PARTS: 281.81		LABOR: 2284.20		SUBLETS: 0.00	SUPPLIES: 50.00
				GOODS & SERVICES TAX (CODE G)	\$130.80
***** THERE IS ABSOLUTELY NO RETURNS ON ELECTRONIC PARTS THANK YOU! *****					
Warranties - all returns and exchanges for warranty are subject to manufacturer inspection and decision.			GOODS RECEIVED BY		SUB-TOTAL TAX 2616.01
					130.80
Terms are net 30 days upon receipt of invoice. Past due interest charged at 2% per month (24% per annum) on all overdue accounts. Positively no goods accepted for credit without prior authorization and invoice number. A minimum of 10% handling charge on goods returned when supplied as ordered. Cores or Merchandise are not returnable after 90 days.				TIME PREPARED	TOTAL 2746.81
				11:56	

ERRORS AND OMISSIONS EXCEPTED

*** DUPLICATE ***