HT278

	A1	Equipment	Issued On	Work Order	Used	Unit Cost
Part #	Name	• •	01/08/2024	WOIK Older	1	\$1,563.36
SPC7V001	JOST 5TH WHEEL PLATE	HT278				\$243.76
SK7501401	KIT BUSHING JOST	HT278	01/08/2024		1	·
SK290594	BUSHING JOST	HT278	01/08/2024		2	\$62.65
870118	BLOWER COIL	HT278	02/06/2025	3582	1	\$224.80
SR2000015	VALVE - EXPANSION	HT278	02/06/2025	3582	1	\$118.35
UB11100	GASKET HVAC	HT278	02/06/2025	3582	1	\$12.03
SR2000075	KIT GASKET SET	HT278	02/06/2025	3582	1	\$35.97
UB12750	GASKET	HT278	02/06/2025	3582	1	\$15.64
UB13800	GASKET	HT278	02/06/2025	3582	1	\$5.05
UB11200	GASKET	HT278	02/06/2025	3582	1	\$5.05
UB12350	GASKET	HT278	02/06/2025	3582	1	\$6.74
VG11000	KIT GASKET	HT278	02/06/2025	3582	1	\$26.46
SR2000029	COVER HEATER A/C	HT278	02/06/2025	3582	1	\$193.33
SR2000023	COIL ASSY	HT278	02/07/2025	3582	1	\$759.33
890088	CASE ASSY HVAC	HT278	02/07/2025	3582	1	\$535.54
	COIL ASSY	HT278	02/07/2025		1	\$519.90
SR2000019		HT278	02/07/2025	3582	1	\$684.19
K1801418538	PIPE AIR INTAKE		02/07/2025		1	\$211.23
K077223	CLAMP AIR INTAKE	HT278			1	\$54.35
X002278	RESTRICTION GAUGE	HT278	02/07/2025			\$13.83
P100089	FITTING	HT278	02/07/2025		1	•
UE10750	VALVE BRACKET	HT278	02/27/2025		1	\$41.13
F531001	DECAL A/C DYE	HT278	02/27/2025	3582	1	\$17.19
3304804	T-HANDLE LATCH	HT278	09/30/2025		2	\$38.15
972704	HINGE SS	HT278	09/30/2025		1	\$80.04



Serial

Tag


Closed Meters

1XKDD40X2DJ961701

J58437

Туре	Created	Scheduled	Due	Started	Closed
Repair	Apr 18, 2025	Apr 18, 2025		Apr 18, 2025 12:30 PM	Apr 18, 2025 12:30 PM

Line	Task	Parts	Labor	Total
1	✓ Coolant leak	\$0.00	\$120.00	\$120.00
	<u>Notes</u>			
	Replace blown coolant hose for EGR delete top off coolant on 881			
	Technician	Hours	Rate	Cost
		2.0	\$60.00	\$120.00
	Jordan Podloski	2.0	4-2	\$0.00
		Part Cost Labor		
		Tax 1 (0.0)%)	\$0.00
		Tax 2 (0.0%) Credit		
		Total Cost	t	\$120.00

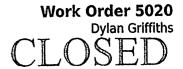

Serial

Tag


Closed Meters

1XKDD40X2DJ961701

J58437

Туре	Created	Scheduled	Due	Started	Closed
	Apr 12, 2025	Apr 12, 2025		Apr 25, 2025 3:21 PM	Apr 25, 2025 3:21 PM

Line	Task ✓ Repairs	Parts \$0.00	Labor \$600.00	Total \$600.00
	Inspection Found -new oil pan gasket leaking.(found braket pinched between oil pan gasket and block) -passenger side #q drive axle brake pot falling off) -found blower motor spinning backwards so it's sucking from cab			
not blowing. Technician Dylan Griffiths		Hours 10.0 Part Cost Labor Tax 1 (0.0 Tax 2 (0.0 Credit Total Cos	0%) 0%)	Cost \$600.00 \$0.00 \$600.00 \$0.00 \$0.00 (\$0.00)

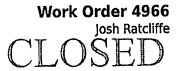

Serial

Tag

Closed Meters

1XKDD40X2DJ961701

J58437

Type Created Scheduled		Due	Started	Closed	
	Apr 10, 2025	Apr 14, 2025		Apr 14, 2025 10:41 AM	Apr 14, 2025 10:41 AM

Line	Task	Parts	Labor	Total
1	✓ Install gps	\$0.00	\$90.00	\$90.00
	<u>Notes</u>			
	Installed gps Technician	Hours	Rate	Cost
	Josh Ratcliffe	1.5	\$60.00	\$90.00
		Part Cost Labor Tax 1 (0.0% Tax 2 (0.0% Credit Total Cost		\$0.00 \$90.00 \$0.00 \$0.00 (\$0.00)

Work Order 4967 Moe Taha

Serial

Tag

Closed Meters

1XKDD40X2DJ961701

J58437

0 km & 0 hr

Туре	Created	Scheduled	Due	Started	Closed
туре	Apr 10, 2025	Apr 10, 2025		Apr 10, 2025 7:17 PM	Apr 10, 2025 7:17 PM

Line	Task	Parts	Labor	Total
1	✓ D	\$0.00	\$420.00	\$420.00
_	Technician	Hours	Rate	Cost
	Moe Taha	7.0	\$60.00	\$420.00
		Part Cost		\$0.00
		Labor		\$420.00
		Tax 1 (0.09	%)	\$0.00
		Tax 2 (0.09	%)	\$0.00
		Credit		(\$0.00)
		Total Cost		\$420.00

Notes

Notes

User

Time

Changed power divider orings Removed all pulleys Taped new threads due to sized bolts Installed new pulleys Removed alternator

Installed new alternator

Moe Taha

Apr 10, 2025 7:17 PM

Work Order 4917 Liam Wheeler CLOSED

Serial

Tag

Total Cost

Closed Meters

1XKDD40X2DJ961701

J58437

0 km & 0 hr

Туре	Created	Scheduled	Due	Started	Closed
	Apr 6, 2025	Apr 6, 2025		Apr 6, 2025 8:51 AM	Apr 6, 2025 8:51 AM

Labor Total **Parts** Line Task \$240.00 \$0.00 \$240.00 ✓ PTO 1 **Notes** Packed up all my tools Fueled up truck drove to CNRL Kirby North Waited for escort Drove to unit Diagnosed PTO issues and fixed air line and fitting Secured RH front fender as it is cracked and falling apart Cost Hours Rate Technician \$60.00 \$240.00 4.0 Liam Wheeler \$0.00 Part Cost \$240.00 Labor \$0.00 Tax 1 (0.0%) \$0.00 Tax 2 (0.0%) (\$0.00)Credit

\$240.00

Work Order 4841

HT278 - 2013 KENWORTH Kenworth 800 TA Winch Tractor (black)

CLOSED Moe Taha

Serial

Tag

Closed Meters

1XKDD40X2DJ961701

J58437

Туре	Scheduled	Due	Started	Closed
	Mar 29, 2025		Mar 29, 2025 9:22 PM	Mar 29, 2025 9:22 PM

Line	Task	Parts	Labor	Total
1	✓ D	\$0.00	\$720.00	\$720.00
_	Technician	Hours	Rate	Cost
	Moe Taha	12.0	\$60.00	\$720.00
		Part Cost		\$0.00
		Labor		\$720.00
		Tax 1 (0.0%	5)	\$0.00
		Tax 2 (0.0%	6)	\$0.00
		Credit		(\$0.00)
		Total Cost		\$720.00

Work Order 4837 Moe Taha

HT278 - 2013 KENWORTH Kenworth 800 TA Winch Tractor (black)

Serial

Tag

Closed Meters

1XKDD40X2DJ961701

J58437

0 km & 0 hr

Туре	Created	Scheduled	Due	Started	Closed
	Mar 28, 2025	Mar 28, 2025		Mar 28, 2025 6:08 PM	Mar 28, 2025 6:08 PM

Line	Task	Parts	Labor	Total
1	✓ D	\$0.00	\$720.00	\$720.00
_	Technician	Hours	Rate	Cost
	Moe Taha	12.0	\$60.00	\$720.00
		Part Cost	Part Cost	
		Labor	\$720.00	
		Tax 1 (0.0%)		\$0.00
		Tax 2 (0.0°		\$0.00
		Credit		(\$0.00)
		Total Cost		\$720.00

Notes

Notes

User

Time

Rebuilt back half of transmission

installed back on trans

Moe Taha

Mar 28, 2025 6:08 PM

Work Order 4785 Moe Taha CLOSED

Serial

Tag

Closed Meters

1XKDD40X2DJ961701

J58437

0 km & 0 hr

Туре	Created	Scheduled	Due	Started	Closed
	Mar 27, 2025	Mar 27, 2025		Mar 27, 2025 6:21 PM	Mar 27, 2025 6:21 PM

Line	Task	Parts	Labor	Total
1	✓ D	\$0.00	\$720.00	\$720.00
_	Technician	Hours	Rate	Cost
	Moe Taha	12.0	\$60.00	\$720.00
		Part Cost		\$0.00
		Labor		\$720.00
		Tax 1 (0.09	%)	\$0.00
		Tax 2 (0.0%) Credit Total Cost		

Notes

Notes

User

Moe Taha


Time

Mar 27, 2025 6:21 PM

Test drove truck
Diaged trans noise
Removed back of trans
Disassembled and inspected

Cleaned parts

· Time

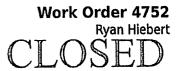

Serial

Tag

Closed Meters

1XKDD40X2DJ961701

J58437

Type Scheduled Due		Started	Closed	
	Mar 26, 2025		Mar 22, 2025 1:28 PM	Mar 22, 2025 1:28 PM

Line	Task ·	Parts	Labor	Total
1	✓ Shorten up broken winch line	\$0.00	\$120.00	\$120.00
	Technician	Hours	Rate	Cost
	Ryan Hiebert	2.0	\$60.00	\$120.00
		Part Cost		\$0.00
		Labor		\$120.00
		Tax 1 (0.0	%)	\$0.00
		Tax 2 (0.0		\$0.00
		Credit		(\$0.00)
		Total Cost	\$120.00	

Work Order 4371 Liam Wheeler

HT278 - 2013 KENWORTH Kenworth 800 TA Winch Tractor (black)

Serial

Tag

Closed Meters

1XKDD40X2DJ961701

J58437

0 km & 0 hr

Туре	Created	Scheduled	Due	Started	Closed
Repair	Mar 2, 2025	Mar 2, 2025		Mar 3, 2025 7:15 AM	Mar 3, 2025 7:15 AM

Line	Task	Parts	Labor	Total
1	✓ Repair	\$0.00	\$1,800.00	\$1,800.00
	Technician	Hours	Rate	Cost
	Liam Wheeler	30.0	\$60.00	\$1,800.00
		Part Cost	Part Cost	
		Labor		\$1,800.00
		Tax 1 (0.	0%)	\$0.00
		Tax 2 (0.	0%)	\$0.00
		Credit		(\$0.00)
		Total Cos	\$1,800.00	

Notes

Notes

User

Time


Labour was set to older dates not in this pay period as the truck sat in the shop

Liam Wheeler

Mar 2, 2025 8:13 PM

Misc admin duties, CVIP inspection repair approvals, Delete/fab work/AC work/ Timing Diag/ CCV sensor diag/ primary and secondary engine speed sensor circuit diag/ engine harness repair

Mar 2, 2025 8:16 PM Liam Wheeler

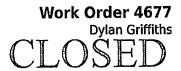

Serial

Tag

Closed Meters

1XKDD40X2DJ961701

J58437

Туре	Created	Scheduled	Due	Started	Closed
	Mar 21, 2025	Mar 21, 2025		Mar 21, 2025 7:23 AM	Mar 24, 2025 4:48 PM

Line	Task ✓ Repairs	Parts \$0.00	Labor \$60.00	Total \$60.00
	<u>Notes</u>			
	Pulled into yard got a call from Blaine his truck wouldn't start. Starter would not engage. Found loose ground wires on starter tighten them up and truck started no problems			
	Technician	Hours	Rate	Cost
	Dylan Griffiths	1.0	\$60.00	\$60.00
	•	Part Cost		\$0.00
		Labor		\$60.00
		Tax 1 (0.09	%)	\$0.00
		Tax 2 (0.09		\$0.00
		Credit		(\$0.00)
		Total Cost		\$60.00

Swamp Cats Ltd

HT278 - 2013 KENWORTH Kenworth 800 TA Winch Tractor (black)



Serial

Tag

Closed Meters

1XKDD40X2DJ961701

J58437

0 km & 0 hr

Туре	Created	Scheduled	Due	Started	Closed
Inspection	Jan 22, 2025	Jan 22, 2025		Jan 25, 2025 4:42 PM	Feb 25, 2025 8:09 AM

Line Task Parts Labor Total

1 ✓ PWI \$2,960.21 \$1,890.00 \$4,850.21

Notes

Boosted truck and brought inside

Diagnosed engine noise

Exhaust manifold gaskets are leaking and possible issue with the VGT

Removed and replaced flexpipe by the tranny for the LH stack

Drained coolant

Removed intake piping

Intake support bracket to the firewall was all loose

Made parts list

Removed exhaust manifold and all engine side emissions components

Started removing heater/evaporator cores and the heater box

Removed remaining components and replaced heater box

Started reinstalling all the other components

Mechanically confirmed that the timing was correct and that the top end was $\ensuremath{\mathsf{good}}$



Finished delete

Replaced Turbo, actuator and mounting studs

Installed all components

Performed VGT calibration

Fixed engine harness for timing code

Fixed Crank case filter code

Took the unit for a very good road test and confirmed all is good

Dropped unit off for CVIP

Part	Warehouse	Vendor/Bin	Qty	Unit Cost	Cost
870118 - BLOWER COIL	Main Parts Room	EDMONTON KENWORTH	1.0	\$224.80	\$224.80
SR2000015 - VALVE - EXPANSION	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$118.35	\$118.35
UB11100 - GASKET HVAC	Main Parts Room	EDMONTON KENWORTH	1.0	\$12.03	\$12.03
SR2000075 - KIT GASKET SET	Main Parts Room	EDMONTON KENWORTH	1.0	\$35.97	\$35.97
UB12750 - GASKET	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$15.64	\$15.64
UB13800 - GASKET	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$5.05	\$5.05
UB11200 - GASKET	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$5.05	\$5.05
UB12350 - GASKET	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$6.74	\$6.74
VG11000 - KIT GASKET	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$26.46	\$26.46
SR2000029 - COVER HEATER A/C	Main Parts Room	EDMONTON KENWORTH	1.0	\$193.33	\$193.33
SR2000012 - COIL ASSY	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$759.33	\$759.33
890088 - CASE ASSY HVAC	Main Parts Room	EDMONTON KENWORTH	1.0	\$535.54	\$535.54

Work Order 3582 Liam Wheeler

K1801418538 - PIPE AIR INTAKE	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$684.19	\$684.19
K077223 - CLAMP AIR INTAKE	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$211.23	\$211.23
X002278 - RESTRICTION GAUGE	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$54.35	\$54.35
P100089 - FITTING	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$13.83	\$13.83
UE10750 - VALVE BRACKET	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$41.13	\$41.13
F531001 - DECAL A/C DYE	Truck Shop Upstairs	EDMONTON KENWORTH	1.0	\$17.19	\$17.19
Technician		H	lours	Rate	Cost
Liam Wheeler			2.0	\$60.00	\$120.00
Liam Wheeler			1.5	\$60.00	\$90.00
Liam Wheeler			2.0	\$60.00	\$120.00
Liam Wheeler			12.0	\$60.00	\$720.00
Liam Wheeler			10.0	\$60.00	\$600.00
Liam Wheeler			4.0	\$60.00	\$240.00
			Part Cost Labor Tax 1 (0.0%) Tax 2 (0.0%) Credit		\$2,960.21
					\$1,890.00
					\$0.00
					\$0.00 (#0.00)
					(\$0.00) \$4,850.21
			Total Cost	\$4,030.21	