

Description of Work Performed:

* - change tranny oil

* - change both diff filters

- change diff oil filter

Work Performed by: _____

Date Repair Completed: _____

Description of Work Performed:

-change oil and filter

- Add fresh oil

- Run check for leaks

- Grease Truck and Quat.

Work Performed by: _____

Date Repair Completed: _____

Description of Work Performed:

OUTP

- Replace All Drums on drive wheels

- steer drum Re Run

* - Replace Fan blades *
- New fan belts

- Replace Air dryer Purge Valve

- oil change and filter

- Add fresh oil

* - Replace Air Filter *

Work Performed by: _____

Date Repair Completed: _____

Description of Work Performed:

- Replue head Temp
- Replae Forward Reverse to top
- Grease Trunk and Both Trainers
- New Po-go stick on head
-

Work Performed by: _____

Date Repair Completed: _____

Description of Work Performed:

- Remove old oil filter and drain old oil
- Install new oil filter and fill with new oil
- Run look for leaks
- Grease job truck + trailers

Work Performed by: _____

Date Repair Completed: _____

Description of Work Performed:

Replace Drive Tire
Fender " Axle ") R Side

- Torque Tire on R Side
- head #1 Axle
- Torque to spec

Work Performed by: _____

Date Repair Completed: _____

Description of Work Performed:

- oil change
- Add fresh oil
- Run check for leaks
- Grease All

Work Performed by: _____

Date Repair Completed: _____

Description of Work Performed:

- Replace Air Bag -

End Dump

2 axle Right Side

- Install New Air Bag

* Replace Both level Valves
on Trunk

- Replace Valve for Air Bag extend
Haldex 90554615

- Working good New

Work Performed by: _____

Date Repair Completed: _____

Description of Work Performed:

- oil change - Add fresh oil
- Run check fuel heavy
- Grease All

- Replace All slack Adjuster
Anchor Blocks on End Pump
#3454#

- Re Set Brakes on End Pump
- check All Hub oils

* J20-6004-003 *

* J20-6004-006 *

-685-365 Tie Rod E

-- # 0047 210579

Pit Man Arm

J23-6015 X

Work Performed by:

Date Repair Completed:

↑ ↑ ↑



SAND + GRAVEL + CONCRETE
A Division of Dale Croswell Construction Co. Ltd

Master Repair

11952.2 hrs.
759458 Km

#21-41
CVIP May/25

Description of Work Performed:

- Replace drivers side window
- Replace Right high beam
- Replace Service Glad hand
- Replace Emergency Glad hand
- Rebuild 5th wheel.
- Replace 3rd axle Right Side drum.
- Clutch linkage to lever loose
- Front V bar worn out.
- Yoke loose on back of transmission
- All drive tires need replaced
- Replace purge valve.
- Replace dryer cartridge
- Check plate loose.
- 5th wheel bracket cracked
- Repair lights out
- Replace Air filters
- Replace DIFF filter
- Replace 2nd axle Right side drum worn out
- Grease unit.
- Replace Left Steer axle drum
- Replace Right Steer axle brake shoes
- Replace Right Steer axle drum
- Torque wheels
- Service unit

Tires			
10	3	3	5
5	3	3	5
4	3	4	4

Drums	Shoes
422.68	422.195
18	16 cracked
419.74	422.10
18	18
421.05	422.38
10	15m

- 1- GBNR4719E2SBP20 Steer axle shoes
- 2- B71-6009 Steer Shock.
- 1- LF3341 DIFF filter
- 8- FD711 Drive tires.
- 1 PW1164 Drivers window
- 1 Steer axle shoe.
- 2 - CM10037815 Steer drum
- 2 - X011622 Air filter
- 2 - SPF69 clutch linkage
- 1 - K022105 Purge valve.
- 1 - 5008414 PG Air dryer cartridge.
- 1 - TR57-44992 V Bar
- 1 - HLD 33005423 V Bar hardware kit
- 1 - 12-008 Emergency Glad hand
- 1 - 12-006 Service Glad hand
- 1 - K022105 Purge valve
- 2 - 5th wheel bushings
- 2 - 5th wheel pins.
- Cast drum.
- 1 - RK-351-A-L 5th wheel rebuild kit.

Work Performed by: inspected by Kirk & Carter

Date Repair Completed: _____



SAND + GRAVEL + CONCRETE
A Division of Dale Croswell Construction Co. Ltd

Master Repair

#21-41

Km. 749877
hrs 11786.

Description of Work Performed:

- #1 injector
- Drag link worn out
- Trailer cord damaged
- high beam water behind it Left side
- loose fender bolts on trailer Right side
- Left rear trailer mudflap bent
- tool box latch on trailer seized
- Left trailer front fender loose bolts
- 3 Brake pots missing a plug
- 2 dust cover plugs
- Hydraulic line too close to transmission
- Oil pan Bolt missing
- Frame Bend on Back of end dump
- Front shocks Leaking
- Low beam Right Side water behind it
- Grease unit

Qty 4327147 PX
24271M526
8HF589UWP

1- 6513589 PX injector
1- 3104392 cover gasket
1- DLP1730B Drag link
1- 10-20196 low beam
1- 10-20197 high beam

Description of Work Performed:

* 2-New Steer Tires *

- No Retague

- oil change

- filter

- Add fresh oil Run checks for leaks

- Replace Murray Tires on Lead Fuel Pump

- Grease All

Work Performed by: _____

Date Repair Completed: _____

Work Order

Start Date: March

Unit #: 21-41

Start Time: 7

KM: 808,827

End Time: 4:30

Hours: 12,760

Completed Date: March

Technician: Carter

Description of Work Performed:

lifted truck on jack stands
removed cross bar
removed expansion joint
removed PTO and Pump, installed bottom plate to stop oil dripping
took drive shaft apart
removed shifter Boot and shifter
removed transmission oil lines



ND + GRAVEL + CONCRETE

A Division of Dale Croswell Construction Co. Ltd

Work Order

Start Date: Mar 10 2026

Unit #: 21-41

Start Time: 5:30 pm

KM: 808824

End Time: 6:00 pm

Hours: 12759

Completed Date: _____

Technician: Tony + Carter

Description of Work Performed:

Clutch no free play

- Grease

- Doug and daryl know clutch going

Drive line vibration

- steady bearing gone

Multiple blank horizontal lines for additional notes.

Work Order

Start Date: March 18, 2026

Unit #: 21-41

Start Time: 7am

KM: 808,827

End Time: 5pm

Hours: 12,760

Completed Date: March 18, 2026

Technician: Carter

Description of Work Performed:

Lifted and mounted transmission to Bellhouse
tightened Bellhousing Bolts to spec
installed clutch bolts, torqued to spec
plugged in all 4 sensors
got new white spacers for mounting bracket
installed mounting bracket
mounted tranny cooler

Parts Used:

Kenworth starter

Part Number

D61-1015-003

Signature: *Cathy Fries*



SAND + GRAVEL + CONCRETE
A Division of Dale Crosswell Construction Co. Ltd

Work Order

Access # 14260-2390

Plate # CDY 4161

Vin # 1XKW D40X2MR 964 835

Start Date: April 1/26

Unit #: 21-41

Start Time: 4:00

KM: 809015

End Time: Total 25 hrs

Hours: 12763.4

Completed Date: April 2/24


Technician: Kirk, LeVP

Description of Work Performed:

- CUIP inspection
- ✓ Repair lights out @ air breather left side
- ✓ Repair lights out under driver door
- ✓ Passenger door won't open
- ADJUST Brakes.
- ✓ Repair Right rear tail light out.
- Repair door pannel on drivers side
- ✓ Repair inner door seal drivers door
- Torque wheels
- Air leak under unit @ transmission
- Tighten deck plate

Shoes

18	20
16	16
11	11

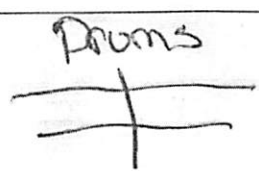

Tires

13			13
14	14	11	11
12	14	13	13

Parts Used:

3 - Amber Micro Light
- 4" Round Red

Part Number

01-4947-82
44030R3

Signature:





SAND + GRAVEL + CONCRETE
A Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Apr 6 2026

Unit #: 21-41

Start Time: 7:00

KM: 809016

End Time: 3:30

Hours: 12 763

Completed Date: _____

Technician: Tony

Description of Work Performed:

- Fix various little thing
- Remove 2 way radio
- Remove sam sara
- Fix Door rubbers
- Fix air line, CVIP???
- Replace windsheld wiper

Parts Used:

Secondary Door seal
Primary Door seal

Part Number

R42-1210
R42-1084

Signature: 

Parts Used:

x2 Horn cover
x2 ~~Part~~ Horn shield

Part Number

H02123SR2
HP2001-23

Signature:

