



F20-3
AUG

Mechanic Work Order

Information

RTK-08

Foster Creek

Tuesday, July 21st 2026, 7:09 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

RTK-08

General Information

Date

July 20, 2026

Tech Name

Brandon German

Last service done @ [HR/KM]:

No Response

Next service due @ [HR/KM]:

No Response

Odometer:

0

Hours:

6421

Repair

Repair Description

unit going into limp mode for turbo over temperature. went for drive in unit checking live data. inter stage turbo air temperature reaching 280F found cyl #1 exhaust leak we need to fix, but also need to inspect turbo"s for damage.

Location

ntr

Hours

2

Parts

Signatures

Brandon German, *Mechanic LC*

 July 21st 2026, 7:09 AM [MDT -06:00]

 51.0447331, -114.0718831

B.G.



Mechanic Work Order

Information

- RTK-08
- Foster Creek
- Saturday, July 18th 2026, 8:18 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number RTK-08

General Information

- Date July 17, 2026
- Tech Name Brandon German
- Last service done @ (HR/KM): No Response
- Next service due @ (HR/KM): No Response
- Odometer: 0
- Hours: 6401

Repair

Repair Description added 10L of engine oil, found EGR block off plate leaking, replaced gasket, coolers were packed full of dust blew out.

Location ntr

Hours 2

Parts

Signatures

Brandon German, *Mechanic LC*

 July 18th 2026, 8:38 AM [MDT -06:00]

B.G.

Kirby McKay, *Project Manager*

 Approved
 July 18th 2026, 3:35 PM [MDT -06:00]

K.M.



Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Tuesday, June 2nd 2026, 10:10 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 May 29, 2026

Tech Name

 Mitchell Teer

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 6146

Repair

Repair Description

 travel to unit, t/s engine code for turbo temp, unbolted rads and blew out bolted rads up and cleared code and tested works good, most likely code came from high ambient temps. travel to shop

Location

 foster creek

Hours

 6

Parts

Signatures

Mitchell Teer, HL Contract Mechanic

 June 2nd 2026, 10:10 AM (MDT -0600)





Mechanic Work Order

Information

RTK-08

Foster Creek

Wednesday, May 6th 2026, 8:05 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

RTK-08

General Information

Date

April 21, 2026

Tech Name

Mitchell Teer

Last service done @ [HR/KM]:

No Response

Next service due @ [HR/KM]:

No Response

Odometer:

0

Hours:

6128

Repair

Repair Description

replaced trans bypass hose from trans to filter and orings.

Location

foster creek

Hours

2

Parts

Signatures

Mitchell Teer, HL Contract Mechanic

 May 6th 2026, 8:05 AM (MDT -06:00)





Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Monday, April 20th 2026, 7:46 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 April 19, 2026

Tech Name

 Mitchell Teer

Last service done @ (HR/KM):

 6000

Next service due @ (HR/KM):

 6500

Odometer:

 0

Hours:

 6128

Repair

Repair Description

 Travel to unit start and bring to shop, did inspection on unit, greased unit checked a/c, installed missing bolts on front engine guard, found two leaks, repaired one and ordered trans hose and orings for other leak, moved out of shop awaiting parts.

Location

 Foster creek

Hours

 5

Parts

Signatures

Mitchell Teer, HL Contract Mechanic

April 20th 2026, 7:46 AM [MDT -06:00]

55.0604648, -110.5289142





Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Friday, February 20th 2026, 9:55 PM [MST -07:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 February 19, 2026

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 5521

Repair

Repair Description

 wiper arm out of time, found bolt broken for arm, replaced and set arm in proper spot, tested, if it happens again will need wiper motor and arm

Location

 BP26

Hours

 1

Parts

Signatures

Brandon German, *Mechanic LC*



February 20th 2026, 9:55 PM [MST -07:00]

B. G

Steven Orcutt, *Project Manager*



Approved



February 24th 2026, 7:12 AM [MST -07:00]



55.060337, -110.5289184



Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Wednesday, February 18th 2026, 9:37 PM (MST -07:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 February 18, 2026

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 5489

Repair

Repair Description

 Ran out to unit, check strut charge. run strut height calibration. sent unit to work.

Location

 BP26

Hours

 1

Parts

Signatures

Brandon German, *Mechanic LC*

 February 18th 2026, 9:37 PM (MST -07:00)

B. G.

Steven Orcutt, *Project Manager*

 Approved

 February 19th 2026, 10:14 AM (MST -07:00)

 55.0605113, -110.5289717

SO



Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Monday, February 2nd 2026, 10:10 PM [MST -07:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 February 2, 2026

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 5291

Repair

Repair Description

 install emissions module from another truck into RTK-08 since it was in the shop. reassembled sheet metal and exhaust. went under unit looped DEF injector coolant lines, removed egr gas pipe at exhaust manifold sandwiched block off plate in between pipe and manifold. removed EGR gas pipe from intake. kept off unit and installed two block off plates. cap line going to 7th injector. filled R3 tire to get out of shop tire guy tomorrow. fired up unit and kicked outside to run for a few hrs to check for leaks and see if any codes come up. unit will be good to return to service once i decide what to do with emission module electrical connector.

Location

 HLC Laydown Yard

Hours

 6


Parts

Signatures

Brandon German, Mechanic LC

 February 2nd 2026, 10:10 PM [MST -07:00]

 55.0564922, -110.491852

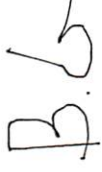

Steven Orcutt, Project Manager

 Approved

 February 3rd 2026, 10:53 AM [MST -07:00]

 55.0604987, -110.5289495



Steven Orcutt, Project Manager

 Approved

 February 3rd 2026, 1:11 PM [MST -07:00]

 55.0604887, -110.5289688





Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Sunday, February 1st 2026, 9:30 PM [MST -07:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 February 1, 2026

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 5291

Repair

Repair Description

 low ash reset done, download tune file send off to delete guy, few hrs later went back to unit flashed delete tune into it. moved unit into shop removed emissions module, disassembled module to removed filters to send out to get hollowed out

Location

 HLC Laydown yard

Hours

 6

Parts

Signatures

Brandon German, *Mechanic LC*

 February 1st 2026, 9:30 PM [MST -07:00]

B.G.

Steven Orcutt, *Project Manager*

 Approved

 February 2nd 2026, 10:48 AM [MST -07:00]





Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Sunday, February 1st 2026, 9:30 PM (MST -07:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 February 1, 2026

Tech Name

 Brandon German

Last service done @ (HR/KM):

 No Response

Next service due @ (HR/KM):

 No Response

Odometer:

 0

Hours:

 5291

Repair

Repair Description

 low ash reset done, download tune file send off to delete guy, few hrs later went back to unit flashed delete tune into it. moved unit into shop removed emissions module, disassembled module to removed filters to send out to get hollowed out

Location

 HLC Laydown yard

Hours

 6

Parts

Signatures

Brandon German, *Mechanic LC*

 February 1st 2026, 9:30 PM [MST -07:00]

B.G

Steven Orcutt, *Project Manager*

 Approved

 February 2nd 2026, 10:48 AM [MST -07:00]





Mechanic Work Order

Information



RTK-08



Foster Creek



Wednesday, January 28th 2026, 9:59 PM [MST -07:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number



RTK-08

General Information

Date



January 28, 2026

Tech Name



Brandon German

Last service done @ [HR/KM]:



No Response

Next service due @ [HR/KM]:



No Response

Odometer:



0

Hours:



5284

Repair

Repair Description



Refill L2/L3 tires checked R2/R3 all set to 60 psi. L3 was at 20psi

Location



Coyote den

Hours



1

Parts

Signatures

Brandon German, *Mechanic LC*

 January 28th 2026, 9:59 PM [MST -07:00]

 55.0549154, -110.4945131



Steven Orcutt, *Project Manager*

 Approved

 January 29th 2026, 11:46 AM [MST -07:00]

 55.05958, -110.5286075





Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Tuesday, July 21st 2026, 7:09 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 July 20, 2026

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 6421

Repair

Repair Description

 unit going into limp mode for turbo over temperature. went for drive in unit checking live data. inter stage turbo air temperature reaching 280F found cyl #1 exhaust leak we need to fix, but also need to inspect turbo"s for damage.

Location

 ntr

Hours

 2

Parts

Signatures

Brandon German, *Mechanic LC*



July 21st 2026, 7:09 AM (MDT -06:00)



51.0447331, -114.0718831

B.G



Mechanic Work Order

Information



RTK-08



Foster Creek



Saturday, October 18th 2025, 7:14 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number



RTK-08

General Information

Date



October 17, 2025

Tech Name



Brandon German

Last service done @ (HR/KM):



No Response

Next service due @ (HR/KM):



No Response

Odometer:



0

Hours:



0

Repair

Repair Description



check over unit, dust blew out of vents when i fired unit up, removed cabin filter HVAC intake box full of dust, removed both filters blew out HVAC vents and box, installed new cabin filters, still oil residue in RH coolers from when oil line blew up, brake cleaned out coolers and blew out with air gun, jerry rigged boost clamp wrapped in hose as a spacer installed proper sized clamp. Greased unit, greased trans to engine jack shaft and diff input seals

Location



HLC laydown yard

Hours



6

Parts

Signatures

Brandon German, *Mechanic LC*



October 18th 2025, 7:14 AM [MDT -06:00]



55.0606918, -110.5286858

B.G

Steven Orcutt, *Project Manager*



Approved



October 22nd 2025, 8:14 AM [MDT -06:00]



52.0267944, -110.9513034



Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Monday, September 22nd 2025, 7:00 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 September 21, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 oil leak, unbolt RH coolers, looks like blown remote oil filter line, fire unit up pin hole in line, remove line, Run back to laydown to see if we can build, can't needs to go to town.

Location

 N30

Hours

 2

Parts

Signatures

Brandon German, *Mechanic LC*

 September 22nd 2025, 7:00 AM (MDT -06:00)

 55.0606896, -110.5286867

B.G

Steven Orcutt, *Project Manager*

 Approved

 September 23rd 2025, 12:57 PM (MDT -06:00)

 51.067252, -114.1350027





Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Tuesday, September 23rd 2025, 6:51 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 September 22, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 install new remote oil filter line, check for leaks wipe up puddles of oil, drive unit to wash pad, wash off engine and fuel tank. Clean out spill trays, restock spill kit.

Location

 N30/sandcell wash pad

Hours

 4

Parts

Signatures

Brandon German, *Mechanic LC*

 September 23rd 2025, 6:51 AM [MDT -06:00]

 55.0606816, -110.5286797



Steven Orcutt, *Project Manager*

 Approved

 September 23rd 2025, 12:54 PM [MDT -06:00]

 51.067252, -114.1350027





Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Monday, August 25th 2025, 6:43 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 August 24, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 rough and clunking noise, go for ride in unit, got operator to shake truck while I inspected unit. RH strut leaking, leak from torque input flange. Pretty sure struts have lost charge and noise is from play in steering cylinders, checked RTK-06 and it makes same noise. Run to laydown and grab nitrogen kit to check charge. Jack up cab to access struts, Both struts have Opsi recharge to 600psi. Drop cab and go for drive way smoother ride and clunking went away from ride being easier

Location

 WTR

Hours

 4

Parts

Signatures

Brandon German, *Mechanic*

 August 25th 2025, 6:43 AM [MDT -06:00]

 55.060587, -110.5287832

B.G

Steven Orcutt, *Project Manager*

 Approved

 August 25th 2025, 7:48 AM [MDT -06:00]

 51.067252, -114.1350027





Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Sunday, July 13th 2025, 7:11 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 July 12, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Added 10L of engine oil

Location

 WTR

Hours

 1

Parts

Signatures

Brandon German, *Mechanic*

 July 13th 2025, 7:11 AM [MDT -06:00]

 55.0605912, -110.5287873



Steven Orcutt, *Project Manager*

 Approved

 July 15th 2025, 8:02 AM [MDT -06:00]

 54.8235292, -111.4816163





Brandt Tractor Ltd.
#5, 360 Mackenzie Blvd.
Fort McMurray, AB
T9H 4G4
(780) 791-6635

Service
Invoice



JOHN DEERE

SOLD TO:

HEART LAKE FIRST NATIONS
STK # 01854706
G/L # 105-00-0008
S/N # 1DW410EBPNF713838

PAGE	1
SALE TYPE	WARRANTY
CUSTOMER NO.	

S
H
I
P
O
T

HEART LAKE FIRST NATIONS
CONSTRUCTION LTD

INVOICE DATE	28MAY25	BRANCH	08	INVOICE NO.	1854706
--------------	---------	--------	----	-------------	---------

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
1854706	03	17MAY25			
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	410E	1DW410EBPNF713838	RTK-08	4723	BRAD
DESCRIPTION					
AMOUNT					

T/S AND REPAIR UNIT BOUNCES ONLY IN 7TH

COMPLAINT:

CUSTOMER COMPLAINED BOUNCERY SUSPENSION

CAUSE:

INTERNAL FAILURE - LEAKING

CORRECTION:

2.5"CHECK SUSPENSION HYD OPERATION,

GOOD. CHECK FOR CODES, NO CODES. CHECK

STRTS FOR NITROGEN CHARGE, FOUND NO

CHARGE. INTERNALLY LEAKING PAST SEAL."

SLIFT CAB. PLUG IN GAUGE AND CHARGE

KIT, CHARGE BOTH TO 595PSI. VERIFY

CHARGE HOLDING. LOWER CAB & SECURE.

VERIFY PROPER OPERATION, GOOD.

PG

BOUNCES IN 7TH DRIVING STRAIGHT ON FLAT GROUND FROM FRONT

** TOTAL LABOR **

ENVIRONMENTAL FEE

>>--> SEG# 03 PRT

LAB

MSC

TOTAL

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUUM), MINIMUM CHARGE OF \$1.50.	QST # 1226957240	DESCRIPTION	AMOUNT
I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto.			
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.			
SIGNATURE		DATE	
X			
TOTAL PARTS		TOTAL LABOR	
MISC. CHARGES		SALES TAX	
PLEASE PAY		THIS TOTAL	

CUSTOMER COPY

LF-1152C

CUSTOMER COPY

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.		SIGNATURE _____ DATE _____	
PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUUM), MINIMUM CHARGE OF \$1.50.		GST # 122697240	
* TOTAL GST/HST * - GST NO. 899544779		DESCRIPTION AMOUNT	
CORRECTION: CUSTOMER COMPLAINED LINE WAS TWISTED, SENT PART TO THEM TO REPLACE. OIL LINE IS NOT COVERED UNDER WARRANTY. 1 AT393196 HOSE, HY		563.25 TOTAL 563.25 28.16	
REPLACE REMOTE ENGINE OIL LINE		563.25 TOTAL 563.25 28.16	
* TOTAL GST/HST * - GST NO. 899544779		DESCRIPTION AMOUNT	
PURCHASE ORDER NO.		PHONE NUMBER	
WORK ORDER NO.		SEG.	
DATE OPENED		SALESPRN	
EQUIP. NO.		AUTHORIZED BY	
METER		BRANDON	
HLRK-08		4007	
1DW410EBBNE713838		1853468	
410E		16OCT24	
JD		13NOV24	
1853468		08	
1853468		13NOV24	
08		1853468	
1853468		1853468	

JOHN DEERE



Service Invoice

Brant Tractor Ltd.
 #5, 360 MacKenzie Blvd.
 Fort McMurray, AB
 T9H 4C4
 (780) 791-6635

SOLD TO:
 HEART LAKE FIRST NATIONS
 CONSTRUCTION LTD 1666340
 BOX 2228
 IAC LA BICHE, AB T0A 2C0

PAGE 1
 SALE TYPE
 CHARGE
 CUSTOMER NO.



Mechanic Work Order

Information



RTK-08



Foster Creek



Wednesday, June 25th 2025, 6:42 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number



RTK-08

General Information

Date



June 24, 2025

Tech Name



Brandon German

Last service done @ [HR/KM]:



No Response

Next service due @ [HR/KM]:



No Response

Odometer:



0

Hours:



0

Repair

Repair Description



Replace blown hyd hose, run to WTR laydown pull hose, run to HLC laydown build hose, run back out to WTR laydown and install it.

Location



WTR laydown

Hours



2

Parts

Signatures

Brandon German, *Mechanic*

 June 25th 2025, 6:42 AM [MDT -06:00]

 55.0605793, -110.5288035



Steven Orcutt, *Project Manager*

 Approved

 June 26th 2025, 12:35 PM [MDT -06:00]

 51.1487021, -114.066704





Mechanic Work Order

Information



RTK-08



Foster Creek



Saturday, May 24th 2025, 7:04 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number



RTK-08

General Information

Date



May 23, 2025

Tech Name



Brandon German

Last service done @ [HR/KM]:



No Response

Next service due @ [HR/KM]:



5080

Odometer:



0

Hours:



4723

Repair

Repair Description



Received paper work saying RTK-08 is due for a 4000hr service, got to unit and checked service sticker, unit is not due for service

Location



BP14

Hours



1

Parts

Description



No Response



Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Friday, May 23rd 2025, 6:58 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 May 22, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Take Brandt out to unit assist in repair

Location

 HLC laydown yard

Hours

 3

Parts

Signatures

Brandon German, *Mechanic*

 May 23rd 2025, 6:58 AM [MDT -06:00]

 55.060693, -110.5287415

B.G

Barrett Norman, *Project Manager*

 Approved

 May 25th 2025, 8:37 AM [MDT -06:00]

 52.3133599, -112.7350174

BN



Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Thursday, May 22nd 2025, 7:13 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 May 21, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Remove leaking line for park brake actuator, run to shop build new hoses, drive back to unit install new hose, fire unit up check for leaks.

Location

 BP14

Hours

 2

Parts

Signatures

Brandon German, *Mechanic*

 May 22nd 2025, 7:13 AM (MDT -06:00)

 55.0607012, -110.528738

B.G

Barrett Norman, *Project Manager*

 Approved

 May 25th 2025, 8:36 AM (MDT -06:00)

 52.3133599, -112.7350174

BN



Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Sunday, May 18th 2025, 6:51 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 May 17, 2025

Tech Name

 Lane Peters

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Drive to unit, look at sweating hose, get part ordered

Location

 Foster

Hours

 1

Parts

Signatures

Lane Peters, *Mechanic*

 May 18th 2025, 6:51 AM (MDT -06:00)



Barrett Norman, *Project Manager*

 May 18th 2025, 4:09 PM (MDT -06:00)



 51.067252, -114.1350027



Mechanic Work Order

Information



RTK-08



Foster Creek



Saturday, May 17th 2025, 11:16 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number



RTK-08

General Information

Date



May 16, 2025

Tech Name



Lane Peters

Last service done @ [HR/KM]:



No Response

Next service due @ [HR/KM]:



No Response

Odometer:



0

Hours:



4695

Repair

Repair Description



Drive to unit, front end hopping while driving. Test drive rtk 05 before hand to compare, rtk 08 is hopping/ bouncing in the front end in 7th gear, between 32 and 40 km/h. Check tire pressures and good, and check gear shifting and actuation while driving off of the laptop, everything seems good. Check with Brandt service guy and he says he doesn't know what it could be, but will send a tech to investigate

Location



Foster

Hours



3

Parts

Signatures

Lane Peters, *Mechanic*

 May 17th 2025, 11:16 AM (MDT -06:00)

LP

Barrett Norman, *Project Manager*

 May 17th 2025, 1:17 PM (MDT -06:00)

BN

 51.067252, -114.1350027



Mechanic Work Order

Information



RTK-08



Foster Creek



Friday, April 4th 2025, 10:46 AM [MDT -06:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number



RTK-08

General Information

Date



April 3, 2025

Tech Name



Brandon German

Last service done @ [HR/KM]:



No Response

Next service due @ [HR/KM]:



5080

Odometer:



0

Hours:



4662

Repair

Repair Description



Fire unit up, inspect, cab interior could use a clean. Ran box up and down. No leaks found on unit. Good to go

Location



Coyote den

Hours



1

Parts

Signatures

Brandon German, *Mechanic*

 April 4th 2025, 10:46 AM [MDT -06:00]

 55.0606422, -110.5287475

B.G.



Third Party Equipment Repair & Maintenance Tracker

Information

RTK-08

Head Office

Wednesday, February 26th 2025, 11:53 AM [MST -07:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

RTK-08

Basic Information

Date of Repair

February 21, 2025

Company or Name of Third Party Doing Maintenance or Repair

Location cats

Provide a quick description of what was done to the unit

Inspection and oil change

Attach a PDF Copy of the Work Order or Invoice

20250226120249806.pdf View

Articulated Truck Inspection Record

PDI-0100

✓ P = Pass F = Fail R = Repaired N/A = Not Applicable

UNIT #: 14212

ODOMETER: 5080

ENGINE HOURS: 1080

DATE: Feb 21

	P	F	R	N/A		P	F	R	N/A
1	✓				28	✓			
2	✓			X	29	✓			
3	✓				30	✓			
4	✓				31	✓			
5	✓				32	✓			
6	✓				33	✓			
7	✓				34	✓			
8	✓				35	✓			
9	✓				36	✓			
10	✓				37	✓			
11	✓				38	✓			
12	✓				39	✓			
13	✓				40	✓			
14	✓				41	✓			
15	✓				42	✓			
16	✓				43	✓			
17	✓				44	✓			
18	✓				45				✓
19	✓				46	✓			
20	✓				47				Pass
21	✓				48				
22	✓				49				✓
23	✓				50				✓
24	✓				51				✓
25				5080	52	✓			
26	✓				53				✓
27	✓				54	✓			

Cheneca	Articulated Truck Inspection Record	PDI-0100
----------------	-------------------------------------	-----------------

✓ P = Pass F = Fail R = Repaired N/A = Not Applicable

TIRE PRESSURE (If not recorded on prescribed Alberta Inspection Record)					
LF:		RF:		LM:	
				LR:	
				RR:	

CHARGING SYSTEM TEST			
VOLTS:		AMPS:	
		RPM:	

FUEL LEVEL/CLEANING 	TEST / DRIVE	
	TEST []	or TEST DRIVE []
	Comments:	

MAINTENANCE REQUIRED/REMARKS	
FUELS USED - RE 572785 - DZ 130550 - HT 365869 - DZ 112918	- RE 230986 - RE 261960 - AT 307501

INSPECTION REPORT SIGN-OFF	
Dave Wilkins Technician (Print Name)	_____ Technicians Signature
	_____ Supervisors Signature

Signatures

Richard Wilson, *Parts Manager*

 February 26th 2025, 11:53 AM (MST -07:00)

 55.0084156, -111.714981

RW



Mechanic Work Order

Information



RTK-08



Foster Creek



Sunday, February 23rd 2025, 7:08 PM [MST -07:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number



RTK-08

General Information

Date



February 22, 2025

Tech Name



Wyatt Feland

Last service done @ [HR/KM]:



No Response

Next service due @ [HR/KM]:



No Response

Odometer:



0

Hours:



0

Repair

Repair Description



Drove out to unit and test drove unit to find diff noise that operator was complaining about. Couldn't find any issues.

Location



Foster

Hours



1

Parts

Signatures

Wyatt Feland, Mechanic

February 23rd 2025, 7:08 PM (MST -07:00)



55.0606353, -110.5289143





Mechanic Work Order

Information

 RTK-08

 Foster Creek

 Monday, February 17th 2025, 6:33 PM (MST -07:00)

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 RTK-08

General Information

Date

 February 17, 2025

Tech Name

 Alexander Auger

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Drive to unit, air up tire

Location

 Foster creek

Hours

 1

Parts

Signatures

Alexander Auger, *Noble Mechanic*

 February 17th 2025, 6:33 PM [MST -07:00]




Date	Unit # Gene	Repair Description Repair
2024-02-19	CT-3204	Changed ripper tooth and protector
2024-02-19	CT-1241	Find track pads and bolts. Drove to unit. Removed cracked track pads and bushed surfaces and installed new ones. Found hydraulic oil was low so roped up.
2024-02-19	U421	Changed battery
2024-02-19	ADT-0794	Drove out to unit. Pressure tested coolant system and found a bunch of leaks. Tightened some hose clamps and decided to get it sent back to shop.
2024-02-19	ADT-0923	Find track pads and bolts. Drove to unit. Removed cracked track pads and bushed surfaces and installed new ones. Found hydraulic oil was low so roped up.
2024-02-19	Hlrk-08	Drove to site for now being able to open the door and get in unit had to take the one side window out to open the door then took the door apart to fix tge door latch and then put it all back together
2024-02-19	Ct-0490	Assisted in going over unit and putting blade on
2024-02-19	CT-0831	Drive to unit install ripper pin keepers. Get hardware ordered for blade
2024-02-19	He-1330	Drive out to unit Remove broken antenna wiring and route new test and works good
2024-02-19	Adt-0923	Removed coolants pipes under engine and put in new one and installed other pipes
2024-02-19	ADT-0923	Drain coolant from system. Remove clamps and mounts for 3 steel coolant pipes. Remove hoses manoeuvre pipes and remove from unit Clean up surfaces orientate pipes and hose clamps install hoses and tighten clamps. Get bolts started at water pump with new orings on flanges
2024-02-19	8011-024	Dis some shop clean up and yard organization
2024-02-19	Ct-0490	Fire up unit get blade flipped up and blocked underneath arms. Install blade onto cat torque horsecock install side pins. Bolt on bracket for hyd lines. Look over unit as it came from different site. Have to change ripper teeth as they had D8 teeth on 6T shanks
2024-02-19	HLLD-02	Tighten up loose fittings before using unit
2024-02-19	HTTR 3941	Wheel swap on trailer to have matching rims
2024-02-19	HLD750 09	Replace segments weld nuts to bolts on sprocket and replace 3 track pads with new bolts
2024-02-19	HE 0125	Diag heat issue unit worked fine when I looked at it
2024-02-19	HLTH 19	Drive to location and install quick attach lines then test lines were pre built
2024-02-19	HLGR 31	Diag leak on ls of machine found leaking hose remove build and replace then test
2024-02-19	HLBH 01	Replace rear window
2024-02-19	HE 0125	Drive to location tighten wedge bolts

Date	Unit Number General Information	Repair Description Repair
2024-03-13	Dozers -> CT-0817	Replace main pump feed hose
2024-03-13	Excavators -> HE-0205	Blow out rad and air filters diagnose fast over heat
2024-03-13	Loader & Skid Steer -> HLSS-02	Replace final drive oils Reseal final drive cover
2024-03-13	Excavators -> LCHE-0327	Replace Sweating oil
2024-03-13	Miscellaneous -> 8011-024	Clean up shop put away hydraulic fittings organize bolt bin on shop truck
2024-03-13	Graders -> HLGR-30	Drove out to site and removes grader tire and had a pickup follow me out so we could put the the tire in the back to take to town
2024-03-13	U426	Tidy tank switch was bad found spare switch in truck and installed now tidy tank works
2024-03-13	Rock Truck -> RTK-08	Low Rear LH tire was low Topped up tire and will monitor
2024-03-13	Rock Truck -> RTK-06	Tighten wiper arm and a adjust position
2024-03-13	Excavators -> LCHE-0189	Went out to site for fuel leak found the tank was leaking had it hauled back to yard
2024-03-13	Dozers -> CT-0520	Unit was dead Boosted unit so it could be moved back to lay down
2024-03-13	Graders -> HLGR-30	Front RH tire broke valve stem Removed tire and loaded into pick up to be sent to town
2024-03-13	Company Service Trucks -> HLSV-08	I stalled new washer sprayers and hose on to unit and tested
2024-03-13	Excavators -> LCHE-0189	Unit had fuel leak from tank Sucked and emptied tank out Removed tank from unit to be repaired
2024-03-13	Dozers -> CT-0304	Went out to site for lose bolts found trunnion bolts were lose and one was missing so I tighten them all and ordered a bolt and nut
2024-03-13	Dozers -> CT-1896	Went out to site and diagnosed oil leak had to remove panels and that and found was blown o-ring was able to contain cuz it was small leak and get it out of the cut
2024-03-13	Company Service Trucks -> Mst-157	Cleaned out unit

Date	Unit Number General Information	Repair Description Repair
2024-03-16	Rock Truck -> RTK-08	Drove out to unit. Waited for equipment to get into a safe workable location. Found where and which hose was leaking. Removed other hoses in order to be able to remove the leaking hose. Removed leaking hose. Drove back to laydown and looked if we had fittings. Had to get Brad to pick up fitting in town.
2024-03-16	Dozers -> CT-1896	Filled hydraulic oil to spec. Fired up unit and moved it.
2024-03-16	Trailers -> HTTR-3941	Changed wheel and tire.
2024-03-16	Excavators -> HLTH-20	Drove out to unit and removed cutting edge. Buffed the mounting surfaces and flipped edge and re mounted onto unit.
2024-03-16	Company Service Trucks -> U421	Diagnosed why slip tank wasn't working. Replaced switch.
2024-03-16	Dozers -> CT-3204	Drove out to unit and assisted to load and chain down unit. Piloted unit back to laydown and assisted unload.
2024-03-16	Ht-8017	Torque tires on tractor and trailer
2024-03-16	Ct-0490	Remove blade from unit Organize units in yard
2024-03-16	He-189x	Swap buckets on unit
2024-03-16	Ct-0314	Drive to unit to inspect crack in track frame
2024-03-16	Ct-0817	Drive to unit tighten leaking blade fitting. Walk cat out to road after repair
2024-03-16	HLTH-20	Drive to unit Flip bucket cutting edge
2024-03-16	Hld750-11	Drive to unit Pull floor pans from unit Pull stump pans from unit Find transmission leak Pull 2 lines off to get at leaking fitting bottom of hydrostatic pump. Change blown o ring and install lines. Test no leaks. Oil was brought by labourers but they brought ATF not the correct fluid. Road in too poor of shape to go back at 5:30 finish in morning

Date	Unit Number General Information	Repair Description Repair
2024-06-23	Dozers -> CT-2435	Replace cutting edges
2024-06-23	Rock Truck -> RTK-08	Code for bad NOX sensor looked into code. Let machine sit and then restarted code didn't go away ran operator to shop to grab another truck
2024-06-23	Dozers -> HL750-10	Had codes for bad NOX outlet sensor Communication. Pulled harness apart and found a broken wire repinned harness and ran new wire
2024-06-23	Rock Truck -> RTK-09	Box wouldn't lift calibrate box
2024-06-23	Rock Truck -> RTK-10	Diagnose terrible drive line noise found bad drive shaft carrier bearings where it goes threw hitch
2024-06-23	Dozers -> HL850-01	Unit showed up to site from another job performed pre use inspection cleaned garbage out of cab blew cab out replaced radio antenna and RH door wiper.
2024-06-23	Packers -> HLP-05	Replace radio would not power on
2024-06-23	Dozers -> HL850-01	Operator complained about weak AC found evaporator cooling fans weren't turning on. Found both 15A fuses were blown
2024-06-23	Tractor W Blade -> FIT-0729	Lights were left on over night and batteries were dead Boosted unit Repaired hose holder on disc
2024-06-23	Loader & Skid Steer -> HLSS-02	AC wasn't working Replaced fuse for AC and let operator run Unit wasn't blowing as cold air as it should Later on the day I recharged AC system was very low will monitor and see if system has a leak Added 1.1 lbs of refrigerant
2024-06-23	Excavators -> HE-0084	Changed engine oil and filter fuel filter fuel/water filter auxiliary fuel filter inner and outer cab filter inner and outer engine air filter 1x- RE539279 engine oil 1x- DZ125392 fuel filter 1x- DZ128543 fuel/ water separator 1x- AT365870 auxiliary fuel filter 1x- AT514725 inner engine air filter 1x- AT514724 outer engine air filter 1x- FYA00001490 inner cab filter 1x- 4S00686R outer cab filter 20L- 0w-40 engine oil
2024-06-23	Packers -> CE-0089	Unit wouldn't start starter is just clicking Hit starter with hammer and got unit to start Have a starter on order
2024-06-23	Rock Truck -> ADT-2593	LH flip down stump pan's bolt fell out and got bent Removed stump pan and bent back into kinda place Reinstalled but could only get front bolt in rear is still bent down a bit
2024-06-23	Shop Time -> Shop Time - 8011-025	Wait for equipment to be break down
2024-06-23	Company Service Trucks -> U468	Air up drivers side rear tire
2024-06-23	Company Service Trucks -> U390	Chisel out mud around transmission linkage make sure transmission would shift
2024-06-23	Shop Time -> Shop Time - 8011-025	WBL-2387 boost walk behind loader and move unit



80-7127ff

Mechanic Work Order

Unit # 1-1005 S/N: 9440440000

Odometer

Hours

11

[illegible]

Mechanic Signature:

Mechanic ID:

[illegible]



MUST BE COMPLETED

Last Service Done @ (HR/KM): 954
Next Service Due @ (HR/KM): 1454

Next Service Due @ (HR/KM): 454

Hour 1234

[illegible]


Arthur

Parts

Mechanic ID:

Mechanic Signature: _____

[illegible]



Mechanic Work Order

MUST BE COMPLETED

Lead Service Done @ (HR/KM): _____

Next Service Due @ (HR/KM): _____

[illegible]

Odometer

Hours _____

[illegible]

Mechanic Work Order

Unit # 48TK-08 S/N:

Odometer

Hours

[illegible]



RTK-08

S/N:

Odometer

Hours

Q53 has

Mechanic Work Order

[illegible]



Hours 862 hrs

S/N:

Odometer

Hours

Shirley

Mechanic ID:

Mechanic Signature: _____

[illegible]



• 19/3

S/N:

Repair Description

Odometer

ate

Hours

Mr. J. A. Mason

01/11/2011

0101

Lab #

Repair Description
- Replaced fuel cap on unit

- Checked fuses ; wiring on air seat ; fuses were good ; wiring coming out of seat looks

good
Told Richard about issue

DATE	Oct. 18/22	Foster Creek
------	------------	--------------

Jordan. L

5.

Mechanic Signature:

Mechanic ID:

Parts

Qty.

Parts #

Description

Returns

Leiden

Mechanic Work Order

[illegible]