


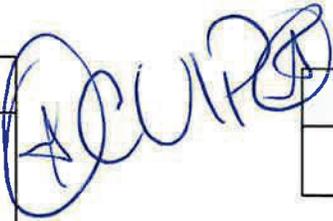

8510 - 105 Street
 Clairmont, AB
 T8X 0S6
 fulltilt@telus.net

Invoice

DATE	INVOICE #
2025-05-08	7680

INVOICE TO:		PO #
T-ruckin Oilfield Services Box 448 Station Main Grande Prairie, AB T8V 3A7		

GST # 843519372

YEAR	MAKE / MODEL	SERIAL #	UNIT #	MILEAGE / HOURS	LICENCE #
2007	Gerry's Low Bed	125073	LB04		6GF850
QTY	Item	DESCRIPTION			AMOUNT
	CVIP	Inspection			250.00
4.0	Axle-Remove wheels	Axles - remove wheels/drums for inspection Cleaned out mud before reinstalling.			636.00
0.5	Hours	Front RHS corner had LED that wasn't working. Found corroded pigtail in the back of light so new pigtail and LED was installed but still didn't work. Followed wiring and found corroded wire close to junction box so it was repaired . Light is good.			79.50
0.5	Hours	Amber oval LED along LHS wasn't working. Found corroded connections in junction box. Repaired all corroded connections. Light functioned properly.			79.50
1.2	Hours	Replaced worn out brakeshoes on #2 LHS and both sides of axle #3.			190.80
4.0	Hours	Replaced worn out brake drums on both sides of #1 & #3 axles.			636.00
		Replaced worn out s-cam and tube on #1 RHS. Wheel hub was removed in order to complete. Once s-cam was installed wheelhub was installed with new wheel seal. Worn out brake shoes were replaced. Cleaned oil off spyder while everything was apart.			
0.6	Hours	Replaced broken and missing dust covers on both sides of #3 axle			95.40
0.2	Hours	Tightened loose bolts on #3 RHS airbag pedestal			31.80
0.2	Hours	Tightened loose brakepot on #3 RHS			31.80
1.5	Hours	Replaced slack adjusters on #1 LHS, #2 RHS and #3 LHS that were not ratcheting and had excessive travel.			238.50
2.8	Hours	Replaced both #1 and #3 shocks due to lower mounts coming loose and damaging lower bushings on shocks. Installed new shocks with new lower bolts.			445.20
0.5	Hours	Welded cracked gussets on axle #1 & 2 C-channel in front of axles.			79.50
3.0	Hours	#3 axle C-channel was broken off, old C-channel that remained was cut out and grinded flat. New C-channel was cut and welded on.			477.00
2.0	Hours	Replaced axles chains on both sides of axle #1 & 3. Replaced broken H-clevis on #2 RHS axle chain.			318.00

3% will be applied to ALL
 VISA and DEBIT transactions

Subtotal
GST
Total



8510 - 105 Street
 Clairmont, AB
 T8X 0S6
 fulltilt@telus.net

Invoice

DATE	INVOICE #
2025-05-08	7680

INVOICE TO:
T-ruckin Oilfield Services Box 448 Station Main Grande Prairie, AB T8V 3A7

PO #

GST # 843519372

YEAR	MAKE / MODEL	SERIAL #	UNIT #	MILEAGE / HOURS	LICENCE #
2007	Gerry's Low Bed	125073	LB04		6GF850
QTY	Item	DESCRIPTION			AMOUNT
0.6	Hours	Greased all the brakes, extracted broken grease zerk on #3 RHS slack adjuster and installed new zerk.			95.40
0.6	Hours	Diagnosed ABS light. Found corroded plug on LHS WSS. Cut out plug and spliced wires.			95.40
	Shop Supplies	Shop Supplies			282.38
1.0	G1003	Amber LED Marker Light			12.90
1.0	67050	2-wire pigtail			3.75
2.0	Grease	Tubes of Grease			21.58
1.0	Litres 75W90	Gear Oil			13.89
1.0	592651	Cam Shaft			128.77
1.0	606	3/8 Midlink			10.16
1.0	608	1/2 Midlink			20.72
5.0	Feet	3/8 Chain			31.80
5.0	Feet	1/2 Chain			61.60
1.0	E10936	Cam Tube			79.56
4.0	85938	Shocks			342.96
4.0	523642	Shock Bolt Kits			360.00
4.0	714707QPK	Brake Shoes			262.80
4.0	SSD6722	Brake Drums			484.08
4.0	E15017B	Auto Slack Adjusters			418.80
2.0	E886	Dustshields			51.10
1.0	372-7097	Wheel Seal			58.08
1.0	E7220	Camshaft RHS			62.88
60.0	Inches	3" Channel			88.40
		GST on sales			328.80

Subtotal \$6,576.01

GST \$328.80

Total \$6,904.81

3% will be applied to ALL
 VISA and DEBIT transactions