



Description of Work Performed:

\* Parts for exhaust \*  
delete

- P235797 - Donaldson  
P235797-016-147  
Flange to DOC

3 = clamps 33970 5"  
= Torcite 33225 stainless

1 = clamp 35228 5"

# = Muc 5R # 1 = clamp Tectran 5"

1 = 41899 5" x 8" long  
connector

1 = 41532 elbow 90° 5" TO  
12x12

- Walker? 6 Radius  
Aluminized


- used this Walker  
Resonator 21835 Fort Barry

**WALKER**

01 24178  
MADE IN  
USA

Resonator

COMMERCIAL  
VEHICLE

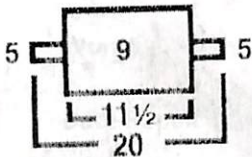

**21835**





Dale Croswell Construction

Phone: (780)398-3568

Fax: (780)398-2548

P.O. Box 690

Thorhild, AB T0A3J0

Vehicle/Equipment Maintenance Log

SCANNED

\*MC500\*

Date: \_\_\_\_\_

Unit #: \_\_\_\_\_

- ushersal -

KM: \_\_\_\_\_

HRS: \_\_\_\_\_

- Zink Plate -

Description of required work: \_\_\_\_\_

452-7975 Adam

- Grind Flange = on Truck 5" No basket
- Shiny over stainless
- 9624 - Donaldson clamp
- Janet -

Repair Requested by: \_\_\_\_\_

- Fort Garry

Quantity	Part Number/Description		
	- Janet = MD	#	# Fort Garry #
	#124		
21.45	- 21835 ✓ Resanator	-	Need -
# 23759 #	- 33225 ✓ = 6		- 20 # -
		stop clamp	
Cody	- Muc 5R = 3		
Walker	- 33905 = 3		
John Fort Garry	- 35906 = 4		





Description of Work Performed:

MD  
Did Delete on truck  
ECM

- We put exhaust pipe and parts in place
- Remove DPF system
- New Bellows
- New Hyd Coupling truck to Quad
- New Fuel Filter
- Replace 2 Hub site glass on Quad

Work Performed by: \_\_\_\_\_

Date Repair Completed: \_\_\_\_\_



Description of Work Performed:

- clutch peddle STIFF
- box lights out.
- Both windows cracked \* OK till cup.\*
- Bumper Bling lights out.
- L side cb coax light out.
- Pressure gauge on 3880 cracked & foggy.
- Right Mirror light out.
- Rear lights above mudflap tongue protector out.
- Should replace Lic plate Last bit missing on truck
- Driver side Rear box light out @ rear
- Both front Shocks leaking \* OK till cup.\*
- P/S hose leaking
- exhaust manifold leaking
- Air leak behind cab
- Transmission oil cooler coolant line leaking
- Install brake stroke indicators on truck & trailer.
- Rear crossmember cracked below the 3 peanut lights
- dump box cylinder leaking.
- clean up batt terminals & Blocks
- change hyd fluid @ cup
- install Brake stroke indicators on trailer
- All Halder pins on converter are worn out
- Left rear slack adjuster
- Replace drain on tank leaking.
- Replace broken dump box side board left side
- Replace Left front air bag on converter to cords
- Lift cylinder on converter won't take grease.
- Front brakes on trailer Seized.

Work Performed by: Inspected by Kirk / repairs

Date Repair Completed: \_\_\_\_\_

**Vehicle/Equipment Maintenance Log**

Pg # 1

Date: Apr 7/25

Unit #: 21-35

KM: 809519

HRS: 3660

- Description of required work: - cup unit.
- Replace headlights
  - Hitch Solenoid not releasing
  - Pintle needs replaced seized
  - Replaced seat belt, R F wheel Seal leaking

Repair Requested by:

- 1 DW1164-30 Driver window
- 1 DW1163-30 Pass window

Quantity	Part Number/Description	
2	B71-6009 Front shock	
2	10-20196 high beam	
2	10-20197 low beam	
1	382-8064 wheel seal	
1	225B-604CC Valve. mac	
1	N-80925 hubs cap gasket	
2	(P) X011622 Air filter	
1	St-530014399 mirror lens	
1	RM-505 wheel seal	
1	Premier hitch	
1	ABP N74B 12801 Convex mirror	
24"	HAB8 1/2" Air brake hose	
1	12-006 Service glad hand	
2	1/2" rubber / 3/4" Npt. Spring fittings	
1	center fuse Drum	1-584-1070-400 Seat belt
1	ABPMK4709E2 23 PREM brake shoe	1-5008414PG Air dryer
1	FD711 Drive tire.	
2	33mm. hex wheel nut.	1-73040 Back up alarm
1	K022105 Purge Valve.	

Description of Work Performed:

- Replace drivers window & passenger window
- Rear plate cracked
- Rear Gate cracked.
- change air filters
- Right stack guard cracked & Left side
- Tarp off to Y Side
- Lic plate missing Last didget.
- Replace Seat belt.
- Replace Left rear mud flap
- Replace Hitch Solenoid not releasing air
- Reverse Back up alarm not working
- All headlights water behind lenses
- exhaust leak @ manifold
- Replace Front Shocks leaking
- Replace Pintle seized
- Replace Front Right wheel seal
- Replace Left side box board
- Remove all bottom lights on box & clean out.
- Coolant leak @ transmission cooler
- Rotate Street tires.
- Replace Rt convex mirror
- Replace Service air line for pop to cords
- Replace 4th axle Right inner tire
- Replace 4th axle Right Drum / Shors cracked.
- Replace Flat tire 3rd axle Right outer.
- Repair leak in tire replaced valve core. 2nd axle Right side.
- 2nd axle left side Replace wheel stud threads pulled
- change purge valve.
- change Air dryer cartridge

Work Performed by: Inspected by Kirk

Date Repair Completed: Apr 11/25

21-35

Tires				Drum & Shors	
8	10	11	12		
7	12	7	⑧	420.58	420.19
				16	16
				419.64	419.19
				16	15
				419.76	419.19
				20	18
				420.23	419.54
				15	21



Description of Work Performed:

- Repair mirror light lens broke
- Replace pig tail on mirror light melted
- LIC plate light out
- Bottom Bumper lights out Right side
- Torque wheels
- Grease unit
- check levels

Work Performed by: Inspected by Kirk

Date Repair Completed: Apr 11/25

Start  
Finish May 27/25

Master Repair

102017 hrs

826524 Km

7121-35

Description of Work Performed:

- ~~Replace transmission~~ \* New Re build Ka \*
- ~~Re locate transmission cooler~~ \* - New easy Petal clutch \*
- Replace mac valve for pintle
- Replace pan heater.
- change oil
- change filter
- change Left steer tire
- install Samsara camera.  
# HW-VG55-NA SN GMXM4-VGC-3WF
- camera HW-CM33, SN GX8M-8YK-W27

- Replace 3 Hyd line

- Pump to Control Valve
- Control Valve to tank
- Control Valve to Cylinder
- Fix air line Hyd Control Valve
- Full Dash Cam

- \* one New steer tire left Side \*

- 1 - CS106C149S clutch shaft
- 1 - K210-883 clutch shaft
- 2 - H4B-3-44C-L5C air line
- 1 - 225B-604CC - mac valve
- 1 - 10094142 - steady bearing

- 1- fly wheel machining
- 1- Transmission
- 1- K4148 Speed Sensor
- 1- CF105C137 clutch fork
- 1- 21-467P Reverse switch
- 1- Q21-1002 Temp Sensor
- 3- Grease hose
- 1- PT2000XEN011RA PTO EATON
- 1- P5151A224AAZA25 Pump
- 1- K3966 heat exchanger
- 1- 250-4-271-1 Yoke (back of transmission)
- 1- E65-1041-0492000 clutch linkage
- 1- K202-2002-01 clutch linkage
- 2- SPF63 clutch linkage end.
- 1- 351-0415 engine heater
- 1- " Hankook Steer tire

Work Performed by: Kirk & Carter

Date Repair Completed: \_\_\_\_\_



Description of Work Performed:

- oil change
- Grease Job
- Add fresh oil
- Run check & leaks
- check All Hub oils

Work Performed by: \_\_\_\_\_

Date Repair Completed: \_\_\_\_\_



Description of Work Performed:

- Replace #2 U Bar drive Axle

U Bar

- Fix light Issue  
Rubbed Wiper

- steering Wheel Way out

- Remove Re straight.

- Fix stea wheel Hous

Work Performed by: \_\_\_\_\_

Date Repair Completed: \_\_\_\_\_



Dale Croswell Construction

Phone: (780)398-3568

Fax: (780)398-2548

P.O. Box 690

Thorhild, AB T0A3J0

Vehicle/Equipment Maintenance Log

Date: Nov 3/25

Unit #: 21-35 Terry

KM: 898, 890

HRS: 501.0

Description of required work: Quad Air Pot leak / Right Cover Mirror  
- Right Rear Trunk Light / oil Pan heater  
- Bling Bling lights  
- low Beam light dim  
- clutch Pedal stiff  
- Rough Idle

Repair Requested by: \_\_\_\_\_

#3231#

Quantity	Part Number/Description	
<del>1</del>	<del>Rad</del>	<del>✓</del>
<del>1</del>	<del>Top Bottom Rad hose</del>	<del>✓</del>
<del>1</del>	<del>Rad Rubbers Bottom</del>	<del>✓</del>
<del>1</del>	<del>Air to Air Rubber</del>	<del>✓</del>
<del>1</del>	<del>Air to Air Air Boots</del>	<del>✓</del>
<del>4</del>	<del>Coolant sensors OEM</del>	<del>✓</del>
<del>1</del>	<del>FAN / AC Belt</del>	<del>✓</del>
<del>1</del>	<del>Rad Cap Both</del>	<del>✓</del>

head fifth wheel kit

Description of Work Performed:

- \* Install New RAD
- \* Install New Air to Air Rad
- Install Various Hose & Coolant lines
- fill With Coolant
- oil change and filter
- Install Weld New Fender Bracket for #1 Axle left side on Quad
- Install These Tires  
Tough to Spe
- Clean lights on Quad  
Inspect
- Replace Air Pot Quad  
#3 Axle left side

Work Performed by: \_\_\_\_\_

Date Repair Completed: \_\_\_\_\_







ND + GRAVEL + CONCRETE  
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: ~~4:30~~ Dec 4 2025 Unit #: 21-35, 3099 @ward  
Start Time: 4:30 pm KM: 910 & 26  
End Time: 6:30 pm Hours: 5196  
Completed Date: Dec 4 2025 Technician: Tony

Description of Work Performed:

Change trailers for CUIP  
- Test

SCANNED





AND + GRAVEL + CONCRETE  
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: ~~10:00~~ Dec 10 2025

Unit #: <sup>Teri</sup> 21-35

Start Time: 10:00 Am

KM: \_\_\_\_\_

End Time: 11:00 Am

Hours: \_\_\_\_\_

Completed Date: Dec 10 2025

Technician: Tony

Description of Work Performed:

Replace Female 7 wire  
~~Rept~~ Fix male 7 wire

SCANNED

Lined area for notes or additional information.

Parts Used:

Female 7 wire

Part Number

—

Signature:

*[Handwritten Signature]*



ND + GRAVEL + CONCRETE  
Division of Dale Croswell Construction Co. Ltd.

Work Order

Start Date: Dec 11 2025 Unit #: 21-35  
Start Time: 11 30 Am KM: 914 246  
End Time: 12:00 pm Hours: 525 5  
Completed Date: Dec 11 2025 Technician: Tony

Description of Work Performed:

Stack bushing broke  
- Replace bushing and kit

SCANNED

Parts Used:

Part Number

Exhaust mount bushing kit  
Exhaust bushing

EM75-69000-HT  
M13109

Signature: 



ROAD + GRAVEL + CONCRETE  
Division of Dale Croswell Construction Co. Ltd.

Work Order

Start Date: Dec 11/2025 Unit #: 21-35 Terry  
Start Time: 10:00 Am KM: \_\_\_\_\_  
End Time: 12:00 Pm Hours: \_\_\_\_\_  
Completed Date: Dec 11/2025 Technician: \_\_\_\_\_

Description of Work Performed:

- Muffler Stack loose
- Install New Hardware
- Fix Air leaks on trailer

SCANNED





ROAD + GRAVEL + CONCRETE  
Division of Dale Croswell Construction Co. Ltd.

Work Order

Start Date: Dec 18 2025 Unit #: 21-35  
Start Time: 4:00 pm KM: -  
End Time: 5:30 pm Hours: -  
Completed Date: Dec 18 2025 Technician: Tony

Description of Work Performed:

Head light fault  
- Further Diag required

SCANNED





ND + GRAVEL + CONCRETE  
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Dec 19 2025

Unit #: 21-35

Start Time: 7:00 AM

KM: 916 941

End Time: 1:30 PM

Hours: 53 00

Completed Date: Dec 19 2025

Technician: Tomy

Description of Work Performed:

Repair various lights

SCANNED

Parts Used:

Part Number

Amber 3 wire round light	60275y
Cone Amber light x2	30276Y
2 wire clearance light Quad harness	0500166

Signature: 



ND + GRAVEL + CONCRETE  
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Jan 10 / 2026

Unit #: 21-35 Terry + Quad 3990

Start Time: 7:00 Am

KM: 919,393

End Time: 5:00 Pm

Hours: 5,348

Completed Date: JAN 10 / 2026

Technician:

Description of Work Performed:

- oil change And filter

- Add Fresh oil

- Run check for heater

- Replace 2 Wiper Blades

- Repair Various Wire Problems

ON Right Side Steer Tire

- Head light Area

- # 2 Axle left Side Replace Service line on Air Pat

- Lube All

- Change five Tires

# 3 Axle Tires

- Good Used Tire

Torque to Spec

SCANNED

\* Re torque Tire # 3 Axle \*  
Tuck on the 12<sup>th</sup> JAN 2026

- Replace Ser vice line on
- # 2 Axle Quad left side

Tony

Parts Used:

43 L

1<sup>st</sup> oil filter

1 = 681866 Tectan

2 =

Part Number

15W/40 Engine oil

LF14000 NW

36" 1/2 Air line

Wiper Blades, Trico  
- 66-150

Signature:

Tony / Day



ROAD + GRAVEL + CONCRETE  
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Jan 18 2026

Unit #: 21-35 + 3880 Quod

Start Time: 2:00 PM

KM: 922964

End Time: 2:30 PM

Hours: 5405

Completed Date: Jan 18 2025

Technician: Tony

Description of Work Performed:

Drive broke both service glad hands  
- Replace

SCANNED

**Parts Used:**

service gear hand x 2

**Part Number**

81-0001 - B

Signature:



## Work Order

Start Date: Feb 2 2024

Unit #: 21-35

Start Time: 7:00 AM

KM: 930352

End Time: 4:30 pm

Hours: 5528

Completed Date: Feb 2 2024

Technician: Fony + Carter

### Description of Work Performed:

oil change ✓ - Service

✓ Right steer tire

- Fix Trunk Mud Flap

- Fix Quad Mud Flap

✓ Tighten Trunk Tail Gate  
Quad Tail Gate

- Drain old oil and remove old oil filter
- Fill with new oil and install new oil filter
- Run

### Grease job

### Fuel filters

- Remove old fuel filters
- Install new fuel filters
- Prime 20x
- Run

Change Right steer tire

Adjust tailgate locks

Fix mudflap

Top up hub oils.

Fony + Carter  
Terry

Parts Used:

oil filter  
~~45L~~ 15-40 oil  
Fuel filter  
Fuel water seperator  
Big steer tire  
2x tail gate adjusters

Part Number

LF14000N  
FF5825N  
ES20172  
22.5 Hankook

Signature: APurba



ND + GRAVEL + CONCRETE  
Division of Dale Croswell Construction Co. Ltd.

Work Order

SCANNED

Start Date: Feb 2

Unit #: 21-35

Start Time: 7

KM:

End Time: 5

Hours:

Completed Date: Feb 2

Technician: Carter

Description of Work Performed:

Service:

- oil change

- grease job

- Fuel Filters changed

passenger steer tire replaced

tailgate latches adjusted on truck and trailer





SAND + GRAVEL + CONCRETE  
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Feb 8/26

Unit #: Terry 21-35

Start Time: 2:00 Pm

KM: 933585

End Time: 4:00 Pm

Hours: 5574

Completed Date: \_\_\_\_\_

Technician: \_\_\_\_\_

Description of Work Performed:

- Grease front Ends

- Fix light

- Track mid Box Right Side

- Quad light Repair left Side  
Converter

- Quad left Side Rear 2"

SCANNED

*[Faint handwritten notes and scribbles across the top section of the page]*

**Parts Used:**

**Part Number**

*[Empty lined area for recording parts used]*

*[Empty lined area for recording part numbers]*

**Signature:**

*Matthew Davy*



ND + GRAVEL + CONCRETE  
Division of Dale Croswell Construction Co. Ltd.

Work Order

Start Date: Feb 18 2026

Unit #: 21-35

Start Time: 4:00pm

KM: 938 928

End Time: 4:30pm

Hours: 5660

Completed Date:

Technician: Tony / Mathew

Description of Work Performed:

No air bag dump  
- Plug loose  
Air leak  
- Red glad hand  
- Replace and test

SCANNED

Parts Used:

\$ Red Glad hand

Part Number

\_\_\_\_\_

Signature:

*APuckert*



AND + GRAVEL + CONCRETE  
A Division of Dale Croswell Construction Co. Ltd.

Teri

Work Order

Start Date: Feb 25 2026

Unit #: 21-35

Start Time: 5:00pm

KM: 5727

End Time: 5:30 pm

Hours: 942989

Completed Date:

Technician: Tony

Description of Work Performed:

Flat drive tire Right Side Inside 2nd drive axle

- Replace with a good used one
- Torque to 500 FT/lbs
- Torque tag in cab

SCANNED

Parts Used:

Part Number

good use tire and rim (Drive 24.5)

Signature:

ADuebnr



ND + GRAVEL + CONCRETE

A Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Feb 26/26

Unit #: 21-35 Terry

Start Time: 5:00 pm

KM: 943871

End Time: 5:30 pm

Hours: 5740

Completed Date: \_\_\_\_\_

Technician: \_\_\_\_\_

Description of Work Performed:

- Re Torque After one shift

Truck - #3 Axle Right Side

- 500 Ft/lbs

SCANNED





AND + GRAVEL + CONCRETE  
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Mar 6 2024

Start Time: 11:00 AM

End Time: 5:00 pm

Completed Date: \_\_\_\_\_

Unit #: 21-5335

KM: 94938

Hours: 5824

Technician: Tony + carter

Description of Work Performed:

Coolant leaking everywhere

- Test

- Find head gasket problem

- EGR ~~box~~ cooler leaking

- Change air filters

- Send for wash to go to kenworth

SCANNED

ENTERED


Parts Used:

Air filters x2  
Exhaust gasket

Part Number

AF4197  
2866636

Signature:





ND + GRAVEL + CONCRETE

A Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Mar 15 2026

Unit #: 21-45

Start Time: 2:00pm

KM: 952699

End Time: 6:00

Hours: 16482

Completed Date: \_\_\_\_\_

Technician: Tony

Description of Work Performed:

Water pump leaking  
-TEST

SCANNED

**Parts Used:**

water pump  
~~gas~~ O Ring

**Part Number**

5719751  
3690234

Signature: *AK*



ND + GRAVEL + CONCRETE

Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Mar 17 2024

Unit #: 21-45

Start Time: 5:00

KM: 953949

End Time: 5:30

Hours: 16508

Completed Date: \_\_\_\_\_

Technician: Tony

Description of Work Performed:

~~Replace 6 wire plug~~  
Replace 2nd drive axle left side  
Service brake hose

SCANNED

Parts Used:

Part Number

~~to wire mate plug~~  
~~for~~ Remade service Brake line

Signature: APress