

Description of Work Performed:

Drain old oil and remove oil filter
Add new oil and install new oil filter
Run and test for leaks.
Check trans oil
check drive axle oils
Replace radio unit.
test
Remove old fuel filters
Install new fuel filters
Prime 20x
test.
Grease job truck + trailer.

Work Performed by: _____

Date Repair Completed: _____

April 24, 2025

Description of Work Performed:

unit 21-40 - Hyd line fail

- Replace Hyd line

- from Pump to Hyd Tank

X Pressure line X

- Re fill Hyd Tank

- Grease All

- Replace both Right Stack Bushing

- *3453* End Dump

- Replace All Stack adjuster
Anchor Blocks, and Pins
to New style!

- Re set Brakes

- # head #*3452*

- Replace 2 Tires # 2 Axle Right Side
- Torque to 500 ft/lbs

- Replace Stack Adjuster Anchor
Blocks, + Pins

Work Performed by: _____

Date Repair Completed: _____

Description of Work Performed:

- Replace one steer
- Tire Right Side
- No Rim Removed

Work Performed by: _____

Date Repair Completed: _____



SAND + GRAVEL + CONCRETE
Division of Dale Croswell Construction Co. Ltd.

SCANNED

Master Repair Km. 638484
Hrs. 10540.3

#21-40

Description of Work Performed: May 21/2025

- Replace Fan hub
- Replace Left Front Steer tire

- 1- 79A9798 Fan hub
- 1- D84-1000-6061620 A/c belt.
- 1- D84-1000-6122310 Fan belt.
- 1- Michelin 11R24.5 steer tire

ENTERED

Description of Work Performed:

All New Shoes and Drums installed all 3 axles

All New stacks installed on drive axles

Set 5th wheel bars

Performed CRIP inspection + measurements (Wheels OFF)

Repaired RR Tire

Installed New Level rover extension Valves

Repaired air leaks

Installed New Classi' Mode

Replaced LF Funden marker signal

New air Drier Filter + Pump Valve

-Checked all Levels

New Cab Air Filter

Installed New Wire + Plug

Installed New DMG Link

Fixed wiring

Fixed air leaks

Torqued Tires

Fixed traction control New Load solenoid wiring

New Front Shocks + Rear Shocks 2

Rechecked Lights

Greased entire truck

Cleaned Fuel Tank Breathers

Set all Brakes To 2mm

Checked all suspension + steering

Checked all Linkages / Functions

Checked air system / Bridle test

Checked all Warning Devices

Checked all in cab functions / optional warnings

Checked over Power train

Work Performed by: Paul Carson / Josh

Date Repair Completed: June 4 2025

Description of Work Performed:

- Install New Power
Steer Box
TAS65219 From law
Capital Gear
- Set up
- oil change and filter
- Add fresh oil
- Run check for leaks
- Repair 6 wire on Tank Motor

Work Performed by: _____

Date Repair Completed: _____

Description of Work Performed:

- Replace Heater Motor

- Fix Belts for Walking Deck End Dump.

-

Work Performed by: _____

Date Repair Completed: _____

Description of Work Performed:

- Coolant Leak Pressure System
- Test Coolant System
- Truck Hyds Locked
- Inform Perry
- unhook -
- Replace Both Air Filters
X011622

Work Performed by: _____

Date Repair Completed: _____



ROAD + GRAVEL + CONCRETE
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Nov 25/25

Unit #: 21-40 Key

Start Time: 5:00 PM

KM: 701,732

End Time: 7:00 PM

Hours: 11571

Completed Date: Nov 25/

Technician: _____

Description of Work Performed:

- Replace Air shifter
on Pump!

- Fuel dump would not
lift

- Test = Normal

ENTERED
SCANNED


Parts Used:

APSCO

Part Number

- C-3505-DM

Signature:

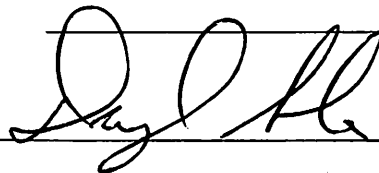A handwritten signature in cursive script, appearing to read "D. J. H.", written over the signature line.



ND + GRAVEL + CONCRETE
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Dec 7 2025

Unit #: 21-40 + 3183 Endump

Start Time: 3:00 pm

KM: 707007

End Time: 5:30 pm

Hours: 11678

Completed Date: Dec 7 2025

Technician: Tony

Description of Work Performed:

Check ride height on endump

- Good

High beam on truck not working

- Find broken wire

- Fix and test

Install pole on endump

Check block heater cord

- A little burnt but wasnt fully plugged in

- need new end

SCANNED



ND + GRAVEL + CONCRETE
ion of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Dec 8th 2025

Unit #: 21-40

Start Time: 3:00

KM: 707481

End Time: 4:30

Hours: 11687.3

Completed Date: Dec 8th 2025

Technician: JR / Josh

Description of Work Performed:

- Wiped Headlights to both be on when highbeams are on
- Replaced passenger side low beam
- looked at junction box for headlight pack for 4way and brake light issue

SCANNED

Parts Used:

4X6 HEADLIGHT

Part Number

10-20196

Signature: _____



ND + GRAVEL + CONCRETE
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Dec 13 2025

Unit #: 21-40

Start Time: 4:00 pm

KM: 709796

End Time: 7:00 pm

Hours: 11754

Completed Date: Dec 13 2025

Technician: Tony

Description of Work Performed:

- Block heater cord melted
- Test element
- Failed
- Replace heater element and cord

SCANNED

Parts Used:

Block heater cord
Block heater element

Part Number

D92-6360-2000W
351-0474

Signature: *APM*



ROAD + GRAVEL + CONCRETE
Division of Dale Crosswell Construction Co. Ltd.

Work Order

3705 End dump

Start Date: JAN 12 / 2026

Unit #: 21-40 / Ken

Start Time: _____

KM: 713 223

End Time: _____

Hours: 11,830

Completed Date: _____

Technician: _____

Description of Work Performed:

- oil change
- New Filter
- Add Fresh oil
- Run check for leaks
- Grease All

SCANNED

Parts Used:

43 L

- LF1400 MW

Part Number

15W 40 oil

oil filter

Signature: _____

Dayl



LAND + GRAVEL + CONCRETE
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Jan 6 2025

Unit #: 21-40

Start Time: 2:00 pm

KM: 713225

End Time: 5:00 pm

Hours: 11838

Completed Date: Jan 6 2025

Technician: Tony

Description of Work Performed:

Ujoint has lots of play
Remove driveshaft
prep Ujoint removal

SCANNED



ND + GRAVEL + CONCRETE
vision of Dale Croswell Construction Co. Ltd.

Work Order

Start Date: Jan 7 2025

Unit #: 21-40

Start Time: 7:00 AM

KM: 713225

End Time: 12:00 pm

Hours: 11838

Completed Date: Jan 7 2025

Technician: Tony

Description of Work Performed:

Ujoint on ~~3rd~~^{2nd} driveshaft input to first
Diff lots of play

- Remove
- Install new one
- Grease

Remove first diff v bar assembly

- Install new one

SCANNED

Parts Used:

Vjoint
Strap kit
VBar hardware kit
- Bolt
- 2x washers flat
- 2x spacers
- 1 locknut
VBar

Part Number

~~S~~ SPL 250-3X
SP 250 70 18x

93004289
93600168
93608561
93400502
801V/ATR TR57 44992

Signature: _____





IND + GRAVEL + CONCRETE
A Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Jan 28 2026

Unit #: 21-40 Ken

Start Time: 9:00am

KM: 724374

End Time: 2:00pm

Hours: 12,078

Completed Date: Jan 28 2026

Technician: Matthew

Description of Work Performed:

- inspect driveline and whole trailer
- fix penny lights on truck
- Make new harness for bumper penny lights
- Make new harness for pass side air cleaner light
- new pass side air cleaner light

SCANNED

Parts Used:

Part Number

-Yellow penny light x 7

-01-4947-82

-Red penny light

-01-4947-72


-Air cleaner light

-GG#81776?

-5ft^{of} double terminal harness

-D604

Signature:

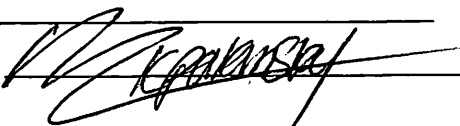



SAND + GRAVEL + CONCRETE
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Ken

Start Date: Feb 9/2026

Unit #: 21-40

Start Time: 7:00 am

KM: 730,253

End Time: 9:00 Am

Hours: 12,182

Completed Date:

Technician:

Description of Work Performed:

- oil change

- Lube Job

- Replace left Side Hood
Signal light Assembly

Test

Add fresh oil

Run check for leaks

ENTERED
2.9.2026

Parts Used:

- 43 L
- Signal light
- oil filter

Part Number

- 15/40 Bulk Oil
- G 5543
Grote
- LF 14000 NW

Signature:

Matthew / Daryl



ND + GRAVEL + CONCRETE

Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: March 4, 2026

Unit #: 21-410

Start Time: 7

KM: _____

End Time: 7

Hours: _____

Completed Date: March 4, 2026

Technician: Carter + Daryl

Description of Work Performed:

replaced crank shaft sensor
repaired damaged wire for harness

SCANNED

Parts Used:

Crankshaft position sensor

Part Number

5594275

Signature:

Carsten Kriem



AND + GRAVEL + CONCRETE
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Mar 8 2026

Unit #: 21-40

Start Time: 11:00 AM

KM: 743 746

End Time: 6:00 pm

Hours: 1245^h

Completed Date: _____

Technician: Tony

Description of Work Performed:

Repair Air cleaner light harness

Power steering pump leaking

- Need gasket

Repair Left side Highbeam harness

Oil change

- Drain old oil remove old oil filter
- Fill with new oil Install new oil filter
- Run

Fuel filter

- Remove ~~fuel~~ old fuel filters
- Install new fuel filters
- Prime 20x
- Run

Grease job

Truck driver complains of air leak

- Found nothing

SCANNED

Parts Used:

Part Number

~~oil filter~~
15-40 oil Jug x 5
15-40 oil pail
Fuel filter
fuel seperator filter

LF1400NN

FF5825NN
FS 20172

Signature: *ADrew*



ND + GRAVEL + CONCRETE

A Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: Mar 13 2026

Unit #: 21-40

Start Time: 2:30 pm

KM: 683096

End Time: 5:00

Hours: 13842

Completed Date: _____

Technician: Tony + carter

Description of Work Performed:

~~PS~~ Right side steer tire, changed on rim
 Oil change
 - Drain old oil remove oil filter
 - fill with new oil install new oil filter
 - Run
 Fuel filters
 Grease job

SCANNED

Parts Used:

Part Number

oil filter

LF 14000NN

Fuel filter

FF 5825NN

Fuel water separator

FS 20172

457 1540 oil

steel tire skinny

Signature: 



IND + GRAVEL + CONCRETE
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date:

March 23/2026

Unit #:

March 23/2026 Ken 21-40

Start Time:

6:00 pm

KM:

751,366

End Time:

9:00 pm

Hours:

12,611

Completed Date:

Technician:

Description of Work Performed:

- Brake Fail

3 Axle LEFT Side

- Remove Tires/drum, Brakes

- Install New Brakes shoes

- New drum

- Set Brakes

- Install Tires

- Torque to spec

- 500 Ft/lbs

SCANNED
3-24-2026

Parts Used:

- Brake Shoes

Part Number

4709

- Brake drum

- light Weight - PF8018X

Signature:

Tony / Carter / Davy



ND + GRAVEL + CONCRETE
Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: March 24/2026

Unit #: Ken ~~2140~~ / ~~3705~~

Start Time: _____

KM: ~~13~~ 752,349

End Time: _____

Hours: 12629

Completed Date: _____

Technician: _____

Description of Work Performed:

- Driver Did Re torque
AT Home !!!

3 Axle left side
Truck !!!

After Tires where off

March 24 2026

* End Dump * ~~#3705~~ #

Driver Did Re Torque At Home

2 Axle Right Side

SCANNED



ND + GRAVEL + CONCRETE

A Division of Dale Crosswell Construction Co. Ltd.

Work Order

Start Date: March 31/2026 Unit #: 21-40 / Ken

Start Time: _____ KM: _____

End Time: _____ Hours: _____

Completed Date: _____ Technician: Dayl

Description of Work Performed:

- Unit Return After
one shift

2xle Right Side Re Torque Trunk Tire
- 500 Ft/lbs

SCANNED

