

Screwdriver Creek Mechanical

1989 PO Box 1989

Pincher Creek AB T0K 1W0

cox.matthew13@gmail.com

GST/HST Registration No.: 84192 4392 RT0001

EG17-2

INVOICE

BILL TO

Vicary Resources Inc

INVOICE 526
DATE 04/06/2025
TERMS Net 15
DUE DATE 19/06/2025

PAYMENT METHOD
Direct Debit

SERVICE	DESCRIPTION	TAX	QTY	RATE	AMOUNT
Services	May 3 2025 290 @ 14257.9 HR Change hose end for aux hydraulics on end of stick , Blow out radiator, blow out air filter, VR-02 @32132 HR Check AC system, repair, vacuum and charge system VR-04 Check AC system, repair, Vacuum and charge system	GST	7	120.00	840.00
1AA12FJB12	dash 12 90 JIC fem for -12 hose	GST	1	80.20	80.20
Services	May 6 2025 VR-04 check unit , scan truck VR-02 Check unit check wiring for end dump bags and gate	GST	2.50	120.00	300.00
Services	May 8 2025 VR-04 @907615KM Program power upgrade, disable VIA	GST	2	120.00	240.00
Programing	Caterpillar engine program	GST	1	880.00	880.00
Services	May 16 2025 VR-04 @742 HR Do valve set, change out jake heads, set Jake clearance, assemble, test drive	GST	6.50	120.00	780.00
Services	Extra Mechanic for May 16	GST	3.50	65.00	227.50
Services	May 21 2025 VR-04@ 748 HR Change Jake heads back to original, set Jakes, test VR-02 Valves VR-03	GST	4	120.00	480.00

	Check over engine, change clamp position and correct bad boot clamping				
Services	Extra Mechanic for may 21	GST	2.50	65.00	162.50
Services	May 24 2025 VR-02 Valve set, check jake springs, Injector Set, Intake Valve actuator set, Jake set, oil pan bolt check and torque, Test run , found some choppy fuel delivery under load cold	GST	6	120.00	720.00
Services	May 26 2025 VR-02 Run cutout test for noisy injector, test run, fuel injector noise loud, missing	GST	2	120.00	240.00
Services	May 27 2025 VR-04 check unit VR-03 Check unit	GST	1.50	120.00	180.00
Services	May 30 2024 VR-05 ABS codes, try to communicate, finding coms between ecu and laptop not good, test circuits, find ecu code indicating failure, found code for lh extra axle sensor, test sensor, passed test, check all fuses for ecu,, will need to open dash to access ecu	GST	2	120.00	240.00

SUBTOTAL	5,370.20
GST @ 5%	268.52
TOTAL	5,638.72

BALANCE DUE **\$5,638.72**

TAX SUMMARY

	RATE	TAX	NET
	GST @ 5%	268.52	5,370.20

Truscott Heavy Equipment Repairs

6 Blackfoot Court West
Lethbridge AB T1K 7P5
Truscottm7@gmail.com
GST/HST Registration No.: 852833474

INVOICE

BILL TO
Vicary Resources Inc

INVOICE 2304 290
DATE 31/05/2025
TERMS Net 30
DUE DATE 30/06/2025

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
20/05/2025	Services	290G: Go to Quarry and remove windshield and take to Elkford glass, can't change. Order glass thur Brandt 14332 hrs.	3.25	105.00	341.25
22/05/2025	Services	290G: Assemble windshield install back into machine, check over machine.	2	105.00	210.00

SUBTOTAL	551.25
GST/HST @ 5%	27.56
TOTAL	578.81
BALANCE DUE	\$578.81

TAX SUMMARY	RATE	TAX	NET
	GST/HST @ 5%	27.56	551.25

Screwdriver Creek Mechanical

1989 PO Box 1989

Pincher Creek AB T0K 1W0

cox.matthew13@gmail.com

GST/HST Registration No.: 84192 4392 RT0001

INVOICE

BILL TO

Vicary Resources Inc

INVOICE 522
DATE 05/05/2025
TERMS Net 15
DUE DATE 20/05/2025

PAYMENT METHOD
Direct Debit

SERVICE	DESCRIPTION	TAX	QTY	RATE	AMOUNT
Services	Apr 4 2025 VR-02 @ 19185 HR Travel to site, remove, cut and crimp new swivle end on hose, check for ABS codes, hook up scan tool, open on sensor, check at snesor, check at ecu, check connection qaulity, found loose fit, coat in dielectric grease, codes gone	GST	3.50	120.00	420.00
Services	Apr 5 2025 290@14158 HR replace radio in unit, check for leak, check other fluid levels	GST	2	120.00	240.00
Services	Apr 7 2025 290 @14162 HR Pull out 20L of over full hydraulic fluid, add engine oil	GST	1.50	120.00	180.00
Services	Apr 12 2205 290 weld bucket tooth pin	GST	1	120.00	120.00
Services	Apr 15 2025 290 @ 14175 Test and repair AC system, change orings, vacuum, charge	GST	5	120.00	600.00
134a	134a Refrigerant	GST	2.66	39.00	103.74
PAG oil	PAG oil w/ dye	GST	1	2.00	2.00
Services	Apr 23 2025 VR-02 @ 32110 HR check over unit VR-03 @ 19264 HR Check over unit	GST	2	120.00	240.00
Services	Apr 25 2025 VR-02 check unit	GST	1.50	120.00	180.00

	VR-03 Check unit				
Services	Apr 29 2025 290 @ 14237 HR	GST	3.50	120.00	420.00
GH781-12	2 braid dash 12 hose	GST	3	19.05	57.15
1AA12FR12	-12 ORFS str for -12 hose	GST	1	106.97	106.97
1AA12FJB12	dash 12 90 JIC fem for -12 hose	GST	1	76.19	76.19
adapter code 61 to JIC -12	adapter code 61 to JIC -12	GST	1	77.00	77.00
Services	Apr 30 2025 VR-03@ 19 291 HR check top end engine noise, found screal from under valve cover, not able to pinpoint, change engine oil and filter, noise better, cut filter, found very little in filter media come back at end of day to check engine noise again, and check unit VR-04 check unit, some weeping on rear two shocks of truck	GST	6.50	120.00	780.00

SUBTOTAL	3,603.05
----------	----------

GST @ 5%	180.16
----------	--------

TOTAL	3,783.21
-------	----------

BALANCE DUE

\$3,783.21

TAX SUMMARY

RATE	TAX	NET
GST @ 5%	180.16	3,603.05

L Broz
Box 73
Hillcrest Alberta T0K1C0
brett.d.linderman@gmail.com
GST/HST Registration No.: 781961750

INVOICE

BILL TO
Vicary Resources

INVOICE 17
DATE 05/04/2025
TERMS Due on receipt
DUE DATE 05/04/2025

SERVICE	DESCRIPTION	TAX	QTY	RATE	AMOUNT
labour	290 EXCAVATOR - check over, oil change, change out filters, replace fan belts 14106.7hrs	GST	23	75.00	1,725.00

SUBTOTAL					1,725.00
GST @ 5%					86.25
TOTAL					1,811.25
PAYMENT					1,811.25
BALANCE DUE					\$0.00
					PAID

TAX SUMMARY			
	RATE	TAX	NET
	GST @ 5%	86.25	1,725.00

Truscott Heavy Equipment Repairs

6 Blackfoot Court West

Lethbridge AB T1K 7P5

Truscottm7@gmail.com

GST/HST Registration No.: 852833474

INVOICE

BILL TO

Vicary Resources Inc

ENTERED

INVOICE

DATE

TERMS

DUE DATE

2280

01/04/2025

Net 30

30/04/2025

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
03/03/2025	Services	290G: Goto Shaw's and pick up 2 tiger teeth and install on digging bucket.	0.50	105.00	52.50
04/03/2025	Services	290G: Goto Shaw's back ordered part suppose to be in. Cut off broken tooth adaptor on digging bucket. Weld thumb pin retainer.	6	105.00	630.00
05/03/2025	Services	290G: Remove hydraulic hose and get new one made. Replace hydraulic hose for thumb.	2.25	105.00	236.25
05/03/2025	Services	290G: Hose hydraulic, thumb.	1	415.69	415.69
10/03/2025	Services	290G: Arc-air cracks along boom and weld cracks, weld on 2 hydraulic tube mounts.	10	105.00	1,050.00
13/03/2025	Services	290G: Weld on tooth adapter to bucket.	5.50	105.00	577.50
SUBTOTAL					2,961.94
GST/HST @ 5%					148.10
TOTAL					3,110.04
BALANCE DUE					\$3,110.04

TAX SUMMARY

RATE	TAX	NET
GST/HST @ 5%	148.10	2,961.94



Invoice #278

31 Jan 2025

BILL TO
VICARY RESOURCES INC.

FROM
Buckshot Mechanical Ltd.
Business Number: 777077140
Box 373
Naicam S0K2Z0
buckshotmechanical@hotmail.com
+13068748490

INVOICE ITEMS	AMOUNT
JAN 29/25 UNIT# 290 JD HOE, PICK UP NEW HOSE IN TOWN TRAVEL TO WAREHOUSE 50, INSTALLED NEW HYD HOSE, RUN CHECK FOR LEAKS, REPLACE 2 MORE O-RINGS, REINSTALL COVERS, 4 hrs x \$155.00/hr	\$620.00
JAN 29/25 SUPPLY HYD HOSE,	\$600.00

Subtotal (excl. GST) \$1,220.00
5% GST \$61.00

\$1,281.00

PAYMENT DUE

MESSAGE
Thanks for your business.

Truscott Heavy Equipment Repairs

6 Blackfoot Court West
Lethbridge AB T1K 7P5
Truscottm7@gmail.com
GST/HST Registration No.: 852833474

INVOICE

BILL TO:
Vicary Resources Inc



INVOICE
DATE 2271
01/03/2025
TERMS Net 30
DUE DATE 31/03/2025

DATE	AMOUNT	DESCRIPTION	QTY	RATE	AMOUNT
24/02/2025	Services	290G: Repair inner door handle. 14044 hrs.	0.50	105.00	52.50
27/02/2025	Services	290G: Check over machine, check oil leaks on engine, turbo return tube connector, tighten hose clamps, replace hydraulic hose at pilot filter, check hydraulic cooler leak.	2.25	105.00	236.25
27/02/2025	Services	43374 hydraulic hose to pilot filter.	1	49.14	49.14

SUBTOTAL 337.89
GST/HST @ 5% 16.90
TOTAL 354.79
BALANCE DUE \$354.79

TAX SUMMARY

RATE	TAX	NET
GST/HST @ 5%	16.90	337.89


Truscott Heavy Equipment Repairs

6 Blackfoot Court West
Lethbridge, Alberta
T1K 7P5

Invoice

Date	Invoice #
2024-11-01	2202

Invoice To
Vicary Resources Inc

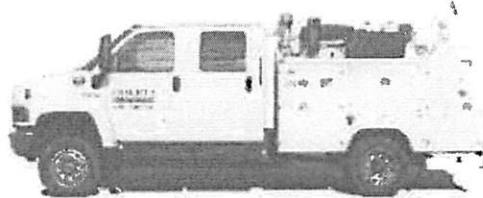

Due Date
2024-11-30

Date	Description	Hours/Qty	Rate	Amount
2024-09-03	290G: Look for thumb hoses and fitting on JD web site.	0.25	105.00	26.25
2024-09-05	290G: Check hydraulic pump pressures, go to Pincher and look for fitting to plumb thumb and install on stick.	6.5	105.00	682.50
2024-10-23	290G: Change light bulb and grease a/c bearing.	0.5	105.00	52.50
	G60130-1612 hydraulic fitting adaptor 16 MP-12FPS U/O 290G	1	12.02	12.02
	15676 Hydraulic fitting to plumb in thumb	1	423.36	423.36
	GST On Sales		5.00%	59.83

I agree to pay on completion of services of machine or on terms satisfactory with you and until paid in full, an express mechanics lien is acknowledged on above machine to secure the amount of parts and repairs thereto. It is understood that Truscott Heavy Equipment Repairs assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, repairs or while field testing.

Received By:

Phone #
1-403-330-7751

truscot@tclusplanet.net

GST/HST No. 852833474

Subtotal \$1,196.63

GST \$59.83

Total \$1,256.46

YG Welding Ltd.

Box 624

Blairmore, AB T0K 0E0

403-394-8774

GST #726668478

ORDER NO.	DEPT.	DATE
SOLD TO Vicary Resources	SHIP TO	9/3/24
ADDRESS	ADDRESS	

[illegible]

583797

SIGNATURE

LIC NO

TOTAL

197

SALES ORDER


Truscott Heavy Equipment Repairs

6 Blackfoot Court West
Lethbridge, Alberta
T1K 7P5

Invoice

Date	Invoice #
2024-09-01	2185

Invoice To
Vicary Resources Inc

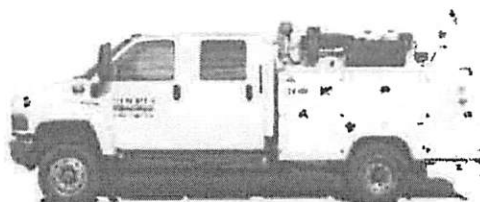

Due Date
2024-09-30

ENTERED

Date	Description	Hours/Qty	Rate	Amount
2024-07-29	290G: Go to BR6 and replace hydraulic hose on hammer attachment, wait for escort and get hose made.	4.25	105.00	446.25
2024-08-01	290G: Go to BR6, replace 2nd hammer hose. Wait for escort and get hose made.	5.75	105.00	603.75
2024-08-07	290G: Go to BR6, pressure test a/c for leaks. Wait for escort in and out.	5.5	105.00	577.50
2024-08-08	290G: Go to BR6, remove a/c compressor not same as replacement. Wait for escorts in and out	5.5	105.00	577.50
2024-08-14	290G: Go to BR6, install new A/C compressor, vac out system, add 1.5 lbs of R134a, check actual engine oil pressure, 68 idle and 80 max RPM. Sensor damaged.	5.75	105.00	603.75
2024-08-15	290G: Go to BR6, weld crack on hammer hydraulic hose. Wait for escorts in and out.	4.25	105.00	446.25
2024-08-19	290G: Go to BR6, wait for escort, repair hydraulic boom tube mounts, remove broken bolt and make 1 mount, remove engine oil pressure switch, new switch wrong item install old switch, wait for escort out.	4.25	105.00	446.25
2024-08-21	290G: Replace engine oil pressure switch, remove final drive covers, check crossover relief valves, weld 3 final drive cover mounts. 290 digging bucket, gouge out cracks on outer teeth and weld in.	10.25	105.00	1,076.25
2024-08-22	290G bucket: Gouge out 2,3 & 4 tooth cracks and reweld, hardsurface bucket.	9.75	105.00	1,023.75
2024-08-23	290G bucket: Gouge cracks and hardsurface worn edges.	4.75	105.00	498.75
	41796 Hydraulic hose used on hammer attachment U/O 290G	2	215.98	431.96
	GST On Sales		5.00%	336.60
	JD290			

I agree to pay on completion of services of machine or on terms satisfactory with you and until paid in full, an express mechanics lien is acknowledged on above machine to secure the amount of parts and repairs thereto. It is understood that Truscott Heavy Equipment Repairs assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, repairs or while field testing.

Received By:

Subtotal \$6,731.96

GST \$336.60

Total \$7,068.56

Phone #

1-403-330-7751

truscot@telusplanet.net

GST/HST No.

852833474


Truscott Heavy Equipment Repairs

Invoice

6 Blackfoot Court West
Lethbridge, Alberta
T1K 7P5

Date	Invoice #
2024-07-01	2155

Invoice To
Vicary Resources Inc

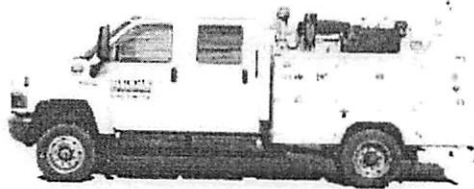

Due Date
2024-07-31



Date	Description	Hours/Qty	Rate	Amount
2024-06-04	290G: Install sensor	0.5	105.00	52.50
2024-06-06	290G: Order filters, hard surface digging bucket.	6	105.00	630.00
2024-06-10	290G: Replace filters and engine oil.	3	105.00	315.00
2024-06-13	290G: Install dust covers on hydraulic quick disconnects	0.5	105.00	52.50
	8WDP 1" W series dust plug U/O excavator hydraulic couplers	2	20.19	40.38
2024-06-24	290G: Hook up hammer	2	105.00	210.00
2024-06-26	290G: Switch out leaking hammer for new rental hammer.	1	105.00	105.00
2024-06-26	290G: Remove chisel bit from first hammer.	0.75	105.00	78.75
2024-06-27	290G: Load up hammer bit and install on second rented hammer and remove broken bit.	2.25	105.00	236.25
	GST On Sales		5.00%	86.02

I agree to pay on completion of services of machine or on terms satisfactory with you and until paid in full, an express mechanics lien is acknowledged on above machine to secure the amount of parts and repairs thereto. It is understood that Truscott Heavy Equipment Repairs assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, repairs or while field testing.

Received By:

Phone #
1-403-330-7751

truscot@telusplanet.net

GST/HST No. 852833474

Subtotal	\$1,720.38
GST	\$86.02
Total	\$1,806.40


Truscott Heavy Equipment Repairs

6 Blackfoot Court West
Lethbridge, Alberta
T1K 7P5

Invoice

Date	Invoice #
2024-12-01	2224

Invoice To
Vicary Resources Inc

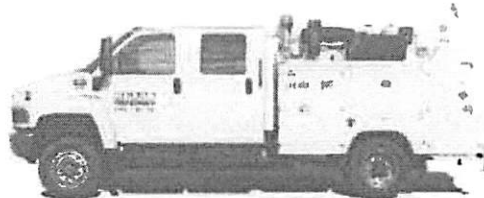

Due Date
2024-12-31

Date	Description	Hours/Qty	Rate	Amount
2024-11-01	290G: Hydraulic leak pilot pump.	0.5	105.00	52.50
2024-11-07	290G: Remove pilot pump and check o-ring, pump damaged. Order new one.	0.75	105.00	78.75
2024-11-13	290G: Install pilot pump.	0.75	105.00	78.75
2024-11-18	290G: Remove hydraulic line from pilot pump and remove lower fitting and change o-ring.	0.75	105.00	78.75
2024-11-21	290G: Weld end ring back on thumb pin.	0.75	105.00	78.75
	GST On Sales		5.00%	18.38

I agree to pay on completion of services of machine or on terms satisfactory with you and until paid in full, an express mechanics lien is acknowledged on above machine to secure the amount of parts and repairs thereto. It is understood that Truscott Heavy Equipment Repairs assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, repairs or while field testing.

Received By:

Phone #
1-403-330-7751

truscot@telusplanet.net
GST/HST No. 852833474

Subtotal	\$367.50
GST	\$18.38
Total	\$385.88


Truscott Heavy Equipment Repairs

6 Blackfoot Court West
Lethbridge, Alberta
T1K 7P5

Invoice

Date	Invoice #
2022-12-01	1873

Invoice To
Vicary Resources Inc

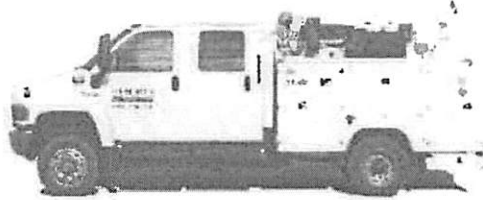

Due Date
2022-12-31

Date	Description	Hours/Qty	Rate	Amount
2022-11-08	Deere 290G, 11589 hrs: Drive to site, wait for autonomous guide and change starter.	3.75	95.00	356.25
2022-11-23	Deere 290G: Check for coolant leak, instead found oil leak, turbo return line.	1	95.00	95.00
	GST On Sales		5.00%	22.56

I agree to pay on completion of services of machine or on terms satisfactory with you and until paid in full, an express mechanics lien is acknowledged on above machine to secure the amount of parts and repairs thereto. It is understood that Truscott Heavy Equipment Repairs assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, repairs or while field testing.

Received By:

Phone #
1-403-330-7751

truscot@telusplanet.net

GST/HST No. 852833474

Subtotal	\$451.25
GST	\$22.56
Total	\$473.81