



FTCI - Prince George - Freightliner A Division of Velocity Vehicle Group 1015 GREAT STREET PRINCE GEORGE, BC V2N 2K8 (250) 563 - 0696

Please Remit Payment to: FTCI - Prince George -

Freightliner

11313 - 170 STREET EDMONTON, AB T5M 3P5 Date Arrived:

11/23/2024

Date Invoiced:

11/27/2024

SalesType: PO No:

SWD WTY TS

Terms:

30

Advisor:

SCOTT MACKINNON smackinnon@vvgtruck.ca

Email:

SCOTT MACKINNON

Salesman:

Reviewer:

TRISTIN SUTTON

F:

WARRANTY REC - DETROIT - &SWD

p.

F:

LOMAK BULK CARRIERS CORP

VIN: 3AKJHLD17NDNJ8499

Fleet Unit #:

108

22

Mileage:

654797

Year/Make/Model:

FTL

PT126DC

Body ID#:

Engine Model / Serial#:

D473910 / 473910S0887716

License#:

Trans Model / Serial#:

DT12 / 716350E0166957

Axle Ratio:

3.58

Front Axle Model / Serial#:

F120-3N / 739912B0249622

Tag#:

DISP

Rear FWD Axle Model / Serial#:

CLAIM NUMBER# DJCD2024BD72T

ART460-4 / 771199B0260893 ART460-4 / 771198B0260892 Selling Dealer: Date In Svc:

10/29/2021

Rear Rear Axle Model / Serial#:

JOB #1 02 SWD

**Express Assessment** 

DONE: INLET NOX SENSOR FAILED

COMPLAINT

Express Assessment: NOX CODES - DAIG AND ADVISE.

CAUSE CORRECTION

ACTIVE CODE SCR CLOSED LOOP AT MAX, NOX CONVERSION LOW BY DETECTION MOVING AVG

4364/17 AND 520372/16

PERFORMED TS AND REPLACED FAILED INLET NOX SENSOR PERFORMED REGEN AND SCR EFFCIENCY TESTS TO CLEAR

LARMF .92

OT/	Tireu	DESCRIPTION
QTY	ITEM	DESCRIPTION
1	812D/DDE RA0101531928	NOX SENSOR HDEP 1BOX GHG17 INL
0	812D/DDE RA0101531928-CORE	CORE
	VMRS	043-007-218-33-03-00-00

JOB #2 05-INSP SWD

**Courtesy Inspection** arranty Pending

COMPLAINT

Courtesy Inspection

**CAUSE** CORRECTION DONE

QTY	ITEM	DESCRIPTION

JOB#3 05-INSP SWD

**Courtesy Inspection** 

COMPLAINT

SHOP LOMAK 250-640-7114

**CAUSE** 

CORRECTION

QTY	ITEM	DESCRIPTION

SERVICE INVOICE: RA812008436:01

**JOB #4 00A SWD** 

### Additional Repairs (Add On Op)

CLAIM NUMBER# DJCD2024BD73T

COMPLAINT

DOSER LEAKING

ADD OP FOR SEPERATE FAILURE FROM OPI

SEE OPI FOR ORIGINAL CUSTOMER AUTH OF DIAG & REPAIR

**CAUSE** 

DOSER LEAKING

CORRECTION

DEF DOSER FOUND TO BE LEAKING REMOVED AND REPLACED GASKET

**COMPLETE** 

QTY	ITEM	DESCRIPTION
1	812D/DDE A0001421180 GASKET, DEF DOSING UNIT	
3	812D/DDE A0019909403	SCREW, DEF DOSING UNIT, 16MM
VMRS 04		043-007-166-18-03-00-00

ANY WARRANTIES ON THE PRODUCTS SOLD HEREBY ARE THOSE MADE BY MANUFACTURER, IF ANY. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES EITHER EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, AND THE COMPANY NEITHER ASSUMES NOR AUTH-ORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PRODUCTS WHICH ARE SOLD AS IS AND WITH ALL FAULTS.

WE HEREBY CERTIFY THAT THESE GOODS WERE PRODUCED IN COMPLIANCE WITH ALL APPLI-CABLE REQUIREMENTS OF SECTIONS 6, 7 AND 12 OF THE FAIR LABOR STANDARDS ACT OF 1938, AS AMENDED AND OF REGULATIONS AND ORDERS OF THE ADMINISTRATOR OR WAGE AND HOUR DIVISION ISSUED UNDER SECTION 14 THEREOF.

CLIENT AGREES THAT JURISDICTION AND VENUE OF ANY DISPUTE, CLAIMS OR LAWSUITS BETWEEN CLIENT AND THE COMPANY REGARDING ANY MATTER, INCLUDING, BUT NOT LIMITED TO SERVICES PROVIDED OR GOODS SOLD BY THE COMPANY TO CLIENT OR ON CLIENT'S BEHALF, SHALL BE EXCLUSIVELY IN THE STATE AND COUNTY THE REPAIR WAS PERFORMED. AGREES TO BE SUBJECT TO THE JURISDICTION OF STATE AND COUNTY IN ANY SUCH DISPUTE.

PLEASE READ TERMS AND CONDITIONS ON THE NEXT PAGE SIDE BEFORE SIGNING.

AUTHORIZED BY	 DATE	

#### SERVICE INVOICE: RA812007932:01



FTCI - Prince George - Freightliner A Division of Velocity Vehicle Group 1015 GREAT STREET PRINCE GEORGE, BC V2N 2K8 (250) 563 - 0696

Please Remit Payment to: FTCI - Prince George -

Freightliner 11313 - 170 STREET EDMONTON, AB T5M 3P5 Date Arrived:

10/11/2024

Date Invoiced:

10/30/2024 SWD

SalesType: PO No:

WTY TS

Terms:

30 Advisor: CHEYENNE VANDRISHE

Email:

cvandrishe@vvgtruck.ca Salesman: CHEYENNE VANDRISHE

Reviewer:

TRISTIN SUTTON

P:

WARRANTY REC - DETROIT - &SWD

DELIVER TO

LOMAK BULK CARRIERS CORP

F:

P:

F:

VIN: 3AKJHLD17NDNJ8499

Fleet Unit #:

108

Year/Make/Model:

22

Mileage:

651727

FTL

PT126DC

Body ID#:

Engine Model / Serial#:

D473910 / 473910S0887716

License#:

Trans Model / Serial#:

DT12 / 716350E0166957

Axle Ratio:

3.58

Front Axle Model / Serial#:

F120-3N / 739912B0249622

Tag#:

WARR

Rear FWD Axle Model / Serial#: Rear Rear Axle Model / Serial#: ART460-4 / 771199B0260893 ART460-4 / 771198B0260892 Selling Dealer: Date In Svc:

10/29/2021

JOB #1 05 SWD

Menu Items

COMPLAINT

STEVE DEWALT 250-565-5218

CAUSE

CORRECTION

-			
- [	QTY	ITEM	DESCRIPTION

### JOB #2 02 SWD

#### **Express Assessment**

CLAIM NUMBER# DJCD2024BC26T

COMPLAINT

TRANSMISSION NOT SHIFTING - DIAG & ADVISE

CAUSE

DONE; SHIFT CONTROLLER FAILED TO ACTUATE CLUTCH

CORRECTION

TRANS FAULT TCM01T 521745/3 - Short circuit to battery(or overvoltage) detected at output of Low-Side-Driver for

solenoid valve gear actuator extend MGg\_Aus ROAD TEST, WILL NOT GO INTO GEAR

REMOVED TCM

21 PIN CONNECTOR BROKEN DURING REMOVAL

REMOVE AND REPLACE AMT SHIFT CONTROLLER PER TS

REPLACED HARNESS DUE TO BROKEN 21 PIN CONNECTOR

QTY	ITEM	DESCRIPTION			
25	812F/23-09796-609	TIE STRAP (LARGE) TY27MX			
1	812F/23-13149-029	PLUG 21CAV MCP2 8S AI BK SEAL			
1	812F/A 948 260 05 63	CONTROLLER, SHIFT, W/O TCM			
0	812F/A 948 260 05 63-CORE	CORE			
1	812F/A 960 261 06 80	SEAL, SHIFT ACTUATOR			
1	812F/A 962 540 46 35	EL.WIR.HARNSS			
	VMRS	026-015-031-08-03-00-00			
-1 WPTCOS [[Warranty Only]]		[[Warranty Only]]			

SERVICE INVOICE: RA812007932:01

#### JOB #3 05 SWD

#### Menu Items

CLAIM NUMBER# DJCD2024BC27T

COMPLAINT

TRANSMISSION NOT GOING INTO GEAR

CAUSE

DONE; FAULTY SHIFT CONTROLLER; COMMUNICATION ERROR

CORRECTION

FAULT ACTIVE DURING TRANS LEARN PROCEDURE AND STILL NOT GOING INTO GEAR, NOT SEEING NEUTRAL CONTROLLER IS ATTEMPTING TO SHIFT FOR LEARN PROCEDURE BUT THERE IS NO PHYSICAL

MOVEMENT IN THE TRANS OPENED TICKET - 3874

DISCONNECT/RECONNECT BATTERIES, ROAD TEST, STILL NOT SHIFTING

REMOVED ELECTRICAL COMPONENTS, AIR LINES, MOUNT BOLTS

REMOVED SHIFT CONTROLLER

INSTALLED NEW GASKET, PUT NEW CONTROLLER ON AND REASSEMBLED

PERFORM CLUTCH AND TRANS LEARN, STILL WILL NOT FIND NEUTRAL OR GO INTO GEAR

SENT LOG FILE TO TECH SUPPORT

PUT SHOP AIR TO AIR DRYER AND RUN PROCEDURES AGAIN PER TECH SUPPORT

SUCCESSFUL, TRANS SHIFTED TO NEUTRAL

TIED UP ELEC AND AIR LINES, REINSTALLED STEPS

SHIFTED GOOD IN YARD

ROAD TESTED UNIT NOW SHIFTING WELL

**COMPLETE** 

QTY	ITEM	DESCRIPTION
ı	812D/DDE RA9482600563	SHIFT POSITIONER
0	812D/DDE RA9482600563-CORE	CORE
25	812F/23-09796-509	TIE STRAP-14 3/4" X .19" ,BLA
l	812F/A 960 261 06 80	SEAL, SHIFT ACTUATOR
	VMRS	026-015-031-11-03-00-00
1	WPTCOS	[[Warranty Only]]

ANY WARRANTIES ON THE PRODUCTS SOLD HEREBY ARE THOSE MADE BY MANUFACTURER, IF ANY. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES EITHER EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, AND THE COMPANY NEITHER ASSUMES NOR AUTH-ORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PRODUCTS WHICH ARE SOLD AS IS AND WITH ALL FAULTS.

WE HEREBY CERTIFY THAT THESE GOODS WERE PRODUCED IN COMPLIANCE WITH ALL APPLI-CABLE REQUIREMENTS OF SECTIONS 6, 7 AND 12 OF THE FAIR LABOR STANDARDS ACT OF 1938, AS AMENDED AND OF REGULATIONS AND ORDERS OF THE ADMINISTRATOR OR WAGE AND HOUR DIVISION ISSUED UNDER SECTION 14 THEREOF.

CLIENT AGREES THAT JURISDICTION AND VENUE OF ANY DISPUTE, CLAIMS OR LAWSUITS BETWEEN CLIENT AND THE COMPANY REGARDING ANY MATTER, INCLUDING, BUT NOT LIMITED TO SERVICES PROVIDED OR GOODS SOLD BY THE COMPANY TO CLIENT OR ON CLIENT'S BEHALF, SHALL BE EXCLUSIVELY IN THE STATE AND COUNTY THE REPAIR WAS PERFORMED, AGREES TO BE SUBJECT TO THE JURISDICTION OF STATE AND COUNTY IN ANY SUCH DISPUTE.

PLEASE READ TERMS AND CONDITIONS ON THE NEXT PAGE SIDE BEFORE SIGNING .



PRINCE GEORGE -FREIGHTLINER 1015 GREAT STREET PRINCE GEORGE, BC V2N 2K8

Phone: (250) 563-0696 FAX: (250) 563-0526

Invoice No.	R009005232:01			
Invoice Date	02/15/2024			
P.O. Number	WARRANTY			
Terms: INTERN	N			
Customer No				
GST No. 859163	263 RT0001			

#### Service Invoice

Bill To:

WARRANTY DETROIT EDMONTON, AB T5M 3P5 Owner:

LOMAK BULK CARRIERS CORP

Wk Phone:

Cell:

109

CUSTOMER NO. &WDE	ГА	DVISOR	CHEYENNE	٧.	KILOMETE	RS IN 5	511631 K	ILOMETERS OUT	511631
VIN 3AKJHLD17NDNJ8499	YEAR 2022	MAKE	FREIGHT N	MODEL	CASCADIA	COLOR	CAB COL	LICENSE NO.	

JOB#1 CEL

SWE

CHECK ENGINE LIGHT

CLAIM NUMBER# DJCD2024A039T

CONDITION

CHECK ENGINE LIGHT - DIAG & ADVISE

CAUSE

FAILED TURBO COMP INLET TEMP SENSOR

CORRECTION

MULTIPLE FAULTS, 3216/FMI 20, 3216/FMI 10, AND 1172/FMI 3. GO THROUGH TROUBLESHOOTING FOR

FAULT 1172/FMI 3, HARNESS CONNECTOR GOOD WITH NO CORROSUON ETC, 2.9 VOLTS IN SPEC,

REPLACED SENSOR

QTY ITEM

DESCRIPTION

**TECHNICIAN** 

H8

SERVICE SHOP WORK

TECH NO. 53701

009F/DDE A0081538628

TEMP SENSOR, TURBO INLET

2 009F/23-13482-001

TIE STRAP-W FIR TREE MOUNT.6.5

**VMRS** 

043-004-068-08-03-00-00

JOB#2 CEL

SWE

CHECK ENGINE LIGHT

CLAIM NUMBER# DJCD2024A038T

CONDITION

CHECK ENGINE LIGHT #2 NOX SENSOR

CAUSE

FAILED NOX SENSOR

CORRECTION

HOOKUP LAPTOPS, GO THROUGH TROUBLESHOOTING FOR 3216/ FMI 10 INLET NOX SENSOR ERRATIC. FOUND NO ISSUES WITH HARNESS, PULL AND REPLACE INLET NOX SENSOR. CLEAR FAULTS, PERFORM A REGEN TO CONFIRM I HAD NO WIRING ISSUES WITH INLET NOX SENSOR.

TECH STORY ON JOB# 1

QTY ITEM

DESCRIPTION

TECH NO. 53701

TECHNICIAN

H8

SERVICE SHOP WORK

(1) 009F/DDE RA0101531928-CORE NOX SENSOR HDEP 1BOX GHG17 INL

1 009F/DDE RA0101531928

NOX SENSOR HDEP 1BOX GHG17 INL

1 009F/DDE RA0101531928-CORE NOX SENSOR HDEP 1BOX GHG17 INL

**VMRS** 

043-007-218-08-03-00-00

Invoice No.	R009005232:01			
Invoice Date	02/15/2024			
P.O. Number	WARRANTY			
Terms: INTER	N			
Customer No	&WDET			
GST No. 85916 3263 RT0001				

CUSTOMER NO. &WDET	Α	DVISOR	CHEYENNE V	KILOMETE	RS IN	511631 KI	LOMETERS OUT	511631
VIN 3AKJHLD17NDNJ8499	YEAR 2022	MAKE	FREIGHT MODEL	CASCADIA	COLOR	CAB COLO	LICENSE NO.	

SIGNATURE X			 	



PRINCE GEORGE -FREIGHTLINER 1015 GREAT STREET PRINCE GEORGE, BC V2N

Phone: (250) 563-0696 FAX: (250) 563-0526

Invoice No.	R009004812:02
Invoice Date	12/28/2023
P.O. Number	WARRANTY
Terms: INTERN	7
Customer No	
GST No. 859163	263 RT0001

#### Service Invoice

Bill To:

WARRANTY FREIGHTLINER

Owner:

LOMAK BULK CARRIERS CORP

Wk Phone:					Cell				109
CUSTOMER NO. &WFTL	A	OVISOR	CANDACE	HARTMIE	KILOMETE	RS IN	495702	CILOMETERS OUT	495702
VIN 3AKJHLD17NDNJ8499	YEAR 2022	MAKE	FREIGHT	MODEL	CASCADIA	COLOR	CAB COI	O LICENSE NO.	

JOB#2 00

SW

GENERAL INFORMATION

CLAIM NUMBER# DJCDZ0010816T

CONDITION

CAUSE

COMPLAINT OF STEER AXLE CLUNKING IN THE CORNERS AND CAN FEEL THEM MOVING. FRONT SPRINGS L&R REAR BUSHINGS SPLIT,

CORRECTION

CONDITION: COMPLAINT OF STEER AXLE CLUNKING IN THE CORNERS AND CAN FEEL THEM MOVING.

CAUSE: FAILED SPRING BUSHINGS.

CORRECTION: REMOVED SPRINGS- REPLACED BUSHINGS- REINSTALLED SPRINGS WITH NEW BOLTS AND U-BOLTS- USED CRANE TO LIFT TRUCK UP- PLACED JACK STANDS UNDER FRAME-REMOVED SPRINGS- PRESSED OUT BUSHINGS- PRESSED IN NEW BUSHINGS- INSTALLED SPRINGS

BACK IN TRUCK- TORQUED ALL BOLTS TO SPEC-

QTY	ITEM		DESCRIPTION	TECHNICIAN
	H8		SERVICE SHOP WORK	TECH NO. 01475
	H8		SERVICE SHOP WORK	TECH NO. 01499
2	009F/23-14069-160		BOLT-HEX,ZNAL,BK,M20X1.5X160	
2	009F/23-14072-120		NUT-HEX,LKG,ZNAL,BK,M20X1.5	
15	009F/23-14091-009		WASHER-STL,HDND,ZNAL,BK,750	
2	009F/23-14125-001		NUT-HEX,HIGH,LKG,ZNAL,BK,M20	
2	009F/16-22182-000		FR SUSP-RUBBER BUSH,M20/60	
4	009F/23-14167-170	Ç	U BOLT-HEAVY DUTY,M20X1.5X170	
8	009F/23-14125-001		NUT-HEX,HIGH,LKG,ZNAL,BK,M20	
	С		U BOLT ~23-14167-170	
B#3 Q8	SP REPAIR	SW	COMPLETE REPAIR FOUND DURING QSP/HEALTH CLAIM NUMBER# DJCDZ0010817T	CHECK INSPECTION

H8

CONDITION

DS STEER AXLE SHOCK ABSORBER LEAKING

**CAUSE** 

SHOCK LEAKING

CORRECTION

CONDITION: DS STEER AXLE SHOCK ABSORBER LEAKING.

CAUSE: FAILED SHOCK.

CORRECTION: REMOVED FENDER TO ACCESS TOP SHOCK BOLT- REMOVED SHOCK AND INSTALLED

NEW SHOCK- REINSTALLED FENDER-

QTY ITEM	DESCRIPTION	TECHNICIAN	

SERVICE SHOP WORK

**TECH NO. 01499** 

Invoice No.	R009004812:02
Invoice Date	12/28/2023
P.O. Number	WARRANTY
Terms: INTER	N
Customer No	
GST No. 85916	3263 RT0001

CUSTOMER NO. &WFT	- A	DVISOR	CANDACE	HARTMIE	KILOMETE	RS IN 4	495702 I	KILOMETERS OUT	495702
VIN 3AKJHLD17NDNJ8499	YEAR 2022	MAKE	FREIGHT	MODEL	CASCADIA	COLOR	CAB COL	O LICENSE NO.	

1 009F/GBL 83396

FLEETLINE HEAVY DUTY SHOCK ABS



PG Freightliner 1015 Great Street Prince George, BC V2N 2K8 Phone: 250-563-0696 Fax: 250.563.0526 DTNA: DJCD

Invoice No.	R009004812
Invoice Date	
Arrival Date	12/19/2023
P.O. No	
Customer No	112015
Terms	NET30
Unit No.	265787
Customer Unit	109
GST No.	11940 1776 RT0004
PST No.	1473-2720
	1

# Not An Invoice

Bill To:

LOMAK BULK CARRIERS CORP

Owner:

LOMAK BULK CARRIERS CORP

Ph:

Cell:

Ph:

Cell:

Make:

FREIGHTLINER

Model:

CASCADIA

Vin:

3AKJHLD17NDNJ8499

Advisor: 53669

Colour: CAB COLOR A: L1

License:

Reviewer:

Odometer In: 495,702 Engine Hrs:

7,455

ESN/Make:

In Service Date: 10/29/2021

473910S0887716-DDE

Job# 1 QSP	SR	FREE QUALITY SERVICE PLUS TRUCK INSPECTION - \$75.00	VALUE
CONDITION	FREE QUALITY SERVICE PLUS TRUCK INSPECTION - \$75.00 VALUE		
CORRECTION	QSP PERFORMED- FOUND DS STEER AXLE SHOCK ABSORBER LEAR	ING	
QTY ITEM	DESCRIPTION	UNIT PRICE EXTE	D PRICE
	LABOR		0.00
	Job# 1 QSP PARTS: 0.00	LABOR: 0.00 TOTAL 0.00	

Job# 2 (	00	sw	GENERAL INFORMATION				
CONDITI		COMPLAINT OF STEER AXLE REAR AND ADVISE- WARRANTY ? -	SPRING PIN BUSHINGS WORN OUT- CLUNKING IN THE CORNERS AND CAN FEEL THEM MOVING- DIAGNOSE				
CORRECT	RECTION REMOVED SPRINGS- REPLACED BUSHINGS- REINSTALLED SPRINGS WITH NEW BOLTS AND U-BOLTS- USED CRANE TO LIFT TRUCK UP- PLACED JACK STANDS UNDER FRAME- REMOVED SPRINGS- PRESSED OUT BUSHINGS- PRESSED IN NEW						
		BUSHINGS- INSTALLED SPRINGS BACK IN TRUCK- TORQUED ALL BOLTS TO SPEC-					
QTY	ITEM		DESCRIPTION				
			LABOR				
2	009F/16-22	182-000	FR SUSP-RUBBER BUSH,M20/60				
4	009F/23-14	167-170	U BOLT-HEAVY DUTY,M20X1.5X170				
8	009F/23-14	125-001	NUT-HEX,HIGH,LKG,ZNAL,BK,M20				
			U BOLT ~23-14167-170				
2	009F/23-14	069-160	BOLT-HEX,ZNAL,BK,M20X1.5X160				
2	009F/23-14	072-120	NUT-HEX,LKG,ZNAL,BK,M20X1.5				
15	009F/23-14	091-009	WASHER-STL,HDND,ZNAL,BK,750				










00# 5 Q3	SP REPAIR	SW	COMPLETE REPAIR FOUND DURING QSP/HEALTH CHECK INSPECTION
ONDITION	N (	S STEER AXLE SHOCK ABSORBER LEAKING	
ORRECTIO	ON F	EMOVED FENDER TO ACCESS TOP SHOCK BOLT- REMOVED SHOCK	AND INSTALLED NEW SHOCK- REINSTALLED FENDER-
QTY	ITEM	DESCRIPTION	
		LABOR	
2 /	009F/GBL 83	396 FLEETLINE HEAVY DUTY SHOCK ABS	

ONDITI	<b>ON</b> ALIGNMENT		
ORRECT	1 X TOE SET AND C 1 X CASTER CHANG 2 X REAR AXLE ADJ	GE .	
QTY	ITEM	DESCRIPTION UNIT PR	RICE EXTD PRICE
		LABOR	635.50
4	009X/WUR079.34.5	L9 NC HEX HEAD CAP SCREW	15.41 61.6
4	009X/WUR 307.3410	LOCKNUT, COLLAR 3/4 UNC - L9	4.47 17.8
8	009X/WUR404.34	3/4 L9 FLAT WASHER	1.96 15.6
2	009X/WUR074.58.3	GR 8 BOLT (23-11755-300)	1.82 3.6
2	009X/WUR335.58	NC STOVER (23-09901-110)	0.42 0.8
4	009X/WUR410.58	GR8 FLAT WASHER (23-11656-010)	0.18 0.7
6	009X/CHI35062	TORQUE ROD SHIM 1/8	2.69 16.1
4	009X/CHI35041	SHIM IHC & PETE 1/16	1.13 4.5





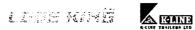

\*\* Should your wheels be removed for any reason, please have them re-torqued after 150 kilometres \*\*

Deposits	\$0.00
Misc Charges	0.00
Parts	\$ 121.06
Labor	\$ 635.50
Body Shop Supplies	\$ 0.00
Sublet	\$ 0.00
Misc Supplies	\$ 63.55
Subtotal	\$ 820.11
GST:	\$ 41.01
PST	<u>\$ 5</u> 7.41
Total	\$ 918.53

I, the undersigned owner, or duly authorized representative, authorize the repair and service work as detailed on this repair order. Permission is also granted to your employees to operate the vehicle herein described on the streets, highways, or elsewhere for the purpose of testing and/or inspection. It is understood that First Truck Centre Inc. does not assume any responsibility whatsoever to vehicles or contents while in their possession.

### \*\*\*\*Disclaimer of Warranty\*\*\*\*

Any warranties on the products sold hereby are those made by the manufacturer, if any. The seller hereby expressly disclaims all warranties either expressed or implied, including any implied warranty or merchantability or fitness for a particular purpose, and First Truck Centre neither assumes nor authorizes any other person to assume any liability in connection with the sale of the said products.

First Truck Centre shall not be liable for special, indirect or consequential damages, e.g.: down time, loss of revenue, loss of vehicle, towing charges, driver's expenses, loss of perishable cargo, etc.

Failed parts return requests must be made when the unit is checked in.

Please be aware that any aftermarket modifications to OEM components are customer responsibility.

First Truck Centre assumes no responsibility for damage to any aftermarket component as a result of our diagnostics or repairs.

Workmanship is warranted for 90 Days from date of invoice. If a possible warrantable situation arises at a location other than First Truck Centre then First Truck Centre must be contacted to be involved in the repair decision.


I/we hereby acknowledge this invoice and an express garageman's lien thereon to secure full amount of indebtedness.

I/We agree to pay interest at the rate of 2% per month (24% per annum), if the balance due is not paid within the credit terms of First Truck Centre. I/We also agree to pay storage fees of fifty dollars (\$50.00) per day, both before and after judgment plus all costs incurred in the collection of the balance owing, legal fees and disbursements on a solicitor client basis.

Authorized by:	Released by:	
Printed Name:	Date:	Time:





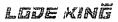





PRINCE GEORGE -FREIGHTLINER 1015 GREAT STREET PRINCE GEORGE, BC V2N

Phone: (250) 563-0696 FAX: (250) 563-0526

R009004483:03		
11/29/2023		
WARRANTY		
V		
3263 RT0001		

#### Service Invoice

Bill To:

WARRANTY FREIGHTLINER T5M 3P5

Owner:

Cell:

LOMAK BULK CARRIERS CORP

Wk Phone:

109

CUSTOMER NO. &WFTL

CANDACE HARTMIE KILOMETERS IN 479187

479187 KILOMETERS OUT

LICENSE NO.

VIN 3AKJHLD17NDNJ8499 COLOR YEAR 2022 MAKE **FREIGHT** MODEL CASCADIA CAB COLO

**ADVISOR** 

JOB#3 00

SW

COMPLAINT OF BRAKE LIGHT ON

GENERAL INFORMATION

CONDITION

CAUSE

RELATED TO ADAPTIVE CRUISE JOB. SEE OTHER STORIES

QTY ITEM

CORRECTION

DESCRIPTION

**TECHNICIAN** 

TECH NO.

JOB#4 00

SW

GENERAL INFORMATION

CLAIM NUMBER# DJCDZ0010671T

CONDITION

COMPLAINT OF ADAPTIVE CRUISE CONTROL LIGHT ON

CAUSE

HARNESS RUBBED THROUGH

CORRECTION

HOOKED UP COMPUTER TO UNIT- PRINTED FAULT CODES- 524042/9 ACTIVE- FOUND RDF MODULE IS NOT SHOWING UP ON J1939 ROLLCALL- FOUND 4 BUNGEES ACROSS RADAR COVER- REMOVED CONNECTOR AND INSPECTED FOR DAMAGED PINS- NO DAMAGE FOUND- MEASURED VOLTAGE ACROSS PIN1 AND 8- FOUND BATTERY VOLTAGE AT PINS- WILL NEED TO PERFORM CAN WIRING TROUBLESHOOTING- PULLED UNIT OUT OF SHOP, FOUND DASH PROMPT STATING RADAR INITIALIZING- DROVE AROUND SHOP WITH LAPTOP HOOKED UP- FOUND FAULT 524127/19 CAME ACTIVE NOW AND 1231/11 INACTIVE- FOLLOWED TROUBLESHOOTING- REMOVED VPDM- REMOVED VRDU AND RDF COVER- STARTED TESTING DATA WIRING AS PER TROUBLESHOTING- LOOKED UP SCHEMATICS, THEY DO NOT MATCH PIN OUTS- FOLLOWED TROUBLESHOOTING FOR INACTIVE CODE 1231/11- MORE THAN 10 COUNTS STORED- TRUNED IGNITON OFF- FOLLOWED G66 SCHEMATIC AND TESTED WIRING- FOUND OPEN CIRCUIT ON 539B- LOOKED UP

ODS CHAS F O DASH 1A CONNECTOR, TESTED- ISSOLATED OPEN CIRCUIT TO CHASSIS SIDE FROM FIREWALL TO RDF- THOUROGHLLY INSPECTED HARNESS- HAD TO REMOVE UNDER RAD AIR DAM- CUT TIES- PULLED MOST OF THE HARNESS FREE TO INSPECT- FOUND A RUB THROUGH UNDER DRIVER SIDE MOTOR MOUNT- PULLED HARNESS FROM BOTH SIDES TO GET ENOUGH SLACK TO INSPECT- CUT LOOMING TAPE AND SEPERATED WIRES- FOUND BOTH DATA LINK WIRES TO THE

RDF RUBBED THROUGH- CUT OUT BAD SECTIONS- RESPLICED WIRES- RECONNECTED ALL COMPONENTS AND CHECKED CODES- ALL INNACTIVE NOW- RDF SHOWING ONLINE IN ROLE CALL-CHECKED FOR PROGRAMMING UPDATES- NONE- CLEARED CODES- RE-ROUTED- TIED UP AND LOOM

HARNESSES- REINSTALLED ALL DASH PANELS BACK TOGETHER- TEST DROVE- OKAY

QTY ITEM	DESCRIPTION	TECHNICIAN	
Н8	SERVICE SHOP WORK	TECH NO. 01465	
H8	SERVICE SHOP WORK	TECH NO. 01465	
h8	SERVICE SHOP WORK	TECH NO. 01440	

Invoice No.	R009004483:03
Invoice Date	11/29/2023
P.O. Number	WARRANTY
Terms: INTER	N
Customer No	
GST No. 85916	3263 RT0001

CUSTOM	ER NO. &WFTL	_	ADVIS	OR	CANDACE	HARTMIE	KILOMETE	RS IN	479187	KII	OMETERS OUT	479187
VIN 3AKJHLD17NDNJ8499 YEAR 202			2 MA	KE	FREIGHT	Ι	CASCADIA	COLOF	R CAB C	OLO	LICENSE NO.	
	h8		SER	/ICE	SHOP WO	DRK		<del></del>	TECH	VO. 0	1440	
33	009F/23-09796-50	9	TIE S	TR	AP, SMALL	14 3/4" X	.19					
33	009F/23-09796-60	9	TIE S	TR	AP (LARGE	) TY27MX	•					
1	009X/WUR894.12	30	TAPE	, R	OT-PROOF							
1	009X/CHIPVC66		ELEC	TR	ICAL TAPE	BLACK						
2	009X/GREG971-1	50	LAY	-LA	T HOSE, 1	1/2 PVC						

SIGNATURE X



PG Freightliner 1015 Great Street Prince George, BC V2N 2K8 Phone: 250-563-0696 Fax: 250.563.0526 DTNA: DJCD

Invoice No.	R009003986:02
Invoice Date	09/25/2023
Arrival Date	09/22/2023
P.O. No	WARRANTY
Customer No	&WDET
Terms	INTERN
Unit No.	265787
Customer Unit	109
GST No.	11940 1776 RT0004
PST No.	1473-2720

# Service Invoice

Bill To:

WARRANTY DETROIT EDMONTON, AB T5M 3P5

Owner:

LOMAK BULK CARRIERS CORP

Ph:

Year:

2022

Colour: CAB COLOR A: L1 Advisor: 01613

Make:

FREIGHTLINER

License:

Reviewer: 01104

Model:

CASCADIA

Odometer In: 452,640 **Engine Hrs:** 

6,926

- Vin:

3AKJHLD17NDNJ8499

In Service Date: 10/29/2021

ESN/Make:

473910S0887716-DDE

			CLAIM NUMBER#	
CONDIT	ION	CHECK ENGINE LIGHT ON.		
CAUSE DEF PUMP FAILED				
CORREC	TION	REMOVED ATD COVER AND TROUBLESHOOTING FOR FA BREATHER. TESTED DEF FLU LEAKING AT DOSER. REPLAC DEF PUMP. REINSTALLED AL	STEP. FOUND HEATER LINE 5 LEAKING DEF. DE ULT CODE 520342/17. NO OTHER FAULTS. DEF	TANK AT 50%. NO RESTRICTION ON TANK S. FOUND RETURN LINE FROM DOSER TO TANK JID LEAKING. DRAINED COOLANT. REPLACED ME PROCEDURE. DEF SPEED AND PRESSURE
QTY	ITEM		DESCRIPTION	CODES,
	ENGINE	*	ENGINE	TECH NO. 01465
1	009F/DDE	RA0001407278	DEF PUMP	
	** F	Remanufactured Part **	8	
1.	009F/DDE	RA0001407278-CORE	** Clean Core **	
1	009F/04-3	1887-300	DEF LINE-RETURN, 3000MM	
26	009F/23-0	9796-609	TIE STRAP (LARGE) TY27MX	
1	009F/04-2	8829-000	CLIP-DEF LINE, E/16 inch	
1	009F/VOS	5841034800	CUP-DEF LINE, 1/4"	
(1)	009F/DDE	RA0001407278-CORE	DEF PUMP	











PG Freightliner 1015 Great Street Prince George, BC V2N 2K8 Phone: 250-563-0696 Fax: 250.563.0526 DTNA: DJCD

Invoice No.	R009003906:01
Invoice Date	09/19/2023
Arrival Date	09/15/2023
P.O. No	WARRANTY
Customer No	&WDET
Terms	INTERN
Unit No.	265787
Customer Unit	109
GST No.	11940 1776 RT0004
PST No.	1473-2720

# Service Invoice

Bill To:

WARRANTY DETROIT EDMONTON, AB T5M 3P5

Ph:

Owner:

LOMAK BULK CARRIERS CORP

Ph:

2022 Make: FREIGHTLINER Model: Vin: 3AKJHLO17NDNJ8499 Year: CASCADIA Colour: CAB COLOR A: L1 License: In Service Date: 10/29/2021 **Odometer In: 449,363** Advisor: 01115 Reviewer: 01606 **Engine Hrs:** 6,926 ESN/Make: 473910S0887716-DDE

			CLAIM NUMBER#	
CONDITION		COMPLAINT OF DEF FLOW -	25% DERATE	
		CONDITION: DERATED.  CAUSE: FAILED METERING UNIT.  CORRECTION: PRINTED FAULTS - TROUBLE SHOOT FAULT 4374/1 OVER PRESSURIZED DEF SYSTEM - REMOVED STRAP AND  COVER - FOLLOWED FAULT TROUBLE SHOOTING STEPS - FOUND FAULTY DEF DOSING UNIT - REPLACED DOSING UNIT -  RAN SCR ADS SELF CHECK ROUTINE AND QUANTITY TEST - PASSED - TEST 120ML - PREFORMED REGEN		
QTY	ITEM	TOTAL SOCK TOO SEEL STEELER	DESCRIPTION	
	Н8		SERVICE SHOP WORK	TECH NO. 01420
1	•	DE EA0001407439 * Remanufactured Part **	METR UNIT KT DEF DOSER	ŧ
1	009F/DE	DE EA0001407439-CORE	** Clean Core **	
(1)	009F/DI	DE EA0001407439-CORE	METR UNIT KT	









Page 1 of 2



TRUCK CENTRE

Service Invoice

PG Freightliner 1015 Great Street Prince George, BC V2N 2K8 Phone: 250-563-0696 Fax: 250.563.0526 DTNA: DJCD

Invoice No.	R009003869:01
Invoice Date	09/13/2023
Arrival Date	09/12/2023
P.O. No	WARRANTY
Customer No	&WDET
Terms	INTERN
Unit No.	265787
Customer Unit	108
GST No.	11940 1776 RT0004
PST No.	1473-2720

Bill To:

WARRANTY DETROIT EDMONTON, AB T5M 3P5 Owner:

LOMAK BULK CARRIERS CORP

Ph:

Year:

2022

Colour: CAB COLOR A: L1

Make:

FREIGHTLINER

Model:

CASCADIA

Vin:

3AKJHLD17NDNJ8499

Advisor: 01115

Job# 2 RECALL

License:

Reviewer: 01104

Odometer In: 516,093

Engine Hrs:

In Service Date: 10/29/2021 ESN/Make:

473910S0887716-DDE

Job# 1 00 SWE GENERAL INFORMATION CLAIM NUMBER# I CONDITION CEL ON. CAUSE INLET NOX SENSOR FAILED. HOOKED UP TO COMPUTER- PRINTED FAULT CODES AND TROUBLESHOOTING- FOLLOWED TROUBLESHOOTING FOR FAULT CORRECTION 3223/7- INSPECTED NOX SENSOR AND HARNESS CONNECTOR- NO DAMAGE FOUND- REPLACED INLET NOX SENSOR-CLEARED FAULT CODES- OKAY QTY ITEM DESCRIPTION H8 SERVICE SHOP WORK TECH NO. 01465 009F/DDE RA0101531928 NOX SENSOR HDEP 1BOX GHG17 INL \*\* Remanufactured Part \*\* 1 009F/DDE RA0101531928-CORE \*\* Clean Core \*\* 009F/DDE RA0101531928-CORE (1) NOX SENSOR HDEP 1BOX GHG17 INL 009F/23-09796-509 TIE STRAP, SMALL 14 3/4" X .19

	CLAIM NUMBER#	
CONDITION	DETROIT RECALL CAMPAIGN D22R6 REV2 SOOT SENSOR NEEDS TO BE COMPLETED	
CAUSE	REQUIRED	
CORRECTION	DETROIT RECALL D22R6-A NEEDS TO BE COMPLETED. FOLLOW DIRECTIONS IN BULLETIN, NO COMPLETION STICKER FOUND. REMOVED ONE BOX COVER, FOUD THERE IS A SOOT SENSOR INSTALLED. CHECKED PROGRAMMING, IT IS UP TO DATE. INSTALLED COVER, ISTALLED COMPLETION SICKER.	
QTY ITEM	DESCRIPTION	



SWE









PG Freightliner 1015 Great Street Prince George, BC V2N 2K8 Phone: 250-563-0696 Fax: 250.563.0526 DTNA: DJCD

Invoice No.	R009003704
Invoice Date	
Arrival Date	08/25/2023
P.O. No	PG 26280
Customer No	911380
Terms	NET30
Unit No.	265787
Customer Unit	109
GST No.	11940 1776 RT0004
PST No.	1473-2720

### **Not An Invoice**

Bill To:

LOMAK BULK CARRIERS CORP

Owner:

LOMAK BULK CARRIERS CORP

Ph:

Ph:

Year: 2022 Colour: CAB COLOR A: L1 Make:

FREIGHTLINER

Model:

CASCADIA

Vin:

3AKJHLD17NDNJ8499

Advisor: 01115

License: Reviewer:

Engine Hrs:

**Odometer In: 439,147** 

ESN/Make:

In Service Date: 10/29/2021

473910S0887716-DDE

Job# 1 CEL

SR

CHECK ENGINE LIGHT

CONDITION

**CHECK ENGINE LIGHT** 

CORRECTION

HOOKED UP TO COMPUTER- FOUND FAULTS 523005/13 AND 524042/19 ACTIVE- INSPECTED FRONT RADAR- FOUND 3 BUNGEES HOOKED UP ON BUMPER IN FRONT OF RADAR- REMOVED BUNGEES AND PERFORMED DETROIT ASSURANCE

PROCEDURE- TEST DROVE UNIT- PASSED SUCCESSFULLY- CODES WENT INACTIVE- OKAY

QTY ITEM

**DESCRIPTION** 

**UNIT PRICE** 

EXTO PRICE


LABOR

186.00

Job# 1 CEL ---- PARTS: 0.00 -- LABOR: 186.00 -- TOTAL 186.00





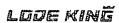



\*\* Should your wheels be removed for any reason, please have them re-torqued after 150 kilometres \*\*

ed after 150 kilometres **	
Deposits	\$0.00
Misc Charges	0.00
Parts	\$ 0.00
abor	\$ 186.00
Body Shop Supplies	\$ 0.00
Sublet	\$ 0.00
Misc Supplies	\$ 18.60
Subtotal	\$ 204.60
GST:	\$ 10.23
PST	\$ <u>1</u> 4.32
Total	\$ 229.15

1. the undersigned owner, or duly authorized representative, authorize the repair and service work as detailed in this repair order. Permission is also granted to your employees to operate the vehicle nerein described on the streets, highways, or elsewhere for the purpose of testing and/or inspection. It is understood that First Truck Centre Inc. does not assume any responsibility whatsoever to vehicles or contents while in their possession.

#### \*\*\*\*Disclaimer of Warranty\*\*\*\*

Any warranties on the products sold hereby are those made by the manufacturer, if any. The seller hereby expressly disclaims all warranties either expressed or implied, including any implied warranty or merchantability or fitness for a particular purpose, and First Truck Centre neither assumes nor authorizes any other person to assume any liability in connection with the sale of the said products

First Truck Centre shall not be liable for special, indirect or consequential damages, e.g. down time, loss of revanue, loss of vehicle, towing charges, driver's expenses, loss of penshable cargo, etc.

Failed parts return requests must be made when the unit is checked in.

Please be aware that any aftermarket modifications to OEM components are customer responsibility.

First Truck Centre assumes no responsibility for damage to any aftermarket component as a result of our diagnostics or repairs.

Workmanship is warranted for 90 Days from date of invoice. If a possible warrantable situation arises at a location other than First Truck Centre then First Truck Centre must be contacted to be involved in the repair decision.


1/we hereby acknowledge this invoice and an express garageman's lien thereon to secure full amount of indebtedness.

I/We agree to pay interest at the rate of 2% per month (24% per annum), if the balance due is not paid within the credit terms of First Truck Centre. I/We also agree to pay storage fees of fifty dollars (\$50.00) per day, both before and after judgment plus all costs incurred in the collection of the balance owing, legal fees and disbursements on a solicitor client basis.

Authorized by:	Released by:	<del></del>
Printed Name:	Date:	Time:





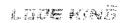



Page 2 of 2



PG Freightliner 1015 Great Street Prince George, BC V2N 2K8 Phone: 250-563-0696 Fax: 250.563.0526 DTNA: DJCD

Invoice No.	R009003704:01
Invoice Date	08/29/2023
Arrival Date	08/25/2023
P.O. No	WARRANTY
Customer No	&WDET
Terms	INTERN
Unit No.	265787
Customer Unit	109
GST No.	11940 1776 RT0004
PST No.	1473-2720

# Service Invoice

Bill To:

WARRANTY DETROIT EDMONTON, AB T5M 3P5

Ph:

Owner:

LOMAK BULK CARRIERS CORP

Ph:

Year: 2022

L1

Make: FRE

FREIGHTLINER

Model:

CASCADIA

Vin:

3AKIHLD17NDNJ8499

Colour: CAB COLOR A: L1 Advisor: 01115 License:

Reviewer: 01606

Odometer In: 439,147

In Service Date: 10/29/2021

Engine Hrs:

ESN/Make:

473910S0887716-DDE

ob# 1 CEL	SR	СНЕ	CK ENGINE LIGHT		
CONDITION CHECK ENGINE LIGHT					
CORRECTION HOOKED UP TO COMPUTER- FOUND FAULTS 523005/13 AND 524042/19 ACTIVE- INSPECTED FRONT RADAR- FOUND 3					
	ND PERFORMED DETROIT ASSURANCE				
	PROCEDURE- TEST DROVE UNIT- PASSED SUCCESSFULLY- CODES WENT INACTIVE-	OKAY			
QTY ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE		
Н8	SERVICE SHOP WORK	TECH NO. 01465			

Job# 2 (	00	SWE		GENERAL INFORMATION	
			CLAIM NUMBER# [		
CONDITION INNER AXLE SOLENOID BYPASSING		INNER AXLE SOLENOID BY	PASSING AIR		
POWER DIVIDER PUSH ROD AND S		CAUSE: LEAKING SHIFT KI CORRECTION REMOVED I POWER DIVIDER PUSH RO RE-INSTALLED FRONT COV	T. DRIVESHAFT, INPUT YOKE AND NUT- REMOVED DD AND SEAL- REMOVED AND REPLACED BUSH VER- SET BEARING PRELOAD- INSTALLED NEW S	DID BYPASSING AIR.  HAFT, INPUT YOKE AND NUT- REMOVED FRONT COVER- REMOVED AND INSPECTED  SEAL- REMOVED AND REPLACED BUSHING- ASSEMBLED WITH NEW PARTS- T BEARING PRELOAD- INSTALLED NEW SEAL AND YOKE NUT- RE-INSTALLED DRIVELINE-	
QTY	ITEM		DESCRIPTION		
	h8		SERVICE SHOP WORK	TECH NO. 53679 .	
1	009F/MB	A 6093500111K	IAD SHIFT KIT		
1	009F/MB	A 6819900252	NUTSLD		
1	009F/MB/	A 6819970746	INPUT RADIAL SEAL		
4	009F/23-3	12891-175	SCREW-SOCKETHEAD 12PT,1/2-20,1		











First Truck Centre BC North Inc. 5239 Continental Way Prince George, BC V2N 5S5 Phone: 250.561.0646 Fax: 250.562.3260

DTNA: AWXD

Invoice No.	R006049552
Invoice Date	
Arrival Date	03/25/2023
P.O. No	PG 25843
Customer No	911380
Terms	NET30
Unit No. 265	
Customer Unit	109
GST No.	11940 1776 RT0005

### Not An Invoice

Bill To:

LOMAK BULK CARRIERS CORP

Owner:

LOMAK BULK CARRIERS CORP

Take our Survey

Ph:

Ph:



Year:

Advisor: 53467

2022

Colour: CAB COLOR A: L1

Make: License:

Reviewer:

FREIGHTLINER

Model:

Odometer In: 0

Engine Hrs:

CASCADIA

Vin:

3AKJHLD17NDNJ8499

In Service Date: 10/29/2021

ESN/Make:

473910S0887716-DDE

Job# 1 #00-00 SR MISCELLANEOUS REPAIR CONDITION INSTALL CUST SUPPLIED DRIVING LIGHTS AS REQUESTED CORRECTION LOOKED UP SCHEMATICS FOR OPT2 HWD SW. SPLICED SIGNAL WIRE INTO SSAM X2-13 AND RAN TO CAVITY 6 OF OPT 2

SW. HAD TO REMOVE DASH PANELS TO GAIN ACCESS TO SSAM. WRAPPED WIRE AND CONNECTED WITH NEW TERMINALS TO SSAM AND SWITCH. REMOVED 76-PIN FIREWALL PLUG AND VERIFIED CIRCUIT OPERATION WITH HIGH BEAM AND SWITCH, MEASURED DRILLED AND INSTALLED THE DRIVING LIGHTS BRACKETS, MOUNTED THE LIGHTS. RAN THE 2 WIRE FROM THE FIRE WALL TO THE LIGHTS. TIED UP THE LIGHTS HARNESS AT THE BUMPER, SPLICED THE LIGHTS HARNESS WITH THE 2 WIRE. DIDNT LIKE THE POSITIONING OF THE FUSE IN THE POWER WIRE, SO I CUT IT OUT AND SPLICED IT IN CLOSER TO THE POWER SUPPLY. TIED UP ALL OF THE WIRES AGAIN. CONFIRMED THAT THE LIGHTS

STILL WORK.

	JOB COMPLETE.				
QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE	
		LABOR		877.50	
1	006X/5130	ATC FUSE HOLDER 12GA	4.53	4.53	
1	006F/WWS 7830-3404	ACTUATOR, SWITCH DRVG	5.08	5.08	
4	006X/074.516.312	5/16-18X3-1/2 UNC HEX BOLT GR8	0.35	1.40	
12	006X/BC2/C14	2WIRE CABLE, 14 GA	0.53	1.40	
12	000// BCZ/C14	ZWING CROEC, AT ON	1.71	20.52	
	Job# 1 #00-00 PARTS: 31.53 LABOR: 877.50 TOTAL 909.03				

Job# 2	QI	SR				QUALITY INSPECTION
CONDITI	ON	QUALITY INSPECTION				
QTY	ITEM	, n	11 =	DESCRIPTION	UNIT PRICE	EXTD PRICE
				LABOR		0.00









#### Job# 2 QI ---- PARTS: 0.00 -- LABOR: 0.00 -- TOTAL 0.00

Job# 3 QSP	SR	FREE QUALITY SERVICE PLUS TRUCK INSPECTIO	N - \$75.00 VALUE
CONDITION	FREE QUALITY SERVICE PLUS TRUCK INSPECTION - \$75.00 VALUE		
QTY ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR		0.00
	Job# 3 QSP PARTS: 0.00 LABO	R: 0.00 TOTAL 0.00	

\*\* Should your wheels be removed for any reason, please have them re-torqued after 150 kilometres \*\*

As an Elite Support dealer, we inspect every job for quality of workmanship. A 15-point Quality Inspection Report is completed by a factory trained technician at the end of your repair.

Your QI report for RO# R006049552

was completed by staff ID # -

Total	\$ 1,116.39
PST	\$ 69.77
GST	\$ 49.84
Subtotal	\$ 996.78
Misc Supplies	\$ 87.75
Sublet	\$ 0.00
Body Shop Supplies	\$ 0.00
Labor	\$ 877.50
Parts	\$ 31.53
Misc Charges	0.00
Deposits	\$0.00

I, the undersigned owner, or duly authorized representative, authorize the repair and service work as detailed on this repair order. Permission is also granted to your employees to operate the vehicle herein described on the streets, highways, or elsewhere for the purpose of testing and/or inspection. It is understood that First Truck Centre Inc. does not assume any responsibility whatsoever to vehicles or contents while in their possession.

#### \*\*\*\*Disclaimer of Warranty\*\*\*\*

Any warranties on the products sold hereby are those made by the manufacturer, if any. The seller hereby expressly disclaims all warranties either expressed or implied, including any implied warranty or merchantability or fitness for a particular purpose, and First Truck Centre neither assumes nor authorizes any other person to assume any liability in connection with the sale of the said products.

First Truck Centre shall not be liable for special, indirect or consequential damages, e.g.: down time, loss of revenue, loss of vehicle, towing charges, driver's expenses, loss of perishable cargo, etc.

Failed parts return requests must be made when the unit is checked in .

Please be aware that any aftermarket modifications to OEM components are customer responsibility.

First Truck Centre assumes no responsibility for damage to any aftermarket component as a result of our diagnostics or repairs.

Workmanship is warranted for 90 Days from date of invoice. If a possible warrantable situation arises at a location other than First Truck Centre then First Truck Centre must be contacted to be involved in the repair decision.

I/we hereby acknowledge this invoice and an express garageman's lien thereon to secure full amount of indebtedness.

I/We agree to pay interest at the rate of 2% per month (24% per annum), if the balance due is not paid within the credit terms of First Truck Centre. I/We also agree to pay storage fees of fifty dollars (\$50.00) per day, both before and after judgment plus all costs incurred in the collection of the balance owing, legal fees and disbursements on a solicitor client basis.

Authorized by:	Released by:		
Printed Name:	Date:	Time:	











First Truck Centre Inc. 1015 Great Street Prince George, BC V2N 2K8 Phone: 250-563-0696 Fax: 250.563.0526 DTNA: DJCD

Invoice No.	R009001701:01		
Invoice Date	02/17/2023		
Arrival Date	02/13/2023		
P.O. No	WARRANTY		
Customer No	&WFTL		
Terms	INTERN		
Unit No.	265787		
Customer Unit	109		
GST No.	11940 1776 RT0004		
PST No.	1473-2720		

# Service Invoice

Bill To:

WARRANTY FREIGHTLINER

, T5M 3P5

Ph:

Owner:

LOMAK BULK CARRIERS CORP

Odometer In: 330,299

Ph:

Year:

Advisor: 01650

2022

Colour: CAB COLOR A: L1

License:

Make:

Reviewer: 01104

FREIGHTLINER

Model:

Engine Hrs:

CASCADIA

Vin:

3AKJHLD17NDNJ8499

In Service Date: 10/29/2021

ESN/Make:

473910S0887716-DDE

ENGINE

Job# 2 ENGINE

SW

CLAIM NUMBER# DJCDZ0009499T

CONDITION

CHECK ENGINE LIGHT ON.

CAUSE

RUBBED WIRE ON ACM HARNESS

CORRECTION

BROUGHT UNIT INTO SHOP. HOOKED UP TO COMPUTER. CHECKED AND PRINTED FAULT CODES, FAULT CODE SPN 4355 FMI 5 FOR LINE HEATER 2 OPEN CIRCUIT. CHECKED FOR MULTIPLE CODE - NONE, DISCONNECTED LINE HEATER 2. TURNED IGNITION ON WITH ENGINE OFF. MEASURED VOLTAGE BETWEEN PIN 2 ON HARNESS SIDE OF LINE HEATER 2 CONNECTOR AND GROUND, FOUND VOLTAGE GREATER THAN 11.75 AT 12.57. MEASURED VOLTAGE BETWEEN PIN 1 ON HARNESS SIDE OF LINE HEATER 2 CONNECTOR AND GROUND, FOUND VOLTAGE BETWEEN 2.25 AND 2.50. MEASURED RESISTANCE ON HEATING ELEMENT SIDE OF LINE HEATER 2, FOUND RESISTANCE WITHIN RANGE. INSTALLED NEW HEATER LINE TO CHECK IF CODE WOULD GO INACTIVE, CODE STILL ACTIVE.. REMOVED ACM COVER. PULLED 120 PIN CONNECTOR FROM ACM. TESTED RESISTANCE IN HEATER LINE 2 HARNESS PLUG PIN 2 TO PIN 15 OF 120 PIN CONNECTOR, FOUND WITHIN RANGE AT 0.02 OHMS. CHECKED RESISTANCE IN HEATER LINE 2 PIN 1 TO PIN 24 OF 120 PIN CONNECTOR, FOUND NO WITHIN RANGE AT 14 OHMS. CUT HARNESS BACK AND CHECKED FOR ANY RUBBED SECTIONS, FOUND SECTION BY LEFT FUEL LINES RUBBED THROUGH. OPENED HARNESS, FOUND RUBBED THROUGH WIRE # 532M2, REPAIRED WIRE AND RE-WRAPPED HARNESS. RE TIED UP HARNESS. CHECKED AND FOUND INACTIVE. CLEARED FAULT CODES. RELEASED UNIT.

QTY	ITEM

DESCRIPTION

**H8** 

SERVICE SHOP WORK

TECH NO. 01425

009F/23-09796-609 18

TIE STRAP (LARGE) TY27MX

009F/23-09796-509 6

TIE STRAP-14 3/4" X .19" ,BLA

1 009X/CHI15001-1 SHRINK TUBE (14 PER PACK)











First Truck Centre Inc. 1015 Great Street Prince George, BC V2N 2K8 Phone: 250-563-0696 Fax: 250.563.0526 DTNA: DJCD

Invoice No.	R009001574:01		
Invoice Date	02/10/202		
Arrival Date	02/01/202		
P.O. No	WARRANTY		
Customer No	&WDE		
Terms	INTERN		
Unit No.	26578		
Customer Unit	109		
GST No.	11940 1776 RT000-		
PST No.	1473-272		

# Service Invoice

Bill To:

WARRANTY DETROIT EDMONTON, AB T5M 3P5

Ph:

Owner:

LOMAK BULK CARRIERS CORP

Ph:

Year:

2022

Make:

FREIGHTLINER

Model:

CASCADIA

Vin:

3AKJHLD17NDNJ8499

Advisor: 01601

Colour: CAB COLOR A: L1

License:

Reviewer: 01104

Odometer In: 324,519 Engine Hrs:

CLAIM NUMBER# DJCDZ0009455T

In Service Date: 10/29/2021

ESN/Make:

473910S0887716-DDE

Job# 1 00

SWE

GENERAL INFORMATION

CONDITION

TOWED IN, COMPLAINT OF UNIT WILL NOT STAYING RUNNING

IT IS FLASHING A CODE AND SHUTS THE VEHICLE DOWN EVERY 30 SECONDS

CAUSE

ACM WIRE HARNESS REBBED

CORRECTION

BROUGHT UNIT INTO SHOP, HOOKED UP TO COMPUTER, CHECKED AND PRINTED FAULT CODES, CODE 520222/12. PERFORMED TROUBLESHOOTING, FOUND NO BATTERY POWER ON PINS 7, 8, 9, 10, 11 AND 18. FOUND ACM POWER AND GROUND HARNESS RUBBED THROUGH MAIN POWER WIRE. REMOVED REAR CAB SHOCKS AND LIFT BACK OF CAB UP. REMOVED ONE BOX STEPS AND SHIELDS. REPAIRED POWER WIRE AND GROUND WIRE, VERY DIFFICULT TO ACCESS. POWER WIRE CUT IN HALF AND GROUND WIRE HAD INSOLATION COVER DAMAGE. WHILE MOVING UNIT OUT OF SHOP CHECK ENGINE LIGHT CAME BACK ON. BROUGHT BACK INTO SHOP. HOOKED UP TO COMPUTER. FOUND CODE 4364/17. PERFORMED TROUBLESHOOTING. CHECKED ! ARMF VALUES. PERFORMED SCR EFFICIENCY TEST, FOUND VALUES RANGING FROM 76-79%. PERFORMED ANOTHER SCR SELF TEST TO GET BIN VALUES TO 100%. CLEARED CODES AND RELEASED UNIT.

QTY

ITEM

DESCRIPTION

**TECH NO. 01470** 

H8

SERVICE SHOP WORK

009X/CHI15002

SHRINK TUBE (12 PER PACK)

009X/CHI15001-1 2

SHRINK TUBE (14 PER PACK)

009F/TYC DCT110HIR 6

TIE STRAP BUTTERFLY

009F/DDE A0001421180 1

METAL SEAL

SCREW

009F/DDE A0019909403

St. - marine at

Job# 2 #01-026

SWE

ENGINE - CHECK AND REPORT, ENGINE CODES

CLAIM NUMBER# DJCDZ0009456T









CONDITION	ENGINE - CHECK AND REPORT, ENGINE CODES			
CAUSE	SOFTWARE			
CORRECTION	CHON COMPLAINT: CEL ON.  CAUSE: WILL NOT REGEN.  CORRECTION: DOWNLOAD AND CHECK CODES, 4364/17 POOK A.JX CONVERSION EFFICENCY. FOLLOW T/S PROCEDURE  358.2 TO STEP 14 AND PERFORMED A PARKED REGEN, NOX EFFICENCY WAS AT 98% CHECKED LARMF VALUES, THEY  WERE 76-79% PERFORMED 2 SCR EFFICIENCY TESTS TO GET THE BIN VALUES TO 100%. CLEARED CODES.			
QTY ITEM	DESCRIPTION			
CHECK	CHECK & REPORT	TECH NO. 01470		

\*\* Should your wheels be removed for any reason, please have them re-torqued after 150 kilometres \*\*

Please Remit Payment to: First Truck Centre Inc 1015 Great Street Prince George, BC V2N 2K8


Parts Labor

Misc Charges

Reprinted

2023-03-15

1:24:16PM

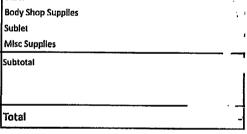





·2 ·2 2.4







First Truck Centre Inc. 1015 Great Street Prince George, BC V2N 2K8 Phone: 250-563-0696 Fax: 250,563,0526 DTNA: DJCD

Invoice No.	R009000997:02		
Invoice Date	12/05/2022		
Arrival Date	12/03/202		
P.O. No	WARRANTY		
Customer No	&WD8		
Terms	INTERN		
Unit No.	26578		
Customer Unit	109		
GST No.	11940 1776 RT0004		
PST No.	1473-2720		
	Establishment of the control of the		

# Service Invoice

Bill To:

WARRANTY DETROIT EDMONTON, AB T5M 3P5

Ph:

Owner:

LOMAK BULY CARRIERS CORP

Ph:

Year: 2022

Advisor: 01619

Make: License: FREIGHTLINER

Model:

CASCADIA

Vin:

3AKJHI.D17NDNJ8499

Colour: CAB COLOR A: L1

Reviewer: 01605

Odometer In: 296,366 Engine Hrs: 0

CLAIM NUMBER# DJCDZ0009184T

ESN/Make:

473910S0887716-DDE

ENGINE

Job# 2 #01-000

SWE

In Service Date: 10/29/2021

CONDITION

COMPLAINT FOR INJECTOR SEALS LEAKING

CORRECTION

CONDITION: ENGINE OIL LEAK RT SIDE.

CAUSE: LEAKING PASS THRU SEALS.

CORRECTION: INSPECTED AND FOUND DRIVER SIDE OF ENGINE COVERED IN OIL, PRESSURE WASHED ENGINE CLEAN. FOUND #3,4,5 AND 6 INJECTOR FASS THROUGH SEALS LEAKING. REMOVED NEEDLE AND AMPLIFIER FUEL LINES. REMOVED FUEL LINES AND SEALS, CLEANED MOUNTING SURFACES AND FUEL LINES, INSTALLED ALL PARTS REMOVED. TORQUED FUEL LINES AND SEALS TO SPEC. RAN ENGINE AND CHECKED FOR LEAKS, ALL GOOD.

VERIFIED MILAGE, INCORRECT KMS ON PREVIOUS CLAIM.

QTY

ITEM

DESCRIPTION

**ENGINE** 

ENGINE

**TECH NO. 01465** 

009F/DDE A4720780480

INI SEAL, PASS THROUGH

- 3









Page 1 of 2



# Not An Invoice

First Truck Centre Prince George Freightliner. 1015 Great Street Prince George, BC V2N 2K8 Phone: 250-563-0696

> Fax: 250.563.0526 DTNA: DJCD

Invoice No.	R009000114
Invoice Date	
Arrival Date	09/09/2022
P.O. No	PO 25070
Customer No	911380
Terms	NET30
Unit No.	265787
Customer Unit	108
GST No.	850463464 RT0001
PST No.	1001-2373

Bill To: LOMAK BULK CARRIERS CORP

Owner: LOMAK BULK CARRIERS CORP

Ph:

Year: 2022 Make: FREIGHTLINER Model: CASCADIA Vin: 3AKJHLD17NDNJ8499

Ph:

Colour: CAB COLOR A: L1 License: Odometer In: 324,342 In Service Date: 10/29/2021

Advisor: 42198 Reviewer: Engine Hrs: 0 ESN/Make: 473910S0887716-DDE

Job# 2 #54-01 LIGHTING CONDITION CUSTOMER REQUEST TO HAVE UTILITY LIGHTS BYPASSED TO A INDEPENDENT SWITCH CORRECTION VERIFIED CUSTOMER REQUEST- LOOKED UP WIRING AND MODULE PATHWAYS- BYPASSED SSAM OUTPUT- REMOVED MSF SLAVE- THE OPT S/W AND THE UTILITY LIGHT S/W- SWAPPED THE FACES- RE-INSTALLED- WIRED UTILITY LIGHT WIRE TO THE OUTPUT OF THE OPT S/W-TESTED- OKAY-TURNED OFF FAULT REPORTING FOR THE UTILITY LAMPS IN THE SSAM-**CLEARED CODE-OKAY** QTY ITEM DESCRIPTION **UNIT PRICE EXTD PRICE** 387.50 **LABOR** SHRINK TUBS (14 PER PACK) 009X/CHI15001-1 2.29 2.29 009F/23-09796-509 TIE STRAP-14 3/4" X .19" ,BLA 1.04 6.24 Job# 2 #54-01 ---- PARTS: 8.53 -- LABOR: 387.50 -- TOTAL 396.03









\*\* Should your wheels be removed for any reason, please have them re-torqued after 150 kilometres \*\*

Total	\$ 486.95
PST	\$ 30.43
GST:	\$ 21.74
Subtotal	\$ 434.78
Misc Supplies	\$ 38.75
Sublet	\$ 0.00
<b>Body Shop Supplies</b>	\$ 0.00
Labor	\$ 387.50
Parts	\$ 8.53
Misc Charges	\$ 0.00

I, the undersigned owner, or duly authorized representative, authorize the repair and service work as detailed on this repair order. Permission is also granted to your employees to operate the vehicle herein described on the streets, highways, or elsewhere for the purpose of testing and/or inspection. It is understood that First Truck Centre Inc. does not assume any responsibility whatsoever to vehicles or contents while in their possession.

#### \*\*\*\*Disclaimer of Warranty\*\*\*\*

- 1°2 W

Any warranties on the products sold hereby are those made by the manufacturer, if any. The seller hereby expressly disclaims all warranties either expressed or implied, including any implied warranty or merchantability or fitness for a particular purpose, and First Truck Centre neither assumes nor authorizes any other person to assume any liability in connection with the sale of the said products.

First Truck Centre shall not be liable for special, indirect or consequential damages, e.g.: down time, loss of revenue, loss of vehicle, towing charges, driver's expenses, loss of perishable cargo, etc.

Failed parts return requests must be made when the unit is checked in.

Please be aware that any aftermarket modifications to OEM components are customer responsibility.

First Truck Centre assumes no responsibility for damage to any aftermarket component as a result of our diagnostics or repairs.

Workmanship is warranted for 90 Days from date of invoice. If a possible warrantable situation arises at a location other than First Truck Centre then First Truck Centre must be contacted to be involved in the repair decision.

I/we hereby acknowledge this invoice and an express garageman's lien thereon to secure full amount of indebtedness.

I/We agree to pay interest at the rate of 2% per month (24% per annum), if the balance due is not paid within the credit terms of First Truck Centre. I/We also agree to pay storage fees of fifty dollars (\$50.00) per day, both before and after judgment plus all costs incurred in the collection of the balance owing, legal fees and disbursements on a solicitor client basis.

Authorized by:	Released by:		
Printed Name:	Date:	Time:	











First Truck Centre Inc. 1015 Great Street Prince George, BC V2N 2K8 Phone: 250-563-0696 Fax: 250.563.0526 DTNA: DJCD

Invoice No.	R009000114:0.		
Invoice Date	09/12/2022		
Arrival Date	09/09/2022		
P.O. No	WARRANTY		
Customer No	&WDET		
Terms	INTERN		
Unit No.	265787		
Customer Unit	109		
GST No.	11940 1776 RT0004		
PST No.	1473-2720		
	į.		

# Service Invoice

Bill To:

WARRANTY DETROIT EDMONTON, AB T5M 3P5

Ph:

Owner:

LOMAK BULK CARRIERS CORP

Ph:

Year: 2022

Advisor: 42198

Colour: CAB COLOR A: L1

Make: License:

Reviewer: 01606

Model:

CASCADIA

Odometer In: 324,342

Engine Hrs:

Vin:

3AKJHLD17NDNJ8499

In Service Date: 10/29/2021

ESN/Make:

473910S0887716-DDE

MISCELLANEOUS REPAIR

Job# 1 #00-00

SWE

CLAIM NUMBER# DJCDZ0008811T

CONDITION

COOLANT FOUND IN OIL - SEE ATTACHED OIL ANALYSIS REPORT

FREIGHTLINER

CAUSE

NPF

CORRECTION

CONDITION: BAD OIL SAMPLE.

CAUSE: NPF.

CORRECTION: BROUGHT TRUCK IN, CUSTOMER HAD OIL ANALIYZED, SHOWS HIGH LEVELS OF POTASSIUM AND SODIUM, CHECKED OIL AND COOLANT LEVELS, GOOD. PRESSURE TESTED EGR COOLER, GOOD. NO ISSUE FOUND AT THIS TIME.

QTY

ITEM

DESCRIPTION

H8

Service Shop Work

Job#			

SWE

CLAIM NUMBER# DJCDZ0008811T

**ENGINE** 

CONDITION

PERFORM RELATIVE COMPRESSION TEST

CORRECTION

PERFORMED RELATIVE COMPRESSION TEST AS REQUESTED, PASSED.

QTY ITEM

ENGINE

ENGINE

DESCRIPTION

TECH NO. 01460







