



**Truck-Trailer
Parts and Service**
www.fleetbrake.com

158 Queens Drive
Red Deer, AB T4P 0R4

PH: (403)343-8771
FAX: (403)340-0888
parts11@fleetbrake.com

FILE
T00-02A
BKAAA

ER35-1

**** Reprint ****

Invoice: **11W3075**
Date / Hour: 7/21/2022 4:08:43PM
Repair Order: 3075
Customer:
Branch: FBP11
Total Invoice: \$13,838.40
Charge

Page 1 of 6

Bill To: KANSAS RIDGE TRUCKING LTD.

Ship To: KANSAS RIDGE TRUCKING LTD.

POSTED
5/50

Work:

Shop:

Fax:

Customer P/O: T00-02A acotton bkreesee Orig R/O: 0 Completion Date: 7/21/2022

Unit Number: T00-02A

Model Year: 1999

Make/Model: Advance LEAD TANKER

Type: Trailer

VIN: 2AEABKBCXXR000112

Meter: 1 Kilometers

Task: 1 16-000000 Suspension

Department: Service

Complaint: Estimate for spring hangers,shackle pins and bushings, compensator
Correction: Checked over for estimate.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	Shop Sup	Shop Supplies		1.0	\$12.75	\$12.75
Task 1 Subtotals				Parts:		\$0.00
				Labor:		\$127.50
				Miscellaneous:		\$12.75
				Task 1 Subtotals		\$140.25

Task: 2 16-000012 Suspension- Spring Hanger- Replace

Department: Service

Complaint: Replace both front and rear hangers
Replace all four springs
Replace both equalizers

Correction: Cut off front and rear hangers. Welded new hangers on. Built and installed new gussets and crosspipe. Replaced both equalizers. Installed all 4 springs. Tightened bolts. Tightened all u-bolts. Torqued to 500 ft/lbs.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	063-524	5/8-11 STOVER LOCKNUT GR C U	EA	4.0	\$1.43	\$5.72
	079-679	5/8X3 HEX HD CAP SCREW GR 8	EA	4.0	\$2.35	\$9.40
	091-024	5/8-11 FINISHED HEX NUT GR 8	EA	4.0	\$1.34	\$5.36
	101-024	5/8 PAP SPRING L/WASHER YZD	EA	4.0	\$0.53	\$2.12
	122-5012	3/4 DEEP NUTS	EA	16.0	\$1.09	\$17.44
	175-012	U-BOLT WASHER 3/4	EA	16.0	\$0.58	\$9.28
	202-1230	RR 3/4 X 30 THREADED ROD	EA	5.0	\$20.65	\$103.25
	202-1230	RR 3/4 X 30 THREADED ROD / 5557.00	EA	3.0	\$20.65	\$61.95
	334-343	SPRING ROLLER ASSEMBLY	EA	2.0	\$3.81	\$7.62
PLEASE NOTE THAT THERE IS 2 IN EACH BAG.						
	338-452S	HANGER-SPRING FRONT H7700 / 5572.00	EA	1.0	\$76.97	\$76.97
	338-452S	HANGER-SPRING FRONT H7700 / 5576.00	EA	1.0	\$76.97	\$76.97
	338-456S	REAR HANGAR	EA	2.0	\$60.21	\$120.42
	EQ16168	33" EQUALIZER / 5556.00	EA	2.0	\$297.53	\$595.06
	TRA-2741	TRAILER SPRING	EA	4.0	\$182.66	\$730.64
	TRK5544A	REPAIR KIT-LATE MODEL-HUTC / 5556.00	EA	2.0	\$23.76	\$47.52



158 Queens Drive
Red Deer, AB T4P 0R4

PH: (403)343-8771
FAX: (403)340-0888
parts11@fleetbrake.com

**** Reprint ****

Invoice: **11W3075**
Date / Hour: 7/21/2022 4:08:43PM
Repair Order: 3075
Customer:
Branch: FBP11
Total Invoice: \$13,838.40
Charge

Page 2 of 6

Bill To: KANSAS RIDGE TRUCKING LTD.

Ship To: KANSAS RIDGE TRUCKING LTD.

Work:	Shop:	Fax:
Customer P/O: T00-02A	acotton	bkreese
Shop Sup	Shop Supplies	Orig R/O: 0
		Completion Date: 7/21/2022
		1.0 \$263.29 \$263.29
	Task 2 Subtotals	Parts: \$1,869.72
		Labor: \$2,632.88
		Miscellaneous: \$263.29
		Task 2 Subtotals \$4,765.89

Task: 3 16-000007 Suspension- Torque Rod- Re-Bush- On Vehicle Department: Service
Complaint: Replace torque rod bushings
Correction: Removed torque rods and replaced bushings, found corrosion on #1 right side, could not rebush due to damaged end. Replaced torque rod

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	321-175	BUSHING-3 LONG RUBBER	EA	-2.0	\$4.21	(\$8.42)
	345-164S	19.25 ADJ TORQUE ARM, HUTCH	EA	1.0	\$87.10	\$87.10
	TRK6326	REPAIR KIT ASSEMBLY HUTCH / 5556.00	EA	8.0	\$11.84	\$94.72
	Shop Sup	Shop Supplies		1.0	\$76.50	\$76.50
		Task 3 Subtotals			Parts: \$173.40	
					Labor: \$765.00	
					Miscellaneous: \$76.50	
					Task 3 Subtotals \$1,014.90	

Task: 4 38-000001 Safety Inspection Trailer- Wheels Off Air Brakes Department: Service
Complaint: CVIP Inspection - Wheels off
Correction: Inspected and certified unit. CVIP #7510039. Inspected wheels off. Torqued wheels to 500 ft/lbs.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
		Task 4 Subtotals			Parts: \$0.00	
					Labor: \$498.53	
					Task 4 Subtotals \$498.53	

Task: 5 06-010002 Trailer Alignment (Tandem Axle) Department: Service
Complaint: Alignment front
Correction: Set up equipment. Adjusted axle 2. Adjusted axle 1 to tram with 2. Removed equipment. Tightened all torque arm clamps.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	Shop Sup	Shop Supplies		1.0	\$29.96	\$29.96
		Task 5 Subtotals			Parts: \$0.00	
					Labor: \$299.63	
					Miscellaneous: \$29.96	
					Task 5 Subtotals \$329.59	

Task: 6 16-000012 Suspension- Spring Hanger- Replace Department: Service
Complaint: Remove and replace new twisted hangers.
Correction: Replaced hangers on job 2.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
-------	------	--------------------------	-----	----------	-------	----------------

** See Last Page for Invoice Total **



**Truck-Trailer
Parts and Service**
www.fleetbrake.com

158 Queens Drive
Red Deer, AB T4P 0R4

PH: (403)343-8771
FAX: (403)340-0888
parts11@fleetbrake.com

**** Reprint ****

Invoice: **11W3075**
Date / Hour: 7/21/2022 4:08:43PM
Repair Order: 3075
Customer:
Branch: FBP11
Total Invoice: \$13,838.40
Charge

Page 3 of 6

Bill To: KANSAS RIDGE TRUCKING LTD.

Ship To: KANSAS RIDGE TRUCKING LTD.

Work:	Shop:	Fax:
Customer P/O: T00-02A	acotton	bkreese
Shop Sup	Shop Supplies	Orig R/O: 0
		Completion Date: 7/21/2022

1.0	\$33.53	\$33.53
Task 6 Subtotals	Parts:	\$0.00
	Labor:	\$335.33
	Miscellaneous:	\$33.53
Task 6 Subtotals		\$368.86

Task: 7 13-070008 Brakes- Glad Hand - Replace

Complaint: Replace glad hand seals.
Correction: Replaced front glad hand seals.

Department: Service

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	10024	CLOSED GLADHAND RUBBER	EA	2.0	\$0.92	\$1.84
	Shop Sup	Shop Supplies		1.0	\$3.19	\$3.19
		Task 7 Subtotals			Parts:	\$1.84
					Labor:	\$31.88
					Miscellaneous:	\$3.19
		Task 7 Subtotals				\$36.91

Task: 8 34-040006 Lighting System - Reflectors/Reflective-Replace

Complaint: Replace reflective tape on rear of tank. Replace reflective tape on rear of trailer.
Correction: Replaced reflective tape on rear of trailer and mud flap mounts. Replaced reflective tape on rear of tank.

Department: Service

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	40641-5	CONSPICUITY TAPE 2"x12" 4 STRIPS	EA	1.0	\$13.96	\$13.96
	41160-1	REFL TAPE 7SLVR 3 RED/FT	EA	3.0	\$1.03	\$3.09
	RS3000	REFLECTOR STRIP (PAIRS)	EA	1.0	\$19.86	\$19.86
	Shop Sup	Shop Supplies		1.0	\$19.13	\$19.13
		Task 8 Subtotals			Parts:	\$36.91
					Labor:	\$191.25
					Miscellaneous:	\$19.13
		Task 8 Subtotals				\$247.29

Task: 9 78-010003 Trailer Trim And Hardware - Fender - Repair

Complaint: Install missing left fender clamp.
Correction: Installed rear left fender clamp.

Department: Service

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	35335	CLAMP	EA	1.0	\$1.98	\$1.98
	Shop Sup	Shop Supplies		1.0	\$6.38	\$6.38
		Task 9 Subtotals			Parts:	\$1.98



**Truck-Trailer
Parts and Service**
www.fleetbrake.com

158 Queens Drive
Red Deer, AB T4P 0R4

PH: (403)343-8771
FAX: (403)340-0888
parts11@fleetbrake.com

**** Reprint ****

Invoice: **11W3075**
Date / Hour: 7/21/2022 4:08:43PM
Repair Order: 3075
Customer:
Branch: FBP11
Total Invoice: \$13,838.40
Charge

Page 4 of 6

Bill To: KANSAS RIDGE TRUCKING LTD.

Ship To: KANSAS RIDGE TRUCKING LTD.

Work:

Shop:

Fax:

Customer P/O: T00-02A acotton bkreesse Orig R/O: 0 Completion Date: 7/21/2022

Task: 10 59-010003 Vehicle Coupling - Fifth Wheel Assembly - Repair

Department: Service

Complaint: 5th wheel is worn needs to be rebuilt. King pin is worn past spec and needs to be built up.

Correction: Removed 5th wheel. Installed new compensator & slides. Installed grease fittings for lines. Installed 5th wheel plate. Greased.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	01049-19	EP1 BLUE GREASE (WINTER)	EA	1.0	\$7.75	\$7.75
	063-522	1/2-13 STQVER LOCKNUT GR C U	EA	6.0	\$0.77	\$4.62
	079-583	1/2X1-1/2 HEX HD CAP SCREW G	EA	2.0	\$1.74	\$3.48
	101-123	FLATWASHER <HARDENED>	EA	6.0	\$0.66	\$3.96
	103-A	COUPLER, 1/8 FPT	EA	1.0	\$0.83	\$0.83
	122-A	FITTING, HEX NIPPLE, 1/8	EA	1.0	\$0.66	\$0.66
	448-4A	FITTING / 5679.00	EA	2.0	\$1.31	\$2.62
	HR5-4-100	100R5 HYDRAULIC HOSE; 1/4 NID	EA	2.0	\$3.55	\$7.10
	REFURBISH TRAILER	KING PIN / 5630.00	EA	1.0	\$1,400.00	\$1,400.00
	SR528-44	100R5, 1/4 x 1/4 MINV	EA	2.0	\$5.43	\$10.86
	STNIP-012-300	1/8X3 NIPPLE / 5679.00	EA	2.0	\$6.20	\$12.40
	TNDS8001	BRAKE CLEAN SPRAY CAN	EA	2.0	\$4.75	\$9.50
	X100-A	90 DEG ELBOW 1/8 FP	EA	1.0	\$1.35	\$1.35
	XA-0014	SHIM, COMPENSATOR	EA	6.0	\$7.60	\$45.60
	XA-0024-1-P	KOMPENSATOR SHOE	EA	2.0	\$598.99	\$1,197.98
	XA-01997	PLATE, COMPENSATOR, RH	EA	1.0	\$142.45	\$142.45
	XA-01998	PLATE, BEARING HOLLAND KOMP	EA	1.0	\$142.45	\$142.45
	XA-1284-2	WASHER	EA	2.0	\$52.80	\$105.60
	XA-39	KOMPENSATOR TIE ROD	EA	1.0	\$87.07	\$87.07
	XB-0009	RUBBER CUSHION	EA	2.0	\$85.84	\$171.68
	XB-01923-P	SPRING	EA	2.0	\$63.73	\$127.46
	XE-06356-P	PIN BRK'T PAINTED	EA	2.0	\$20.89	\$41.78
	Shop Sup	Shop Supplies		1.0	\$146.37	\$146.37

Task 10 Subtotals

Parts: \$3,527.20

Labor: \$1,463.70

Miscellaneous: \$146.37

Task 10 Subtotals \$5,137.27

Task: 11 13-030009 Brakes- Brake Pot- Replace


Department: Service

Complaint: Replace R#1 brake pot.

Correction: Replaced R#1 brake pot.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	1460-6	FITTING, BRASS, SLEEVE, 3/8	EA	1.0	\$0.19	\$0.19

**** See Last Page for Invoice Total ****

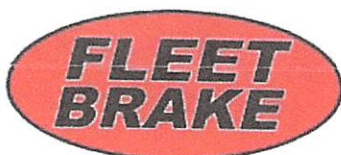

**Truck-Trailer
Parts and Service**
www.fleetbrake.com

158 Queens Drive
Red Deer, AB T4P 0R4

PH: (403)343-8771
FAX: (403)340-0888
parts11@fleetbrake.com

**** Reprint ****

Invoice: **11W3075**
Date / Hour: 7/21/2022 4:08:43PM
Repair Order: 3075
Customer:
Branch: FBP11
Total Invoice: \$13,838.40
Charge
Page 5 of 6

Bill To: KANSAS RIDGE TRUCKING LTD.

Ship To: KANSAS RIDGE TRUCKING LTD.

Work:		Shop:		Fax:	
Customer P/O:	T00-02A	acotton	bkreese	Orig R/O: 0	Completion Date: 7/21/2022
1461-6	AB COMP NUT, 3/8	EA	1.0	\$0.56	\$0.56
1468-6C	AB CONN, 3/8 Tx3/8 MPT	EA	1.0	\$2.66	\$2.66
1481-6	AB BRASS INSERT, 250 T ID	EA	1.0	\$0.19	\$0.19
1485-6-REEL	3/8 SYN FLEX	EA	1.0	\$0.75	\$0.75
GC3030	GOLD SEAL 3030 COMBO	EA	1.0	\$95.97	\$95.97
X124-C	FITTING, STREET ELBOW, 45 DEG, 3	EA	1.0	\$2.48	\$2.48
Shop Sup	Shop Supplies		1.0	\$19.13	\$19.13
Task 11 Subtotals				Parts:	\$102.80
				Labor:	\$191.25
				Miscellaneous:	\$19.13
				Task 11 Subtotals	\$313.18

Task: 12 77-020007 Trailer Frame -Leg Crank Handle - Replace

Complaint: Replace dolly leg handle.

Correction: Replaced dolly leg handle.

Department: Service

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	XA-V-90-10	17 CRANK HANDLE	EA	1.0	\$31.58	\$31.58
	Shop Sup	Shop Supplies		1.0	\$4.46	\$4.46
Task 12 Subtotals				Parts:		\$31.58
				Labor:		\$44.63
				Miscellaneous:		\$4.46
				Task 12 Subtotals		\$80.67

Task: 14 17-000000 Tires And Rims

Complaint: Repair inner L #2 tire. Replace valve core on inner R #1 tire.

Correction: Repaired inner L #2 tire. Replaced valve core on inner R #1 tire. Adjusted brakes. Torqued wheels to 500 ft/lbs. Adjusted tire pressures to 105 PSI.

Department: Service

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	S-100	BRAKE MATE FOR 5/8 PUSHROD	EA	2.0	\$1.84	\$3.68
	Shop Sup	Shop Supplies		1.0	\$7.65	\$7.65
Task 14 Subtotals				Parts:		\$3.68
				Labor:		\$76.50
				Miscellaneous:		\$7.65
				Task 14 Subtotals		\$87.83

Task: 15 13-070016 Brakes- Slack Adjuster- Pins And Bushings-Replace

Complaint: Replace slack positioning pins and bushings.

Correction: Replaced slack positioning pins and bushings.

Department: Service

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	42710558	ARM BUSHING KIT	EA	1.0	\$16.01	\$16.01



**Truck-Trailer
Parts and Service**
www.fleetbrake.com

158 Queens Drive
Red Deer, AB T4P 0R4

PH: (403)343-8771
FAX: (403)340-0888
parts11@fleetbrake.com

**** Reprint ****

Invoice: **11W3075**
Date / Hour: 7/21/2022 4:08:43PM
Repair Order: 3075
Customer:
Branch: FBP11
Total Invoice: \$13,838.40
Charge

Page 6 of 6

Bill To: KANSAS RIDGE TRUCKING LTD.

Ship To: KANSAS RIDGE TRUCKING LTD.

Work:	Shop:	Fax:
Customer P/O: T00-02A	acotton	bkreese
Shop Sup	Shop Supplies	Orig R/O: 0
		Completion Date: 7/21/2022
		1.0 \$6.38 \$6.38
		Task 15 Subtotals
		Parts: \$16.01
		Labor: \$63.75
		Miscellaneous: \$6.38
		Task 15 Subtotals \$86.14

GST/HST Number: 101819472

Detail Tax Info:

GST

\$658.98
Total: \$658.98

Total Parts: \$5,765.12
Total Labor: \$6,785.58
Total Miscellaneous: \$628.72
Invoice Subtotal: \$13,179.42
Total Tax: \$658.98
Total Invoice: \$13,838.40

Payment Method Terms Due Date
Charge Net 30 8/20/2022

Remit To:

Fleet Brake Parts & Service - Red Deer
7843 54th STREET SE
CALGARY, AB T2C 4R7

I, the undersigned owner or duly authorized representative: Authorize the service work to the above unit to be done. I also grant you and/or your employees permission to operate the vehicle in your yard or on streets & highways for testing and/or inspection. Fleet Brake Parts & Service Ltd and its affiliates do not assume any liability for damage or contents while in their possession. Re-torque is required by customer after 30-50km for passenger vehicles & 80-160 km for Commercial Vehicles. U-bolts to be re-torqued after 7 days or 1000km. Service Warranty is 90 days and full warranty can be found at www.fleetbrake.com/service. Any warranties on the product sold hereby are those made by the manufacturer. Payment is Net 30 Days. Service Charge of 2% per month will be charged for all overdue accounts. A storage fee of \$200.00 per month applies for units left after 30 days from completion. No returns on special order parts. A restocking charge of 15% or greater applies to all returned goods. An express Mechanics Lien is hereby acknowledged on the vehicle described on this order.

Work Authorized & Payment Guaranteed by,

Signature: _____