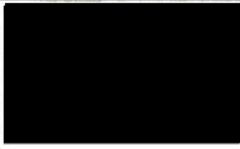


Homestead Mobile Equipment Repair LTD.

26 Glen Howard Way
 Prince Albert, SK S6X 0A8
 (306) 220-7414
 PST #2702751

Invoice

Date	Invoice #
2023-09-26	1080

Invoice To




P.O. No.	Terms	Project

Qty	Description	Rate	Amount
	John Deere 9750 STS combine SN 696089 Inspect combine and compile list of parts and repairs required. Replace feeder chain top shaft sprockets, brgs, conveyor chain wear strips, slip clutch key and nuts, front drum brgs. Replace wear plates on feed accelerator. Replace feeder house 60H drive chain. Replace clean grain top sprocket and brgs. Replace plastics at top of CG elevator. Replace 2 CG drive belt idlers. Replace lower tailings cross auger brgs and sprocket. New key way cut in shaft. Replace tailings #50 chain. Replace serpentine belt tensioner. Replace brg in serpentine belt idler. R & R alternator for repair. Replace inner rotary screen belt and tensioner pulley. Replace elevator drive belt (H154723). Remove half link from tailings paddle chain. Replace rear straw chopper drive belt and idlers (AH171385). Replace grain tank cross auger brgs. Replace unloading auger drive chain. Replace separator drive shaft brgs, Replace discharge beater brgs and belt tensioner pulley. Replace sieve element. Replace chaffer element. Replace concaves and zero. R & R reverser gearcase to have shaft built up where RH brg rides.	<i>Combines</i> <i>Px. Oct. 20/23</i>	

Sales Tax Summary

Thank you for your business.	Total
------------------------------	--------------

Homestead Mobile Equipment Repair LTD.

26 Glen Howard Way
Prince Albert, SK S6X 0A8
(306) 220-7414
PST #2702751

Invoice

Date	Invoice #
2023-09-26	1080

Invoice To
Tom Galloway Farms Box 515 Shellbrook, Sk. S0J 2E0

P.O. No.	Terms	Project

Qty	Description	Rate	Amount
	Replace seals in reverser gearcase. Replace feeder house drive sprocket on reverser shaft (AXE10874). Replace hydro cable ball joint at hydro.		

Sales Tax Summary

Thank you for your business.

Total

Homestead Mobile Equipment Repair LTD.

26 Glen Howard Way
 Prince Albert, SK S6X 0A8
 (306) 220-7414
 PST #2702751

Invoice

Date	Invoice #
2023-09-26	1080

Invoice To
Tom Galloway Farms Box 515 Shellbrook, Sk. S0J 2E0

P.O. No.	Terms	Project

Qty	Description	Rate	Amount
	John Deere 9870 combine Replace CG upper and lower sprockets and brgs. Replace paddle chain. Replace tailings upper and lower sprockets and brgs. Replace tailings paddle chain. Replace shoe supply auger drive belt. John Deere 4555 2wd tractor Check AC. Found system empty. Leak check with 300 psi Nitrogen. Found cab post line leaking. Replace cab post lines and return line from cab post to coupler under cab. <i>/dwyer</i> Vac system amd charge with 3.5 lb R-134A Terex skid steer Install AC line. Vac system and charge with 3.0 lb R-134A Condenser fans aren't cutting in causing high psi.		
136	Service call - Aug 12 2023	2.50	340.00
136	Service call - Aug 13 2023	2.50	340.00
136	Service call - Aug 21 2023	2.50	340.00

Sales Tax Summary

Thank you for your business.	Total
------------------------------	--------------

Homestead Mobile Equipment Repair LTD.

26 Glen Howard Way
Prince Albert, SK S6X 0A8
(306) 220-7414
PST #2702751

Invoice

Date	Invoice #
2023-09-26	1080

Invoice To
Tom Galloway Farms Box 515 Shellbrook, Sk. S0J 2E0

P.O. No.	Terms	Project

Qty	Description	Rate	Amount
136	Service call - Aug 26 2023	2.50	340.00
2	6203 brg	10.00	20.00
1	Nitrogen leak check	40.00	40.00
88	R-134A (oz)	2.00	176.00
65	Labour	130.00	8,450.00

Sales Tax Summary

GST@5.0%	502.30
Total Tax	502.30

Thank you for your business.

Total \$10,548.30