

336239 Alberta Ltd O/A Dave's Diesel Repair

11491 - 261 ST,

Acheson, AB. T7X 6C6

Phone: (780) 962-1264 Fax: (780)-962-6230

www.davesdieselrepair.com

G.S.T. Number : R106157043

DO2-17
SEP



Invoice

Bill To Ron Prokipchuk Trucking Ltd (RPTL)

PO Box 122
Whitecourt, AB T7S 1N3
Canada

Business (780) 648-3950

Cell

Cell

Business Fax

Email

Email

Invoice # 50722

Work Order # 62750

Service Advisor BB2203

Technician KVP0403

Plate AB AB B-11918

Description Orange/Black 1990 Kenworth W900 CAT 3406 C


3ZJ29351

VIN 2XKWDB9X5LM924620

Unit UNIT 5

Odometer 786,314

CUSTOMER COPY

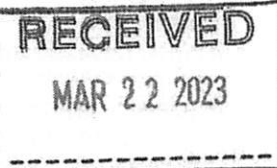

Invoice Date 3/15/2023 12:16 PM

Appointment 1/18/2023 10:30 AM

Promised 2/14/2023 12:30 PM

Concern

ISSUES / CONCERNS / INSTRUCTIONS. -
PREVIOUS WO#62652 (ENGINE MISFIRE)
ENGINE STILL MISFIRES AFTER REPAIR

Service

CA200- Engine, Cat

TROUBLE SHOOT MISS AND REPAIR - RE & RE TOP END REMOVED #6 NOZZLE FOUND TIP WAS BROKEN OFF.

Labor

\$268.72 *G

Technician: KVP0403 / Service Advisor: BB2203

Discount (\$268.72)
Sub \$0.00

CA335- Nozzles (A/B/C - PEEC)

Remove Nozzles. . Reinstall. = WHEN NOZZLE WAS REMOVED THE TIP WAS BROKE OFF REPLACED WITH A NEW ONE .

Labor

\$302.31 *G

Technician: KVP0403 / Service Advisor: BB2203

CAT7W7041 - NOZZLE

1 Unit

\$144.83 / Unit

\$144.83 G

Technician: KVP0403 / Service Advisor: BB2203

HG220C - HI-GEAR DIESEL FUEL LUBRICANT (1.9L)

1 Unit

\$8.26 / Unit

\$8.26 G

Technician: KVP0403 / Service Advisor: BB2203

Discount (\$455.40)
Sub \$0.00

CA210- Engine (In-Frame Overhaul)

Drain Coolant. Drain Engine Oil. Remove Oil Pan and Inspect for Debris. Remove Oil Pump and Girdle. Inspect Oil Pump, Replace IF Required. Remove Valve Covers, Rocker Shafts, Spacer Cover and Injectors. Remove Intake and Exhaust Piping. Remove Turbo. Remove Exhaust Manifold. Remove Cylinder Head. Remove ALL Piston Coolers. Remove ALL Cylinder Kits. Clean Block and Inspect. Inspect Crankshaft. Replace Main and Rod Bearing. Replace ALL Pistons, Liners, Rings as Required. Install Piston Coolers. Transfer ALL Fittings to Cylinder Head. Install Exhaust Manifold on Cylinder Head. Install Cylinder Head and Torque. Install Injectors. Inspect Rocker Levers, Replace IF Required. Set Valves and Injectors. Close Up Top End. Install Oil Pan. Fill With All Fluids. Run Engine. Check For Leaks. **OIL SAMPLES TO BE TAKEN FOR WARRANTY TO BE VALID**** DO NOT USE SYNTHETIC OIL FOR FIRST 160,000kms. IF USED WARRANTY WILL BE VOID**

Labor

\$6,718.00 *G

Technician: KVP0403 / Service Advisor: BB2203

Labor

\$0.00 *G

Technician: RA1901 / Service Advisor: BB2203

39 Years!!! DEDICATED To CUSTOMERS

3/15/2023 12:17 PM

Invoice #50722

Page 1 of 6

CAT233-9198 - HEAD GASKET KIT Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$849.60 / Unit	\$849.60 G
228-0R4425-407 - REBUILT CYLINDER HEAD 3406 ROUND PORT (SN:60841) Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$4,918.72 / Unit	\$4,918.72 G
CAT0R9847/3757 - *CYLINDER KIT Technician: KVP0403 / Service Advisor: BB2203	5 Unit	\$1,285.37 / Unit	\$6,426.85 G
CAT0R9847/3757 - *CYLINDER KIT Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$1,579.60 / Unit	\$1,579.60 G
CAT166-3650/145-6860/100-3851 - *PISTON COOLING NOZZLE(DUAL) Technician: KVP0403 / Service Advisor: BB2203	6 Unit	\$242.90 / Unit	\$1,457.40 G
CAT4P2064/0R6169 - REBUILT TURBO Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$3,602.10 / Unit	\$3,602.10 G
CAT243-6718/196-9523 - *MAIN BEARING KIT Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$997.50 / Unit	\$997.50 G
CAT101-7788/422-3883 - LIFTER Technician: KVP0403 / Service Advisor: BB2203	3 Unit	\$175.00 / Unit	\$525.00 G
CAT328-5573/9Y7735 - *ROD BEARING Technician: KVP0403 / Service Advisor: BB2203	6 Unit	\$70.75 / Unit	\$424.50 G
228-9Y2587-008 - MANIFOLD, WATER 3406B Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$272.32 / Unit	\$272.32 G
CAT153-7058/017996 - *SLAVE PISTON KIT Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$215.00 / Unit	\$215.00 G
337-3406SK - EXHAUST STUD KIT (ABC) Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$247.57 / Unit	\$247.57 G
CAT129-9452 - *FIBRE EXHAUST GASKET Technician: KVP0403 / Service Advisor: BB2203	6 Unit	\$0.00 / Unit	\$0.00 G
CAT104-9526/015529 - *JAKE STUD(349) Technician: KVP0403 / Service Advisor: BB2203	4 Unit	\$42.22 / Unit	\$168.88 G
860-9802 - OIL PAN HEATER Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$150.32 / Unit	\$150.32 G
TEM860-8059 - POWER CORD, WEATHER PROOF "Y" Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$156.27 / Unit	\$156.27 G
228-9Y2586-008 - HOUSING THERMOSTAT Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$162.96 / Unit	\$162.96 G
5526-062/NL4875-063X50 - HEATER HOSE, SILICONE, 5/8" Technician: KVP0403 / Service Advisor: BB2203	30 Unit	\$4.81 / Unit	\$144.30 G
38-0353 - HEAVY DUTY T-BOLT CLAMP Technician: KVP0403 / Service Advisor: BB2203	4 Unit	\$24.45 / Unit	\$97.80 G
CAT5P5678B - VALVE COVER SEAL Technician: KVP0403 / Service Advisor: BB2203	4 Unit	\$21.76 / Unit	\$87.04 G
CAT2N2765 - *BOLT Technician: KVP0403 / Service Advisor: BB2203	4 Unit	\$17.20 / Unit	\$68.80 G
57248 - RAD HOSE HI-MILER Technician: KVP0403 / Service Advisor: BB2203	13 Unit	\$5.54 / Unit	\$72.02 G
190297-8 / N65032-08-08 - 45" HOSE FITTING Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$59.80 / Unit	\$59.80 G
462-247-7133 - REGULATOR (THERMOSTAT), CAT, 190 DEG Technician: KVP0403 / Service Advisor: BB2203	1 Unit	\$57.92 / Unit	\$57.92 G
CAT2N2766 - MANIFOLD LOCKNUT Technician: KVP0403 / Service Advisor: BB2203	4 Unit	\$10.52 / Unit	\$42.08 G
76-9906/76-9875RL/816S-T - HIGH TEMP SPLIT LOOM 1" Technician: KVP0403 / Service Advisor: BB2203	17 Foot	\$2.62 / Foot	\$44.54 G
CAT4N1151-6 - OIL PAN GASKET (ONE PIECE) Technician: KVP0403 / Service Advisor: BB2203	2 Unit	\$21.24 / Unit	\$42.48 G
CAT5H7704 - TURBO CROSSOVER ORING/ELBOW Technician: KVP0403 / Service Advisor: BB2203	2 Unit	\$18.51 / Unit	\$37.02 G
CAT165-6170/4N0999 - *BLOCK PLUG Technician: KVP0403 / Service Advisor: BB2203	3 Unit	\$10.81 / Unit	\$32.43 G
4401-8/N65031-08-08 - FITTING FLANGE	2 Unit	\$15.92 / Unit	\$31.84 G

Technician: KVP0403 / Service Advisor: BB2203			
CAT4W5998 - PUSH TUBE	1 Unit	\$35.00 / Unit	\$35.00 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT108-3612 - EXHAUST STUD SPACER	1 Unit	\$28.77 / Unit	\$28.77 G
Technician: KVP0403 / Service Advisor: BB2203			
KYS3022-01372-01 - BUSHING	1 Unit	\$19.50 / Unit	\$19.50 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT9L9098 - CARBON DAM SEAL	5 Unit	\$4.96 / Unit	\$24.80 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT7W4487 - *WASHER	5 Unit	\$4.68 / Unit	\$23.40 G
Technician: KVP0403 / Service Advisor: BB2203			
4401-4S/DSR528-44/N65031-04-04 - FITTING FLANGE	2 Unit	\$7.87 / Unit	\$15.74 G
Technician: KVP0403 / Service Advisor: BB2203			
4401-8/N65031-08-08 - FITTING FLANGE	1 Unit	\$15.92 / Unit	\$15.92 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT114-3364/8T0659 - SEAL WASHER	5 Unit	\$2.87 / Unit	\$14.35 G
Technician: RA1901 / Service Advisor: BB2203			
FC350-8/ NL245-08 - HOSE	1 Unit	\$10.75 / Unit	\$10.75 G
Technician: KVP0403 / Service Advisor: BB2203			
FC350-8/ NL245-08 - HOSE	1 Unit	\$10.75 / Unit	\$10.75 G
Technician: KVP0403 / Service Advisor: BB2203			
HSS12 / N62ET-12 - SILICONE HOSE CLAMP	8 Unit	\$1.44 / Unit	\$11.52 G
Technician: KVP0403 / Service Advisor: BB2203			
FC350-4/NL245-04 - HOSE	1 Unit	\$9.01 / Unit	\$9.01 G
Technician: KVP0403 / Service Advisor: BB2203			
57224 - RAD HOSE HI-MILER	3 Unit	\$2.72 / Unit	\$8.16 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT4N0699 - GASKET	1 Unit	\$6.50 / Unit	\$6.50 G
Technician: KVP0403 / Service Advisor: BB2203			
N79VW-356 - SUPPORT CLAMP	1 Unit	\$5.70 / Unit	\$5.70 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT9Y2588 - THERMOSTAT HOUSING GASKET	1 Unit	\$5.38 / Unit	\$5.38 G
Technician: KVP0403 / Service Advisor: BB2203			
BEN236170 - INLET GASKET	2 Unit	\$2.46 / Unit	\$4.92 G
Technician: KVP0403 / Service Advisor: BB2203			
HS20 / N64-20 - CLAMP	2 Unit	\$1.72 / Unit	\$3.44 G
Technician: KVP0403 / Service Advisor: BB2203			
GRO84-2433 - CONNECTOR, FEMALE BULLET, 16-14, .156, HEAT SHRINK, FI	1 Unit	\$3.31 / Unit	\$3.31 G
Technician: KVP0403 / Service Advisor: BB2203			
GRO83-2350 - CONNECTOR, BUTT SPLICE, 16-14 (BLUE)	2 Unit	\$1.65 / Unit	\$3.30 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT100-6178\7W6084 - COMPRESSOR MOUNTING GASKET	1 Unit	\$3.22 / Unit	\$3.22 G
Technician: KVP0403 / Service Advisor: BB2203			
N2404-08-08 - ADAPTER, STEEL, MALE JIC TO MALE PIPE	1 Unit	\$3.00 / Unit	\$3.00 G
Technician: KVP0403 / Service Advisor: BB2203			
GRO83-2408/76-1648PK - CONNECTOR, RING, 16-14 X #8, HEAT SHRINK	2 Unit	\$1.17 / Unit	\$2.34 G
Technician: KVP0403 / Service Advisor: BB2203			
K66999 / N5406-06-04/N260-038-025BI - HEX PIPE BUSHING-ST	1 Unit	\$2.30 / Unit	\$2.30 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT1H1023 - O RING	2 Unit	\$1.05 / Unit	\$2.10 G
Technician: KVP0403 / Service Advisor: BB2203			
76-9902 / 773.38/76-9864RL/83-8000RL - HIGH TEMP SPLIT LOOM 3/8"	1 Foot	\$1.97 / Foot	\$1.97 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT6L1883/236577N - GASKET, GOVERNOR	1 Unit	\$1.10 / Unit	\$1.10 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT7M9831 - *FUEL LINE SCREW	1 Unit	\$1.09 / Unit	\$1.09 G

Technician: KVP0403 / Service Advisor: BB2203			
SSS516X100NC - SOCKET SET SCREW, 5/16" NC X 1"	1 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
11123 / N79VN-050 - BODY CLAMP	1 Unit	\$0.89 / Unit	\$0.89 G
Technician: KVP0403 / Service Advisor: BB2203			
1214BK - BLACK WIRE 14 GAUGE	1 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
GRO84-2501 - CONNECTOR, RING, 12-10 X #8, HEAT SHRINK	1 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
1214WH - WHITE WIRE.14 GAUGE	1 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
120-000-109Z - NUT, HEX, GR8, 1/2" NF	1 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
UNI-3.78 - UNI GAURD ANTIFREEZE (GREEN)	7 Unit	\$15.34 / Unit	\$107.38 E2G
Technician: KVP0403 / Service Advisor: BB2203			
		Discount	(\$19,558.47)
		Sub	\$10,517.80

CA330- Time Engine (B & C)

Install Timing Tool. Adjust Timing as Required. Re-Seal Timing Cover. Remove Timing Tool.

Labor			\$285.52 *G
Technician: KVP0403 / Service Advisor: BB2203			
CAT4B2047 - *NUT	2 Unit	\$0.26 / Unit	\$0.52 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT2W0459 - *TIMING COVER GASKET	1 Unit	\$6.98 / Unit	\$6.98 G
Technician: KVP0403 / Service Advisor: BB2203			
		Sub	\$293.02

DU01- CAC (Test)

Remove Clamps from Turbo And Air Inlet. Test ALL Connections and CAC. Replace Hoses and Clamps as Required.

Labor			\$120.00 *G
Technician: KVP0403 / Service Advisor: BB2203			
B9224-0406B/ N68SL-406/ 38-0072/38-0373 - HEAVY DUTY T-BOLT CLAMP	1 Unit	\$17.30 / Unit	\$17.30 G
Technician: KVP0403 / Service Advisor: BB2203			
		Sub	\$137.30

CA070- Dampner

Remove Vibration Dampner and Replace with New. Run Engine Up and Check for Vibration.

Labor			\$520.64 *G
Technician: KVP0403 / Service Advisor: BB2203			
TVD 716405-000/7E9520/167-8126 - VIBRATION DAMPNER W/PLATE(CAT)	1 Unit	\$870.33 / Unit	\$870.33 G
Technician: KVP0403 / Service Advisor: BB2203			
		Discount	(\$520.64)
		Sub	\$870.33

FI02- Fuel Filters AND/OR Coolant Filters

Replace Fuel AND/OR Coolant Filters.

WF2077 - WATER FILTER	1 Unit	\$16.46 / Unit	\$16.46 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT256-8753 - FUEL/WATER FILTER	1 Unit	\$41.22 / Unit	\$41.22 G
Technician: KVP0403 / Service Advisor: BB2203			
49N1676-ATF-L - ATF, CONVENTIONAL, DEXRON/MERCON	3 Unit	\$6.46 / Unit	\$19.38 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT1R0749 - FILTER, FUEL	1 Unit	\$38.90 / Unit	\$38.90 G
Technician: KVP0403 / Service Advisor: BB2203			
		Sub	\$115.96

FI01- Air Filter(s)

Remove and Inspect. Replace IF Required.

Labor			\$167.95 *G
Technician: KVP0403 / Service Advisor: BB2203			
AF4664/ P521598 - AIR FILTER	2 Unit	\$107.04 / Unit	\$214.08 G
Technician: KVP0403 / Service Advisor: BB2203			
		Sub	\$382.03

DS110- Chassis Dyno (Engine Overhaul)
 Complete Hook-Up. Fuel Pressure, Boost Pressure, Exhaust Temp, Crankcase Pressure. Run Engine Up After Engine Overhaul.
 Seat Engine Rings. Perform Full Power Check at End of Run.

Labor			\$750.00 *G
Technician: JJ1904 / Service Advisor: BB2203			
BEN279615 - BENDIX UNLOADER KIT	1 Unit	\$20.00 / Unit	\$20.00 G
Technician: KVP0403 / Service Advisor: BB2203			
CAT6L1883/236577N - GASKET, GOVERNOR	1 Unit	\$1.02 / Unit	\$1.02 G
Technician: KVP0403 / Service Advisor: BB2203			
800405-G3 - AD-9 S/S PURGE VALVE 12V (NEW)	1 Unit	\$88.47 / Unit	\$88.47 G
Technician: KVP0403 / Service Advisor: BB2203			
		Discount	(\$760.85)
		Sub	\$98.64

TD01- Test Drive

Test Drive Unit Before and/or After Repairs. (49)

Labor			\$65.00 *G
Technician: BB2203 / Service Advisor: BB2203			
		Discount	(\$65.00)
		Sub	\$0.00

Shop Supplies

Shop Supplies used for the purpose of working on a Unit

KIM54015 - KIM TOWELS	0 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
72954 / 76-2890 / CHTB-1450 - CABLE TIE (BLACK)	24 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
CRC75088/45046 - BRAKELEEN	3 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
MMM07447 - 6X9 RED SCOTCH BRITE PADS	2 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
CA21033 - SUPERLUBE	1 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
MMM5528/07480 - ROLOC DISC COARSE...2"	6 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
HOWHMP056 - PENETRATING OIL(AEROSOL)	1 Unit	\$0.00 / Unit	\$0.00 G
Technician: KVP0403 / Service Advisor: BB2203			
BD1312/892150016 - PAINT. AEROSOL CAT YELLOW	4 Unit	\$21.23 / Unit	\$84.92 G
Technician: KVP0403 / Service Advisor: BB2203			
		Sub	\$84.92

Total Parts	\$11,926.53
Total Labor	\$573.47
Total Before Taxes & Miscellaneous Charges	\$12,500.00

(*) Shop Supplies*		\$0.00 G
(E2) Environmental Charge-Coolant	\$1.00 Each	\$7.00
(G) Canadian Goods and Services Tax (GST)	5 %	\$625.00
Grand Total		\$13,132.00

Total discounts applied is \$21,629.08

Ron Prokipchuk Trucking Ltd (RPTL) charged \$13,132.00 to Account - 1795 - Ron Prokipchuk Trucking Ltd (RPTL) - Net 30 Days

G.S.T. Number : R106157043

Terms: Cash or Credit Card unless arrangements made when work order is started. Interest on all overdue accounts shall be charged at 42.58% per annum (3% per month) & storage charges in the Sum of \$25.00 per day. Core must be returned within 30 days after the purchase, together with the

39 Years!!! DEDICATED To CUSTOMERS

3/15/2023 12:17 PM

Invoice #50722

Page 5 of 6

original invoice copy to be eligible for the core credit. All parts return will be subject to 25% restocking charge.

I have read and understand the above terms and agree to be bound thereby.

I hereby acknowledge my indebtedness in the amount of above Invoice Total, or otherwise specified here as \$_____

Signature _____



336239 Alberta Ltd O/A Dave's Diesel Repair

11491 - 261 ST,

Acheson, AB. T7X 6C6

Phone: (780) 962-1264 Fax: (780)-962-6230

www.davesdieselrepair.com

G.S.T. Number : R106157043

TS✓

Invoice

Bill To Ron Prokipchuk Trucking Ltd (RPTL)

PO Box 122
Whitecourt, AB T7S 1N3
Canada

Business (780) 648-3950

Cell

Cell

Business Fax

Email

Email

Invoice # 50114

Work Order # 62652

Service Advisor DS83

Technician LM1807

Plate AB AB B-11918

Description Orange/Black 1990 Kenworth W900 CAT 3406 C
3ZJ29351

VIN 2XKWDB9X5LM924620

Unit UNIT 5

Odometer 785,349

CUSTOMER COPY

RECEIVED

JAN 18 2022

Invoice Date 1/12/2023 9:00 AM

Appointment 1/9/2023 1:17 PM

Promised 1/12/2023 3:17 PM

Concern

ISSUES / CONCERNS / INSTRUCTIONS. - **TECH; RECORD ENGINE HOURS AND FROM WHAT SOURCE (dash gauge, ecm)**
CUSTOMER ADVISES ENGINE HAD A MISS & SEEMS TO HAVE CLEARED UP. (TEST NOZZLES) FIRST TIME UNIT TO DDR
*** PLEASE NOTE ***

THIS WORK ORDER (or Estimate) CONTAINS ONLY THE JOB CODES & PARTS THAT ARE ANTICIPATED. ADDITIONAL JOB
CODES & PARTS MAYBE REQUIRED TO COMPLETE THE REPAIR(s).

Service

DU01- CAC (Test)

Remove Clamps from Turbo And Air Inlet. Test ALL Connections and CAC. Replace Hoses and Clamps as Required. 0 PSI LEAK
Labor \$120.00 *G

Technician: LM1807 / Service Advisor: DS83

Sub \$120.00

CA335- Nozzles (A/B/C - PEEC)

Remove Nozzles. Send to Fuel Room for Testing. Reinstall.

Labor

Technician: LM1807 / Service Advisor: DS83

\$302.31 *G

CAT1H1023 - O RING

8 Unit

\$1.05 / Unit

\$8.40 G

Technician: LM1807 / Service Advisor: DS83

Sub \$310.71

CA340- Test Nozzles (A/B/C)

Test Nozzles. Re-Seal/Replace as Required. (ALL NOZZLES TESTED WEAK ON VOP, ALL HAD POOR SPRAY PATTERN AND A
COUPLE HAD TIP LEAKAGE, REPLACED ALL SIX)

Labor

Technician: CR2002 / Service Advisor: DS83

\$200.00 *G

CAT7W7041 - NOZZLE

6 Unit

\$144.83 / Unit

\$868.98 G

Technician: CR2002 / Service Advisor: DS83

Sub \$1,068.98

REPLACE CA760- Valve Set (A/B/C)

Remove Valve Covers and Necessary Piping. Remove Jakes. Set Valves and Cross-Heads. Reinstall Jakes and Adjust (346 Only).
Replace Valve Cover Material IF Required. Reinstall ALL Required Piping. REPLACE JAKE SPACER GASKETS, VALVE COVER IS
FINE. HELI-COIL SEVERAL BOLT HOLES. ****NOTE: JAKE SOLNOID SHOULD HAVE BEEN REPLACED. NO STOCK
ANYWHERE(BUTTONS STARTING TO SINK)

Labor

\$722.18 *G

39 Years!!! DEDICATED To CUSTOMERS

1/12/2023 9:01 AM

Invoice #50114

Page 1 of 2

Technician: LM1807 / Service Advisor: DS83

CAT5P5678B - VALVE COVER SEAL

2 Unit

\$25.60 / Unit

\$51.20 G

Technician: LM1807 / Service Advisor: DS83

R1185-5/ P208-105 - HELICOIL 5/16NC

2 Unit

\$1.91 / Unit

\$3.82 G

Technician: LM1807 / Service Advisor: DS83

Sub \$777.20

CA090- Engine Brake Adjust (349)

Additional Charge for 349 Engine Brake

Labor

\$134.36 *G

Technician: LM1807 / Service Advisor: DS83

Sub \$134.36

CA325- Timing Advance

Remove Timing Advance and Inspect. Repair as Required.

REMOVE TIMING ADVANCE AND INSPECT WEIGHTS

\$251.92 *G

AND RACE. ALL LOOKED LIKE NEW. REINSTALL. DID

NOT BOTHER TO INSTALL TIMING TOOL BECAUSE

WEIGHTS AND RACE WERE IN VERY GOOD CONDITION

AND RUNNING OUT OF TIME.

Technician: TK0710 / Service Advisor: DS83

Sub \$251.92

Total Parts

\$932.40

Total Labor

\$1,730.77

Total Before Taxes & Miscellaneous Charges

\$2,663.17

(*) Shop Supplies

\$173.08 G

(G) Canadian Goods and Services Tax (GST)

5 %

\$141.82

Grand Total

\$2,978.07

Ron Prokipchuk Trucking Ltd (RPTL) charged \$2,978.07 to Account - 1795 - Ron Prokipchuk Trucking Ltd (RPTL) - Net 30 Days

G.S.T. Number : R106157043

Terms: Cash or Credit Card unless arrangements made when work order is started. Interest on all overdue accounts shall be charged at 42.58% per annum (3% per month) & storage charges in the Sum of \$25.00 per day. Core must be returned within 30 days after the purchase, together with the original invoice copy to be eligible for the core credit. All parts return will be subject to 25% restocking charge.

I have read and understand the above terms and agree to be bound thereby.

I hereby acknowledge my indebtedness in the amount of above Invoice Total, or otherwise specified here as \$ _____

Signature _____

39 Years!!! DEDICATED To CUSTOMERS

1/12/2023 9:01 AM

Invoice #50114

Page 2 of 2

Invoice

Page 1

FROM Tax ID/EIN/VAT No.: 38-2142868 Contact Name: Truck Spring Michigan Truck Spring 2870 Nodular Dr. Saginaw, MI 48601 United States Phone: 9897550561		Waybill Number: 422828TZ3DS Shipment ID: 422828TZ3DS  Date: 05/DEC/2022 Invoice No: PO No: Terms of Sale (Incoterm): DAP Reason for Export: SALE	
SHIP TO Tax ID/VAT No.: Contact Name: RPTL PO Box 122 Stn Main 590003 Hwy 751 Whitecourt, AB T7S1N3 Canada Phone:		SOLD TO INFORMATION Tax ID/VAT No.: Contact Name: RPTL PO Box 122 Stn Main 590003 Hwy 751 Whitecourt, AB T7S1N3 Canada Phone:	

Units	U/M	Description of Goods/Part No.	Harm. Code	C/T/O	Unit Value	Total Value
2	EA	Center Frame Bracket Kenworth Air		US	545.91	1,091.82

Additional Comments:

Declaration Statement: I hereby certify that the information on this invoice is true and correct and the contents and value of this shipment are as stated.		Invoice Line Total: 1,091.82 Discount/Rebate: 0.00 Invoice Sub-Total: 1,091.82 Freight: 0.00 Insurance: 0.00 Other: 0.00 Total Invoice Amount: 1,091.82	
Shipper	Date	Total Number of Packages: 2 Currency: USD Total Weight: 94.0 LBS	

These items are controlled by the U.S. Government and authorized for export only to the country of ultimate destination for use by the ultimate consignee or end-user(s) herein identified. They may not be resold, transferred, or otherwise disposed of, to any other country or to any person other than the authorized ultimate consignee or end-user(s), either in their original form or after being incorporated into other items, without first obtaining approval from the U.S. government or as otherwise authorized by U.S. law and regulations.

Packing Slip

Michigan Truck Spring

2870 Nodular Dr.
Saginaw, MI 48601


**Ship To:**

RPTL
PO Box 122 Stn Main
590003 Hwy 751
Whitecourt, AB T7S 1N3 CA

Order # 231923**Date** 11/28/2022**User****Ship Date** 12/5/2022

Item	Description	Qty
MK16917	Center Frame Bracket Kenworth Airglide Aluminum	2



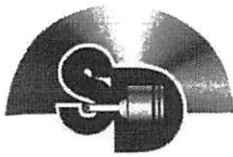

Sunset Diesel Service Ltd
10781-184st
Edmonton, AB
T5S 2T2
(780) 455-1171

INVOICE

T5

INVOICE # 14223

DATE: 1/16/2015

Page 1 of 1

PO#:

R.P.T.L.
 Box 122
 Whitecourt AB T5S 1N3

Unit No. T 5
 Make / Year Kenworth 1989
 Serial No. 2XKWDB9X5LM924620
 Mileage 764,786
 License No. B-11918
 Eng. Serial No. 3ZJ29351

Description	Part Number	Ordered	Shipped	Price	Total	Tax
Check engine for hard starting and possible miss or sputtering problem. Check fuel sytem for possible air problem. Replace gasket on hand primer pump. Replace loose fitting and oring on filter base. Check fuel pressure. Pressure is good. Check override system and found override switch not working all the time. Repair ground connection and change ground contact location. Test shut off solenoid and curcuit. Rack is not coming back all the time if you step down on throttle and let it up the rack will come back. Problem is likely in the back of pump. Customer does not want to repair at this time. Check engine timing. Remove and rebuild timing advance unit. Set valves. Valve were out lots. Set jake trigger valves. Valves were not set right. Test charge air cooler and hoses. Remove and replace charge air cooler. Customer supplied cooler.						
T/A seal	4W2754	2.00	2.00	27.45	54.90	G
Cover Gasket T/A	2W0459	1.00	1.00	7.98	7.98	G
Race T/A 3406C	4P3337	1.00	1.00	27.40	27.40	G
Gasket	1P0436	1.00	1.00	4.65	4.65	G
T/A Seal	9X7715	1.00	1.00	36.72	36.72	G
Connector	23023	1.00	1.00	1.25	1.25	G
Connector	23097	1.00	1.00	1.50	1.50	G
14Ga Wire Blk	GRO87-7000	3.00	3.00	0.50	1.50	G
Gasket	2W5447	1.00	1.00	5.45	5.45	G
Oring 3406	8L2779	2.00	2.00	5.90	11.80	G
Seal/sold by the met	5P5678	5.00	5.00	26.05	130.25	G
Clamp Air to Air	90600K	1.00	1.00	11.95	11.95	G
Labour Shop	SD100	18.25	18.25	145.00	2,646.25	G
Supplies / Enviro	SHOP SUPP	1.00	1.00	211.70	211.70	G

GST Number R109195685

I/We hereby acknowledge the indebtedness of this invoice. If the balance due is not paid within Sunset Diesel's credit terms, I agree to pay interest at the rate of 2% per month (24% per annum).

Terms - Net 30 Days.

Storage changes \$35 per day

One Hour minimum charge on all invoices.

One year parts and labour warranty. Some restrictions apply.

Sub Total	\$3,153.30
GST 5%	\$157.67
Total	\$3,310.97
Paid	\$0.00
Balance	\$3,310.97

DATE: 16/01/15 SIGNATURE

Cheque # 3673



Sunset Diesel Service Ltd
10781-184st
Edmonton, AB
T5S 2T2
(780) 455-1171

INVOICE

T5

INVOICE #	14254
DATE:	2/2/2015
Page	1 of 1
PO#:	

R.P.T.L.
 Box 122
 Whitecourt AB T5S 1N3

Unit No.	5
Make / Year	Kenworth 1989
Serial No.	2XKWDB9X5LM924620
Mileage	768,919
License No.	B-11918
Eng. Serial No.	3ZJ29351

Description	Part Number	Ordered	Shipped	Price	Total	Tax
Hard Starting. Customer has to step down all the way on the throttle to start engine. After a cold start in the morning the engine stumbles may have possible air problem also. Rebuild back governor section of the fuel pump. Check engine for possible air in fuel system. Replace hand pump. Pump is leaking out the top but the valves are working. Replace 1 bad oring on filter base housing on the top side of engine. Customer will monitor.						
F/P Kit 3406B	6V9894	1.00	1.00	268.89	268.89	G
Race	8E5237	2.00	2.00	13.43	26.86	G
Bearing F/P 3406B	7L3326	1.00	1.00	13.43	13.43	G
Dowel F/P 3406B	4N9019	1.00	1.00	5.98	5.98	G
Race	7E4892	2.00	2.00	7.95	15.90	G
Bearing F/P Cat	7M7219	1.00	1.00	4.87	4.87	G
Spring 3406B	8L9790	1.00	1.00	16.43	16.43	G
Cover F/P 3406B	8N8082	1.00	1.00	17.98	17.98	G
Seal	4M8303	1.00	1.00	2.30	2.30	G
Gasket Housing F/P	8N9384	1.00	1.00	5.87	5.87	G
Dowel	1S5440	4.00	4.00	5.75	23.00	G
Shaft F/P 3406B	8N2510	1.00	1.00	73.70	73.70	G
Pump 3406 Primer	1052508	1.00	1.00	126.75	126.75	G
Gasket	1P0436	1.00	1.00	4.65	4.65	G
Gov Weight	7N7264	4.00	4.00	65.50	262.00	G
Oring Viton	2116V	1.00	1.00	2.50	2.50	G
Labour Shop	SD100	7.00	7.00	145.00	1,015.00	G
Supplies / Enviro	SHOP SUPP	1.00	1.00	81.20	81.20	G

GST Number R109195685

I/We hereby acknowledge the indebtedness of this invoice. If the balance due is not paid within Sunset Diesel's credit terms, I agree to pay interest at the rate of 2% per month (24% per annum).

Terms - Net 30 Days.

Storage charges \$35 per day

One Hour minimum charge on all invoices.

One year parts and labour warranty. Some restrictions apply.

Sub Total	\$1,967.31
GST5%	\$98.37
Total	\$2,065.68
Paid	\$0.00
Balance	\$2,065.68

DATE: _____ SIGNATURE: RDP