

J22-22
MAY

Invoice #55908

Fleet PO# 27

Page 1 of 10
07/10/2025 4:22 PM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

**CARIBOO RAILROAD
CONTRACTING CORP**
#117 3030 Pandosy St
Kelowna, BC V1Y 0C4
thawryluk@cariboorail.com
+1 250-997-7510

2017 GMC Sierra 1500
3GTU2LEC0HG361946
Engine: 5.3L V8 (C) L83
FLEX FI
Plate: CPP6751
Fleet #: 27
Odometer In: 479992
Odometer Out: 480000

Advisor: Laura Letendre
Technician: 8 Sophie Ireland

GRAND TOTAL: \$5,194.76

BALANCE DUE: \$5,194.76

Reason for Customer's Visit

a/c not working was "repaired" at dealership 2 weeks ago now blowing hot air

SERVICES

1 Courtesy Vehicle Health & Safety Inspection & Check-In

SUBTOTAL: \$0.00

LABOR

VEHICLE WALKAROUND

RECORD KILOMETERS, LIC PLATE, VIN, & ENGINE HOURS (WHERE APPLICABLE)

RECORD ENGINE HOURS (WHERE APPLICABLE)

RECORD VEHICLE OPTIONS (AWD, 4X4, 2WD, A/C, AUTO, MANUAL)

VEHICLE PRE-SCAN & DIGITAL VEHICLE INSPECTION - INCLUDES TESTING BLOCK HEATER

"GOOD TO GO" COURTESY BATTERY TEST (For vehicles with easily accessible battery)

TEST DRIVE (Cannot be performed if vehicle appears unsafe or other issues arise)

2 A/C SYSTEM INSPECTION & RECHARGE (EITHER R134A OR 1234YF)

SUBTOTAL: \$384.98

LABOR

VERIFY CUSTOMER CONCERN AND CHECK VENT TEMPERATURE FROM DRIVER SIDE AND PASSENGER SIDE (MAY REQUIRE TEST DRIVE)

VERIFY A/C CONDENSER CONDITION

VERIFY COMPRESSOR ENGAGEMENT

VISUAL LEAK DETECTION WITH UV LAMP AND DYE

CONNECT A/C MACHINE AND IDENTIFY REFRIGERANT AND VERIFY HIGH AND LOW PRESSURES.

IF ALL TESTS PASS - EVACUATE AND RECHARGE SYSTEM WITH NEW UV DYE

CLIENT TO RETURN IN 3-5 DAYS TO RECHECK FOR DYE

HAZMATS & FEES

QTY	FEE	TOTAL
0.0	\$10.99	\$0.00
2.0	\$7.99	\$15.98

Universal PAG Oil with Dye



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #55908

Fleet PO# 27

Page 2 of 10
 07/10/2025 4:22 PM

Remove & Replace: Evaporator Core & Heater Core

SUBTOTAL: \$4,487.41

LABOR

Remove & Replace: EVAPORATOR CORE
 DOES NOT include Air Conditioning System recover, evacuate and/or recharge.

HEATER CORE AVAIL THROUGH POCO 5-7 DAYS

-Used the A/C machine to drain out the remaining refrigerant still in the system. Used the disconnect tool on the heater core inlet/outlet hoses to disconnect them and while doing so one of the hoses broke. Inspected where the break occurred and it broke at the plastic line. Found that the plastic line was crumbling and was going to break soon and cause a leak. Need to replace both hoses. Disconnected the battery and removed it and the brackets from the vehicle. Removed the front floor mats, front pillars and dish board side covers. Removed the dashboard vent/speaker cover and the side door sill garnish molding. Secured the steering wheel and separated it from the intermediate shaft. Disconnected all the electrical connectors from underneath the dash and above. Removed 6 bolts from the top of the dash and 4 on the sides of the dash. After removing the bolts, moved the dash out of the way to gain access to the heater box. In order to remove the heater box, the nuts/bolts needed to be removed from the engine compartment. After they were removed the heater box was able to be removed from the vehicle. Removed components from the heater box to gain access to the heater core and the evaporator core. Removed both and noticed a lot of the A/C oil/dye inside the box. Used brake clean to wash out the oily mess to prevent any oil from getting inside the cab or false diagnosis. After replacing the parts and installing the new seals. Installed the new heater/evaporator cores. Re-assembled the heater box and installed it into the vehicle. Put the dash back up and secure it with the bolts that were removed. Re-connected the steering wheel to the intermediate shaft. Connected all the electrical connectors and reinstalled all the interior panels. Installed the battery and brackets.

Removed the air intake hoses to get access to the lower heater hoses. Removed the heater hoses and installed new ones. Put in 4L of Dex-cool 50/50 to top up the coolant reservoir. Re-assembled air ducts. Connected the A/C machine and applied vacuum to the trucks system to see if there are any leaks. Found no major leaks. Put in 0.550Kg of 1234Yf refrigerant and 1oz of PAO 68. Started the engine and turned on the A/C the air coming through the vents is very cold. Used a device to check for leaks and checked around the vents and all the connection points and nothing was picked up. Found no leaks at this time. Checked to make sure there was heat in the cab and there was lots of heat. Checked all switches inside the cab to make sure everything works. Everything is working. Checked for leaks at the heater hoses and there are no leaks. Test drove the vehicle and the A/C still works. Rechecked the coolant level and it's good. The vehicle is good to go.

PARTS	PART #	QTY	EACH	TOTAL
A/C Evaporator Core	A34072	1.0	\$331.69	\$331.69
HEATER CORE	84418888	1.0	\$276.00	\$276.00
HVAC Heater Hose	17128	1.0	\$147.62	\$147.62
SEAL	13579649	1.0	\$63.10	\$63.10
SEAL	52474375	1.0	\$26.84	\$26.84
50/50 Dexcool Orange (North American Orange: Ford, GM, Ram, Chrysler)	10953456	4.0	\$10.44	\$41.76

HAZMATS & FEES	QTY	FEE	TOTAL
Coolant Disposal	4.0	\$0.10	\$0.40

Post-Inspection QUALITY CONTROL

SUBTOTAL: \$0.00



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #55908

Fleet PO# 27

Page 3 of 10
 07/10/2025 4:22 PM

LABOR

Client Driving Position & Cleanliness Check - Return seat to driver's position (as close as possible) & ensure vehicle is as it was when dropped off

Record final Kilometers

Any & All Engine Covers, skid pans, & other trim pieces re-installed (if removed)

Wheel Lock Key Located - If applicable

HAZMATS & FEES	QTY	FEE	TOTAL
Branded Torque Tag	1.0	\$0.00	\$0.00
Nitrile Gloves - 1 Pair	1.0	\$0.00	\$0.00
Cleaning Wipes	1.0	\$0.00	\$0.00

Terms of Service:

****Any jobs that require the removal of wheels/tires REQUIRE A RE-TORQUE within 100kms. Failure to do so could cause wheels to loosen, possibly causing an accident or damage.****

WE THANK YOU FOR CHOOSING CITY CENTRE AUTOMOTIVE FOR YOUR AUTO REPAIR NEEDS. TO SERVE YOU BETTER, WE HAVE A NATIONAL 2YR, 40,000km "Peace of Mind WARRANTY" PROGRAM THROUGH NAPA AUTOPRO, as well as our exclusive 10/400 Powertrain Warranty.

FOR ANY WARRANTY CONCERNS WHILE TRAVELLING, PLEASE CALL 1-866-GET-NAPA AND YOU WILL BE DIRECTED TO THE AUTOPRO/AUTOCARE NEAREST YOU.

ENTER FOR A CHANCE TO WIN \$50-\$100 ON OUR ONLINE SURVEY. @ napa-autopro-survey.com OR TRY OUR NEW MOBILE VERSION @ tinyurl.com/napaautopro. By signing this document or the duplicate onboarding form you agree to the following:

1. **DISCLAIMER REGARDING QUOTES and ESTIMATES:**
 Please note that all repair quotes provided by CITY CENTRE AUTOMOTIVE are estimates based on the information available at the time of assessment. While we make every effort to ensure the accuracy of our estimates, unforeseen circumstances may arise during the repair process, leading to adjustments in costs and timelines. Factors such as the discovery of additional damage, parts availability, and other unforeseeable complications may affect the final cost and duration of the repair. Therefore, the estimate provided should be considered as an approximation rather than a definitive price. We strive to keep our customers informed throughout the repair process and will notify you promptly of any changes to the initial estimate. Your understanding and cooperation in such situations are greatly appreciated.

2. **CUSTOM WORK, WIRING/ELECTRICAL and ACCESSORY INSTALLATIONS:**
 Due to the nature of the above mentioned work, service time is billed out at a straight hourly rate. (Hourly rate is dependent on the nature of the repair/installation/work)
 Upfront payments/deposits may be required.

3. **DISCLAIMER REGARDING VEHICLES and PERSONAL BELONGINGS**

GRAND TOTAL: \$5,194.76

Total Labor: \$3,969.00
 Total Parts: \$887.01
 Total Fees: \$16.38
 Total Sublets: \$0.00
 Materials & Consumables: \$75.00
 Sales Tax: \$247.37

BALANCE DUE: \$5,194.76

Job Code:AB.IP.GP.HR
 Equipment Unit #: 27
 Comment:

Tim Hawryluk



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #55908

Fleet PO# 27

Page 4 of 10
07/10/2025 4:22 PM

IN OUR POSSESSION:

We take all necessary precautions to ensure your vehicle is safe while in our care, however, we are not responsible for damaged vehicles or the contents within them. Subsequently we are not responsible for lost/stolen property or vehicle thefts. If there are concerns with leaving your vehicle in our care long term (weeks, months, or more at a time), we recommend arranging to have the vehicle picked up.

4. STORAGE FEES:

In the event that a vehicle is left with us over a long term, and that no prior arrangements have been made, a storage fee of \$30/day will be applied to the repair order. This applies to customer whom which we cannot make contact and vehicles left in our possession longer than one week after work is complete.

5. SERVICE CHARGES and INTEREST:

For customers with charge/credit accounts, service charges of 8% per month will be applied to ALL unpaid Invoices past the 30 day period.

6. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

7. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

City Centre Automotive staff may operate my vehicle for the purpose of testing, inspection, and delivery.

8. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

9. "ONLINE and TEXT COMMUNICATION OK"

I welcome emails and text messages from City Centre Automotive as a means of receiving copies of my estimate, work order, and invoice.

"HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to the above terms.

Authorization:

CARIBOO RAILROAD CONTRACTING CORP

07/07/2025



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #55908

Fleet PO# 27


Page 5 of 10
07/10/2025 4:22 PM

INSPECTION REPORT

Courtesy Vehicle Health & Safety Inspection & Check-In

WALK-AROUND

Many dents, scrapes, and body damage on all sides.

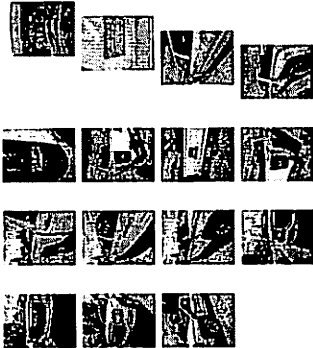

Written by 8 Sophie Ireland at 07/07/2025 10:46 AM

MAINTENANCE REMINDER: Oil Service Indicator (window sticker or OB maintenance monitor) CHECK FUEL FILTER SERVICE INTERVAL (Diesel Vehicles ONLY)



Written by 8 Sophie Ireland at 07/07/2025 10:45 AM

Battery Test Results & Condition of Battery Terminals



Written by 8 Sophie Ireland at 07/07/2025 10:45 AM

VEHICLE START UP: Confirm proper operation of instrument cluster and note any warning lights

TEST DRIVE NOTES:

INTERIOR: HVAC Controls, Cabin Air Filter, Entertainment Unit, Door Hardware (handles & locks), Window Controls, Multi-Function Controls

Controls work but ac not blowing cold at all.



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #55908

Fleet PO# 27

Page 6 of 10
07/10/2025 4:22 PM

Written by 8 Sophie Ireland at 07/07/2025 10:45 AM

- EXTERIOR: Glass, Lighting, Wipers, Trim
- ENGINE START UP & IDLE - note odd noises, vibrations, slow crank, etc.
- ON BOARD DIAGNOSTICS (OBD): System Pre-scan results: CEL, TPMS, ABS, STAB CONTROL, SRS, BATTERY, ETC.
- UNDERHOOD: Accessory Belt System, Engine Air Filter, Upper Engine, Radiator, Coolant Tank & Hoses, A/C components, Engine Block Heater Plugin



Written by 8 Sophie Ireland at 07/07/2025 10:45 AM

- FLUIDS: Coolant Level, Condition & Strength, Engine Oil, Brake & P/S Fluid Levels,



Written by 8 Sophie Ireland at 07/07/2025 10:45 AM

- DRIVELINE: Differential/T-case/Transmission Fluid Levels & Condition

Transmission fluid good. Driveline fluids condition and level good.



Written by 8 Sophie Ireland at 07/07/2025 10:45 AM

UNDERCAR: Steering & Suspension Components, Lower Engine, Transmission, Driveline Components, Exhaust System, Hard Lines & Hoses (fuel, brake, A/C)

Right front cv axle boot torn.



Remove & Replace: Axle Shaft - RIGHT FRONT
\$1059.52 +tax

Declined for Now by CARIBOO RAILROAD CONTRACTING CORP 7/7/25 4:49pm



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #55908

Fleet PO# 27

Page 7 of 10
07/10/2025 4:22 PM

T-FN

Written by 8 Sophie Ireland at 07/07/2025 10:45 AM

BRAKES: Linings, Surfaces, Calipers, Parking Brake Operation

Front pads at 4-5mm rear at 8mm.

Written by 8 Sophie Ireland at 07/07/2025 10:45 AM

TIRES: Size, Brand, Measurements, Condition, Tread-wear, ALL MATCHING?

14/32 front 13/32 rear

Written by 8 Sophie Ireland at 07/07/2025 09:58 AM

OTHER: Findings & Notes

A/C SYSTEM INSPECTION & RECHARGE (EITHER R134A OR 1234YF)

VENT TEMPERATURE - D/S & P/S - PRE-RECHARGE

30*c on max ac. Blowing very hot on max cold



Written by 8 Sophie Ireland at 07/07/2025 10:39 AM

COMPRESSOR ENGAGEMENT

LEAKS?

Found mass amounts of dye from condensation drain on fire wall. This means there is a leak from evaporator core. This needs to be replaced.



Remove & Replace: Evaporator Core & Heater Core
\$4308.50 +tax

Approved by CARIBOO RAILROAD CONTRACTING CORP. 7/7/25

T-FN



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #55908

Fleet PO# 27

Page 8 of 10
07/10/2025 4:22 PM

Written by 8 Sophie Ireland at 07/07/2025 10:39 AM

SYSTEM PRESSURE PRE-RECHARGE

-There was a little bit of a charge before repairs, recovered the refrigerant,

Written by Laura Letendre at 07/10/2025 02:14 PM

SYSTEM PRESSURE - POST RECHARGE

-After repairs and charge the pressures are good.

Written by Laura Letendre at 07/10/2025 02:14 PM

VENT TEMPERATURE - POST RECHARGE

-After repairs there are no leaks and the air being blown out of the vents is cold.

Written by Laura Letendre at 07/10/2025 02:14 PM

Remove & Replace: Evaporator Core & Heater Core

Evaporator core



Written by 2 CALEB MARLIKOWSKI at 07/10/2025 12:47 PM

-Note:

-While on the test drive, when using the signals. The signal indicator on the dash would tick slow then go fast and a message would appear for the turn signal out on the driver or passenger side rear. Checked all lights and they all work.

Written by 2 CALEB MARLIKOWSKI at 07/10/2025 12:47 PM

-Coolant Level



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #55908

Fleet PO# 27

Page 9 of 10
07/10/2025 4:22 PM



Written by 2 CALEB MARLIKOWSKI at 07/10/2025 12:47 PM

Post-Inspection QUALITY CONTROL

FINAL NOTES:



Written by Laura Letendre at 07/10/2025 02:04 PM

Wheel Lock Key Location - If applicable



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #55908

Fleet PO# 27

Page 10 of 10
07/10/2025 4:22 PM

Past Recommendations

COOLING SYSTEM FLUSH \$370.55 +tax

Remove & Replace: Shock Absorber \$663.56 +tax

Wash & Dye [Wash Off Leaked Fluid, Add UV Dye, Re-Inspect for Leaks] \$151.57 +tax

**DRIVELINE SERVICE (NOT INCL. TRANSMISSION)
\$307.59 +tax**



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 1 of 17
03/20/2025 12:55 PM

**CARIBOO RAILROAD
CONTRACTING CORP**
#117 3030 Pandosy St
Kelowna, BC V1Y 0C4
thawryluk@cariboorail.com
+1 250-612-7010

2017 GMC Sierra 1500
3GTU2LEC0HG361946
Engine: 5.3L V8 (C) L83
FLEX FI
Plate: CPP6751
Fleet #: 27
Odometer In: 467779
Odometer Out: 467985

Advisor: Laura Letendre
Technician: 6 MATT
MISKOLCZI

GRAND TOTAL: \$16,063.58

BALANCE DUE: \$12,703.72

Reason for Customer's Visit

check front axle

SERVICES



Courtesy Vehicle Health & Safety Inspection & Check-In

SUBTOTAL: \$0.00

LABOR

VEHICLE WALKAROUND

RECORD KILOMETERS, LIC PLATE, VIN, & ENGINE HOURS (WHERE APPLICABLE)
RECORD ENGINE HOURS (WHERE APPLICABLE)
RECORD VEHICLE OPTIONS (AWD, 4X4, 2WD, A/C, AUTO, MANUAL)

VEHICLE PRE-SCAN & DIGITAL VEHICLE INSPECTION - INCLUDES TESTING BLOCK HEATER

"GOOD TO GO" COURTESY BATTERY TEST (For vehicles with easily accessible battery)

TEST DRIVE (Cannot be performed if vehicle appears unsafe or other issues arise)



CEL/SES Light On - (2Hr) Vehicle Scan & Diagnostics & Troubleshooting

SUBTOTAL: \$326.00

LABOR

Check & Advise on CEL SES Light

Pull Diagnostic Trouble Codes (DTCs)

Document diagnostic information on work order (codes, freeze frame, live data)

Reference related Technical Service Bulletins (where applicable)

ROAD TEST WITH NO DRIVABILITY CONCERNS NOTED. VISUAL INSPECTION ALL APPEARS OK. SCAN FOR CODES, FOUND P0420 P0430 CATALYST LOW EFFICIENCY CODES STORED. RUN VEHICLE TO OPERATING TEMPERATURE, MONITOR DATA AND O2 SENSORS. FOUND DOWNSTREAM O2 SENSOR DATA MATCHING UPSTREAM DATA INDICATING CATALYTIC CONVERTOR FAILURE. RECOMMEND REPLACING CATALYTIC CONVERTORS OR PERFORMING CAT DELETE AND PRGRAMMING.



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 2 of 17
 03/20/2025 12:55 PM



**LiquiMoly
 - Premium Oil Service for Gasoline Engines: LOF \$65 plus Oil & Filter**

SUBTOTAL: \$156.88

LABOR

- Drain and fill engine oil
- Replace engine oil filter
- Replace Drain plug and/or gasket
- Lubricate suspension components as needed
- Reset Maintenance Monitor & Apply Service Reminder Label to Windshield
- Verify Engine Oil Level (Time & Procedures vary by manufacture)
- Top up Coolant & WW Fluid as needed

DISCLAIMER: *** OIL STICKER PROVIDED WILL BE SHOWN IN 'MILES' AND NOT 'KILOMETERS', IT IS NOT SOMETHING WE CAN CHANGE AND FOR ALL INTENTS AND PURPOSES WE ARE REFERRING TO KM'S.

PARTS	QTY	EACH	TOTAL
Liqui Moly Special Tec AA 0W-20 Synthetic Motor Oil	7.6	\$10.74	\$81.62
NAPA GOLD OIL FILTER	1.0	\$7.74	\$7.74
HAZMATS & FEES	QTY	FEE	TOTAL
Enviro	7.6	\$0.20	\$1.52
Filter Enviro	1.0	\$1.00	\$1.00



Check & Advise: Vibration At Highway Speeds

SUBTOTAL: \$163.00

LABOR

check & advise: front axle vibrates at hwy speeds

ROAD TEST VEHICLE TO HIGHWAY SPEEDS. INTERMITTANTLY CAN FEEL VIBRATION FROM FRONT OF VEHICLE, FEELS LIKE GOING OVER RUMBLE STRIPS. VISUAL INSPECTION FOUND LH FRONT TIRE SEPARATING, FRONT STRUTS STARTING TO LEAK. REAR SHOCKS LEAKING. MINOR PLAY IN LH INNER TIE ROD END. DRIVELINE ALL APPEARS OK. NO DRIVABILITY ISSUES NOTED CAUSING VIBRATION. RECOMMEND NEW TIRES, REPAIRING STEERING/SUSPENSION WITH WHEEL ALIGNMENT AND RETESTING.



Full Tire Replacement: LT Truck - up to 19" (MOUNT & BALANCE 4 TIRES)

SUBTOTAL: \$1,381.08

TIRES WILL NOT BE AVAILABLE UNTIL MONDAY

LABOR



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 3 of 17
 03/20/2025 12:55 PM

MOUNT & BALANCE FOUR TIRES

Remove & Replace Valve Stem as needed

Bead Seal Application

SET PRESSURES TO SPEC & TORQUE WHEELS TO SPEC.

Calibrate TPMS Sensors/System

PARTS			QTY	EACH	TOTAL
TIRES	SIZE	DOT#	QTY	EACH	TOTAL
ROADIAN	LT265/70R17		4.0	\$304.29	\$1,217.16
ATX ALL					
WEATHER					
HAZMATS & FEES			QTY	FEE	TOTAL
Valve Stem (Core or Stem)			4.0	\$3.99	\$15.96
BEAD SEAL			4.0	\$1.99	\$7.96
Tire Levy			4.0	\$5.00	\$20.00



Precision Four Wheel Alignment

SUBTOTAL: \$200.00

performed wheel alignment
 reset steering angle sensor.

LABOR

Test drive before alignment

Inspect ALL wheels, tires, steering & suspension components, shocks and/or struts

Adjust tire pressures to factory specifications (if needed)

Measure and record pre-alignment condition

Perform alignment adjustments to factory specifications

EXTRA TIME FOR RUSTED/SEIZED COMPONENTS

Measure and record post-alignment condition

Center steering wheel; calibrate zero point position (as needed)

Test drive after alignment



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 4 of 17
 03/20/2025 12:55 PM

7

Remove & Replace: Left Hand Inner Tie Rod &/or End

SUBTOTAL: \$359.34

Replaced LH inner tie rod.

LABOR

Remove & Replace: TIE ROD &/OR END

Includes: Adjust toe-in only. NOTE: Deduct .4 if alignment is also performed.

NOTE: Manufacturer recommends removal of Rack and Pinion Steering Gear when replacing Inner Tie Rod End(s) on some models. If removal of the Rack and Pinion Gear is necessary, use Steering Gear (Complete) - Remove & Replace plus combinations.

PARTS	QTY	EACH	TOTAL
NAPA INNER TIE ROD	1.0	\$85.50	\$85.50

8

Remove & Replace: Tail Light Bulb

SUBTOTAL: \$186.38

Replaced both lower tail light bulbs, cleaned up pigtail, a little green. both working fine.

LABOR

Remove & Replace: TAIL LIGHT BULB

PARTS	QTY	EACH	TOTAL
TAIL LIGHT BULB	2.0	\$36.14	\$72.28

9

Remove & Replace: Water Pump Drive Belt

SUBTOTAL: \$244.13

removed air box & intake tube for access. replaced drive belt.

LABOR

Remove & Replace: WATER PUMP DRIVE BELT

Includes: Serpentine and V-Belt type Belt(s).

PARTS	QTY	EACH	TOTAL
NAPA Cooling Serpentine Belt	1.0	\$152.85	\$152.85

10

Remove & Replace: Air Cleaner Element

SUBTOTAL: \$53.13

Replaced air filter

LABOR

Remove & Replace: AIR CLEANER ELEMENT

PARTS	QTY	EACH	TOTAL
NAPA Gold Filters AIR FILTER	1.0	\$53.13	\$53.13



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 5 of 17
 03/20/2025 12:55 PM

11

Remove & Install Or Remove & Replace: Front Shock &/or Strut Assembly

SUBTOTAL: \$1,561.76

Removed stabiliser link, brake hose retaining bolts & upper ball joint nut . separated knuckle from upper control arm. replaced struts & assembled.

LABOR

Remove & Install or Remove & Replace: SHOCK &/OR STRUT ASSEMBLY
 DOES NOT include disassemble or alignment (where applicable).

PARTS	QTY	EACH	TOTAL
NAPA Shocks and Struts Suspension Strut Assembly	2.0	\$598.32	\$1,196.64

12

Remove & Replace: Engine Oil Cooler Hose

SUBTOTAL: \$970.15

Removed air filter box, lowered front diff, removed cooler line retaining clips. Replaced engine oil cooler lines. Assembled.

LABOR

Remove & Replace: ENGINE OIL COOLER HOSE

PARTS	QTY	EACH	TOTAL
GM ENGINE OIL COOLER LINES	1.0	\$395.09	\$395.09

13

CAME BACK FOR VIBRATION STILL

SUBTOTAL: \$0.00

LABOR

CAME BACK FOR VIBRATION STILL

14

Remove & Replace: Transmission Oil Pan Gasket & Filter

SUBTOTAL: \$752.03

LABOR

Remove & Replace: TRANSMISSION OIL PAN GASKET &/OR FILTER

PARTS	QTY	EACH	TOTAL
WXC AUTOMATIC TRANSMISSION/Transmission Filter Kit	1.0	\$116.89	\$116.89
Liqui Moly TOP TECH 1800 Multi-Vehicle ATF (Auburn in Colour)	5.0	\$21.40	\$107.00
HAZMATS & FEES	QTY	FEE	TOTAL
	5.0	\$0.20	\$1.00



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 6 of 17
 03/20/2025 12:55 PM

Enviro

15

Remove & Replace: Transmission Assembly

SUBTOTAL: \$7,338.84

AVAILABLE IN 3-4 DAYS

2 year 60 000 KM WARRANTY

FOR WARRANTY PURPOSES NEED TO FLUSH OUT TRANSMISSION OIL COOLER

ACCOUNT FOR CORE

LABOR

REMOVE AND REPLACE: TRANSMISSION ASSEMBLY drove truck into shop removed negative cable from battery. lifted on hoist removed both front and rear drive shaft, removed starter to access torque converter bolts, removed torque converter bolts. removed transmission cross member, removed exhaust flange bolts, and exhaust tail pipe clamp. removed all electrical pig tails on transmission and t-case, removed t-case, removed bell housing bolts. removed transmission. flushed cooler lines and cooler. reassembled with new transmission. topped with 4 litres of fluid. needs to be programed

PARTS	QTY	EACH	TOTAL
NORTHERN AUTOMATIC 6L80 REMAN' TRANSMISSION (PRE-PROGRAMMED)	1.0	\$4,499.00	\$4,499.00
Liqui Moly TOP TECH 1800 Multi-Vehicle ATF (Auburn in Colour)	14.0	\$21.40	\$299.60
NAPA Exhaust Exhaust Pipe Flange Gasket	1.0	\$58.74	\$58.74
NAPA Exhaust Exhaust Pipe Flange Gasket 2 3/8	1.0	\$59.40	\$59.40
HAZMATS & FEES	QTY	FEE	TOTAL
	1.0	\$220.00	\$220.00
FREIGHT			
	1.0	\$100.00	\$100.00
THERMO BYPASS KIT			
	14.0	\$0.20	\$2.80
Enviro			
	1.0	\$260.66	\$260.66
PROGRAMMING			

16

Catalyst Delete

SUBTOTAL: \$1,324.01

Customer approved catalyst delete by phone.

PARTS	QTY	EACH	TOTAL
GMC O2 SENSOR/Oxygen Sensor	1.0	\$292.67	\$292.67
NAPA Exhaust Exhaust Clamp	1.0	\$81.34	\$81.34
SUBLETS			TOTAL
			\$950.00
Catalyst Delete and Program			



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 7 of 17
 03/20/2025 12:55 PM



Flush: Transmission Oil Cooler & Lines

SUBTOTAL: \$206.91

LABOR

Flush: TRANSMISSION OIL COOLER & LINES
 Includes: Inspect for leaks and fluid flow test.

PARTS	QTY	EACH	TOTAL
19111 / KOOLER KLEEN	1.0	\$43.91	\$43.91



QUALITY CONTROL - FINAL CHECK

SUBTOTAL: \$0.00

LABOR

Final Road Test

Record final Kilometers

Torque Tag: Placed on one of the following: Mirror - Shift Lever - Turn signal stock - Other

Warning Lights & Diagnostic System Post-Scan

Job Code: AB.IP.GP.HR

Equipment Unit #: UNIT 70

Any & All Engine Covers, skid pans, & other trim pieces re-installed

Comment:

Client Driving Position & Cleanliness Check

HAZMATS & FEES	QTY	FEE	TOTAL
Branded Torque Tag	1.0	\$0.00	\$0.00
Nitrile Gloves - 1 Pair	1.0	\$0.00	\$0.00
Cleaning Wipes	1.0	\$0.00	\$0.00

Tim Hawryluk

Terms of Service:

****Any jobs that require the removal of wheels/tires REQUIRE A RE-TORQUE within 100kms. Failure to do so could cause wheels to loosen, possibly causing an accident or damage.****

WE THANK YOU FOR CHOOSING CITY CENTRE AUTOMOTIVE FOR YOUR AUTO REPAIR NEEDS. TO SERVE YOU BETTER, WE HAVE A NATIONAL 2YR, 40,000km "Peace of Mind WARRANTY" PROGRAM THROUGH NAPA AUTOPRO, as well as our exclusive 10/400 Powertrain Warranty.

FOR ANY WARRANTY CONCERNS WHILE TRAVELLING, PLEASE CALL 1-866-GET-NAPA AND YOU WILL BE DIRECTED TO THE AUTOPRO/AUTOCARE NEAREST YOU.

ENTER FOR A CHANCE TO WIN \$50-\$100 ON OUR ONLINE SURVEY. @ napa-autopro-survey.com OR TRY OUR NEW MOBILE VERSION @ tinyurl.com/napaautopro. By signing this document or the duplicate onboarding form you agree to the following:

GRAND TOTAL: \$16,063.58

Total Labor: \$4,822.18
 Total Parts: \$8,820.56
 Total Fees: \$630.90
 Total Sublets: \$950.00
 Materials & Consumables: \$75.00
 Sales Tax: \$764.94

BALANCE DUE: \$12,703.72

04/07/2025 10:24 AM

Paid by Other - EFT: **\$3,359.86**

Notes: "Total amount covers the remaining balance of February's Invoices and a portion of March."

**City Centre Automotive**

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54666**Fleet PO# 27**Page 8 of 17
03/20/2025 12:55 PM**1. DISCLAIMER REGARDING QUOTES and ESTIMATES:**

Please note that all repair quotes provided by CITY CENTRE AUTOMOTIVE are estimates based on the information available at the time of assessment. While we make every effort to ensure the accuracy of our estimates, unforeseen circumstances may arise during the repair process, leading to adjustments in costs and timelines. Factors such as the discovery of additional damage, parts availability, and other unforeseeable complications may affect the final cost and duration of the repair. Therefore, the estimate provided should be considered as an approximation rather than a definitive price. We strive to keep our customers informed throughout the repair process and will notify you promptly of any changes to the initial estimate. Your understanding and cooperation in such situations are greatly appreciated.

2. CUSTOM WORK, WIRING/ELECTRICAL and ACCESSORY INSTALLATIONS:

Due to the nature of the above mentioned work, service time is billed out at a straight hourly rate. (Hourly rate is dependent on the nature of the repair/installation/work)

Upfront payments/deposits may be required.

3. DISCLAIMER REGARDING VEHICLES and PERSONAL BELONGINGS IN OUR POSSESSION:

We take all necessary precautions to ensure your vehicle is safe while in our care, however, we are not responsible for damaged vehicles or the contents within them. Subsequently we are not responsible for lost/stolen property or vehicle thefts. If there are concerns with leaving your vehicle in our care long term (weeks, months, or more at a time), we recommend arranging to have the vehicle picked up.

4. STORAGE FEES:

In the event that a vehicle is left with us over a long term, and that no prior arrangements have been made, a storage fee of \$30/day will be applied to the repair order. This applies to customer whom which we cannot make contact and vehicles left in our possession longer than one week after work is complete.

5. SERVICE CHARGES and INTEREST:

For customers with charge/credit accounts, service charges of 8% per month will be applied to ALL unpaid Invoices past the 30 day period.

6. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

7. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

City Centre Automotive staff may operate my vehicle for the purpose of testing, inspection, and delivery.

8. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

9. "ONLINE and TEXT COMMUNICATION OK"

I welcome emails and text messages from City Centre Automotive as a means of receiving copies of my estimate, work order, and invoice.

"HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to the above terms.



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54666
Fleet PO# 27

Page 9 of 17
03/20/2025 12:55 PM

Authorization:

A handwritten signature in black ink, appearing to be 'JPD', is written over a horizontal line.

CARIBOO RAILROAD CONTRACTING CORP

03/06/2025



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 10 of 17
03/20/2025 12:55 PM

INSPECTION REPORT

Courtesy Vehicle Health & Safety Inspection & Check-In

WALK-AROUND



Written by Kevin Robinson at 03/06/2025 11:05 AM

MAINTENANCE REMINDER: Oil Service Indicator (window sticker or OB maintenance monitor) CHECK FUEL FILTER SERVICE INTERVAL (Diesel Vehicles ONLY)

"GOOD TO GO" - Battery Test Results & Condition of Battery Terminals

VEHICLE START UP: Confirm proper operation of instrument cluster and note any warning lights

SES LIGHT, TPMS LIGHTS ON



Written by Kevin Robinson at 03/06/2025 11:05 AM

TEST DRIVE NOTES:

INTERIOR: HVAC Controls, Cabin Air Filter, Entertainment Unit, Door Hardware (handles & locks), Window Controls, Multi-Function Controls

EXTERIOR: Glass, Lighting, Wipers, Trim

LOWER TAIL LIGHTS OUT, LH TAIL LIGHT ASSY BROKEN



Remove & Replace: Tail Light Bulb \$186.38 +tax

Approved by phone: 4:26pm 3/6/25

Written by Kevin Robinson at 03/06/2025 11:06 AM

ENGINE START UP & IDLE - note odd noises, vibrations, slow crank, etc.



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 11 of 17
03/20/2025 12:55 PM

ON BOARD DIAGNOSTICS (OBD): System Pre-scan results: CEL, TPMS, ABS, STAB CONTROL, SRS, BATTERY, ETC.



Written by Kevin Robinson at 03/06/2025 11:05 AM

UNDERHOOD: Accessory Belt System, Engine Air Filter, Upper Engine, Radiator, Coolant Tank & Hoses, A/C components, Engine Block Heater Plugin

MAIN DRIVE BELT STARTING TO HAVE SMALL CRACKS, AIR FILTER DIRTY, AIR BOX DAMAGED AND MISSING RETAINING SCREW, BRAKE FLUID SLIGHTLY LOW COMPARED TO PAD WEAR.



Remove & Replace: Air Cleaner Element \$53.13 +tax

Approved by phone: 4:27pm 3/6/25

Remove & Replace: Water Pump Drive Belt \$244.13 +tax

Approved by phone: 4:27pm 3/6/25

Written by Kevin Robinson at 03/06/2025 11:06 AM

FLUIDS: Coolant Level, Condition & Strength, Engine Oil, Brake & P/S Fluid Levels,

DRIVELINE: Differential/T-case/Transmission Fluid Levels & Condition

DRIVELINE FLUIDS DARK, RECOMMEND 4X4 SERVICE



**DRIVELINE SERVICE (NOT INCL. TRANSMISSION)
\$307.59 +tax**

Declined for Now by CARIBOO RAILROAD CONTRACTING CORP: 1:49pm 3/12

Tom N

Written by Kevin Robinson at 03/06/2025 11:07 AM

UNDERCAR: Steering & Suspension Components, Lower Engine, Transmission, Driveline Components, Exhaust System, Hard Lines & Hoses (fuel, brake, A/C)

FRONT STRUTS STARTING TO LEAK AND ARE WEAK, REAR SHOCKS LEAKING. VERY SLIGHT PLAY IN LH



City Centre Automotive


9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 12 of 17
03/20/2025 12:55 PM

INNER TIE ROD END, RECOMMEND REPLACING SO ACCURATE WHEEL ALIGNMENT CAN BE PERFORMED. ENGINE OIL COOLER LINES LEAKING WITH DRIPS, ENGINE OIL LEAK AT REAR OF ENGINE WITH DRIPS UNABLE TO PINPOINT LOCATION.

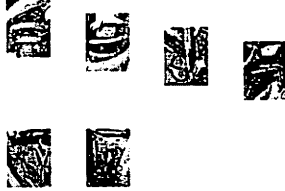

Wash & Dye [Wash Off Leaked Fluid, Add UV Dye, Re-inspect for Leaks] \$151.57 +tax

Declined for Now by CARIBOO RAILROAD CONTRACTING CORP 1:49pm 3/12

Tim N

Remove & Install Or Remove & Replace: Front Shock &/or Strut Assembly \$1561.76 +tax

Approved by phone 4:30pm 3/6/25

Remove & Replace: Shock Absorber \$663.56 +tax

Declined for Now by Kevin Robinson 11:18am 3/18/25

Remove & Replace: Engine Oil Cooler Hose \$970.15 +tax

Approved by phone 4:34pm 3/6/25

Written by Kevin Robinson at 03/06/2025 11:07 AM

BRAKES: Linings, Surfaces, Calipers, Parking Brake Operation

FRONT BRAKES 6MM REMAIN, SLIGHT PULSATION FELT WHEN BRAKING AT HIGHER SPEEDS. REAR BRAKES 8MM REMAIN



Written by Kevin Robinson at 03/06/2025 11:08 AM

TIRES: Size, Brand, Measurements, Condition, Tread-wear, ALL MATCHING?

LH FRONT TIRE SEPARATED AND UNEVEN WEAR. LT265/70R17 BRIDGESTONE BLIZZAK. REAR TIRES 6-7MM REMAINING. RECOMMEND ALL 4 TIRES REPLACEMENT





City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 13 of 17
03/20/2025 12:55 PM

Written by Kevin Robinson at 03/06/2025 11:07 AM

OTHER: Findings & Notes

CEL/SES Light On - (2Hr) Vehicle Scan & Diagnostics & Troubleshooting

Diagnostic Trouble Codes (DTCs)

NOTES

LiquiMoly - Premium Oil Service for Gasoline Engines: LOF \$65 plus Oil & Filter

NOTES:

Filter 100255, marked filter, and drain plug.
Filter and plug tight



Written by 10 JAYCE WOWK at 03/06/2025 03:14 PM

Full Tire Replacement: LT Truck - up to 19" (MOUNT & BALANCE 4 TIRES)

Brake Pad Measurements

Other Notes

Precision Four Wheel Alignment

Tire pressure before alignment

Road test before alignment

Check shock absorbers

Check Front & Rear Suspension & Steering Components

Check subframe

Check wheel/rim/tire condition

PRE & POST ALIGNMENT RESULTS ATTACHED - Actuals completed within factory specifications



Written by 9 CLINT JABS at 03/10/2025 10:41 AM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 14 of 17
03/20/2025 12:55 PM

NOTES

Harmonic balancer full of mud, cleaned out



Written by 9 CLINT JABS at 03/10/2025 10:41 AM

CAME BACK FOR VIBRATION STILL

Shudder

Remove & Replace: Transmission Oil Pan Gasket &/or
Filter \$816.83 +tax

Approved by phone 4:12pm 3/11/25

Written by 8 Sophie Ireland at 03/11/2025 10:45 AM

Remove & Replace: Transmission Assembly

NOTES

Flush: Transmission Oil Cooler & Lines

NOTES

QUALITY CONTROL - FINAL CHECK

- Post-Road test kilometers
- Torque Tag - _____
- Warning Lights Present?
- Post-Scan Results - If relevant
- Re-installation of ALL covers, plates, air dams, etc
- Driving Position & Cleanliness
- FINAL NOTES:



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 15 of 17
03/20/2025 12:55 PM

FINDINGS

Could Not confirm a driveline "vibration" on test drive, but felt a shudder under acceleration around 80KM/H also rough shifting at lower gears. Pulled dipstick for transmission and found fluid VERY VERY dark and smells VERY burnt. This points us towards transmission issues. Recommend dropping transmission pan and checking for debris in pan. There is TSBs for shuddering and torque converter issues.



Written by 8 Sophie Ireland at 03/11/2025 10:02 AM

Abnormal amount of debris on magnet and fluid very very dark. And chunks in fluid. Recommend to quote out transmission and complete flush of cooler and lines.

Removed bolts for transmission pan and drained fluid removed filter and installed new filter. Gasket is reusable metal gasket. Cleaned gasket and mating surfaces. Reinstalled pan. Refilled fluid 5 litres of ATF (amount that was removed from pan drip). Ensured level is good on dipstick. Transmission is a 6I80.



Written by 8 Sophie Ireland at 03/12/2025 09:54 AM

REMOVE AND REPLACE: TRANSMISSION-BAAAN
\$7490.42 +tax

Approved by CARIBOO RAILROAD CONTRACTING CORP 1:49pm 3/12/25

Tim N

Written by Laura Letendre at 03/12/2025 12:18 PM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 16 of 17
03/20/2025 12:55 PM

Past Recommendations

COOLING SYSTEM FLUSH \$370.55 +tax

Declined for Now by CARIBOO RAILROAD CONTRACTING CORP 1:49pm 3/12/25

Ten N



City Centre Automotive





9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54666

Fleet PO# 27

Page 17 of 17
03/20/2025 12:55 PM

Attached Images:

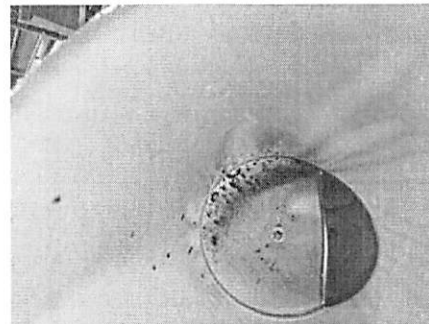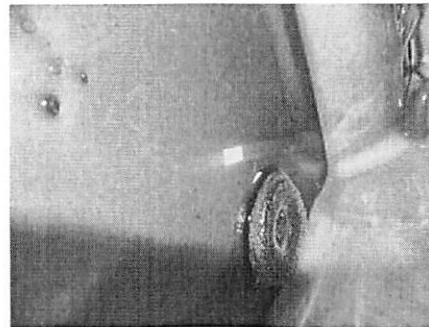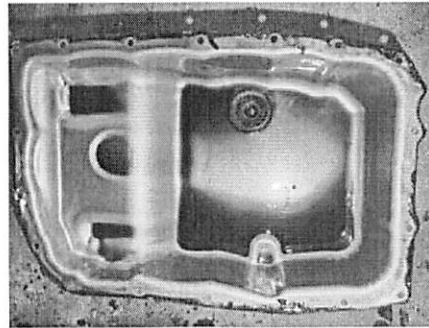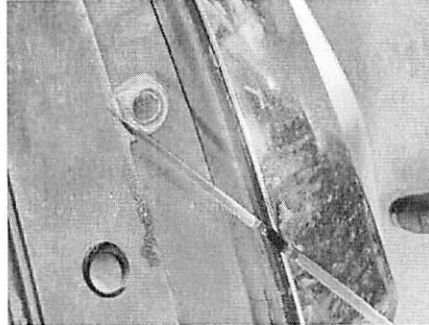



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
GST: 137064580 RT0001
780-538-1154
service@citycentreautomotive.com

Invoice #51012

Page 1 of 9
03/21/2024 4:12 PM

**CARIBOO RAILROAD
CONTRACTING CORP**
Tfroehlich@cariboorail.com
+1 250-640-0553

2017 GMC Sierra 1500
3GTU2LECOHG361946
Engine: 5.3L V8 (C) L83
FLEX FI
Plate: CPP6751
Fleet #: 27
Odometer In: 414124
Odometer Out: 414124

Advisor: Jessica Gilchrist
Technician: 9 CLINT JABS

GRAND TOTAL: \$5,935.44

✓ PAID

Reason for Customer's Visit

POSSIBLE OIL PAN GASKET LEAKING ENGINE WAS JUST REBUILT BOLTS WERE NOT TIGHTENED, LINES & WIRES WERE NOT TIED UP, GOOD CHECKOVER, 02SENSOR, WINDSHIELD WASHER NOT WORKING.

SERVICES

1	Vehicle Check-in	SUBTOTAL: \$0.00
	LABOR	Labor: \$0.00
	TEST DRIVE	Parts: \$0.00
	CHECK WARNING LIGHTS	Fees: \$0.00
	RECORD KILOMETERS, LIC PLATE, VIN	Sublet: \$0.00
	ASSIGN S/A & TECHNICIAN	
	BATTERY TEST	
	RECORD VEHICLE OPTIONS (AWD, 4X4, 2WD, A/C, AUTO, MANUAL)	
	RECORD ENGINE HOURS (WHERE APPLICABLE)	
<hr/>		
2	CEL/SES Light On - Basic Vehicle Scan	SUBTOTAL: \$100.00
	Had p2635 fuel pump performance	Labor: \$100.00
	monitored fuel pump duty cycle, too high % running @ 89 % on idle pressure dropped as low as 33 psi.	Parts: \$0.00
	needs in tank fuel pump.	Fees: \$0.00
		Sublet: \$0.00
	LABOR	
	Pull Diagnostic Trouble Codes (DTCs)	
	Document diagnostic information on work order (codes, freeze frame, live data)	
	Reference related Technical Service Bulletins (where applicable)	
<hr/>		
3	Vehicle Check Over	SUBTOTAL: \$224.99
	-RH lower tail light bulb, 3rd brk light-Lower oil pan leaking-Rear brks @ 2mm rotors have some rust.-Small play in lower ball joints -Side play in RH lower ball joint, needs ball joint. Play in LH upper ball joint. -Air dam falling off, need securing. - Vehicle has green coolant in it, recommended to have orange coolant. As long as its not mixed it should be okay, but the improper acidity could cause future mechanical issues.	Labor: \$224.99
		Parts: \$0.00
		Fees: \$0.00
		Sublet: \$0.00



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
GST: 137064580 RT0001
780-538-1154
service@citycentrautomotive.com

Invoice #51012

Page 2 of 9
03/21/2024 4:12 PM

LABOR

Inspection

4

Windshield washer not working

SUBTOTAL: \$128.26

Not spraying on RH.
Removed cowel & wiper arms
removed line on RH nozzel blew out nozzel & cleared out washer line.
tested washers working properly.
Assembled

Labor: \$75.00
Parts: \$53.26
Fees: \$0.00
Sublet: \$0.00

LABOR

Repair

PARTS	PART #	QTY
Windshield Washer Nozzle	89913151	1.0

5

Lines & wires not tied up after replacing engine

SUBTOTAL: \$85.49

Tied up o2 wire, loose near front driveshaft

Labor: \$85.49
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

LABOR

Repair

6

Remove & Replace: Fuel Pump

SUBTOTAL: \$1,493.05

Replaced fuel pump had to remove driveshaft. cleared codes started vehicle no codes returned

Labor: \$521.97
Parts: \$971.08
Fees: \$0.00
Sublet: \$0.00

LABOR

Remove & Replace: FUEL PUMP

PARTS	PART #	QTY
Fuel Pump Module Assy	FG1832	1.0

7

Remove & Replace: Brake Shoes &/or Pads

SUBTOTAL: \$848.08

Replaced rear brake pads and rotors. We serviced rear brake calipers, and cleaned e-brake shoes of excessive dust.

Labor: \$179.99
Parts: \$657.14
Fees: \$10.95
Sublet: \$0.00

LABOR

Remove & Replace: BRAKE SHOES &/OR PADS Includes: Clean, lube and/or replace Brake Hardware as necessary. Adjust Brakes (where applicable). Includes: Repack Wheel Bearings (where applicable). DOES NOT include refinishing.



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
GST: 137064580 RT0001
780-538-1154
service@citycentreatomotive.com

Invoice #51012

Page 3 of 9
03/21/2024 4:12 PM

PARTS	PART #	QTY
Disc Brake Pad Set	SG8312X	1.0
Disc Brake Rotor	7488821580	2.0
HAZMATS & FEES		QTY
Lubrication		1.0

8 Remove & Reseal: Oil Pan Gasket SUBTOTAL: \$428.17

Lower oil pan gasket is leaking, the bolts were not tightened properly after new engine installed. Drained engine oil, removed lower oil pan, and cleaned pan surfaces. Resealed oil pan, refilled oil, and change oil filter. Checked for leaks, all now ok.

Labor: \$287.98
Parts: \$137.90
Fees: \$2.29
Sublet: \$0.00

LABOR
Remove & Replace: OIL PAN GASKET

PARTS	PART #	QTY
The Right Stuff (GREY) 1 Minute Gasket Maket	30870	1.0
OIL FILTER	100255	1.0
SuperSyn 0W20 Synthetic 1L	126855	7.6
HAZMATS & FEES		QTY
ENVIRO		1.0
ENVIRO		7.6

9 Remove & Replace: Control Arm LH Upper SUBTOTAL: \$1,094.30

replace lh upper control arm. replace arm adjuster bolts due to rust corrosion on bolts. greased ball joint

Labor: \$395.97
Parts: \$698.33
Fees: \$0.00
Sublet: \$0.00

LABOR
Remove & Replace: BALL JOINT DOES NOT include alignment.

PARTS	PART #	QTY
CAMBER ADJUST KIT N	2643717	1.0
CONTROL ARM & BALL JOINT	260-8235	1.0

10 Remove & Replace: Control Arm RH Lower SUBTOTAL: \$935.46

replace rh lower control arm with aluminum arm. replaced rh sway bar end link that was bent and could not be properly removed.

Labor: \$323.98
Parts: \$611.48
Fees: \$0.00
Sublet: \$0.00

LABOR
Remove & Replace: CONTROL ARM DOES NOT include alignment.



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
GST: 137064580 RT0001
780-538-1154
service@citycentreautomotive.com

Invoice #51012

Page 4 of 9
03/21/2024 4:12 PM

PARTS	PART #	QTY
Suspension Control Arm and Ball Joint Assembly	1481105	1.0
Suspension Stabilizer Bar Link	1850820	1.0

11 Precision Four Wheel Alignment

SUBTOTAL: \$180.00

Performed wheel alignment reset steering angle sensor

Labor: \$180.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

LABOR

- Test drive before alignment
- Inspect ALL wheels, tires, steering & suspension components, shocks and/or struts
- Adjust tire pressures to factory specifications (if needed)
- Measure and record pre-alignment condition
- Perform alignment adjustments to factory specifications
- EXTRA TIME FOR RUSTED/SEIZED COMPONENTS
- Measure and record post-alignment condition
- Center steering wheel; calibrate zero point position (as needed)
- Test drive after alignment

12 Secure Air Dam (Deflector)

SUBTOTAL: \$75.00

The front air dam broken too severely to reattach, so we removed air dam completely. We reinstalled screws where required for bumper cover.

Labor: \$75.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

LABOR

- Repair



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
GST: 137064580 RT0001
780-538-1154
service@citycentreautomotive.com

Invoice #51012

Page 5 of 9
03/21/2024 4:12 PM

Terms of Service:

1. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

2. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

City Centre Automotive staff may operate my vehicle for the purpose of testing, inspection, and delivery.

3. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

4. "ONLINE COMMUNICATION OK"

I welcome email from City Centre Automotive as a means of receiving copies of my estimate, work order, and invoice.

5. "HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to these five terms.

DISCLAIMER REGARDING QUOTES & ESTIMATES: Please note that all repair quotes provided by CITY CENTRE AUTOMOTIVE are estimates based on the information available at the time of assessment. While we make every effort to ensure the accuracy of our estimates, unforeseen circumstances may arise during the repair process, leading to adjustments in costs and timelines.

Factors such as the discovery of additional damage, parts availability, and other unforeseeable complications may affect the final cost and duration of the repair. Therefore, the estimate provided should be considered as an approximation rather than a definitive price.

We strive to keep our customers informed throughout the repair process and will notify you promptly of any changes to the initial estimate. Your understanding and cooperation in such situations are greatly appreciated.

We take all necessary precautions to ensure your vehicle is safe while in our care, however, we are not responsible for damaged vehicles or the contents within them. Subsequently we are not responsible for lost/stolen property or vehicle thefts. If there are concerns with leaving your vehicle in our care long term (weeks, months, or more at a time), we recommend arranging to have the vehicle picked up.

WE THANK YOU FOR CHOOSING CITY CENTRE AUTOMOTIVE FOR YOUR AUTO REPAIR NEEDS. TO SERVE YOU BETTER, WE HAVE A NATIONAL "Peace of Mind WARRANTY" PROGRAM THROUGH NAPA AUTOPRO, as well as our exclusive 10/400 Powertrain Warranty.

FOR ANY WARRANTY CONCERNS WHILE TRAVELLING, PLEASE CALL 1-866-GET-NAPA AND YOU WILL BE DIRECTED TO THE AUTOPRO/AUTOCARE NEAREST YOU.

ENTER FOR A CHANCE TO WIN \$50-\$100 ON OUR ONLINE SURVEY.
@ napa-autopro-survey.com OR TRY OUR NEW MOBILE VERSION @
tinyurl.com/napaautopro.

GRAND TOTAL: \$5,935.44

Total Labor: \$2,450.37

Total Parts: \$3,129.19

Total Fees: \$13.24

Total Sublets: \$0.00

Shop Supplies & Consumables: \$60.00

Sales Tax: \$282.64

✓ PAID

03/22/2024 11:14 AM

Paid by Credit Card - VISA: \$5,935.44



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
GST: 137064580 RT0001
780-538-1154
service@citycentreautomotive.com

Invoice #51012

Page 6 of 9
03/21/2024 4:12 PM

Authorization:

TF

03/20/2024



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
GST: 137064580 RT0001
780-538-1154
service@citycentreautomotive.com

Invoice #51012

Page 7 of 9
03/21/2024 4:12 PM

INSPECTION REPORT

Vehicle Check-in

- ABS LIGHT
- TPMS
- SES/CEL**
- STABILITY CONTROL
- BATTERY/CHARGING SYSTEM
- SRS AIR BAG
- MISC WARNING LIGHTS
- BATTERY CONDITION RESULTS

CEL/SES Light On - Basic Vehicle Scan

- DTCs

Precision Four Wheel Alignment

- Tire pressure before alignment
- Road test before alignment
- Check Front & Rear Suspension Components
- Check steering components & knuckles
- Check wheel/rim condition
- Check shock absorbers
- Check subframe
- PRE-ALIGNMENT RESULTS
- POST ALIGNMENT RESULTS ATTACHED - Actuals completed within factory specifications
- Steering wheel centered



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
GST: 137064580 RT0001
780-538-1154
service@citycentreautomotive.com

Invoice #51012

Page 8 of 9
03/21/2024 4:12 PM

FINDINGS



<https://services.shop->

[ware.com/uploads/v1/original/goq9n0VGVt_bz2m2e6nG8](https://services.shop-ware.com/uploads/v1/original/goq9n0VGVt_bz2m2e6nG8)

Written by 9 CLINT JABS at 03/19/2024 02:24 PM

Remove & Replace: Fuel Pump \$1533.05 +tax

Approved by email, 11:31am 3/20/24

Written by Jessica Gilchrist at 03/19/2024 02:27 PM

**Remove & Replace: Brake Shoes &/or Pads \$848.08
+tax**

Approved by email, 11:31am 3/20/24

Written by Jessica Gilchrist at 03/19/2024 02:30 PM

Remove & Replace: Oil Pan Gasket \$337.99 +tax

Approved by email, 11:31am 3/20/24

Written by Jessica Gilchrist at 03/19/2024 03:04 PM

**Remove & Replace: Control Arm LH Upper \$705.01
+tax**

Approved by email, 11:31am 3/20/24

Written by Jessica Gilchrist at 03/19/2024 05:01 PM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
GST: 137064580 RT0001
780-538-1154
service@citycentreautomotive.com

Invoice #51012

Page 9 of 9
03/21/2024 4:12 PM

Remove & Replace: Control Arm RH Lower +tax **\$890.81**

Approved by email, 11:31am 3/20/24

Written by Jessica Gilchrist at 03/19/2024 05:02 PM

Precision Four Wheel Alignment **\$180.00 +tax**

Approved by email, 11:31am 3/20/24

Written by Jessica Gilchrist at 03/19/2024 05:02 PM

Secure Air Dam **\$105.00 +tax**

Approved by email, 11:31am 3/20/24

Written by Jessica Gilchrist at 03/20/2024 09:02 AM

COOLING SYSTEM FLUSH **\$370.55 +tax**

Written by Jessica Gilchrist at 03/21/2024 11:21 AM

RailCore X Inc.

93-54200 Range Road 265
 Sturgeon County, AB T8T 0E2
 1-855-349-7245
 Email:roslyn@RailCoreXinc.com

INVOICE

Invoice No.: 4177
 Date: Mar 05, 2024
 Ship Date:
 Page: 1
 Re: Order No.

Sold to:


Cariboo Railroad Contracting Corp. Attn Tim Marshall
 459 N Dean Rd
 Auburn, AL 36830
 US

Ship to:

Cariboo Railroad Contracting Corp. Attn Tim Marshall
 459 N Dean Rd
 Auburn, AL 36830
 US

Business No.: 726887870RT0001

Quantity	Unit	Description	Tax	Unit Price	Amount
		UNIT 27 2018 GMC Sierra VIN 3GTU2LEC0HG361946 KM 412873	G		
1.0	Each	Replacement Engine 5.3L L83 KM 135,000	G	6,500.00	6,500.00
2.0	Each	Jug Of Coolant	G	24.63	49.26
1.0	Each	Wx8734 Oil Filter	G	28.39	28.39
6.0	Each	Litres Of Oil	G	10.00	60.00
32.2	Each	Shop Rate (Automotive) Dissassembled and removed old engine, installed new engine, filled oil and coolant. test drove.	G	145.00	4,669.00
1.0	Dollars	Shop Supplies (Added to every hours of work)	G	55.00	55.00
Subtotal:					11,361.65
G - GST 5%					
GST					568.08
<p>Job Code: AB . IP . GP . HR</p> <p>Task Code: A16NB</p> <p>Equipment Unit #: 27</p> <p>Comment: ENGINE</p>					
<div style="border: 1px solid black; padding: 2px; display: inline-block;">Rec Apr 18/24</div>					
RailCore X Inc. GST: #726887870RT0001					
Shipped By: _____ Tracking Number: _____				Total Amount 11,929.73	
Comment: Thank You for your Business!!!				Amount Paid 0.00	
Sold By: _____				Amount Owning 11,929.73	

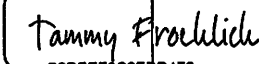DocuSigned by:

 C2DEEF0C9EDD4F2...
 2024-04-19



WINDSOR FORD
 10001 139 Avenue • Grande Prairie, AB • T8X 0V3
 Tel: (780) 532-9555 • 1-800-422-6094
 service@windsorford.com • www.windsorford.com
 SERVICE HOURS - Mon - Sat 7:15 a.m. - 6:00 p.m.

**GENUINE PEOPLE
 TREATING YOU LIKE
 A PERSON**

**OUR REPUTATION IS
 YOUR EXPERIENCE**

SO# 566652

**SERVICE ORDER
 CUSTOMER COPY**



Printed 01/24/2024 10:27:32 AM

User 1264 Page 1

Customer No		Advisor Brian J	Promised 11/23/2023 6:00 PM	9392
CARIBOU CENTRAL RAILROAD 307 BANKS ROAD KELOWNA, BC V1X 6A1		Shop WF	Opened 11/23/2023 4:48 PM	Location
		Priority	Cashiered 11/27/2023 2:57 PM	PO # cariboo.ti
Home	Bus (604) 613-5005	License	Odom In	Odom Out
Cell	Today	CPP - 6751	410304	410304
Email		Year 2017	Make GMC	Model SIERRA 1500
		Vehicle ID No	Selling Dealer	Model Number TK15743
		3GTU2LEC0HG361946		Colour WHITE
		Engine 5.3L ECOTEC3 V8 WITH ACTIVE		Delivery Date
Term CASH				

Request	Description	Job	CSR	Status			
151	CHECK & ADVISE > CEL LIGHT IS ON	1	BRIAN J	Original			
Labour	Description	Type	Amount				
151	CHECK & ADVISE > CEL LIGHT IS ON	CD	390.00				
Part	Description	Shp	Bin	Type	Retail	Price	Amount
DG9Z 14526 J	CIRCUIT BREAKER ASY;15A	1	H2D	CR16	1.59	1.59	1.59
Technician	1348 -			Parts Total			1.59
Cause	Broken wires			Labour Total			390.00
Correction	Inspect and verified the check engine light is on. Connected scan tool and found DTCs P0097 Intake air temp sensor 2 fault P00F4 Intake humidity sensor fault. P0102 MAF frequency low. Tested and found the fuse for this sensor is open. Installed new fuse and found it opened right away. used wiring diagram and found this fuse also powers the flex fuel sensor. raised on hoist and found the flex fuel sensor wiring is damaged and will need to be repaired. Made estimate for repairs. Performed wiring repairs and installed a new fuse. Road test and verified the light did not come back on. (Note: when driving into the shop there is a loud grinding sound from the front end. Performed quick inspection and found the right front wheel bearing is very loose. The left side has some play as well)			Request Sub-total			391.59

Request	Description	Job	CSR	Status
888	CUSTOMER INFORMATION/CONTACT#DEANNA 778 363 1871	2	BRIAN J	Original
	Would you like your used parts returned Yes / No (not applicable if warranty)			
Labour	Description	Type	Amount	
888	CUSTOMER INFORMATION/CONTACT#DEANNA 778 363 1871	CQL	0.00	
	Would you like your used parts returned Yes / No (not applicable if warranty)			
Technician	999 -			

Request	Description	Job	CSR	Status
99P	WINDSOR FORD SAFETY & RELIABILITY INSPECTION \$49.95 VALUE -NO CHARGE	3	BRIAN J	Original

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES: Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes or authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

PRIVACY STATEMENT: Personal information is collected in accordance with applicable privacy legislation and is governed by the Dealer's Privacy Policy. Your privacy is important to us. Ask us if you would like information about our Privacy Policy. We provide this personal information to Ford Motor Company of Canada Limited (together with third parties acting on its behalf "Ford") to enable Ford to administer your transaction, to provide you with services, to improve automotive related products and services by conducting customer surveys, and to provide you with marketing material which may be of interest to you. To obtain the Ford Privacy Policy or if you do not want to receive marketing or survey materials from Ford please call 1-800-565-FORD (3673).

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS

DISCLAIMER: Wheel lug nuts must be retorqued 100km after any wheel has been removed. This is the CUSTOMERS responsibility.

Customer Signature: _____

GST# 10570 8457 RT0001



WINDSOR FORD
 10001 139 Avenue • Grande Prairie, AB • T8X 0V3
 Tel: (780) 532-9555 • 1-800-422-6094
 service@windsorford.com • www.windsorford.com
 SERVICE HOURS - Mon - Sat 7:15 a.m. - 6:00 p.m.

**GENUINE PEOPLE
 TREATING YOU LIKE
 A PERSON**

**OUR REPUTATION IS
 YOUR EXPERIENCE**

SO# 566652

**SERVICE ORDER
 CUSTOMER COPY**



Printed 01/24/2024 10:27:32 AM

User 1264 Page 2

Customer No		Advisor Brian J	Promised 11/23/2023 6:00 PM	9392
CARIBOU CENTRAL RAILROAD 307 BANKS ROAD KELOWNA, BC V1X 6A1		Shop WF	Opened 11/23/2023 4:48 PM	Location
		Priority	Cashiered 11/27/2023 2:57 PM	PO # cariboo.ti
Home	Bus (604) 613-5005	License	Odom In	Odom Out
Cell	Today	CPP - 6751	410304	410304
Email		Year 2017	Make GMC	Model SIERRA 1500
		Vehicle ID No 3GTU2LEC0HG361946	Selling Dealer	Extended Warranty
	Term CASH	Engine 5.3L ECOTEC3 V8 WITH ACTIVE	In Service Date	Stock No
			Model Number TK15743	Colour WHITE
				Delivery Date

Labour	Description	Type	Amount
99P	WINDSOR FORD SAFETY & RELIABILITY INSPECTION \$49.95 VALUE -NO CHARGE	C	0.00

Technician 1348 -

Request	Description	Job	CSR	Status			
140	REPLACE BOTH FRONT WHEEL BEARING	4	BRIAN J	Approved			
Labour	Description	Type	Amount				
140	REPLACE BOTH FRONT WHEEL BEARING	CD	468.00				
Part	Description	Shp	Bin	Type	Retail	Price	Amount
BR930914	WHEEL BEARING	2		CR160	652.74	567.60	1,135.20
Technician	1348 -			Parts Total			1,135.20
Cause	As per estimate			Labour Total			468.00
Correction	Replaced both front wheel bearing/hub assemblies. Road-test and verified noise is no longer present			Request Sub-total			1,603.20

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES: Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes or authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

PRIVACY STATEMENT: Personal information is collected in accordance with applicable privacy legislation and is governed by the Dealer's Privacy Policy. Your privacy is important to us. Ask us if you would like information about our Privacy Policy. We provide this personal information to Ford Motor Company of Canada Limited (together with third parties acting on its behalf "Ford") to enable Ford to administer your transaction, to provide you with services, to improve automotive related products and services by conducting customer surveys, and to provide you with marketing material which may be of interest to you. To obtain the Ford Privacy Policy or if you do not want to receive marketing or survey materials from Ford please call 1-800-565-FORD (3673).

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS

DISCLAIMER: Wheel lug nuts must be retorqued 100km after any wheel has been removed. This is the CUSTOMERS responsibility.

Customer Signature: _____

GST# 10570 8457 RT0001



WINDSOR FORD
 10001 139 Avenue • Grande Prairie, AB • T8X 0V3
 Tel: (780) 532-9555 • 1-800-422-6094
 service@windsorford.com • www.windsorford.com
 SERVICE HOURS - Mon - Sat 7:15 a.m. - 6:00 p.m.

**GENUINE PEOPLE
 TREATING YOU LIKE
 A PERSON**

**OUR REPUTATION IS
 YOUR EXPERIENCE**

SO# 566652

**SERVICE ORDER
 CUSTOMER COPY**



Printed 01/24/2024 10:27:32 AM

User 1264 Page 3

Customer No CARIBOU CENTRAL RAILROAD 307 BANKS ROAD KELOWNA, BC V1X 6A1 Home Cell Email Bus Today (604) 613-5005 Term CASH	Advisor Brian J Shop WF Priority	Promised 11/23/2023 6:00 PM Opened 11/23/2023 4:48 PM Cashiered 11/27/2023 2:57 PM	9392 Location PO # cariboo.ti
	License CPP - 6751 Year 2017 Make GMC Vehicle ID No 3GTU2LEC0HG361946 Engine 5.3L ECOTEC3 V8 WITH ACTIVE	Odom In 410304 Model SIERRA 1500 Selling Dealer	Odom Out 410304 Model Number TK15743 Extended Warranty

Job Code: ab.cn.hr

Task Code: a16

Equipment Unit #: 41

Comment: repairs

Rec Jan 24/23

DocuSigned by:

 FEC3DE5E49404D9...
 2024-01-25

Labour	858.00
Parts	1,136.79
Supplies	75.00
Env Fee	5.00
Sub-Total	2,074.79
GST	0.00
Third Party GST	103.74
Total Invoice	2,178.53

Customer Deductible	0.00
GST	0.00
Customer Total	0.00

Third Party Billable	2,178.53
CARIBOO RAILROAD CONTRACTING CORP. - CARIBOO CENTR1	

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES: Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes or authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

PRIVACY STATEMENT: Personal information is collected in accordance with applicable privacy legislation and is governed by the Dealer's Privacy Policy. Your privacy is important to us. Ask us if you would like information about our Privacy Policy. We provide this personal information to Ford Motor Company of Canada Limited (together with third parties acting on its behalf "Ford") to enable Ford to administer your transaction, to provide you with services, to improve automotive related products and services by conducting customer surveys, and to provide you with marketing material which may be of interest to you. To obtain the Ford Privacy Policy or if you do not want to receive marketing or survey materials from Ford please call 1-800-565-FORD (3673).

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS

DISCLAIMER: Wheel lug nuts must be retorqued 100km after any wheel has been removed. This is the CUSTOMERS responsibility.

Customer Signature: _____

GST# 10570 8457 RT0001



12308 100 Street
Grande Prairie, AB
T8V 4H7

Phone: (780) 532-8865
Administrative Fax: (780) 539-7510
Toll Free: (888) 532-8865
Parts Direct Line: (780) 539-3745
Parts Fax: (780) 830-4220
Service Direct Line: (780) 830-4200

INVOICE ORIGINAL
Work Order
#344476
Cariboo Central Railroad Cont
May 07, 2021
Svc.Adv Sonnenberg, Brenda
Cust.Ph. (778) 478-1745
Tag# 8967

Page 1 of 2
05/10/2021 13:25:45

To: Cariboo Central Railroad Contracting 209-307 Banks Rd Kelowna BC V1X 6A1	Year: 2017 Veh Id: 88932 Unit #: Make: GMC License #: Model: Sierra Short BOX Crew 1500 Odo. In: 192,608 Colour: White Odo. Out: V.I.N.#: 3GTU2LECOHG361946 Next Service: Date In: 05/07/2021 In Service Date: 07/31/2017 Out: 05/10/2021 Cases: 2 Ext. War - - (mo/) - D: \$0.00 R/Lab. Rate 160.00 Promised Time: 05/10/2021 10:00:00 AM Call When Ready:
---	--

Case: 1 Customer concerned the service engine light is on please advise - Remove & Replace TRANSMISSION ASSEMBLY V8,6 Spd Trans,4WD w/Skid Plate

Quantity	Description/Correction	Retail	Price	Total
1.00	15035747 - SEAL	\$24.05	\$24.05	\$24.05
1.00	15077362 - SEAL,EXH MANIF PIPE	\$24.36	\$24.36	\$24.36
6.00	15709703 - NUT-MUFFL	\$3.09	\$3.09	\$18.52
10.00	19264579 - FLUID,A/TRNS ACDELCO DEX VI - BULK	\$5.50	\$5.50	\$55.00
1.00	19419937 - Transmiss	\$4,309.32	\$3,207.47	\$3,207.47
1.00	20779889 - CLAMP ASM-EXH PIPE	\$43.27	\$43.27	\$43.27
1.00	24245110 - Gasket	\$13.80	\$13.80	\$13.80
			\$1,424.00	\$1,424.00

• Tech Cause: Found codes - P0700,P0741,P0777,P0796 transmission codes. Trans fluid is burnt and can hear internal pump noise. Trans has internal damage and will be more cost affective to install new trans assembly.

• Tech Comments: 6L80E trans cooler flush code - 2BC7E93, 0.9gpm @ 70F. Removed and replaced complete trans assembly. Filled trans fluid level. Programmed new TCM. WCC - 18YN67815944. Cleared codes. Reset shift adapts. Road tested. Verified vehicle is now operating as designed. Verified fluid level after road test at operating temp. No further repair required at this time.

• Completed by: Timmermans, Willy
Tech License #: (6641A)

• Core Charges - 19419937 \$2,000.00 \$2,000.00
• Core Return - 19419937COR (\$2,000.00) (\$2,000.00)
• Shop Charges - \$27.25 \$27.25

Misc \$27.25 Labour \$1,424.00 Parts \$3,386.47 Prepaid Parts Amt: \$0.00 Case Total: \$4,837.72

Case: 2 Customer concerned has a grinding noise from driveline gets worse as he goes faster please advise

Quantity	Description/Correction	Price	Total
		\$0.00	\$0.00

• Tech Cause: In relation to transmission damage on case #1

• Tech Comments: Road tested after trans repair and verified grinding noise is now gone. No further repair required.



12308 100 Street
Grande Prairie, AB
T8V 4H7

Phone: (780) 532-8865
Administrative Fax: (780) 539-7510
Toll Free: (888) 532-8865
Parts Direct Line: (780) 539-3745
Parts Fax: (780) 830-4220
Service Direct Line: (780) 830-4200

INVOICE ORIGINAL

Work Order
#344476
Cariboo Central Railroad Cont
May 07, 2021
Svc.Adv Sonnenberg, Brenda
Cust.Ph. (778) 478-1745
Tag# 8967

Page 2 of 2
 05/10/2021 13:25:45

• Completed by: Buck, Jeremiah Tech
 License #: (164816A)

Misc	\$0.00	Labour	\$0.00	Parts	\$0.00	Prepaid Parts Amt:	\$0.00	Case Total:	\$0.00
									\$0.00

O U T	Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order.		Currency:	Labour:	\$1,424.00	
				Parts:	\$3,386.47	
			Payment Ref:	Misc:	\$27.25	
			Expiry Date:	Sub Total:	\$4,837.72	
			P/O#:	G/HST:	\$241.88	
			G/HST Reg # 105411359RT0001	PST:	\$0.00	
				Tax Adjustment:	\$0.00	
	05/10/2021					
	Date	Signature	Payment Type	Total:	\$5,079.60	

Job Code: Cariboo.Track.INSP

Task Code: A99

Equipment Unit #: Unit 27

Comment: New Transmission

DocuSigned by:

 12188F15F0CD418...

May 11, 2021

Received May 10/21