

Zukhaven Mechanical
(780)264-1156
PO Box 20
Sunnybrook AB T0C 2M0

Billed To
Tim Fougere
2220164 AB LTD.

Date of Issue
05/21/2025

Invoice Number
0002866

Due Date
05/26/2025

Amount Due (CAD)
\$931.10

Description	Rate	Qty	Line Total
Service 125 Unit 900 53308hrs 628158km -Oil change and grease -Inspect clutch brake and adjust clutch and linkage Unit 910 16981hrs 341840km -Remove and replace ps #2 air bag -check pump rotation speed, too slow, adjust relief no change, adjust maximum pto rpm to 1350 and tach pump, 730 rpm -retorque all wheels -repair air leak to pto	\$125.00 +GST	7	\$875.00
1/4 PTC union	\$10.66 +GST	1	\$10.66
1/4 SYNFLEX AIRLINE 1/4 synflex airline per/ft	\$0.55 +GST	2	\$1.10
Subtotal			886.76
GST (5%) #82809 3005 RT0001			44.34
Total			931.10
Amount Paid			0.00
Amount Due (CAD)			\$931.10

Terms

Diesel Junkies Repairs Inc.

Site 448 Box 2 Comp 13 RR 3
Drayton Valley AB T7A 2A3
dieseljunkiesrepair@gmail.com
GST/HST Registration No.: 744551219

INVOICE

BILL TO
Jacc's Oilfield Services Ltd.
Box 5157
Drayton Valley Alberta T7A 1R3

INVOICE
DATE
TERMS
DUE DATE


INV-1884
03/18/2025
Due on receipt
03/18/2025

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
03/18/2025	Labor				420.00
	Shop Supplies				12.60
		SO-1884 Unit # 900			
SUBTOTAL					432.60
GST @ 5%					21.63
TOTAL					454.23
BALANCE DUE					\$454.23

TAX SUMMARY

	RATE	TAX	NET
GST @ 5%		21.63	432.60

WORK ORDER

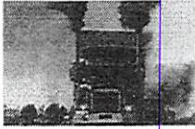

Diesel Junkies Repairs Inc.
Site 448 Box 2 Comp 13 RR 3
Drayton Valley, AB T7A 2A3
Phone # 780-263-4946

BILL TO

JACC'S OILFIELD SERVICES

4408 55 AVENUE
DRAYTON VALLEY, AB T7A1A1
780-515-1513
ADMIN@JACCISOILFIELD.COM

UNIT #

900

DATE

03/18/2025

WORK ORDER

SO1884

TERMS

Due Upon Receipt

KM

626214

HOURS

53236

Service and Scheduled Maintenance completed as required

DESCRIPTION	PART #	QTY	LIST PRICE	NET PRICE	AMOUNT
2002					
PETERBILT - CONVENTIONAL					
1NPFLBOX22D579927					
FIX SEAT & CLEAN CAB					
Labor		3		\$ 140.00	\$ 420.00
Labor \$ 420.00				SUBTOTAL	\$ 420.00
Parts \$ -				SHOP SUPPLIES 3%	\$ 12.60
				TAX 5%	\$ 21.63
				TOTAL	\$ 454.23

Thank you for your business!

IF WHEELS REMOVED, RE-TORQUE BETWEEN 50-150KM

If you have any questions about this invoice, please contact us

Diesel Junkies Repairs Inc.

Site 448 Box 2 Comp 13 RR 3
Drayton Valley AB T7A 2A3
dieseljunkiesrepair@gmail.com
GST/HST Registration No.: 744551219

INVOICE

BILL TO
Jacc's Oilfield Services Ltd.
Box 5157
Drayton Valley Alberta T7A 1E3

INVOICE
DATE
TERMS
DUE DATE
INV-1591
11/05/2024
Due on receipt
11/05/2024


DATE	ACTIMTY	DESCRIPTION	QTY	RATE	AMOUNT
11/05/2024	Labor				980.00
	Parts				118.00
	Shop Supplies				29.40
		SO-1591 Unit# 900			

SUBTOTAL	1,127.40
GST @ 5%	56.37
TOTAL	1,183.77
BALANCE DUE	\$1,183.77

TAX SUMMARY

	RATE	TAX	NET
GST @ 5%		56.37	1,127.40

WORK ORDER

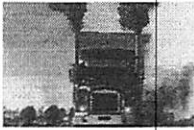

Diesel Junkies Repairs Inc.
Site 448 Box 2 Comp 13 RR 3
Drayton Valley, AB T7A 2A3
Phone # 780-263-4946

BILL TO

JACC'S OILFIELD SERVICES

4408 55 AVENUE
DRAYTON VALLEY, AB T7A1A1
780-515-1513
ADMIN@JACCSOILFIELD.COM

UNIT #

900

DATE

11/05/2024

WORK ORDER

SO1591

TERMS

Due Upon Receipt

KM

620282

HOURS

DESCRIPTION	PART #	QTY	LIST PRICE	NET PRICE	AMOUNT
2002					
PETERBILT - CONVENTIONAL					
1NPFLBOX22579927					
TAKE TO BREEZE TRUCKING FOR INSPECTION					
COMPLETE CVIP INSPECTION BREEZE SUBL					
STICKER		1		\$ 118.00	\$ 118.00
Labor		7		\$ 140.00	\$ 980.00

Labor \$ 980.00

Parts \$ 118.00

SUBTOTAL \$ 1,098.00

SHOP SUPPLIES 3% \$ 29.40

TAX 5% \$ 56.37

TOTAL \$ 1,183.77

Thank you for your business!

IF WHEELS REMOVED, RE-TORQUE BETWEEN 50-150KM

If you have any questions about this invoice, please contact us

Zukhaven Mechanical
(780)264-1156
PO Box 20
Sunnybrook AB T0C 2M0

Billed To
Tim Fougere
2220164 AB LTD.

Date of Issue
10/29/2024

Invoice Number
0002779

Due Date
11/03/2024

Amount Due (CAD)
\$2,292.91

Description	Rate	Qty	Line Total
Service 125 Unit 900 52977hrs 619972km Complaint of coolant leak by oil cooler and oil in coolant, inspect and find coolant leak typical cold leak from cat engines, requires o ring change, drain coolant remove pipe from oil cooler to water pump, clean mating surfaces, install new o ring and gasket. Pull coolant sample find clean brown/ green oil, check transmission for coolant contamination, none found, suspect faulty transmission cooler, remove and replace transmission cooler, Fill truck with coolant and start, check for leaks, none found. Replace coolant filter and skim coolant retorque wheels	\$125.00 +GST	6.5	\$812.50
Transmission cooler k4245	\$1,218.10 +GST	1	\$1,218.10
rad cap 7 psi rc0730	\$23.98 +GST	1	\$23.98
gasket 1250434	\$55.80 +GST	1	\$55.80
o ring 1090077	\$34.49 +GST	1	\$34.49
coolant filter 4355142	\$38.85 +GST	1	\$38.85

Subtotal	2,183.72
GST (5%)	109.19
#82809 3005 RT0001	
Total	2,292.91
Amount Paid	0.00
Amount Due (CAD)	\$2,292.91

Terms

Payments can be made by check to Zukhaven Mechanical
or by email money transfer at zukhavenmechanical@yahoo.ca
Thank you for your business!

Zukhaven Mechanical
(780)264-1156
PO Box 20
Sunnybrook AB T0C 2M0

Billed To
Tim Fougere
2220164 AB LTD.

Date of Issue
10/16/2024

Due Date
10/21/2024

Invoice Number
0002774

Amount Due (CAD)
\$11,538.27

Description	Rate	Qty	Line Total
Service 125 Inspect for CVIP remove all wheels and measure brakes, reinstall wheels and torque Ds front fender marker out replace bulb PS hood latch tore remove and replace clean windshield wiper nozzles engine belts cracked, remove fan blade loosen, remove and replace belts and reinstall fan blade and tighten belts ds steer shock broken, remove and replace install new cabin air filter install conspicuity tape on bumper repair bumper drop down with welder and reinstall both sides rear upper and lower spring pin bushings bad, remove quarter fenders, spring hanger mounts have bushings pressed out and new ones pressed in, reinstall quarter fenders with new mudflaps water temp bulb out remove and replace interior light out remove and replace air leak on #2 diff when lock engaged, remove and replace qr1 valve air leak service brake application, ds steer pot leaking remove and replace ps steer brake has wrong clevis pin remove and replace	\$125.00 +GST	40	\$5,000.00

ps steer wheel seal leaking remove and replace and fill with oil

ds steer auto adjuster bracket broken remove and replace

3 of 4 drive axle upper shock mounts rotted, remove and replace
mounts and shocks

levelling valve leaking remove and replace valve and rod

#1 drive ps s cam bushings bad remove and replace bushings and
cam,

check fluid levels on diffs and fill as needed

grease truck

both drive axle passenger brakes low, remove and replace

drag link wore out remove and replace

ps tie rod end worn out remove and replace

ps air leak in front of engine, tighten fitting

1/2 x 1 bolt	\$1.60 +GST	4	\$6.40
1/2 flat washers	\$0.47 +GST	4	\$1.88
3/8 x 1 bolt	\$0.74 +GST	4	\$2.96
3/8" Flat washer BLTC104	\$0.14 +GST	4	\$0.56
type 24 service pot	\$93.82 +GST	1	\$93.82
slack adjuster bushing	\$2.63 +GST	2	\$5.26
3/8 x 1 sockethead cap screw	\$0.46 +GST	4	\$1.84
slack adjuster auto bracket mid42710585	\$42.21 +GST	1	\$42.21
5/8 stover nc nut	\$1.96 +GST	4	\$7.84
5/8 flat washer	\$0.74 +GST	4	\$2.96
barco levelling valve hen60501	\$149.87 +GST	1	\$149.87
levelling valve rod	\$37.36	1	\$37.36

saf50860006	+GST		
912 bulb	\$1.75 +GST	1	\$1.75
2.5 amber led tru1050a	\$15.79 +GST	1	\$15.79
2.0 clear amber led	\$21.81 +GST	1	\$21.81
quick release valve qr1 ben0r229860x	\$32.52 +GST	1	\$32.52
hood latch gaf12365	\$37.77 +GST	1	\$37.77
reflective tape per ft	\$1.96 +GST	9	\$17.64
steer shock gab85311	\$144.55 +GST	1	\$144.55
1/4 flat washer	\$0.12 +GST	2	\$0.24
1/4 stover nc nut	\$0.14 +GST	2	\$0.28
5/8 flat washer	\$0.74 +GST	24	\$17.76
5/8 stover nc nut	\$1.96 +GST	12	\$23.52
5/8 x 3.5 bolt nc	\$5.15 +GST	8	\$41.20
5/8 x 3 bolt nc	\$4.51 +GST	4	\$18.04
axle gasket 8 hole 5/8	\$7.81 +GST	1	\$7.81
5/16 flat washer	\$0.12 +GST	8	\$0.96
3/8 flat washer	\$0.14 +GST	8	\$1.12
5/16 x 1.25 bolt nc	\$0.58 +GST	4	\$2.32
Grease	\$11.66	2	\$23.32

per tube	+GST		
spring pin 02-01781	\$121.21 +GST	4	\$484.84
spring pin bushing 02-01805	\$123.24 +GST	4	\$492.96
drive axle shock upper bracket c11-1126	\$454.98 +GST	3	\$1,364.94
cabin air filter cf19900	\$53.64 +GST	1	\$53.64
draglink dlp3170b	\$388.91 +GST	1	\$388.91
mudflap quarter fender 15-06691	\$79.16 +GST	2	\$158.32
steer wheel seal revmax rm-s01	\$71.04 +GST	1	\$71.04
S cam 04391071	\$146.36 +GST	1	\$146.36
1 1/8 flat washer	\$2.22 +GST	4	\$8.88
5/16" flat washer BLTB104	\$0.07 +GST	20	\$1.40
5/16" Stover lock nut BLTB116	\$0.08 +GST	10	\$0.80
5/8 stover nc nut	\$1.96 +GST	10	\$19.60
5/8 nf nut	\$1.10 +GST	3	\$3.30
5/16 x 1.25 nc bolt	\$0.58 +GST	10	\$5.80
5/8 x 2.5 nc bolt	\$4.04 +GST	2	\$8.08
5/8 flat washer	\$0.74 +GST	18	\$13.32
5/8 x 3 nc bolt	\$4.51 +GST	9	\$40.59
SYN. GEAR OIL 75/90 PER litre	\$18.75	4	\$75.00

	+GST		
GUN3600A 10 bolt budd drum prder 16792X	\$161.73 +GST	2	\$323.46
eaton es 2 drive axle shoes	\$173.65 +GST	2	\$347.30
camshaft seal bat02304	\$1.89 +GST	2	\$3.78
s cam snap ring bat04319	\$3.68 +GST	1	\$3.68
drive axle shock 03-07421plus	\$234.47 +GST	3	\$703.41
v belt 22550blt	\$37.40 +GST	2	\$74.80
v belt 17590	\$48.53 +GST	2	\$97.06
front axle assist air bag fir6926	\$336.20 +GST	1	\$336.20
Subtotal			10,988.83
GST (5%) #82809 3005 RT0001			549.44
Total			11,538.27
Amount Paid			0.00
Amount Due (CAD)			\$11,538.27

Terms

Payments can be made by check to Zukhaven Mechanical
or by email money transfer at zukhavenmechanical@yahoo.ca
Thank you for your business!

Zukhaven Mechanical
(780)264-1156
PO Box 20
Sunnybrook AB T0C 2M0

Billed To
Tim Fougere
2220164 AB LTD.

Date of Issue
10/01/2024

Invoice Number
0002773

Due Date
10/06/2024

Amount Due (CAD)
\$764.70

Description	Rate	Qty	Line Total
Service 125 Unit 900 52913hrs 618584km	\$125.00 +GST	3	\$375.00
Work lights not working, inspect and find melted fuse holder, repair wiring as needed.			
Blower motor faulty remove and replace blower motor and squirrel cage. pu5 new knob on fan speed switch			
Test proheat, no issues			
Fuse Holder 82-2208	\$6.25 +GST	1	\$6.25
blower motor sr2000010	\$265.27 +GST	1	\$265.27
squirrel cage sr2000021	\$63.05 +GST	1	\$63.05
fan speed knob 121-0001-000	\$18.72 +GST	1	\$18.72
Subtotal			728.29
GST (5%) #82809 3005 RT0001			36.41
Total			764.70
Amount Paid			0.00