



Weidners



LACOMBE

SCANNED

CHEVROLET

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#154006

CBO Earth Works / 1196172 Alb

November 22, 2024

Svc. Adv Boyd, Ron

Cust. Ph. (403) 782-3437

Tag# R

Page 1 of 2

12/20/2024 10:05:43

*B20-5
MAY*

COPY

To: CBO Earth Works / 1196172 Alberta LI 5913 Len Thompson Dr. Lacombe AB T4L 0E8	Year: 2011 Veh Id: 27258 Unit #: PT-29 Make: GMC License #: CST5156 Model: SIERRA CREW CAB 2500 4 ¹ Odo. In: 359,124 Colour: White Odo. Out: V.I.N.#: 1GT12ZCG5BF157602 Next Service: Date In: 11/22/2024 In Service Date: 02/04/2011 Out: 11/30/2024 Cases: 2 Ext. War - - (mol) - D: \$0.00 Promised Time: 11/22/2024 04:00:00 PM Call When Ready:
--	---

Case: 1 Customer is concerned with low oil pressure reading on the gauge. Engine might be a little noisier than normal as well. Diagnose & advise

Quantity	Description/Correction	Retail	Price	Total					
1.00	PF48 - Oil Filter	\$9.00	\$9.00	\$9.00					
6.00	19432455 - OIL,ENG DEXOS1 GEN3 FULL SYN 5W30 ACDELCO	\$7.05	\$7.05	\$42.30					
			\$214.50	\$214.50					
	• Tech Cause: Will not start. Boost to start. Check oil level. Not showing on dip stick. Drain oil. Only has 1.5 liters of oil and very dirty.								
	• Tech Comments: Change oil and filter. Start and run engine. Road test and scan. Oil pressure at 28 to 30 psi in drive, ok. Did not hear engine making noise.								
	• Completed By: Olson, Jim (0058)								
	• Environmental Fee		\$0.50	\$0.50					
	• Environmental Fee		\$0.30	\$0.30					
	• Shop Supplies/Enviro Charges		\$25.74	\$25.74					
Misc	\$26.54	Labour	\$214.50	Parts	\$51.30	Prepaid Parts Amt:	\$0.00	Case Total:	\$292.34

Case: 2 Please replace headlamp bulbs

Quantity	Description/Correction	Price	Total						
	• Tech Cause: Check lights. Lights working. Head light lens very dirty.	\$21.45	\$21.45						
	• Tech Comments: Needs headlights cleaned or new headlights. Bulbs will not help.								
	• Completed By: Olson, Jim (0058)								
	• Shop Supplies/Enviro Charges	\$2.57	\$2.57						
Misc	\$2.57	Labour	\$21.45	Parts	\$0.00	Prepaid Parts Amt:	\$0.00	Case Total:	\$24.02
									\$0.00

Notes

- 403 872 6275 Mark
Douglas Miller - 11/25/2024 08:08:12

** missed in Nov.*



Weidners

CHEVROLET



LACOMBE CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#154006

CBO Earth Works / 1196172 Alb

November 22, 2024

Svc. Adv Boyd, Ron

Cust. Ph. (403) 782-3437

Tag# R

Page 2 of 2

12/20/2024 10:05:44

O U T	Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order.		Currency:	Labour:	\$235.95	
	Privacy - Personal information is collected in accordance with applicable privacy legislation and is governed by Weidner Motors Ltd.'s Privacy Policy.		Payment Ref:	Parts:	\$52.10	
	General Motors Parts carry a 1YR PARTS AND LABOR WARRANTY. Non-G.M. Parts carry a PARTS ONLY WARRANTY. Please ask your parts or service representative for more information.		Expiry Date:	Misc:	\$28.31	
			P/O#: PT-29	Sub Total:	\$316.36	
			G/HST Reg # 105611867RT001	G/HST:	\$15.84	
				PST:	\$0.00	
				Tax Adjustment:	\$0.00	
	11/30/2024					
	Date	Signature	Payment Type	Charge	Total:	\$332.20

Payer	Payment Type	Reference	Date	
CBO Earth Works / 1196172 Alb	Charge		11/30/2024	\$332.20
			Balance Owing:	\$332.20



Weidners

CHEVROLET



LACOMBE CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#151390

DB Bobcat Services Ltd

June 14, 2024

Svc.Adv Mundorf, Lindsay

Cust.Ph. (403) 782-3437

Tag#

Page 1 of 2

06/14/2024 11:43:47

<p>To: DB Bobcat Services Ltd</p> <p>5913 Len Thompson Dr.</p> <p>Lacombe AB T4L 0E8</p> <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 10px auto;"> <p style="text-align: center; font-weight: bold;">RECEIVED</p> <p style="text-align: center;">JUN 14 2024</p> </div>	<p>Year: 2011 Veh Id: 27258 Unit #:PT-29</p> <p>Make: GMC License #: BMG0378</p> <p>Model: SIERRA CREW CAB 2500 4¹ Odo. In: 327,531</p> <p>Colour: White Odo. Out:</p> <p>V.I.N.#: 1GT12ZCG5BF157602 Next Service:</p> <p>Date In: 06/14/2024 In Service Date: 02/04/2011</p> <p>Out: 06/14/2024 Cases: 1</p> <p>Ext. War - - (mo/) - D: \$0.00</p> <p>Promised Time: 06/14/2024 04:00:00 PM Call When Ready:</p>
---	--

Case: 1 Customer states the vehicle is squealing bad at idle - report

Quantity Description/Correction

1.00 19253263 - PUMP KIT,WAT

1.00 12626222 - Belt

2.00 10953464 -
COOLANT,ENG,EXTENDED LIFE
(DEX COOL), 3.

Retail	Price	Total
\$520.39	\$520.39	\$520.39
\$101.44	\$101.44	\$101.44
\$29.95	\$29.95	\$59.90
	\$286.00	\$286.00

COPY

- Tech Cause: Checked for noise under the hood.
- The waterpump is noisy.
- Bearings are loose and is leaking coolant.
- Serp. belt is soaked with coolant and was slipping and burnt.
- Installed new waterpump.
- Installed new serp. belt.
- Filled with coolant.
- Noise is gone.
- Tech Comments: Replaced waterpump and serp. belt.
- Completed By: Luebke, Erich (0040)
- Shop Supplies/Enviro Charges

Misc \$34.32	Labour \$286.00	Parts \$681.73	Prepaid Parts Amt: \$0.00	Case Total: \$1,002.05
--------------	-----------------	----------------	---------------------------	------------------------

\$0.00



Weidners



LACOMBE

CHEVROLET

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#151390

DB Bobcat Services Ltd

June 14, 2024

Svc.Adv Mundorf, Lindsay

Cust.Ph. (403) 782-3437

Tag#

Page 2 of 2

06/14/2024 11:43:47

Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order.

Currency:

Labour: \$286.00

Parts: \$681.73

Misc: \$34.32

Sub Total: \$1,002.05

G/HST: \$50.10

PST: \$0.00

Tax Adjustment: \$0.00

Privacy - Personal information is collected in accordance with applicable privacy legislation and is governed by Weidner Motors Ltd.'s Privacy Policy.

Payment Ref:

Expiry Date:

P/O#: PT-29

G/HST Reg # 105611867RT001

General Motors Parts carry a 1YR PARTS AND LABOR WARRANTY.

Non-G.M. Parts carry a PARTS ONLY WARRANTY.

Please ask your parts or service representative for more information.

O
U
T

06/14/2024

Date

Signature

Payment Type

Total:

\$1,052.15



Weidners

CHEVROLET



LACOMBE

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#149873

DB Bobcat Services Ltd

March 11, 2024

Svc. Adv Boyd, Ron

Cust. Ph. (403) 782-3437

Tag# RON

Page 1 of 3

03/13/2024 09:58:45

<p>To: DB Bobcat Services Ltd</p> <p>5913 Len Thompson Dr.</p> <p>Lacombe AB</p> <p>T4L 0E8</p> <p>COPY</p>	<p>Year: 2011 Veh Id: 27258 Unit #:PT-29</p> <p>Make: GMC License #: BMG0378</p> <p>Model: SIERRA CREW CAB 2500 4' Odo. In: 314,864</p> <p>Colour: White Odo. Out:</p> <p>V.I.N.#: 1GT12ZCG5BF157602 Next Service:</p> <p>Date In: 03/11/2024 In Service Date: 02/04/2011</p> <p>Out: 03/13/2024 Cases: 4</p> <p>Ext. War - - (mo/) - D: \$0.00</p> <p>Promised Time: 03/11/2024 04:00:00 PM Call When Ready:</p>
--	---

Case: 1 Customer states engine light is on and flashing- check and report

Quantity	Description/Correction	Retail	Price	Total
8.00	19417055 - SPARK PLUG ASM,GAS ENG IGN	\$20.90	\$20.90	\$167.20
1.00	12731654 - Wire kit	\$296.22	\$296.22	\$296.22
1.00	12699382 - Coil	\$240.03	\$240.03	\$240.03
			\$400.40	\$400.40

- Tech Cause: Installed scan tool.
- ECM P0300 misfire.
- has history misfires on cylinder #6.
- Checked sparkplug and the center electrode is missing.
- Removed all sparkplugs.
- Performed compression test, all cylinders have 150/155 psi.
- Cleaned throttle body.
- #6 coil the attach for the plug wire is broken.
- Installed new sparkplugs, ignition wires and #6 coil.
- Cleared codes.
- No misfires now.
- Tech Comments: Performed compression test.
- Replaced spark plugs, ignition wires and #6 coil.
- Completed By: Luebke, Erich (0040)
- Shop Supplies/Enviro Charges

\$24.23 \$24.23

Misc \$24.23 Labour \$400.40 Parts \$703.45 Prepaid Parts Amt: \$0.00 Case Total: \$1,128.08

Case: 2 Customer states they have had to add oil 1L 1/2 - see history - was in here in Nov for lof

Quantity	Description/Correction	Retail	Price	Total
1.00	19432455 - OIL,ENG DEXOS1 GEN3 FULL SYN 5W30 ACDEL	\$7.05	\$7.05	\$7.05



Weidners

CHEVROLET



LACOMBE CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3

Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#149873

DB Bobcat Services Ltd

March 11, 2024

Svc. Adv Boyd, Ron

Cust.Ph. (403) 782-3437

Tag# RON

Page 2 of 3

03/13/2024 09:58:45

\$71.50 \$71.50

- Tech Cause: Checked for oil leaks.
- No engine oil leaks.
- Engine oil level is one liter low.
- Added one liter engine oil.
- Has P/S oil leak.
- P/S pressure hose is leaking from pump to booster.
- Two screw holes that hold air cleaner lid on are stripped.
- Need to change oil and see if it improves, there may be fuel in the oil from misifring.
- Tech Comments: Engine oil level was one liter low, topped up oil.
- P/s pressure hose is leaking.
- Air cleaner lid has two stripped holes.
- Completed By: Luebke, Erich (0040)
- Environmental Fee
- Shop Supplies/Enviro Charges

\$0.05 \$0.05

\$4.33 \$4.33

Misc	\$4.38	Labour	\$71.50	Parts	\$7.05	Prepaid Parts Amt:	\$0.00	Case Total:	\$82.93
------	--------	--------	---------	-------	--------	--------------------	--------	-------------	---------

Case: 3 Added Operation: Replace leaking power steering hose - Tech Cause: Replaced p/s pressure hose from pump to brake booster.

Filled with ps/ fluid. - Tech Comments: Installed new P/S hose from pump to brake booster.

Quantity Description/Correction

1.00 23226913 - Hose

Retail	Price	Total
\$105.21	\$105.21	\$105.21

\$171.60 \$171.60

- Tech Cause: Replaced p/s pressure hose from pump to brake booster.
- Filled with ps/ fluid.
- Tech Comments: Installed new P/S hose from pump to brake booster.
- Completed By: Luebke, Erich (0040)
- Shop Supplies/Enviro Charges

\$10.38 \$10.38

Misc	\$10.38	Labour	\$171.60	Parts	\$105.21	Prepaid Parts Amt:	\$0.00	Case Total:	\$287.19
------	---------	--------	----------	-------	----------	--------------------	--------	-------------	----------

Case: 4 Added Operation: Repair air cleaner lid has two stripped holes - Tech Cause: Removed lower air cleaner housing.

Put two part epoxy into air cleaner screw holes.

Drilled out holes and threaded in screws.

Installed new grommets to hold to bracket.

Installed new air filter.

Installed air cleaner assembly. - Tech Comments: Used two part epoxy to repair screw holes in air cleaner.

Replaced air filter.

Quantity Description/Correction

1.00 22845992 - Element

2.00 22739022 - INSULATOR-A/CL BRKT

Retail	Price	Total
\$79.50	\$79.50	\$79.50

\$10.76 \$10.76 \$21.52



Weidners



LACOMBE

CHEVROLET

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3

Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#149873

DB Bobcat Services Ltd

March 11, 2024

Svc. Adv Boyd, Ron

Cust.Ph. (403) 782-3437

Tag# RON

Page 3 of 3

03/13/2024 09:58:46

\$100.10 \$100.10

- Tech Cause: Removed lower air cleaner housing.
- Put two part epoxy into air cleaner screw holes.
- Drilled out holes and threaded in screws.
- Installed new grommets to hold to bracket.
- Installed new air filter.
- Installed air cleaner assembly.
- Tech Comments: Used two part epoxy to repair screw holes in air cleaner.
- Replaced air filter.
- Completed By: Luebke, Erich (0040)
- Shop Supplies/Enviro Charges

Misc	\$6.06	Labour	\$100.10	Parts	\$101.02	Prepaid Parts Amt:	\$0.00	Case Total:	\$207.18
									\$0.00

O U T	Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order.		Currency:	Labour:	\$743.60
	Privacy - Personal information is collected in accordance with applicable privacy legislation and is governed by Weidner Motors Ltd.'s Privacy Policy.		Payment Ref:	Parts:	\$916.78
	General Motors Parts carry a 1YR PARTS AND LABOR WARRANTY. Non-G.M. Parts carry a PARTS ONLY WARRANTY. Please ask your parts or service representative for more information.		Expiry Date:	Misc:	\$45.00
			P/O#: PT-29	Sub Total:	\$1,705.38
		G/HST Reg # 105611867RT001	G/HST:	\$85.27	
			PST:	\$0.00	
			Tax Adjustment:	\$0.00	
03/13/2024		Date		Signature	
			Payment Type	Total:	\$1,790.65

CERTIFIED SERVICE REPORT

Name: DB Bobcat Services Ltd

Date: 05/13/2024

Repair Order #: 150874

Year: 2011

Make: GMC

Odometer: 321538 PT 29

Service Consultant: Boyd, Ron

Technician: _____

C = Checked and Okay

F = Future Attention Required

I = Immediate Maintenance/Repair Required

Lube, Oil & Filter Service with 15 Point Inspection

Lube, Oil and Filter

- Replace Filter with GM-approved oil filter Completed
- Drain oil and replace with up to 5L premium GM oil Completed
- Lubrication chassis, suspension and steering components Completed
- Reset oil life monitor Not Applicable Completed

15 Point Inspection

- All lights (Including signals) C F I
- Air filter C F I
- Coolant Strength -40 C F I
- Hoses C F I
- Drive belts C F I
- Battery (cables & clamps) C F I
- Wiper blades C F I
- Brake fluid C F I
- Windshield washer fluid Okay
- Power steering fluid Okay
- Differential fluid (RWD) Okay
- Transfer case fluid (4WD/AWD) Okay
- Transmission/Transaxle fluid Okay
- Tire pressure Okay

Tire wear and tread depth

- 8/32" C F I
- 9/32" C F I



Additional Regular Maintenance Services

- Tire Rotation Completed
 - Alignment Service Completed
 - Tune-Up - Emission Control Service Completed
 - Cooling System Service Completed
 - Automatic Transmission/Transaxle Service Completed
 - Cabin Air Filter Service Completed
 - Suspension System Inspection C F I
 - Alignment Inspection C F I
 - Exhaust System Inspection C F I
 - Battery Test C F I
 - Other: _____ C F I
-
- Brake Inspection
 - _____ mm C F I
 - _____ mm C F I



Comments:

Next Visit

Date: _____ Time: _____

Service(s) required:



Weidners
LACOMBE

CHEVROLET
CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#148242

DB Bobcat Services Ltd

November 23, 2023

Svc. Adv Boyd, Ron

Cust. Ph. (403) 782-3437

Tag# RON

Page 1 of 6

11/30/2023 09:21:14

To: DB Bobcat Services Ltd

5913 Len Thompson Dr.

Lacombe
T4L 0E8

AB

COPY

Year: 2011 Veh Id: 27258 Unit#: PT-29
Make: GMC License #: BMG0378
Model: SIERRA CREW CAB 2500 4' Odo. In: 308,005
Colour: White Odo. Out:
V.I.N.#: 1GT12ZCG5BF157602 Next Service:
Date In: 11/23/2023 In Service Date: 02/04/2011
Out: 11/30/2023 Cases: 12
Ext. War - - (mo/) - D: \$0.00
Promised Time: 11/23/2023 04:00:00 PM Call When Ready:

Case: 1 Lube, Oil, Filter - DEXOS Synthetic MPVI

- Top up all Fluid levels.
- Reset oil life reminder
- Air Filter Inspection
- Cabin Air Filter Inspection
- Multi Point Vehicle Inspection MPVI
- Antifreeze Protection Test

COPY

Quantity	Description/Correction	Retail	Price	Total
1.00	PF48 - Oil Filter	\$9.00	\$0.00	\$0.00
6.00	19432455 - OIL, ENG DEXOS1 GEN3 FULL SYN 5W30 ACDELCO	\$7.05	\$0.00	\$0.00
			\$76.30	\$76.30

- Tech Cause: LOF
- Tech Comments: Changed engine oil and filter, checked air filter(s), lights and fluid levels, coolant is rated for -50C. Front tire tread is 9/32, Rear tire tread is 10/32, completed inspection, Oil life was 0% before reset. 2 of the screws on the engine air box are stripped. Oil and transmission pans are sweating. Both front axles are sweating/ leaking.

- Completed By: Willman, Darryl (3834)
- Environmental Fee (Extra Item) \$0.50 \$0.50
- Environmental Fee (Extra Item) \$0.30 \$0.30
- Shop Supplies/Enviro Charges (Extra Item) \$0.55 \$0.55

Misc \$1.35 Labour \$25.00 Parts \$51.30 Prepaid Parts Amt: \$0.00 **Case Total: \$77.65**



Weidners
 **LACOMBE**

CHEVROLET
 CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
 Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#148242

DB Bobcat Services Ltd

November 23, 2023

Svc. Adv Boyd, Ron

Cust.Ph. (403) 782-3437

Tag# RON

Page 2 of 6

11/30/2023 09:21:14

Case: 2 Multi-point Vehicle Inspection

- RETORQUE AFTER 100KM./ CUSTOMER RESPONSIBLE
- Relearn tire pressure sensors
- Multi Point Vehicle Inspection MPVI
- Inspect Under Carriage Visually
- Brake Inspection
- Cabin filter inspection / serv
- Battery Test
- Tires - Rotate

Quantity Description/Correction

Price	Total
\$49.95	\$49.95

- Tech Cause: Battery 12.74 volts 760 cca
- Rear exhaust hanger coming apart.
- RF exhaust manifold has leak, rear bolt is broken.
- Has oil leak at the rear of the engine.
- LF axle seal is leaking, RF is seeping.
- LF uoer ball joint has play in it.
- Tech Comments: Completed Multi-point Vehicle Inspection.
- Completed By: Luebke, Erich (0040)
- Shop Supplies/Enviro Charges (Extra Item)

\$1.10	\$1.10
--------	--------

Misc	\$1.10	Labour	\$49.95	Parts	\$0.00	Prepaid Parts Amt:	\$0.00	Case Total:	\$51.05
------	--------	--------	---------	-------	--------	--------------------	--------	--------------------	----------------

Case: 3 Interior door handle on RF door is broken. Check & replace door handle is required

Quantity Description/Correction

1.00 80375 - Door Handle Repair

Retail	Price	Total
\$235.82	\$235.82	\$235.82
	\$85.80	\$85.80

- Tech Cause: Removed passenger front door panel.
- Removed broken handle assembly.
- Installed new inner handle assembly.
- Installed passenger front door panel.
- Tech Comments: Replaced passenger front inside door handle.
- Completed By: Luebke, Erich (0040)
- Shop Supplies/Enviro Charges

\$1.89	\$1.89
--------	--------

Misc	\$1.89	Labour	\$85.80	Parts	\$235.82	Prepaid Parts Amt:	\$0.00	Case Total:	\$323.51
------	--------	--------	---------	-------	----------	--------------------	--------	--------------------	-----------------

Case: 4 Intermittently when turning the key nothing happens. Driver continues to try the key & eventually it will crank over & start. Suspects a starter problem? Diagnose & advise

Quantity Description/Correction

Price	Total
\$42.90	\$42.90

- Tech Cause: Cranked engine several times and it cranked and started each time.
- The starter has oil in the drive may be affecting it.
- Tech Comments: Unable to duplicate at this time.
- Completed By: Luebke, Erich (0040)



Weidners
LACOMBE

CHEVROLET
 CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
 Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#148242

DB Bobcat Services Ltd

November 23, 2023

Svc. Adv Boyd, Ron

Cust.Ph. (403) 782-3437

Tag# RON

Page 3 of 6

11/30/2023 09:21:14

• Shop Supplies/Enviro Charges

\$0.94

\$0.94

Misc \$0.94 Labour \$42.90 Parts \$0.00 Prepaid Parts Amt: \$0.00 Case Total: \$43.84

Case: 5 Added Operation: Replace starter - Tech Cause: Starter - Tech Comments: Installed new starter

Quantity Description/Correction

1.00 19180528 - Starter

Retail
\$648.65

Price
\$648.65
\$200.20

Total
\$648.65
\$200.20

- Tech Cause: Starter
- Tech Comments: Installed new starter
- Completed By: Walter, Philip (0081)
- Core Charges - 19180528
- Core Return - 19180528COR
- Shop Supplies/Enviro Charges

\$45.00

\$45.00

(\$45.00)

(\$45.00)

\$4.40

\$4.40

Misc \$4.40 Labour \$200.20 Parts \$648.65 Prepaid Parts Amt: \$0.00 Case Total: \$853.25

Case: 6 Added Operation: Replace broken bolt on right front exhaust manifold - Tech Cause: Rear bolt on the RH exhaust manifold is broken - Tech Comments: Removed RH exhaust manifold; found engine dipstick tube broken off at engine block

Used easy out to remove broken tube got upper picece out but lower picece fell into oil pan

also removed broken exhaust manifold bolt, reinstalled manifold used new gaskets seal bolts and nuts

Quantity Description/Correction

6.00 11546600 - BOLT/SCREW

3.00 15032594 - Nut

1.00 12617944 - GASKET

1.00 12609269 - Tube

1.00 20987829 - Seal

Retail

\$6.91

\$7.23

\$37.21

\$44.57

\$27.44

Price

\$6.91

\$7.23

\$37.21

\$44.57

\$27.44

\$343.20

Total

\$41.46

\$21.69

\$37.21

\$44.57

\$27.44

\$343.20

- Tech Cause: Rear bolt on the RH exhaust manifold is broken
- Tech Comments: Removed RH exhaust manifold; found engine dipstick tube broken off at engine block
- Used easy out to remove broken tube got upper picece out but lower picece fell into oil pan
- also removed broken exhaust manifold bolt, reinstalled manifold used new gaskets seal bolts and nuts
- Completed By: Walter, Philip (0081)
- Shop Supplies/Enviro Charges

\$7.54

\$7.54

Misc \$7.54 Labour \$343.20 Parts \$172.37 Prepaid Parts Amt: \$0.00 Case Total: \$523.11

Case: 7 Added Operation: Replace hanger on tail pipe - Tech Cause: Rear tail pipe hanger - Tech Comments: Installed new rear exhaust pipe hanger

Quantity Description/Correction

1.00 15092802 - Insulator

Retail

\$29.94

Price

\$29.94

Total

\$29.94



Weidners
LACOMBE

CHEVROLET
 CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
 Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#148242

DB Bobcat Services Ltd

November 23, 2023

Svc.Adv Boyd, Ron

Cust.Ph. (403) 782-3437

Tag# RON

Page 4 of 6

11/30/2023 09:21:14

\$71.50 \$71.50

- Tech Cause: Rear tail pipe hanger
- Tech Comments: Installed new rear exhaust pipe hanger
- Completed By: Walter, Philip (0081)
- Shop Supplies/Enviro Charges

\$1.57 \$1.57

Misc \$1.57 Labour \$71.50 Parts \$29.94 Prepaid Parts Amt: \$0.00 Case Total: \$103.01

Case: 8 Added Operation: Replace right front control arm - Tech Cause: RF upper control arm - Tech Comments: Installed new RF upper control arm

Quantity Description/Correction

1.00 20924215 - Arm

Retail	Price	Total
\$286.29	\$286.29	\$286.29
	\$143.00	\$143.00

- Tech Cause: RF upper control arm
- Tech Comments: Installed new RF upper control arm
- Completed By: Walter, Philip (0081)
- Shop Supplies/Enviro Charges

\$3.14 \$3.14

Misc \$3.14 Labour \$143.00 Parts \$286.29 Prepaid Parts Amt: \$0.00 Case Total: \$432.43

Case: 9 Wheel Alignment - 4 Wheel

- Center strg wheel
- Inspect steering components
- Castor / Camber adjustment
- Toe in adjustment
- Wheel alignment

Quantity Description/Correction

Price	Total
\$155.00	\$155.00

- Tech Cause: Wheel align
- Tech Comments: Completed wheel alignment
- Completed By: Walter, Philip (0081)

Misc \$0.00 Labour \$155.00 Parts \$0.00 Prepaid Parts Amt: \$0.00 Case Total: \$155.00

Case: 10 Added Operation: Replace leaking left front axle seal - Tech Cause: LF axle seal is leaking - Tech Comments: Installed new LF axle seal,oil level in diff is good

Quantity Description/Correction

1.00 23196678 - Seal

Retail	Price	Total
\$134.07	\$134.07	\$134.07
	\$143.00	\$143.00

- Tech Cause: LF axle seal is leaking
- Tech Comments: Installed new LF axle seal,oil level in diff is good
- Completed By: Walter, Philip (0081)
- Shop Supplies/Enviro Charges

\$3.14 \$3.14

Misc \$3.14 Labour \$143.00 Parts \$134.07 Prepaid Parts Amt: \$0.00 Case Total: \$280.21



Weidners
LACOMBE

CHEVROLET
 CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
 Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#148242

DB Bobcat Services Ltd

November 23, 2023

Svc. Adv Boyd, Ron

Cust. Ph. (403) 782-3437

Tag# RON

Page 5 of 6

11/30/2023 09:21:15

Case: 11 Added Operation: Replace front brake pads and service Calipers - Tech Cause: Front brakes - Tech Comments: Installed new front pads and serviced calipers

Quantity	Description/Correction	Retail	Price	Total					
1.00	19428008 - Pad kit	\$202.18	\$202.18	\$202.18					
			\$257.40	\$257.40					
	• Tech Cause: Front brakes								
	• Tech Comments: Installed new front pads and serviced calipers								
	• Completed By: Walter, Philip (0081)								
	• Shop Supplies/Enviro Charges		\$5.66	\$5.66					
Misc	\$5.66	Labour	\$257.40	Parts	\$202.18	Prepaid Parts Amt:	\$0.00	Case Total:	\$465.24

Case: 12 Added Operation: Repair leaking oil pan - Tech Cause: Engine oil pan leaking oil. - Tech Comments: Removed engine oil pan, cleaned reinstalled using new gaskets new oil filter and new 5-30 dexos

Quantity	Description/Correction	Retail	Price	Total					
1.00	12612350 - Gasket	\$98.35	\$98.35	\$98.35					
1.00	PF63 - Oil Filter	\$9.00	\$9.00	\$9.00					
6.00	19432455 - OIL,ENG DEXOS1 GEN3 FULL SYN 5W30 ACDELCO	\$7.05	\$7.05	\$42.30					
1.00	15203889 - Gasket	\$14.36	\$14.36	\$14.36					
			\$686.40	\$686.40					
	• Tech Cause: Engine oil pan leaking oil.								
	• Tech Comments: Removed engine oil pan, cleaned reinstalled using new gaskets new oil filter and new 5-30 dexos								
	• Completed By: Walter, Philip (0081)								
	• Environmental Fee		\$0.50	\$0.50					
	• Environmental Fee		\$0.30	\$0.30					
	• Shop Supplies/Enviro Charges		\$15.08	\$15.08					
Misc	\$15.88	Labour	\$686.40	Parts	\$164.01	Prepaid Parts Amt:	\$0.00	Case Total:	\$866.29

\$0.00



Weidners



LACOMBE

CHEVROLET

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3

Bus: 403.782.3626 • Fax: 403.782.7040

email@weidnerchevrolet.ca • www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#148242

DB Bobcat Services Ltd

November 23, 2023

Svc.Adv Boyd, Ron

Cust.Ph. (403) 782-3437

Tag# RON

Page 6 of 6

11/30/2023 09:21:15

O U T	<small>Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order.</small>		Currency:	Labour:	\$2,203.35
	<small>Privacy - Personal information is collected in accordance with applicable privacy legislation and is governed by Weidner Motors Ltd.'s Privacy Policy.</small>		Payment Ref:	Parts:	\$1,926.23
	<small>General Motors Parts carry a 1YR PARTS AND LABOR WARRANTY. Non-G.M. Parts carry a PARTS ONLY WARRANTY. Please ask your parts or service representative for more information.</small>		Expiry Date:	Misc:	\$45.01
			P/O#: PT-29	Sub Total:	\$4,174.59
		G/HST Reg # 105611867RT001	G/HST:	\$208.73	
			PST:	\$0.00	
			Tax Adjustment:	\$0.00	
11/30/2023					
Date	Signature	Payment Type	Total:	\$4,383.32	

Weidner's

CHEVROLET

Date: 11/23/2023

RO# : 148242

Customer Name: DB Bobcat Services Ltd

SERVICE DEPARTMENT

(403) 782-3626

BRAKES		Pass	Fail	N/A
Left Front	5 mm	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Left Rear	4 mm	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Right Front	10 mm	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Right Rear	10 mm	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Hoses - Front		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Hoses - Rear		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Rotors - Front		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Rotors/Drums - Rear		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Calipers - Front		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Calipers - Rear		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Wheel Cylinders		<input type="radio"/>	<input type="radio"/>	<input checked="" type="radio"/>
Master Cylinder		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Emergency Brake		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>

TIRES		Pass	Fail	N/A
Left Front	11/32	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Left Rear	12/32	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Right Front	11/32	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Right Rear	12/32	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Pressure	60 f 75 r psi	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>

LIGHTS		Pass	Fail	N/A
Headlamps		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Daytime Running Lamps		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Hazard Lamps		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Park Lamps		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Brake Lights		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Signal Lights		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Reverse Lights		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
License Plate Lights		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Marker Lights		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Interior Lights		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>

FILTERS		Pass	Fail	N/A
Air Filter		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Cabin Filter		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>

RECALL CHECK Outstanding Completed

		Pass	Fail	N/A
Dash Warning Lights On		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>

EXHAUST SYSTEM		Pass	Fail	N/A
Exhaust Pipes		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Muffler		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Tailpipe		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Manifolds		<input type="radio"/>	<input checked="" type="radio"/>	<input type="radio"/>
Hangers		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>

FLUID LEVELS AND CONDITIONS		Pass	Fail	N/A
Transmission		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Front Differential		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Rear Differential		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Transfer Case		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Coolant	-40 C	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Brake Fluid		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Clutch Fluid		<input type="radio"/>	<input type="radio"/>	<input checked="" type="radio"/>
Power Steering		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>

LEAKS		Pass	Fail	N/A
Transmission		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Engine		<input type="radio"/>	<input checked="" type="radio"/>	<input type="radio"/>
Front Differential		<input type="radio"/>	<input checked="" type="radio"/>	<input type="radio"/>
Rear Differential		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Transfer Case		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Power Steering		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>

MISCELLANEOUS		Pass	Fail	N/A
Drive Belt		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
A/C Belt		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Windshield Glass		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Windshield Wipers/Washers		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Rear Wiper Operation		<input type="radio"/>	<input type="radio"/>	<input checked="" type="radio"/>
Horn		<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>

TECHNICIAN COMMENTS

Batter 12.74 volts 760 cca

CERTIFIED SERVICE REPORT

Name: DB Bobcat Services Ltd Date: 11/23/2023 Repair Order #: 148242
 Year: 2011 Make: GMC Odometer: 308005
 Service Consultant: Boyd, Ron Technician: _____

C = Checked and Okay F = Future Attention Required I = Immediate Maintenance/Repair Required

Lube, Oil & Filter Service with 15 Point Inspection

Lube, Oil and Filter

- Replace Filter with GM-approved oil filter Completed
- Drain oil and replace with up to 5L premium GM oil Completed
- Lubrication chassis, suspension and steering components Completed
- Reset oil life monitor Not Applicable Completed

15 Point Inspection

- All lights (Including signals) C F I
- Air filter C F I
- Coolant Strength -50 C F
- Hoses C F I
- Drive belts C F I
- Battery (cables & clamps) C F I
- Wiper blades C F I
- Brake fluid C F I
- Windshield washer fluid Okay
- Power steering fluid Okay
- Differential fluid (RWD) Okay
- Transfer case fluid (4WD/AWD) Okay
- Transmission/Transaxle fluid Okay
- Tire pressure Okay

- Tire wear and tread depth
- | | |
|--|--|
| <u>9/32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I | <u>9/32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <u>10/32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I | <u>10/32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I |




Next Visit

Date: _____ Time: _____

Service(s) required:

Additional Regular Maintenance Services

- | | |
|---|---|
| <ul style="list-style-type: none"> <input type="checkbox"/> Tire Rotation <input type="checkbox"/> Alignment Service <input type="checkbox"/> Tune-Up - Emission Control Service <input type="checkbox"/> Cooling System Service <input type="checkbox"/> Automatic Transmission/Transaxle Service <input type="checkbox"/> Cabin Air Filter Service <input type="checkbox"/> Suspension System Inspection <input type="checkbox"/> Alignment Inspection <input type="checkbox"/> Exhaust System Inspection <input checked="" type="checkbox"/> Battery Test <input type="checkbox"/> Other: _____ | <ul style="list-style-type: none"> <input type="checkbox"/> Completed <input type="checkbox"/> Completed <input type="checkbox"/> Completed <input type="checkbox"/> Completed <input type="checkbox"/> Completed <input type="checkbox"/> Completed <input type="checkbox"/> Completed <input type="checkbox"/> Completed <input type="checkbox"/> Completed <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
|---|---|
- Brake Inspection
- | | |
|--|--|
| _____ mm <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I | _____ mm <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| _____ mm <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I | _____ mm <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |



Comments:



Fix Auto Lacombe

5511 Wolf Creek Drive
Lacombe, Alberta T4L 2H8
Canada

INVOICE

Invoice No.: 18528
Date: 04/21/2023
Ship Date:
Page: 1
Re: Order No.


DIRECT
DEPOSIT

Sold to:

DB Bobcat
5913 Len Thompson Drive
Lacombe, Alberta T4L 0E8

Ship to:

DB Bobcat
2011 GMC Sierra 2500
Unit: PT - 29

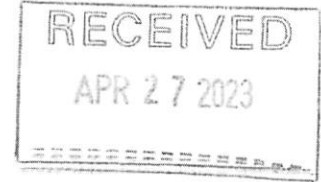

COPY
File

Business No.: 780182499

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
4200	Each		Repairs as per attached repair estimate	G		5,579.80
			Subtotal:			5,579.80
			G - GST 5%			
			GST/HST			278.99

Fix Auto Lacombe GST/HST: #780182499

Shipped By: Tracking Number:

Comment: Thank you for your business

Sold By:

Total Amount	5,858.79
Amount Paid	0.00
Amount Owing	5,858.79

FIX AUTO LACOMBE
5511 WOLF CREEK DR
LACOMBE, AB T4L 2H8
PHONE: (403) 782-1666 FAX: (403) 782-1676
EMAIL: lacombe@fixauto.com

*** PRELIMINARY ESTIMATE ***

27/03/2023 04:24 PM

Owner

Owner: DB Bobcat Services Ltd.

Inspection

Inspection Date: 27/03/2023 04:25 PM

Inspection Type:

Company: Fix Auto Lacombe
Contact: Jerry Pala
Address: 5511 Wolf Creek Drive
City Province Postal: Lacombe, AB T4L 2H8
Email: lacombe@fixauto.com

Appraiser License # :

Work/Day: (403)782-1666
FAX: (403)782-1676

Repairer

Repairer: Fix Auto Lacombe
Address: 5511 Wolf Creek Drive
City Province Postal: Lacombe, AB T4L 2H8
Email: lacombe@fixauto.com

Contact: Jiri Pala
Work/Day: (885)782-1666
Work/Day: (403)782-1666
FAX: (403)782-1676

Target Complete Date/Time:

Days To Repair: 12

Vehicle

2011 GMC Sierra K2500 HD SLE 4 DR Crew Cab Short Bed
8cyl Gasoline 6.0
6-Speed Automatic

Lic Expire:
Veh Insp# :
Condition:
Ext. Refinish: Two-Stage

VIN: 1GT12ZCG5BBF15760
Kilometer Type: Actual
Code: U8775E
Int. Refinish:

Options

4-Wheel Drive
Alarm System
Auto Headlamp Control
Cruise Control
Electronic Transfer Case
Full Size Spare Tire
Heavy Duty Battery
Intermittent Wipers
MP3 Decoder
Power Door Locks
Split Folding Rear Seat
Tachometer

AM/FM CD Player
Aluminum/Alloy Wheels
Auto Locking Hubs (4WD)
Daytime Running Lights
Emergency S.O.S. System
Halogen Headlights
Heavy Duty Suspension
Keyless Entry System
Overhead Console
Power Steering
Split Front Bench Seat
Theft Deterrent System

Air Conditioning
Anti-Lock Brakes
Center Console
Dual Airbags
Floor Mats
Heated Power Mirrors
Illuminated Visor Mirror
Lighted Entry System
Power Brakes
Power Windows
Stability Cntrl Suspensn
Tilt Steering Wheel

		Replace Hrs			
Sheet Metal (SM)	\$80.00	6.4	15.0	21.4	\$1,712.00
Mech/Elec (ME)	\$100.00				
Frame (FR)	\$90.00				
Refinish (RF)	\$80.00	17.2		17.2	\$1,376.00
Labour Total				38.6 Hours	
Sublet Repairs					\$5.00
Goods & Services Tax		@ 5.000%			\$278.99
Gross Total					\$5,858.79
Net Total					\$5,858.79


Alternate Parts Y/01/00/00/01/00 Cumulative 01/00/00/01/00 Postal Code: T4L Default
 Rate Name Default

Audatex Estimating 10.21.118 ES 27/03/2023 04:44 PM REL 10.21.118 DT 01/03/2023 DB 15/03/2023
 Province Disclosure:AB
 © 2023 Audatex North America, Inc.

**2.5 HRS WERE ADDED TO THIS ESTIMATE BASED ON AUDATEX'S TWO-STAGE REFINISH FORMULA.
 ESTIMATE CALCULATED USING THE 2.5 HOUR MAXIMUM ALLOWANCE FOR TWO-STAGE REFINISH OF NON-FLEX, EXTERIOR SURFACES.**

Op Codes

* = User-Entered Value	E = Replace OEM	NG = Replace NAGS
EC = Replace Economy	OE = Replace PXN OE Srpls	UE = Replace OE Surplus
ET = Partial Replace Labour	EP = Replace PXN	EU = Replace Recycled
TE = Partial Replace Price	PM = Replace PXN Reman/Rebit	UM = Replace Reman/Rebuilt
L = Refinish	PC = Replace PXN Reconditioned	UC = Replace Reconditioned
TT = Two-Tone	SB = Sublet Repair	N = Additional Labour
BR = Blend Refinish	I = Repair	IT = Partial Repair
CG = Chipguard	RI = R & I Assembly	P = Check
AA = Appearance Allowance	RP = Related Prior Damage	

	Audatex	<p>This report contains proprietary information of Audatex and may not be disclosed to any third party (other than the insured, claimant and others on a need to know basis in order to effectuate the claims process) without Audatex's prior written consent.</p> <p>© 2023 Audatex North America, Inc. AUDATEX is a trademark owned by Audatex North America, Inc. All rights reserved.</p>
---	----------------	---

CERTIFIED SERVICE REPORT

Name: DB Bobcat Services Ltd Date: 08/18/2023 Repair Order #: 146753
 Year: 2011 Make: GMC Odometer: 294889
 Service Consultant: Mundorf, Lindsay Technician: _____


C = Checked and Okay F = Future Attention Required I = Immediate Maintenance/Repair Required

Lube, Oil & Filter Service with 15 Point Inspection


- Lube, Oil and Filter**
- Replace Filter with GM-approved oil filter Completed
 - Drain oil and replace with up to 5L premium GM oil Completed
 - Lubrication chassis, suspension and steering components Completed
 - Reset oil life monitor Not Applicable Completed

- 15 Point Inspection**
- All lights (Including signals) C F I
 - Air filter C F I
 - Coolant Strength -50 C F I
 - Hoses C F I
 - Drive belts C F I
 - Battery (cables & clamps) C F I
 - Wiper blades C F I
 - Brake fluid C F I
 - Windshield washer fluid Okay
 - Power steering fluid Okay
 - Differential fluid (RWD) Okay
 - Transfer case fluid (4WD/AWD) Okay
 - Transmission/Transaxle fluid Okay
 - Tire pressure Okay

Tire wear and tread depth

<u>11 /32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I		<u>11 /32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I
<u>15 /32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I		<u>15 /32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I

Additional Regular Maintenance Services

- | | |
|---|--|
| <input type="checkbox"/> Tire Rotation | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Alignment Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Tune-Up - Emission Control Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Cooling System Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Automatic Transmission/Transaxle Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Cabin Air Filter Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Suspension System Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Alignment Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Exhaust System Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input checked="" type="checkbox"/> Battery Test | <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Other: _____ | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
- Brake Inspection
- | | | |
|---|---|---|
| <u>8 mm</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I |  | <u>8 mm</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <u>10 mm</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I | | <u>10 mm</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I |

Comments:

Next Visit

Date: _____ Time: _____

Service(s) required:



Weidner
Motors Limited

CHEVROLET
LACOMBE CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL
Work Order
#142591
DB Bobcat Services Ltd
November 14, 2022
Svc. Adv Miller, Douglas
Cust.Ph. (403) 782-3437
Tag# DOUG
Page 1 of 4
12/07/2022 14:54:45

To: DB Bobcat Services Ltd		Year: 2011 Veh Id: 27258 Unit#: PT-29
5913 Len Thompson Dr.		Make: GMC License #: BMG0378
Lacombe AB		Model: SIERRA CREW CAB 2500 4 Odo. In: 275,947
T4L 0E8		Colour: White Odo. Out:
		V.I.N.#: 1GT12ZCG5BF157602 Next Service:
		Date In: 11/14/2022 In Service Date: 02/04/2011
		Out: 12/06/2022 Cases: 8
		Ext. War - - (mo/) - D: \$0.00
		Promised Time: 00/00/0000 00:00:00 AM Call When Ready:

Case: 1 Check and advise for a driveline vibration on right hand side In 2wd gets better when In 4wd

Quantity	Description/Correction	Price	Total
	<ul style="list-style-type: none"> Tech Cause: Roadtested truck. The tires are cupped and making noise. Rotated tires, thread depth now LF 2/32, RF 3/32, LR 7/32, RR 6/32. Brakes front 6mm, rear right 3mm, left 6mm Checked front end and did not find any loose parts. The front and rear shocks bounce lots. Steering wheel is off center. Roadtested truck and noise is from rear now. 	\$135.00	\$135.00
	<ul style="list-style-type: none"> Tech Comments: Needs front and rear shocks, rear brakes and calipers, tires and wheel alignment. Completed By: Luebke, Erich (0040) Shop Supplies/Enviro Charges 	\$8.06	\$8.06
Misc	\$8.06	Labour \$135.00	Parts \$0.00
		Prepaid Parts Amt: \$0.00	Case Total: \$143.06

Case: 2 Added Operation: Replace front shocks - Tech Cause: Installed new front shocks.
The lower shock bushing in the LF lower control arm is worn out, insert comes out. - Tech Comments: Installed new front shocks.

Quantity	Description/Correction	Retail	Price	Total
2.00	20908414 - Absorber	\$228.63	\$135.00	\$457.26
	<ul style="list-style-type: none"> Tech Cause: Installed new front shocks. The lower shock bushing in the LF lower control arm is worn out, insert comes out. Tech Comments: Installed new front shocks. Completed By: Luebke, Erich (0040) Shop Supplies/Enviro Charges 	\$8.06	\$8.06	
Misc	\$8.06	Labour \$135.00	Parts \$457.26	Prepaid Parts Amt: \$0.00
		Case Total: \$600.32		



Weidner
Motors Limited

CHEVROLET
LACOMBE CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL
Work Order
#142591
DB Bobcat Services Ltd
November 14, 2022
Svc. Adv Miller, Douglas
Cust.Ph. (403) 782-3437
Tag# DOUG
Page 2 of 4
12/07/2022 14:54:46

Case: 3 Added Operation: Replace rear shocks - Tech Cause: Installed new rear shocks. - Tech Comments: Installed new rear shocks.

Quantity	Description/Correction	Retail	Price	Total
2.00	20906289 - Shocks	\$210.66	\$210.66	\$421.32
	<ul style="list-style-type: none"> Tech Cause: Installed new rear shocks. Tech Comments: Installed new rear shocks. Completed By: Luebke, Erich (0040) Shop Supplies/Enviro Charges 	\$6.45	\$6.45	
Misc	\$6.45	Labour \$108.00	Parts \$421.32	Prepaid Parts Amt: \$0.00
		Case Total: \$535.77		

Case: 4 Added Operation: Install right rear caliper and left and rear pads - Tech Cause: Installed rebuilt RR caliper.
Installed new rear brake pads, both sides.
Bled brakes. - Tech Comments: Installed rebuilt RR caliper and new rear brake pads.

Quantity	Description/Correction	Retail	Price	Total
1.00	19310569 - Caliper	\$173.32	\$173.32	\$173.32
1.00	19428008 - Pad kit	\$192.55	\$192.55	\$192.55
1.00	19353127 - Fluid	\$9.25	\$9.25	\$9.25
2.00	21012386 - Washer	\$1.40	\$1.40	\$2.80
	<ul style="list-style-type: none"> Tech Cause: Installed rebuilt RR caliper. Installed new rear brake pads, both sides. Bled brakes. Tech Comments: Installed rebuilt RR caliper and new rear brake pads. Completed By: Luebke, Erich (0040) Core Charges - 19310569 Core Return - 19310569COR Shop Supplies/Enviro Charges 	\$90.00	\$90.00	
		(\$90.00)	(\$90.00)	
		\$14.50	\$14.50	
Misc	\$14.50	Labour \$243.00	Parts \$377.92	Prepaid Parts Amt: \$0.00
		Case Total: \$635.42		

Case: 5 Wheel Alignment - 4 Wheel

Quantity	Description/Correction	Price	Total
	<ul style="list-style-type: none"> Center strg wheel Inspect steering components Castor / Camber adjustment Toe in adjustment Wheel alignment 	\$155.00	\$155.00
	<ul style="list-style-type: none"> Tech Cause: Checked wheel alignment. Adjusted front camber and caster. Adjusted front toe. Tech Comments: Completed wheel alignment. 		



Weidner
Motors Limited

CHEVROLET



LACOMBE

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB - T4L 1A3
Bus: 403.782.3626 - Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order
#142591
DB Bobcat Services Ltd
November 14, 2022
Svc. Adv Miller, Douglas
Cust.Ph. (403) 782-3437
Tag# DOUG
Page 3 of 4
12/07/2022 14:54:46

- Completed By: Luebke, Erich (0040)

Misc \$0.00 Labour \$155.00 Parts \$0.00 Prepaid Parts Amt: \$0.00 Case Total: \$155.00

Case: 6 Added Operation: Replace left front lower shock bushing - Tech Cause: LF lower shock bushing in control arm is loose.
Installed new bushong. - Tech Comments: Installed new LF lower shock bushing in lower control arm.

Quantity	Description/Correction	Retail	Price	Total
1.00	25803377 - INSULATOR ASM-FRT SIABS LWR	\$31.37	\$31.37	\$31.37
			\$108.00	\$108.00

- Tech Cause: LF lower shock bushing in control arm is loose.
- Installed new bushong.
- Tech Comments: Installed new LF lower shock bushing in lower control arm.
- Completed By: Luebke, Erich (0040)
- Shop Supplies/Enviro Charges

Misc \$6.45 Labour \$108.00 Parts \$31.37 Prepaid Parts Amt: \$0.00 Case Total: \$145.82

Case: 7 Lube, Oil, Filter - DEXOS Synthetic MPVI

- Top up all Fluid levels.
- Reset oil life reminder
- Air Filter Inspection
- Cabin Air Filter Inspection
- Multi Point Vehicle Inspection MPVI
- Antifreeze Protection Test

Quantity	Description/Correction	Retail	Price	Total
1.00	PF48 - Oil Filter	\$9.00	\$0.00	\$0.00
6.00	19432455 - OIL_ENG DEXOS1 GEN3 FULL SYN 5W30 ACDEL	\$7.05	\$0.00	\$0.00
			\$76.30	\$76.30

- Tech Cause: The air cleaner lid screws are stripped.
- Transference oil is dark colored, should have service.
- Battery 12.64 volts 737 cca.
- LF low beam headlamp inop.
- Left licence plate lamp inop.
- Tech Comments: Completed Lube, Oil, Filter.
- Completed By: Luebke, Erich (0040)
- Environmental Fee (Extra Item)
- Environmental Fee (Extra Item)
- Shop Supplies/Enviro Charges (Extra Item)

Misc \$2.29 Labour \$25.00 Parts \$51.30 Prepaid Parts Amt: \$0.00 Case Total: \$78.59



Weidner
Motors Limited

CHEVROLET



LACOMBE

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB - T4L 1A3
Bus: 403.782.3626 - Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order
#142591
DB Bobcat Services Ltd
November 14, 2022
Svc. Adv Miller, Douglas
Cust.Ph. (403) 782-3437
Tag# DOUG
Page 4 of 4
12/07/2022 14:54:46

Case: 8 Added Operation: Replace exterior bulbs as required - Tech Cause: Installed new LF low beam headlamp bulb.
Installed new LR licence plate lamp bulb.
Both work now. - Tech Comments: Installed new LF low beam headlamp bulb and left licence plate lamp bulb.

Quantity	Description/Correction	Retail	Price	Total
1.00	13503417 - Bulb	\$20.40	\$20.40	\$20.40
1.00	13503401 - Bulb	\$3.44	\$3.44	\$3.44
			\$33.75	\$33.75

- Tech Cause: Installed new LF low beam headlamp bulb.
- Installed new LR licence plate lamp bulb.
- Both work now.
- Tech Comments: Installed new LF low beam headlamp bulb and left licence plate lamp bulb.
- Completed By: Luebke, Erich (0040)

Misc \$0.00 Labour \$33.75 Parts \$23.84 Prepaid Parts Amt: \$0.00 Case Total: \$57.59

\$0.00

Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repair, parts & accessories described in this work order.		Currency	Labour:	\$942.75
Privacy - Personal information is collected in accordance with applicable privacy legislation and is governed by Weidner Motors Ltd's Privacy Policy.		Payment Ref:	Parts:	\$1,363.81
General Motors Parts carry a 1YR PARTS AND LABOR WARRANTY. Non-GM Parts carry a PARTS ONLY WARRANTY. Please ask your parts or service representative for more information.		Expiry Date:	Misc:	\$45.01
U		P/O#: PT-29	Sub Total:	\$2,351.57
T		GHST Reg # 105611867RT001	GHST:	\$117.57
			PST:	\$0.00
			Tax Adjustment:	\$0.00
12/06/2022	Signature	Payment Type	Total:	\$2,469.14


CERTIFIED SERVICE REPORT

Name: DB Bobcat Services Ltd Date: 11/14/2022 Repair Order #: 142591
 Year: 2011 Make: GMC Odometer: 275947
 Service Consultant: Miller, Douglas Technician: _____

C = Checked and Okay F = Future Attention Required I = Immediate Maintenance/Repair Required

Lube, Oil & Filter Service with 15 Point Inspection

- Lube, Oil and Filter**
- Replace Filter with GM-approved oil filter Completed
 - Drain oil and replace with up to 5L premium GM oil Completed
 - Lubrication chassis, suspension and steering components Completed
 - Reset oil life monitor Not Applicable Completed
- 15 Point Inspection**
- All lights (Including signals) C F I
 - Air filter C F I
 - Coolant Strength _____ C F I
 - Hoses C F I
 - Drive belts C F I
 - Battery (cables & clamps) C F I
 - Wiper blades C F I
 - Brake fluid C F I
 - Windshield washer fluid Okay
 - Power steering fluid Okay
 - Differential fluid (RWD) Okay
 - Transfer case fluid (4WD/AWD) Okay
 - Transmission/Transaxle fluid Okay
 - Tire pressure Okay
 - Tire wear and tread depth



_____ 17/32" C F I _____ 17/32" C F I
 _____ 17/32" C F I _____ 17/32" C F I

Next Visit

Date: _____ Time: _____

Service(s) required:

Additional Regular Maintenance Services

- | | |
|---|---|
| <input type="checkbox"/> Tire Rotation | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Alignment Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Tune-Up - Emission Control Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Cooling System Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Automatic Transmission/Transaxle Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Cabin Air Filter Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Suspension System Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Alignment Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Exhaust System Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Battery Test | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Other: _____ | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
- Brake Inspection
- _____ mm C F I _____ mm C F I
 _____ mm C F I _____ mm C F I



Comments:

Battery 12.64 volts 737 cca.



CHEVROLET



LACOMBE

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#141592

DB Bobcat Services Ltd

September 07, 2022

Svc. Adv Boyd, Ron

Cust. Ph. (403) 782-3437

Tag# RON

Page 1 of 2

09/08/2022 11:01:24

To: DB Bobcat Services Ltd

5913 Len Thompson Dr.

Lacombe

AB

T4L 0E8

RECEIVED
SEP 08 2022

Year: 2011 Veh Id: 27258 Unit #: PT-29

Make: GMC

License #: BMG0378

Model: SIERRA CREW CAB 2500 4'

Odo. In: 266,122

Colour: White

Odo. Out:

V.I.N.#: 1GT12ZCG5BF157602

Next Service:

Date In: 09/07/2022

In Service Date: 02/04/2011

Out: 09/08/2022

Cases: 3

Ext. War - - (mo/) - D: \$0.00

Promised Time: 09/07/2022 11:15:00 AM Call When Ready:

Case: 1 Lube, Oil, Filter - DEXOS Synthetic MPVI

- Top up all Fluid levels.
- Reset oil life reminder
- Air Filter Inspection
- Cabin Air Filter Inspection
- Multi Point Vehicle Inspection MPVI
- Antifreeze Protection Test

COPY

DIRECT DEPOSIT

Quantity Description/Correction

Quantity	Description/Correction	Retail	Price	Total
1.00	PF48 - Oil Filter	\$9.00	\$0.00	\$0.00
6.00	19420161 - Oil Dexos 1 Gen 2 5w30	\$6.65	\$0.00	\$0.00

Retail	Price	Total
	\$73.90	\$73.90

- Tech Cause: lof
- Tech Comments: Changed engine oil and filter, Checked air filters lights and fluid levels, Coolant is rated for -50 C, Front tire treads are 6/32, rears are 5/32, completed inspection, Oil life was at 0% before reset, transercase front out put seal leak, transercase fluid is dark
- Completed By: Jones, Cole (0044)
- Environmental Fee (Extra Item) \$0.50 \$0.50
- Environmental Fee (Extra Item) \$0.30 \$0.30
- Shop Supplies/Enviro Charges (Extra Item) \$3.00 \$3.00

Misc \$3.80 Labour \$25.00 Parts \$48.90 Prepaid Parts Amt: \$0.00 Case Total: \$77.70

Case: 2 RF seat belt will not latch. Inspect for cause & advise

Quantity Description/Correction

Quantity	Description/Correction	Retail	Price	Total
1.00	19121537 - BELT KIT	\$248.11	\$248.11	\$248.11

Retail	Price	Total
	\$94.50	\$94.50

- Tech Cause: needs drivers seat belt buckle
- Tech Comments: Installed new drivers seat belt buckle works good now
- Completed By: Walter, Philip (0081)
- Shop Supplies/Enviro Charges \$11.34 \$11.34

Misc \$11.34 Labour \$94.50 Parts \$248.11 Prepaid Parts Amt: \$0.00 Case Total: \$353.95



Weidner Motors Limited

LACOMBE

CHEVROLET
CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL
Work Order
#141592
DB Bobcat Services Ltd
September 07, 2022
Svc. Adv Boyd, Ron
Cust.Ph. (403) 782-3437
Tag# RON

Page 2 of 2
09/08/2022 11:01:25

Case: 3 Added Operation: Replace transfer case output seal - Tech Cause: Front tc case output seal is leaking oil - Tech Comments: Installed new front tc case output seal, add 1 liter ATF to tc case

Quantity	Description/Correction	Retail	Price	Total					
1.00	84644580 - Seal Transfer Case	\$98.44	\$98.44	\$98.44					
1.00	19420141 - FLUID, A/TRANS DEXRON VI ACDELCO BULK	\$7.95	\$7.95	\$7.95					
			\$135.00	\$135.00					
	• Tech Cause: Front tc case output seal is leaking oil								
	• Tech Comments: Installed new front tc case output seal, add 1 liter ATF to tc case								
	• Completed By: Walter, Philip (0081)								
	• Environmental Fee		\$0.05	\$0.05					
	• Shop Supplies/Enviro Charges		\$16.20	\$16.20					
Misc	\$16.25	Labour	\$135.00	Parts	\$106.39	Prepaid Parts Amt:	\$0.00	Case Total:	\$257.64
									\$0.00

O U T	Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order.		Currency:	Labour:	\$254.50
	Privacy - Personal information is collected in accordance with applicable privacy legislation and is governed by Weidner Motors Ltd.'s Privacy Policy.		Payment Ref:	Parts:	\$404.25
	General Motors Parts carry a 1YR PARTS AND LABOR WARRANTY. Non-G.M. Parts carry a PARTS ONLY WARRANTY. Please ask your parts or service representative for more information.		Expiry Date:	Misc:	\$30.54
			P/O#: PT-29	Sub Total:	\$689.29
		G/HST Reg # 105611867RT001	G/HST:	\$34.48	
			PST:	\$0.00	
			Tax Adjustment:	\$0.00	
09/08/2022	Signature	Payment Type	Total:	\$723.77	



CHEVROLET



LACOMBE

CHEV TRUCKS

5640. - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#139513

DB Bobcat Services Ltd

April 20, 2022

Svc. Adv Miller, Douglas

Cust.Ph. (403) 782-3437

Tag# DOUG

Page 1 of 2

04/22/2022 16:32:38

To: DB Bobcat Services Ltd 5913 Len Thompson Dr. Lacombe AB T4L 0E8	Year: 2011 Veh Id: 27258 Unit #: PT-29 Make: GMC License #: BMG0378 Model: SIERRA CREW CAB 2500 4' Odo. In: 253,957 Colour: White Odo. Out: V.I.N.#: 1GT12ZCG5BF157602 Next Service: Date In: 04/20/2022 In Service Date: 02/04/2011 Out: 04/22/2022 Cases: 4 Ext. War - - (mo/) - D: \$0.00 Promised Time: 00/00/0000 00:00:00 AM Call When Ready:
--	---

Case: 1 Check serpentine belt and replace pulleys as needed

Quantity	Description/Correction	Retail	Price	Total
1.00	12609719 - Tensioner	\$191.15	\$191.15	\$191.15
1.00	12626222 - Belt	\$92.36	\$92.36	\$92.36
			\$148.50	\$148.50

COPY

- Tech Cause: Found squeal coming from serp belt removed belt found tensioner not moving very well not tightening belt properly
- Tech Comments: Installed new serp belt and tensioner noise gone.
- Completed By: Walter, Philip (0081)
- Shop Supplies/Enviro Charges

Misc	\$9.90	Labour	\$148.50	Parts	\$283.51	Prepaid Parts Amt:	\$0.00	Case Total:	\$441.91
------	--------	--------	----------	-------	----------	--------------------	--------	-------------	----------

Case: 2 Check and advise had to replace fuel pump fuse to get truck to start (fuse had corrosion in it)

Quantity	Description/Correction	Price	Total
		\$0.00	\$0.00

- Tech Cause: Checked for fuel pump fuse blowing no issues found at this time
- Tech Comments: If fuse blows again will have to check wires from underhood fuse block to fuel pump, in main harness.
- Completed By: Walter, Philip (0081)

Misc	\$0.00	Labour	\$0.00	Parts	\$0.00	Prepaid Parts Amt:	\$0.00	Case Total:	\$0.00
------	--------	--------	--------	-------	--------	--------------------	--------	-------------	--------

Case: 3 Added Operation: Replace Drivers lower Hinge - Tech Cause: DRivers lower door hinge is seized roller bent - Tech Comments: Replaced lower drivers door hinge adjust door

Quantity	Description/Correction	Retail	Price	Total
1.00	20969645 - Hinge	\$170.45	\$170.45	\$170.45
			\$135.00	\$135.00

- Tech Cause: DRivers lower door hinge is seized roller bent
- Tech Comments: Replaced lower drivers door hinge adjust door
- Completed By: Walter, Philip (0081)



CHEVROLET

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL
Work Order
#139513
DB Bobcat Services Ltd
April 20, 2022
Svc. Adv Miller, Douglas
Cust.Ph. (403) 782-3437
Tag# DOUG
Page 2 of 2
04/22/2022 16:32:38

• Shop Supplies/Enviro Charges \$9.00 \$9.00

Misc \$9.00 Labour \$135.00 Parts \$170.45 Prepaid Parts Amt: \$0.00 Case Total: \$314.45

Case: 4 Added Operation: Replace broken exhaust manifold bolts Left side - Tech Cause: Exhaust leaking LH side -
Tech Comments: Removed LH exhaust manifold welded and removed 2 broken exhaust bolts, reinstalled
manifold used new gaskets, bolts seal and nuts,

Quantity	Description/Correction	Retail	Price	Total
1.00	12617944 - GASKET	\$33.16	\$33.16	\$33.16
6.00	11546600 - BOLT/SCREW	\$6.23	\$6.23	\$37.38
3.00	15032594 - Nut	\$7.02	\$7.02	\$21.06
1.00	15077362 - Seal	\$24.12	\$24.12	\$24.12
			\$391.50	\$391.50

- Tech Cause: Exhaust leaking LH side
- Tech Comments: Removed LH exhaust manifold welded and removed 2 broken exhaust bolts, reinstalled manifold used new gaskets, bolts seal and nuts,
- Completed By: Walter, Philip (0081)
- Shop Supplies/Enviro Charges \$26.10 \$26.10

Misc \$26.10 Labour \$391.50 Parts \$115.72 Prepaid Parts Amt: \$0.00 Case Total: \$533.32

\$0.00

O U T	Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order.	Currency:	Labour:	\$675.00
	Privacy - Personal information is collected in accordance with applicable privacy legislation and is governed by Weidner Motors Ltd.'s Privacy Policy.	Payment Ref:	Parts:	\$569.68
	General Motors Parts carry a 1YR PARTS AND LABOR WARRANTY. Non-G.M. Parts carry a PARTS ONLY WARRANTY. Please ask your parts or service representative for more information.	Expiry Date:	Misc:	\$45.00
		P/O#: PT-29	Sub Total:	\$1,289.68
	G/HST Reg # 105611867RT001	G/HST:	\$64.50	
		PST:	\$0.00	
		Tax Adjustment:	\$0.00	
04/22/2022	Signature	Payment Type	Total:	\$1,354.18



CHEVROLET



LACOMBE

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#139267

DB Bobcat Services Ltd

April 04, 2022

Svc. Adv Boyd, Ron

Cust.Ph. (403) 782-3437

Tag# RON

Page 1 of 2

04/06/2022 15:26:22

To: DB Bobcat Services Ltd 5913 Len Thompson Dr. Lacombe AB T4L 0E8	Year: 2011 Veh Id: 27258 Unit #: PT-29 Make: GMC License #: BMG0378 Model: SIERRA CREW CAB 2500 4' Odo. In: 253,228 Colour: White Odo. Out: V.I.N.#: 1GT12ZCG5BF157602 Next Service: Date In: 04/04/2022 In Service Date: 02/04/2011 Out: 04/06/2022 Cases: 2 Ext. War - - (mo/) - D: \$0.00 Promised Time: 04/04/2022 04:00:00 PM Call When Ready:
--	---

Case: 1 Lube, Oil Service 0W-20 MPVI

- Reset oil life reminder
- Air Filter Inspection
- Multi Point Vehicle Inspection MPVI
- Top up of all fluid levels
- Cabin filter inspection / serv

COPY

Quantity	Description/Correction	Retail	Price	Total
1.00	PF48 - Oil Filter	\$9.00	\$0.00	\$0.00
6.00	19420161 - Oil Dexos 1 Gen 2 5w30	\$6.65	\$0.00	\$0.00
			\$25.00	\$25.00

- Tech Cause: lof
- Tech Comments: Changed engine oil and filter, Checked air filters lights and fluid levels, Coolant is rated for -38 C, Front tire treads are 7/32, rears are 6/32, completed inspection, Oil life was at 30% before reset, transfer case fluid is dark

• Completed By: Jones, Cole (0044)			
• Environmental Tax (Extra Item)		\$0.50	\$0.50
• Environmental Tax (Extra Item)		\$0.30	\$0.30
• Shop Supplies/Enviro Charges (Extra Item)		\$3.00	\$3.00

Misc \$3.80 Labour \$25.00 Parts \$48.90 Prepaid Parts Amt: \$0.00 **Case Total: \$77.70**

Case: 2 Customer states there is a broken leaf spring - check and report

Quantity	Description/Correction	Retail	Price	Total
2.00	11610960 - Bolt u	\$42.59	\$42.59	\$85.18
1.00	518-00153 - Rear Leaf Spring	\$210.00	\$210.00	\$210.00
4.00	11569655 - NUT-METRIC ALL METAL DIR PREVAIL TORQUE	\$6.63	\$6.63	\$26.52
			\$324.00	\$324.00

- Tech Cause: Left rear leaf spring has broken leaf.
- Tech Comments: Price parts.
- Install used left rear leaf spring.
- Completed By: Olson, Jim (0058)



CHEVROLET
CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB • T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL
Work Order
#139267
DB Bobcat Services Ltd
April 04, 2022
Svc.Adv Boyd, Ron
Cust.Ph. (403) 782-3437
Tag# RON

Page 2 of 2
04/06/2022 15:26:23

• Shop Supplies/Enviro Charges						\$38.88	\$38.88
Misc	\$38.88	Labour	\$324.00	Parts	\$321.70	Prepaid Parts Amt:	\$0.00
						Case Total:	\$684.58
							\$0.00

O U T	Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order.		Currency:	Labour:	\$349.00
	Privacy - Personal information is collected in accordance with applicable privacy legislation and is governed by Weidner Motors Ltd.'s Privacy Policy.		Payment Ref:	Parts:	\$371.40
	General Motors Parts carry a 1YR PARTS AND LABOR WARRANTY. Non-G.M. Parts carry a PARTS ONLY WARRANTY. Please ask your parts or service representative for more information.		Expiry Date:	Misc:	\$41.88
			P/O#: PT-29	Sub Total:	\$762.28
		G/HST Reg # 105611867RT001	G/HST:	\$38.13	
			PST:	\$0.00	
			Tax Adjustment:	\$0.00	
04/06/2022					
Date	Signature	Payment Type	Total:	\$800.41	

CERTIFIED SERVICE REPORT

Name: DB Bobcat Services Ltd Date: 04/04/2022 Repair Order #: 139267
 Year: 2011 Make: GMC Odometer: 253228
 Service Consultant: Boyd, Ron Technician: _____

C = Checked and Okay F = Future Attention Required I = Immediate Maintenance/Repair Required

Lube, Oil & Filter Service with 15 Point Inspection

Lube, Oil and Filter


- Replace Filter with GM-approved oil filter Completed
- Drain oil and replace with up to 5L premium GM oil Completed
- Lubrication chassis, suspension and steering components Completed
- Reset oil life monitor Not Applicable Completed

15 Point Inspection

- All lights (Including signals) C F I
- Air filter C F I
- Coolant Strength _____ C F C F I
- Hoses C F I
- Drive belts C F I
- Battery (cables & clamps) C F I
- Wiper blades C F I
- Brake fluid C F I
- Windshield washer fluid Okay
- Power steering fluid Okay
- Differential fluid (RWD) Okay
- Transfer case fluid (4WD/AWD) Okay
- Transmission/Transaxle fluid Okay
- Tire pressure Okay

Tire wear and tread depth

_____ 7/32" <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I	_____ 7/32" <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I
_____ 6/32" <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I	_____ 6/32" <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I



Additional Regular Maintenance Services

- | | |
|---|--|
| <input type="checkbox"/> Tire Rotation | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Alignment Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Tune-Up - Emission Control Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Cooling System Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Automatic Transmission/Transaxle Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Cabin Air Filter Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Suspension System Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Alignment Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Exhaust System Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input checked="" type="checkbox"/> Battery Test | <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Other: _____ | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
-
- Brake Inspection
- | | | |
|--|--|--|
| _____ mm <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I | | _____ mm <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| _____ mm <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I | | _____ mm <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |

Comments:

Next Visit

Date: _____ Time: _____

Service(s) required:



CHEVROLET



LACOMBE

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB - T4L 1A3
Bus: 403.782.3626 • Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#138435

DB Bobcat Services Ltd

February 02, 2022

Svc. Adv Boyd, Ron

Cust. Ph. (403) 782-3437

Tag# RON

Page 1 of 2

02/02/2022 14:40:53

<p>To: DB Bobcat Services Ltd</p> <p>5913 Len Thompson Dr.</p> <p>Lacombe AB T4L 0E8</p> <p style="font-size: 2em; opacity: 0.5; text-align: center;">COPY</p>	<p>Year: 2011 Veh Id: 27258 Unit #: PT-29</p> <p>Make: GMC License #: BMG0378</p> <p>Model: SIERRA CREW CAB 2500 4' Odo. In: 245,159</p> <p>Colour: White Odo. Out:</p> <p>V.I.N.#: 1GT12ZCG5BF157602 Next Service:</p> <p>Date In: 02/02/2022 In Service Date: 02/04/2011</p> <p>Out: 02/02/2022 Cases: 2</p> <p>Ext. War - - (mo/) - D: \$0.00</p> <p>Promised Time: 02/02/2022 04:00:00 PM Call When Ready:</p>
--	--

Case: 1 Lube, Oil, Filter - DEXOS Synthetic MPVI

- Top up all Fluid levels.
- Reset oil life reminder
- Air Filter Inspection
- Cabin Air Filter Inspection
- Multi Point Vehicle Inspection MPVI
- Antifreeze Protection Test

Quantity	Description/Correction	Retail	Price	Total
1.00	PF48 - Oil Filter	\$9.00	\$0.00	\$0.00
6.00	19420161 - Oil Dexos 1 Gen 2 5w30	\$6.65	\$0.00	\$0.00
			\$73.90	\$73.90

- Tech Cause: lof
- Tech Comments: Chnaged engine oil and filter, Checked air filters lights and fluid levels, Coolant is rated for -38 C, Front tires are 7/32, Rears are 7/32, Completed inspection, Oil life was at 18% before reset
- Completed By: Jones, Cole (0044)
- Environmental Tax (Extra Item) \$0.50 \$0.50
- Environmental Tax (Extra Item) \$0.30 \$0.30
- Shop Supplies/Enviro Charges (Extra Item) \$3.00 \$3.00

Misc \$3.80 Labour \$25.00 Parts \$48.90 Prepaid Parts Amt: \$0.00 Case Total: \$77.70

Case: 2 HVAC fan only works on the highest speeds - Diagnose & advise

Quantity	Description/Correction	Retail	Price	Total
1.00	22803996 - Motor asm	\$253.76	\$253.76	\$253.76
1.00	84178783 - Module	\$155.96	\$155.96	\$155.96
			\$175.50	\$175.50

- Tech Cause: Inspect for blower motor inop, power ground at motor is good, tapping on motor will work but only on high speed, needs motor and resistor
- Tech Comments: Installed new blower motor and new blower resistor, all speeds work now
- Completed By: Walter, Philip (0081)



Weidner Motors Limited



LACOMBE

CHEVROLET

CHEV TRUCKS

5640 - Hwy. 2A, Lacombe, AB - T4L 1A3
Bus: 403.782.3626 - Fax: 403.782.7040
www.weidnerchevrolet.ca

INVOICE ORIGINAL

Work Order

#138435

DB Bobcat Services Ltd

February 02, 2022

Svc. Adv Boyd, Ron

Cust.Ph. (403) 782-3437

Tag# RON

Page 2 of 2

02/02/2022 14:40:53

• Shop Supplies/Enviro Charges

\$21.06 \$21.06

Misc \$21.06 Labour \$175.50 Parts \$409.72 Prepaid Parts Amt: \$0.00 Case Total: \$606.28

\$0.00

Notes

- Driver - Mark 403 348 9702 when ready

O U T	Indebtedness is hereby acknowledged for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order.	Currency:	Labour:	\$200.50
	Privacy - Personal information is collected in accordance with applicable privacy legislation and is governed by Weidner Motors Ltd.'s Privacy Policy.	Payment Ref:	Parts:	\$459.42
	General Motors Parts carry a 1YR PARTS AND LABOR WARRANTY. Non-G.M. Parts carry a PARTS ONLY WARRANTY. Please ask your parts or service representative for more information.	Expiry Date:	Misc:	\$24.06
		P/O#: PT-29	Sub Total:	\$683.98
	G/HST Reg # 105611867RT001	G/HST:	\$34.22	
		PST:	\$0.00	
		Tax Adjustment:	\$0.00	
		POSTED		
02/02/2022		Payment Type	Charge	Total: \$718.20

CERTIFIED SERVICE REPORT

Name: DB Bobcat Services Ltd Date: 02/02/2022 Repair Order #: 138435
 Year: 2011 Make: GMC Odometer: 245159
 Service Consultant: Boyd, Ron Technician: _____

C = Checked and Okay F = Future Attention Required I = Immediate Maintenance/Repair Required


Lube, Oil & Filter Service with 15 Point Inspection

Lube, Oil and Filter

- Replace Filter with GM-approved oil filter Completed
- Drain oil and replace with up to 5L premium GM oil Completed
- Lubrication chassis, suspension and steering components Completed
- Reset oil life monitor Not Applicable Completed

15 Point Inspection

- All lights (Including signals) C F I
- Air filter C F I
- Coolant Strength -38 C F I
- Hoses C F I
- Drive belts C F I
- Battery (cables & clamps) C F I
- Wiper blades C F I
- Brake fluid C F I
- Windshield washer fluid Okay
- Power steering fluid Okay
- Differential fluid (RWD) Okay
- Transfer case fluid (4WD/AWD) Okay
- Transmission/Transaxle fluid Okay
- Tire pressure Okay
- Tire wear and tread depth



7/32" C F I 7/32" C F I
7/32" C F I 7/32" C F I

Next Visit

Date: _____ Time: _____

Service(s) required:

Additional Regular Maintenance Services

- | | |
|---|---|
| <input type="checkbox"/> Tire Rotation | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Alignment Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Tune-Up - Emission Control Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Cooling System Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Automatic Transmission/Transaxle Service | <input type="checkbox"/> Completed |
| <input checked="" type="checkbox"/> Cabin Air Filter Service | <input checked="" type="checkbox"/> Completed |
| <input type="checkbox"/> Suspension System Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Alignment Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Exhaust System Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input checked="" type="checkbox"/> Battery Test | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Other: _____ | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |

Brake Inspection

_____ mm C F I

_____ mm C F I

_____ mm C F I

_____ mm C F I

Comments:



Weidner
Motors Limited



CHEVROLET
CHEV TRUCKS

INVOICE ORIGINAL

Work Order #132970
DB Bobcat Services Ltd
January 13, 2021
Svc. Adv Millior, Douglas
Cust. Ph. (403) 782-3437
Tag# DOUG
Page 3 of 3
01/14/2021 08:10:02

5640 - Hwy. 2A, Lacombe, AB - T4L 1A3
Bus: 403.782.3626 - Fax: 403.782.7040
www.weidnerchevrolet.ca

Case: 5 Tire Rotation / Press Sensors

- Includes Torquing Wheel Studs
- RETORQUE AFTER 100KM / CUSTOMER RESPONSIBLE
- Relearn tire pressure sensors
- Tires - Rotate

Quantity Description/Correction

- Tech Cause: tires
- Tech Comments: rotated tires, treads are now at 12/32nds front and 15/32nds rear, set tire pressures, learned sensors, brakes are at 6mm front and 8mm rear.
- Completed By: Boeltger, A. Andy (0008)

Price	Total
\$46.00	\$46.00

Misc	Labour	Parts	Prepaid Parts Amt:	Case Total:
				\$46.00
				\$0.00

<small>Intelligence is hereby acknowledged for the "Total Charge" being all or the balance owing to repair, parts & accessories ordered in this work order.</small>		<small>Privacy - Personal information is collected in accordance with applicable privacy legislation and is governed by Weidner Motors Ltd.'s Privacy Policy.</small>	<small>General Motors Parts carry a 1YR PARTS AND LABOUR WARRANTY. Non-GM Parts carry a PARTS ONLY WARRANTY. Please ask your parts service representative for more information.</small>
Labour: \$428.75 Parts: \$351.86 Misc: \$43.50 Sub Total: \$824.11 GHST: \$41.21 PST: \$0.00 Tax Adjustment: \$0.00	Payment Ref: Expiry Date: GHST Reg # 105611867RT001	Payment Type Total: \$865.32	Signature Date 01/13/2021

CERTIFIED SERVICE REPORT

Name: DB Bobcat Services Ltd Date: 01/13/2021 Repair Order #: 132970
 Year: 2011 Make: GMC Odometer: 213959
 Service Consultant: Miller, Douglas Technician: _____

C = Checked and Okay F = Future Attention Required I = Immediate Maintenance/Repair Required

Lube, Oil & Filter Service with 15 Point Inspection


Lube, Oil and Filter

- Replace Filter with GM-approved oil filter Completed
- Drain oil and replace with up to 5L premium GM oil Completed
- Lubrication chassis, suspension and steering components Completed
- Reset oil life monitor Not Applicable Completed


15 Point Inspection

- All lights (Including signals) C F I
- Air filter C F I
- Coolant Strength -40 C F C F I
- Hoses C F I
- Drive belts C F I
- Battery (cables & clamps) C F I
- Wiper blades C F I
- Brake fluid C F I
- Windshield washer fluid Okay
- Power steering fluid Okay
- Differential fluid (RWD) Okay
- Transfer case fluid (4WD/AWD) Okay
- Transmission/Transaxle fluid Okay
- Tire pressure Okay

Tire wear and tread depth

<u>12/32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I		<u>12/32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I	<u>15/32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I
<u>15/32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I		<u>15/32"</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I	

Additional Regular Maintenance Services

- | | |
|---|---|
| <input checked="" type="checkbox"/> Tire Rotation | <input checked="" type="checkbox"/> Completed |
| <input type="checkbox"/> Alignment Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Tune-Up - Emission Control Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Cooling System Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Automatic Transmission/Transaxle Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Cabin Air Filter Service | <input type="checkbox"/> Completed |
| <input type="checkbox"/> Suspension System Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Alignment Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Exhaust System Inspection | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Battery Test | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <input type="checkbox"/> Other: _____ | <input type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
-
- Brake Inspection
- | | | |
|--|---|--|
| <u>6 mm</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I |  | <u>6 mm</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I |
| <u>8 mm</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I | | <u>8 mm</u> <input checked="" type="radio"/> C <input type="radio"/> F <input type="radio"/> I |

Comments:

Next Visit

Date: _____ Time: _____

Service(s) required: