



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

DOI-44
NOV

Ship to: JD X9 1100 MACHURA TRD - (820541)

Invoice to: INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch			
ST. PAUL		*REPRINT*	
Date	Time	Page	
02/13/25	23:05:50 (B)	01	
Account No.	Phone No.	Invoice No.	
INTER01A	7808754471	W00606	
Ship Via		Purchase Order	
		Salesperson	
		KK	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XPN0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P

Have you heard about MyDealer yet? We have a great new way to help you stay connected to your equipment. Either mobile or laptop - look up parts, order them online, view past purchases, or book a service appointment, you are in control. Ask a parts or service member about MyDealer today!

SEGMENT# 1 C 9662 10-000-200-1 10/25/24 01/21/25

PLATINUM INSPECTION

27.00 HRS

*PLEASE PREFORM PLATINUM CERTIFICATION USING GREENLIGHT INSPECTION CHECKLIST FROM HORIZON VELOCITY

*TRANSFER GREENLIGHT ESTIMATE CREATOR AND INSPECTION TO SERVICE MANAGER. PLEASE NOTE PRESSURES TAKEN. CONSULT WITH OWNER OF MACHINE

TO WHICH REPAIRS WE RECOMMEND AND WHICH THEY WISH US TO DO. HAVE SEGMENTED WORKORDER CREATED, FOR WORK TO BE DONE. THIS DOES NOT INCLUDE ANY MAJOR CLEANING OR BLOWING OF THE DUST CHAFF OFF.

-ADD ARROWS TO FEEDERHOUSE AND PLATFORM FOR EASE OF ALIGNMENT AND HOOKING UP

*ONCE CHECKLIST IS COMPLETED PLEASE GO OVER WITH SALES FOR APPROVAL OF REPAIRS TO BE DONE.

*CONSULT SALES REGARDING SERVICES THAT HAVE BEEN COMPLETED ON COMBINE (EX. FILTERS, DAMAGED COMPONENTS,)

*CLEANING, PAINTING, AND ANY SERVICES ALL TO BE DONE ON SEPARATE W/O SEGMENTS

*BE SURE TO ATTACH COMPLETE CHECKLIST TO WORK ORDER

-INSTALL A BAG OF THE MOUSE FRAGRANCE TO THE CAB TO DETER RODENT INFESTATION

***** TECHNICIANS COMMENTS *****


*

*

CONTINUED ON PAGE 02

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonaglturf.com

Ship to:

JD X9 1100 MACHURA TRD - (820541)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	02
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via		Purchase Order
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XPN0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P
*Removed all panels from unit. Performed trade inspection. *					
*Installed all belts and tensioned. Performed final runs, *					
*checks, and adjustments. *					
* *					

				LABOR	4860.00
16001001				SEGMENT TOTAL==>	4860.00

SEGMENT# 2 C 9662 10-000-003 10/25/24 01/22/25
TRADE COMBINE- CLEAN AND WASH EXTERIOR TIN WORK ONLY 5.00 HRS
TOUCH UP PAINT ON COMBINE
LUBE ALL CHAINS
GREASE MACHINE ENTIRELY AFTER WASH
PARK IN LINE UP
DETAIL AS NEEDED
***** TECHNICIANS COMMENTS *****
* *
*Cleaned and washed exterior as per instructions. *
* *

SEGMENT# 4 C 9662 NA 01/28/25 02/04/25
DIAGNOSE AND REPAIR ACTIVE HAD 517486 2.50 HRS
***** TECHNICIANS COMMENTS *****
* *
*Cleared codes. Cycled actuator with no bank. Actuator *
functioned and operated normal. Suspected jammed knife bank.
* *

LABOR 180.00
CONTINUED ON PAGE 03

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

Ship to: JD X9 1100 MACHURA TRD - (820541)

Invoice to: INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	03
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via	Purchase Order	
	Salesperson	
	KK	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XPN0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P
	16001001			SEGMENT TOTAL==>	180.00

SEGMENT# 5 C 9662 NA 01/28/25 02/04/25

DIAGNOSE AND REPAIR FRONT RHS CONCAVE POSITION FAULT 2.50 HRS

***** TECHNICIANS COMMENTS *****

*
*Tightened loose concave linkage bolt. Calibrated left
*thresh and right thresh. Calibrations successful. No active
*codes.
*

LABOR 180.00

16001001 SEGMENT TOTAL==> 180.00

SEGMENT# 6 C 9662 NA 01/28/25 02/04/25

DIAGNOSE AND ADVISE OF REPAIRS FOR RETHRESHER VIBRATION 3.00 HRS

***** TECHNICIANS COMMENTS *****


*
*Suspect bad inner rethresher bearing. Removed rethresher
*clutch off shaft. Removed lock collar. Removed bearing.
*Installed new bearing. Installed new lock collar.
*Reinstalled clutch and torqued. Routed rethresher belt.
*Tension rod was broken. Ordered and installed new rod.
*

AXE86017	Bearing With Ho	1 N	251.07	251.07
	Bearing With Housing			
AXE88286	Rod	1 N	117.76	117.76
11M7021	COTTER-5/32 X 1	1	.68	.68
14M7275	NUT-12MM REG	2	1.78	3.56

CONTINUED ON PAGE 04

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,

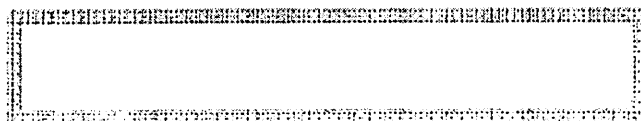

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

Ship to:

JD X9 1100 MACHURA TRD - (820541)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	04
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via		Purchase Order
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XPN0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P
				PARTS	373.07
				LABOR	450.00
	16001001		SEGMENT TOTAL==>		823.07

SEGMENT# 7 C 23001 NA 01/28/25 01/28/25
RETURN AUGER HAS EXCESSIVE RUN OUT 3.00 HRS
DIAGNOSE CAUSE OF EXCESSIVE AUGER RUNOUT

***** TECHNICIANS COMMENTS *****

*
*Check pulley runout and auger runout. Found excessive
*auger runout. Replaced return auger and bearings. Installed
*pulley and belt. Tensioned belt.
*

AXE85994	BRG,W/HSG	1 N	194.69	194.69
	Bearing With Housing			
AXE86013	BRG,W/HSG	1 N	241.28	241.28
	Bearing With Housing			
AXE89574	AUGER, RETURN	1	1364.30	1364.30
H149361	L.NUT FLG.20MM	1	8.15	8.15
	PARTS			1808.42
	LABOR			540.00
	16001001	SEGMENT TOTAL==>		2348.42

SEGMENT# 8 C 23001 NA 01/28/25 01/28/25
CHOPPER HAMMERS AND BUSHINGS DAMAGED /WORN OUT-HAMMERS 3.00 HRS
WERE FLIPPED


***** TECHNICIANS COMMENTS *****

*
*Replaced all chopper hammers and bushings.
*

CONTINUED ON PAGE 05

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,

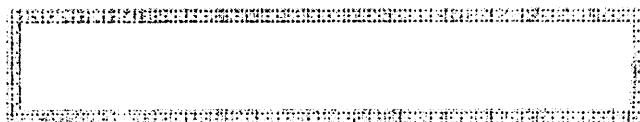

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

Ship to: JD X9 1100 MACHURA TRD - (820541)

Invoice to: INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	05
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via	Purchase Order	
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XPN0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P

HXE15909	Spacer	68	15.84	1077.12	
HXE59496	BUSHING	68	14.26	969.68	
KXE10761	Knife Kit	9	400.98	3608.82	
			PARTS	5655.62	
			LABOR	540.00	
16001001			SEGMENT TOTAL==>	6195.62	

SEGMENT#	9 C 9662 NA	01/28/25 01/28/25		
STATIONARYS WORN			2.00 HRS	
- REPLACE STATIONARY KNIVES				
- REPLACE CENTER HOUSING KNIFE				
***** TECHNICIANS COMMENTS *****				
*Replaced all knives. Noticed some cracked spots on				
*housing. Welded and reinstalled.				

HXE21494	Blade	1 N	120.78	120.78
H215004	CHOPPER KNIFE	61	12.50	762.50
			PARTS	883.28
			LABOR	487.80
16001001			SEGMENT TOTAL==>	1371.08

SEGMENT#	10 C 9662 NA	01/28/25 01/28/25		
FRONT FEED DRUM BADLY DENTED-REPLACE FEED DRUM			4.00 HRS	
***** TECHNICIANS COMMENTS *****				
*Removed feederchain. Feederchain half links were cut				

CONTINUED ON PAGE 06

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

Ship to:

JD X9 1100 MACHURA TRD - (820541)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	06
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via		Purchase Order
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XPN0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P
*apart. Removed midfloor bolts. Slid midfloor ahead. Removed *					
*drum. Installed new bearings and hardware into drum. *					
*Torqued. Installed new drum into midfloor. Torqued side *					
*walls. Repositioned midfloor onto FH. Installed midfloor *					
*bolts and torqued. Reconnected feederchain master links. *					
*Had to replace some damaged links. Torqued masters. *					
*Tensioned chain. Rolled over and verified tension. *					
*Reinstalled front seals and plates. *					

AXE66860	Bearing With Ho	2 M	204.81	409.62	
	Bearing With Housing				
AXE88163	Drum	1 M	2452.16	2452.16	
19M7789	FL/BOLT-M12X30M	8	2.25	18.00	
			PARTS	2879.78	
			LABOR	720.00	
16001001			SEGMENT TOTAL==>	3599.78	

SEGMENT#11 C 23001 NA 01/28/25 01/28/25
FEEDER DRIVE CHAIN WORN PAST MIN SPEC 1.00 HRS
- REPLACE DRIVE CHAIN
- GRIND DOWN CHAIN MOUNTING PLATES

***** TECHNICIANS' COMMENTS *****

* *

*Ground down wear marks. Primed and painted. Installed new *

*chain and tensioned. *

* *


AH220867 HALF LK CA557 1 38.68 38.68

AXE82777 FDR DRIVE CHAIN 1 S 848.63 848.63

CONTINUED ON PAGE 07

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturfltd.com

Ship to:

JD X9 1100 MACHURA TRD - (820541)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	07
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via		Purchase Order
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XPN0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P
				PARTS	887.31
				LABOR	180.00
	16001001		SEGMENT TOTAL==>		1067.31

SEGMENT#12 C 23001 NA	01/28/25 01/28/25	
ROTOR BELT HAS DEEP CRACKS/LUGS TEARING OUT		3.00 HRS
- REPLACE BELT		
- ADJUST SHEAVE GAP		
***** TECHNICIANS COMMENTS *****		
*Replaced belt and adjusted gap.		

HXE107859	ROTOR BELT	1 S 1505.40 1505.40
		PARTS 1505.40
		LABOR 540.00
	16001001	SEGMENT TOTAL==> 2045.40


SEGMENT#13 C 23001 NA	01/28/25 01/28/25	
UNLOAD AUGER PULLEY BUSHING WORN AND SHEAR PIN POUNDED		1.00 HRS
- REPLACE PIN BUSHING AND INSTALL SPARE PIN		
***** TECHNICIANS COMMENTS *****		
*Removed pulley, press bushings out. Clean up all surfaces		
*and install new bushings. Replaced missing shear pin.		

HXE158348	SHEAR BOLT UNL	1 14.06 14.06
HXE161359	Bushing	1 N 156.47 156.47
HXE165783	Bushing	1 N 42.91 42.91

CONTINUED ON PAGE 08

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturfltd.com

Ship to:

JD X9 1100 MACHURA TRD - (820541)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	08
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via		Purchase Order
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XP0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P
				PARTS	213.44
				LABOR	302.40
	16001001		SEGMENT TOTAL==>		515.84

SEGMENT#14 C 9662 NA 01/28/25 02/04/25
DIAGNOSE AND ADVISE LHS SPREADER LOOSE 3.00 HRS
***** TECHNICIANS COMMENTS *****
*
*Removed LHS spinner fin. Cleaned dust and debris. Verified *
*play in gearcase and not loose shaft nut. Leaving at this *
*time. *
*

LABOR 45.00
16001001 SEGMENT TOTAL==> 45.00

SEGMENT#15 C 23001 NA 01/28/25 01/28/25
LOWER HEADER BELT PULLEY SEAL DAMAGED 1.00 HRS
- REPLACE BEARING
***** TECHNICIANS COMMENTS *****
*
*Replaced bearing. *
*


AXE87708 Bearing 1 N 134.55 134.55
PARTS 134.55
LABOR 180.00
16001001 SEGMENT TOTAL==> 314.55

SEGMENT#16 C 9662 NA 01/28/25 02/04/25

CONTINUED ON PAGE 09

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,

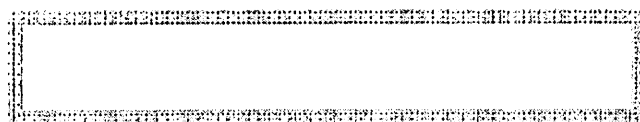

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

Ship to: JD X9 1100 MACHURA TRD - (820541)

Invoice to: INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	09
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via	Purchase Order	
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS
151123A JOHN DEERE X9 1100 694 1H0X911XPN0820541 08/01/24
X9 1100 450 07/31/28 2000 P
TENSION ELEVATOR CHAINS AND REMOVE LINK IF REQUIRED 1.50 HRS
***** TECHNICIANS COMMENTS *****
*
*Tensioned clean grain chain. Removed half link and
*tensioned return chain.
*

LABOR 180.00
16001001 SEGMENT TOTAL==> 180.00

SEGMENT#17 C 23001 NA 01/28/25 01/28/25
MISSING WATER EXTINGUISHER 1.00 HRS
- PDI NEW EXTINGUISHER
***** TECHNICIANS COMMENTS *****
*
*Replaced fire extinguisher.
*


TY25183 Fire Extinguish 1 331.90 331.90
Fire Extinguisher
PARTS 331.90
LABOR 90.00
16001001 SEGMENT TOTAL==> 421.90

SEGMENT#18 C 23001 NA 01/28/25 01/28/25
REPLACE 5 BROKEN SEPARATOR COVER KNOBS 1.50 HRS
***** TECHNICIANS COMMENTS *****
*
*Replaced broken knobs. Heated and removed studs. Repaired
*threads.

CONTINUED ON PAGE 10

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

Ship to:

JD X9 1100 MACHURA TRD - (820541)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	10
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via		Purchase Order
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XPN0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P

HXE167838	Knob		5 N	14.77	73.85
				PARTS	73.85
				LABOR	277.20
16001001			SEGMENT TOTAL==>		351.05

SEGMENT#19 C 23001 NA	01/28/25 02/05/25	
ADJUST ENGINE LANDING LADDER		1.50 HRS
***** TECHNICIANS COMMENTS *****		
Adjust rear panel to no longer bind with ladder panel.		

	LABOR	270.00
16001001	SEGMENT TOTAL==>	270.00

SEGMENT#20 C 23001 NA	01/28/25 02/03/25	
CLEAN HOPPER AND LOAD AUGER BUILDUP		1.00 HRS
***** TECHNICIANS COMMENTS *****		
Cleaned out hopper.		


	LABOR	180.00
16001001	SEGMENT TOTAL==>	180.00

SEGMENT#21 C 9662 NA	01/28/25 02/05/25	
PLASTIC COVER TORE OFF CABIN DOOR		.50 HRS
- REMOUNT COVER		

CONTINUED ON PAGE 11

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

Ship to:

JD X9 1100 MACHURA TRD - (820541)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	11
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via		Purchase Order
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XPN0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P
***** TECHNICIANS COMMENTS *****					
*Reinstalled cover.					

GX10571	PLUG	2	.85		1.70
			PARTS		1.70
			LABOR		90.00
16001001			SEGMENT TOTAL==>		91.70

SEGMENT#22 C 9662 NA	01/28/25 02/05/25	
DOWNLOAD AND UPDATE LATEST PAYLOADS	2.00 HRS	
***** TECHNICIANS COMMENTS *****		
*Downloaded latest software and installed payloads.		


	LABOR	360.00
16001001	SEGMENT TOTAL==>	360.00

SEGMENT#23 C 9662 NA	01/28/25 01/28/25	
SERVICE	4.00 HRS	
- REPLACE ENGINE OIL AND FILTER		
- REPLACE FUEL FILTERS		
- CLEAN SEDIMENT BOWL		
- ALL AIR		
- TOP UP MEG / HYD		
- TOP UP COOLANT		
- INSTALL EXTRA SHEAR PIN FOR MULTICOUPLER		
***** TECHNICIANS COMMENTS *****		

CONTINUED ON PAGE 12

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,

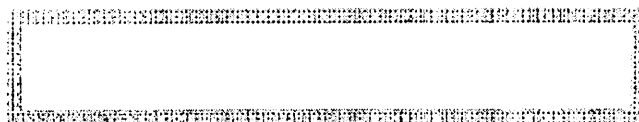

SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

Ship to:

JD X9 1100 MACHURA TRD - (820541)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	12
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via		Purchase Order
		Salesperson
		KK

SERVICE INVOICE


STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XPN0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P

*Drained engine oil. Replaced engine oil filter and fuel					
*filter. Cleaned sediment bowl. Topped up hydraulic oil and					
*coolant. Replaced all air filters. Installed shear pin.					
*Refilled engine crankcase. Ran unit. Topped up fluids as					
*required.					

AXE70605	Air Filter REC	1		35.75	35.75
DZ124761	FUEL FILTER PR.	1		149.17	149.17
DZ124786	FUEL FIL SEC	1		143.31	143.31
ENVO114	OIL ENVIRO FEE	3		1.14	3.42
ENV100	ENVIRO CHARGE	2		1.25	2.50
ENV114	CONTAIN ENV FEE	1		1.14	1.14
ENV227	CONTAIN ENV FEE	3		2.27	6.81
ENV50	ENVIRO CHARGE	1		.55	.55
ENV57	OIL ENVIRO FEE	1		.57	.57
HXE11090	AIR FILTER PRM.	1		421.93	421.93
HXE11091	AIR FILTER SEC.	1		297.72	297.72
RE284091	CAB FILTER	1		111.24	111.24
RE572785	ENG OIL FILTER	1		138.38	138.38
TY22062	HYGARD 9.46L	1		77.09	77.09
TY26575	COOLGARDII PMIX	1		24.37	24.37
TY26679	15W40+50II 19L	3		154.45	463.35
	Plus-50 II Oil 15W40 CK4/SN				
14M7264	LOCK NUT	1		.52	.52
19M9326	SHEARBOLT M4X30	1		1.93	1.93
				PARTS	1879.75
				LABOR	720.00
16001001				SEGMENT TOTAL==>	2599.75
CONTINUED ON PAGE 13					

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



St. Paul
Box 1468 St Paul, AB T0A 3A0
Tel: 780.645.4437 Fax: 780.645.4016
www.horizonagturf.com

Ship to:

JD X9 1100 MACHURA TRD - (820541)

Invoice to:

INTERNAL CUSTOMER
Horizon Ag & Turf
Lloydminster AB T9V 3A2

Branch		
ST. PAUL		
Date	Time	Page
02/13/25	23:05:50 (B)	13
Account No.	Phone No.	Invoice No.
INTER01A	7808754471	W00606
Ship Via	Purchase Order	
		Salesperson
		KK

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
151123A	JOHN DEERE X9 1100	694	1H0X911XPN0820541	08/01/24	
	X9 1100	450		07/31/28	2000 P

SEGMENT#24 C 9662 NA 01/28/25 01/28/25

REPAIR CRACKS IN CHOPPER HOUSING

***** TECHNICIANS COMMENTS *****

* *

*Disconnected batteries. Grind weld paint. Reconnected *

*batteries. *

* *


	LABOR	315.00
16001001	SEGMENT TOTAL==>	315.00

***** WORK ORDER TOTALS *****

	INTERNAL	CUSTOMER
PARTS	16628.07	
LABOR	11687.40	
Shop Supplies	250.00	
INTERNAL TOTAL	28565.47	

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



SIGNATURE

RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO