

D/C Heavy Duty Mechanical Inc

36 Sunset Cres SW
 Medicine Hat AB
 T1B 4T6
 403-581-9885
 dchd.mechanical@gmail.com

Invoice

Date	Invoice #
5/9/2017	0812
Due Date	
4/9/2017	

Invoice To



Vehicle Info

Year:1988
 Make: International
 Model:f9370-6x4
 Vin:2hsfbx6r4jc016917

Unit F-106

P.O. No.	KMS/ HRS	Unit#
	1313695km	

Item	Quantity	Description	Rate	Amount
Labour	22	Wash off motor and check for leaking head gasket. Gasket is leaking oil from passenger side of head and pushing coolant out over flow. replace head gaskets and send head to get checked for cracks. Set Valves and Jake assemblies.		
Parts	1	Repair wiring to engine fan solenoid	90.00	1,980.00
Sub - Trades		Change engine oil and filters	767.09	767.09
		Replace missing block plug behind starter	790.97	790.97
		Replace leaking compressor return line		
Parts	2	rotella 15w40		
Parts	1	lf691a filter	73.00	146.00
Parts	1	block plug 1656170	15.00	15.00
Parts	2	100r5 fitting #4	11.08	11.08
Parts	1	100r5 hy hose	6.56	13.12
Parts	1	pre mix coolant	8.62	8.62
Parts	34	GST on sales	3.00	102.00
			5.00%	191.69

GST/HST No. 804149326

All invoices are Due Net 30 days
 Invoices past 30 days will be subject to 2.99%
 monthly

Subtotal \$3,833.88

GST \$191.69

Total \$4,025.57



WORK ORDER INVOICE

Hat Truck Repair
3278 - 17th Avenue SW
Medicine Hat, AB T1B 4B2
Tel. : 403-527-9975
G.S.T #89753 9607 RT0001

Invoice To:
[Redacted]

Date	Invoice No.	A/C No.	Customer PO#	Payment Term	Vendor Code	Page No.
04/12/21	WI012320	[Redacted]	[Redacted]	NET30		1 of 1

Work Order No. WO012666 [Redacted] W0 Date 04/05/21

Equipment No.	1988	VIN#	1HSFBX6R4JC016917	Odometer	321,345 KM
Make	International	Engine#	7FB70675 3406B	Year	1988
License#	451KJJ	Model		Last Cert. ()	Tire Sizes

Activity Description	Part No.	Part Description	Unit Price	Quantity	Total
1. CHECK FOR RUNNING ROUGH			111.00	5.00 HR	555.00
TROUBLR SHOOT FUEL IN OIL INSTALLED TRACER DYE AND FOUND #2 INJECTOR LEAKING REMOVED VALVE COVERS FOR REPAIRS REMOVED AND REPLACED #2 INJECTOR TORQUED TO CAT SPECS REINSTALLED VALVE COVERS REPLACED OIL AND FILTER					
	0R3421	INJECTOR	227.9160	1.00 EA	227.92
	7W2315	RETAINER	63.1150	1.00 EA	63.12
	1H1023	RING	1.9110	1.00 EA	1.91
	SH550045128	15W40 ROTELLA 20L	93.5350	2.00 EA	187.07
	LF691AFLG	FILTER-OIL	18.0440	1.00 EA	18.04

Technician: HT-08-Eddie
HT-17-Larry

Authorized By:

Total Labor:	555.00
Total Parts:	498.06
Shop Supplies:	73.71
Subtotal:	1,126.77
GST:	56.34
INVOICE TOTAL	1,183.11

I hereby acknowledge my indebtedness being the total balance owing as shown on this invoice. I hereby acknowledge that a finance charge will be charged at a rate of 2% per month (24% annually) on all amounts not paid within 30 days of invoice date. An express mechanic's lien is acknowledged on above vehicle to secure the amount of the repairs in case vehicle repairs are not paid in full. Hat Truck Repair make the limited warranty covering any defect in workmanship or material finished in connection with this invoice for a period of thirty (30) days from the day of delivery of said vehicle to the customer/owner, or 15,000 kilometers whichever occurs first.

Signature: _____

D/C Heavy Duty Mechanical Inc


36 Sunset Cres SW
 Medicine Hat AB
 T1B 4T6
 403-581-9885
 dchd.mechanical@gmail.com

Invoice

F-106

Date	Invoice #
7/26/2018	1233
Due Date	
7/26/2018	

Invoice To

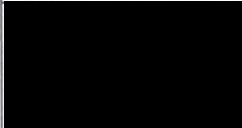

Vehicle Info

YEAR 1988
 MAKE INTERNATIONAL
 MODEL GRAIN BOX
 VIN 2HSFBX6R4JC016917

P.O. No.	KMS/ HRS	Unit#
	319576 KM	

Item	Quantity	Description	Rate	Amount
		DIAGNOSE ENGINE COOLANT INSIDE OIL PAN. DISASSEMBLE MOTOR AND FOUND RIPPED LINER O RINGS, CYLINDERS 3 AND 5 HAVE CAVITATIONS HOLES IN LINERS. CAVITATION PITTING IN ALL CONNECTING ROD BEARINGS.	0.00	0.00
		MEASURE LINER HEIGHT AND FOUND CYLINDERS TO HAVE EXCESSIVE WEAR TO LINER SEAT AREA. CUT CYLINDERS 2 3 4 5 AND REPAIR CROOKED CUT ON CYLINDER 6.		
		REPLACE ENGINE OIL PUMP INSTALL NEW PISTONS, LINERS, AND ROD BEARINGS REPLACE MAIN BEARINGS MACHINE HEAD AND REPLACE EXHAUST VALVE GUIDES AND SEALS, REPLACE SPACER PLATE. REMOVE OIL COOLER AND REPLACE ALL O RINGS SET OVERHEAD REPLACE ALL CLOTH BRADED COOLANT HOSES AND BALL VALVE FOR COOLANT SHUT OFF ON WATER PUMP OUTLET		
Labour	32.5		90.00	2,925.00
Labour	1	HEAD MACHINE WORK	1,449.15	1,449.15
Labour	1	CUT COUNTER BORE	906.50	906.50
Parts	1	3178766 FP DIESEL INFRAME KIT	2,195.00	2,195.00

GST/HST No. 804149326

All invoices are Due Net 30 days
 Invoices past 30 days will be subject to 2.99%
 monthly

Subtotal

GST

Total

D/C Heavy Duty Mechanical Inc

36 Sunset Cres SW
 Medicine Hat AB
 T1B 4T6
 403-581-9885
 dchd.mechanical@gmail.com

Invoice

Date	Invoice #
7/26/2018	1233
Due Date	
7/26/2018	

Invoice To



Vehicle Info

YEAR 1988
 MAKE INTERNATIONAL
 MODEL GRAIN BOX
 VIN 2HSFBX6R4JC016917

P.O. No.	KMS/ HRS	Unit#
	319576 KM	

Item	Quantity	Description	Rate	Amount
Parts	1	6I2981 SPACER PLATE	625.00	625.00
Parts	48	50 50 COOLANT	2.50	120.00
Parts	40	15W40 ENGINE OIL	4.00	160.00
Parts	1	0r-9448 OIL PUMP FP DIESEL	654.22	654.22
Parts	1	LF691A OIL FILTER	19.67	19.67
Parts	1	6I4362 LINER SHIM	101.23	101.23
Parts	1	6I4363 LINER SHIM	105.63	105.63
Parts	3	9Y3368 LINER SHIM	101.23	303.69
Parts	1	245BMNPT FITTING BRASS	2.40	2.40
Parts	1	49-6B ELBOW #8	3.90	3.90
Parts	3	1090077 COOLER O RING	16.32	48.96
Parts	2	1250434 FILTER HOUSING O RING	12.335	24.67
Parts	6	Farhr58 #8 CLOTHBRADE HOSE	4.00	24.00
Parts	4	#8 SAE REUSABLE END farsr52888	7.00	28.00
Parts	2	Farhr510cut #10 CLOTHBRADE HOSE	5.52	11.04
Parts	2	Farsr5281010 #10 END	10.99	21.98
Parts	1	REPLACE BROKEN FLEXPipe UNDER CAB 5 INCH FLEXPipe	8.84	8.84
Parts	2	EC50PLA EXHAUST CLAMP 5 INCH	10.00	20.00
		GST on sales	5.00%	487.94

GST/HST No. 804149326

All invoices are Due Net 30 days
 Invoices past 30 days will be subject to 2.99%
 monthly

Subtotal	\$9,758.88
GST	\$487.94
Total	\$10,246.82