



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
[www.southcountry.ca](http://www.southcountry.ca)

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> [REDACTED] <b>Invoice Date:</b> 2/18/2025 <b>Location:</b> [REDACTED] <b>Work Order Number:</b> [REDACTED] <b>Payment Type:</b> [REDACTED]  <b>Page:</b> 1 of 12
--------------------------	--------------------------	---

<b>Make/Model:</b>	<b>Meter:</b>	<b>Serial Number:</b>	<b>Eq ID:</b>	<b>Fleet No:</b>
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**/HEADEROP645FD Internal**

COMPLAINT:

01 RECONDITIONING INSPECTION HEADER

CORRECTION:

BROUGHT HEADER UP TO SHOP AND PLUGGED IN UNIT, STARTED COMBINE TO WARM UP, WENT OVER HEADER AS COMBINE WARMED UP, PICKED UP HEADER WITH COMBINE TO CHECK OVER REST OF HEADER LIST, PARKED OUT OF WAY, PLUGGED IN COMBINE, HAD TO BREAK UP ICE AND SNOW AROUND DRAPERS BEFORE RUNNING

<b>Labor: \$549.00</b>	<b>Parts: \$0.00</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$0.00</b>	<b>Sub-Total: \$549.00</b>
------------------------	----------------------	-------------------------	---------------------	----------------------------

**/GLOPCLEAN645FD Internal**

COMPLAINT:

02 GREENLIGHT/RECONDITIONING CLEANING CHECKLIST - ON WO [REDACTED]

CORRECTION:

TO BE WASHED IN SPRING


<b>Labor: \$0.00</b>	<b>Parts: \$0.00</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$0.00</b>	<b>Sub-Total: \$0.00</b>
----------------------	----------------------	-------------------------	---------------------	--------------------------

**Gen3- Internal**

COMPLAINT:

03 DIAGNOSE NO DRAPER & PEA AUGER MOVEMENT AND NOT READING SPEED

CORRECTION:

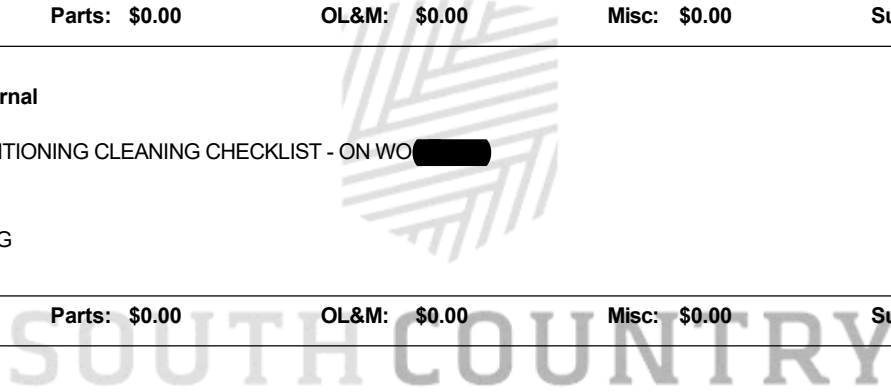



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
[www.southcountry.ca](http://www.southcountry.ca)

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> [REDACTED] <b>Invoice Date:</b> 2/18/2025 <b>Location:</b> [REDACTED] <b>Work Order Number:</b> [REDACTED] <b>Payment Type:</b> [REDACTED]  <b>Page:</b> 2 of 12
--------------------------	--------------------------	---

<b>Make/Model:</b>	<b>Meter:</b>	<b>Serial Number:</b>	<b>Eq ID:</b>	<b>Fleet No:</b>
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**Gen3- Internal**

CLEANED OFF THE DRAPERS AND HOOKED IT UP TO A COMBINE. RAN THE UNIT SEVERAL TIMES TO TRY TO GET THE DRAPERS TO KEEP TURNING. HAD A CODE FOR THE DRAPER PROTECTION COME AND GO FOR SLIPPAGE OF LH BELTS.

LOOSENED OFF AND CLEANED INSIDE ALL THE LH BELTS. RAN THE UNIT AGAIN AFTER TENSIONING THE BELTS. CODE WOULD STILL COME UP AND KILL ANY CONVEYOR SPEED. TESTED ALL THE SENSORS AND FOUND THAT THE DRAPER SPEED SENSOR ON THE MOTOR WAS NO GOOD. REPLACED THE SENSOR. RAN THE UNIT AND STILL HAD NO DRAPER SPEED READING IN THE CAB AND THE DRAPERS WOULD START THEN WHEN THE CODE CAME UP IT WOULD KILL ALL FLOW TO THE DRAPER MOTORS.

DISCONNECTED THE DRAPER SPEED SOLENOID AND RAN THE DRAPERS, ALL RAN GOOD WITH THE SOLENOID UNPLUGGED BUT CODE STILL PRESENTED.

TESTED ALL THE SENSOR HARNESSSES AND FOUND THEY ALL GOOD CONTINUITY TESTED THE LH OUTER DRAPER SPEED SENSOR AND FOUND IT WAS GOOD. TRIED TO SPIN THE ROLLER OVER AND FOUND THAT THE BEARINGS WOULD COMPLETELY SEIZE AT ONE SPOT.

REMOVED THAT ROLLER AND FOUND THAT THE BEARINGS WERE GONE. REPLACED BOTH BEARINGS AND REINSTALLED THE ROLLER. TESTED THE SPEEDS AND ALL WAS GOOD.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AXE50068	Ball Bearing	2.00	53.41	53.41	\$106.82	N
AXE68069	Sensor	1.00	155.88	155.88	\$155.88	N
H165874	WASHER	2.00	8.36	8.36	\$16.72	N
N70171	SNAP RING	2.00	9.32	9.32	\$18.64	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	63.19	63.19	\$63.19	N

**Labor: \$1,053.15      Parts: \$298.06      OL&M: \$0.00      Misc: \$63.19      Sub-Total: \$1,414.40**

**Gen5- Internal**

COMPLAINT:  
 05 DIAGNOSE & REPAIR BROKEN LIP FOR PTO SHIELD ON MAIN GEAR CASE



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
[www.southcountry.ca](http://www.southcountry.ca)

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> <b>Invoice Date:</b> 2/18/2025 <b>Location:</b> <b>Work Order Number:</b> <b>Payment Type:</b>  <b>Page:</b> 3 of 12
--------------------------	--------------------------	---

<b>Make/Model:</b>	<b>Meter:</b>	<b>Serial Number:</b>	<b>Eq ID:</b>	<b>Fleet No:</b>
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**Gen5- Internal**

**CORRECTION:**

INSTALLED THE CLAMP AND TIGHTENED IT DOWN WILL CONTINUE TO MONITOR WHILE RUNNING. WHEN RUNNING THE MACHINE THE HOSE CLAMP DID NOT LOOSEN OFF AND THE BOOT STAYED IN PLACE WHEN RUNNING IN BOTH FORWARD AND REVERSE THROUGH ALL SPEEDS.

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	21.24	21.24	\$21.24	N
<b>Labor: \$354.00</b>		<b>Parts: \$0.00</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$21.24</b>	<b>Sub-Total: \$375.24</b>	

**Gen6- Internal**

**COMPLAINT:**

06 INSTALL MISSING BOLT AND NUT FOR LEFT HAND SIDE INNER FLOAT ARM

**CORRECTION:**

INSTALLED THE MISSING FLOAT ARM BOLT AND NUT.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
14M7299	Flange Nut M12	1.00	2.79	2.79	\$2.79	N
19M8044	Hex Head Cap Screw M16 X 210 GR10.9	1.00	24.30	24.30	\$24.30	N
24M7053	WASHER	2.00	1.88	1.88	\$3.76	N
A31869	LOCK NUT	1.00	5.94	5.94	\$5.94	N
H207478	CAP SCREW	1.00	20.99	20.99	\$20.99	N
HXE39520	Bushing	2.00	26.95	26.95	\$53.90	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	2.66	2.66	\$2.66	N
<b>Labor: \$44.25</b>		<b>Parts: \$111.68</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$2.66</b>	<b>Sub-Total: \$158.59</b>	



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
[www.southcountry.ca](http://www.southcountry.ca)

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> [REDACTED] <b>Invoice Date:</b> 2/18/2025 <b>Location:</b> [REDACTED] <b>Work Order Number:</b> [REDACTED] <b>Payment Type:</b> [REDACTED]  <b>Page:</b> 4 of 12
--------------------------	--------------------------	---

<b>Make/Model:</b>	<b>Meter:</b>	<b>Serial Number:</b>	<b>Eq ID:</b>	<b>Fleet No:</b>
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**/1017031645FD Internal**

COMPLAINT:

07 REPLACE BOTH KNIFE DRIVE BUSHINGS. RETIME BOTH KNIVES - PLAY ON BOTH SIDES

CORRECTION:

REMOVED AND REPLACED BOTH BUSHINGS THEN RETIMED THE KNIFE.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
H157812	Knifehead Sleeve ( White Plastic )	2.00	21.00	21.00	\$42.00	N
<b>Miscellaneous</b>	<b>DESCRIPTION</b>	<b>Quantity</b>	<b>List Price</b>	<b>Net Price</b>	<b>Extended Price</b>	<b>Taxed Ind</b>
SERVACCESS	SERVICE ACCESSORIES	1.00	25.49	25.49	\$25.49	N
<b>Labor: \$424.80</b>		<b>Parts: \$42.00</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$25.49</b>	<b>Sub-Total: \$492.29</b>	

**/10170061645FD F Internal**

COMPLAINT:

08 KNIFE SECTION(S), REPLACE 3 - BROKEN

CORRECTION:

REPLACED THE THREE BROKEN SECTIONS OF KNIVES.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
H163131	4in Coarse Section Std	3.00	4.61	4.61	\$13.83	N
<b>Miscellaneous</b>	<b>DESCRIPTION</b>	<b>Quantity</b>	<b>List Price</b>	<b>Net Price</b>	<b>Extended Price</b>	<b>Taxed Ind</b>
SERVACCESS	SERVICE ACCESSORIES	1.00	4.78	4.78	\$4.78	N
<b>Labor: \$79.65</b>		<b>Parts: \$13.83</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$4.78</b>	<b>Sub-Total: \$98.26</b>	

**/120100645FD F Internal**

COMPLAINT:

09 ADJUST KNIFE HOLD DOWNS

CORRECTION:



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
 www.southcountry.ca

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> <b>Invoice Date:</b> 2/18/2025 <b>Location:</b> <b>Work Order Number:</b> <b>Payment Type:</b>  <b>Page:</b> 5 of 12
--------------------------	--------------------------	---

<b>Make/Model:</b>	<b>Meter:</b>	<b>Serial Number:</b>	<b>Eq ID:</b>	<b>Fleet No:</b>
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**/120100645FD F Internal**  
 ADJUSTED ALL KNIFE HOLD-DOWNS TO THE PROPER SPEC.

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	10.62	10.62	\$10.62	N
<b>Labor: \$177.00</b>		<b>Parts: \$0.00</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$10.62</b>	<b>Sub-Total: \$187.62</b>	

**/10130061645FD Internal**  
 COMPLAINT:  
 10 SKID SHOE, REPLACE 4 AND 1 RIVET - BROKEN/MISSING

CORRECTION:  
 REMOVED THE OLD BROKEN SKIDS AND REPLACED WITH NEW ONES. FOUND THE ONES MISSING RIVETS AND INSTALLED NEW RIVETS.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
HXE169294	Skid Shoe Pop Rivet M6.48 X 24	20.00	0.74	0.74	\$14.80	N
HXE185137	SKID PLATE	4.00	42.26	42.26	\$169.04	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	10.62	10.62	\$10.62	N
<b>Labor: \$177.00</b>		<b>Parts: \$183.84</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$10.62</b>	<b>Sub-Total: \$371.46</b>	

**/15178645FD Internal**  
 COMPLAINT:  
 11 REPLACE CENTER FEED SKID PLATE - BROKEN

CORRECTION:  
 DRILLED OUT ALL THE RIVETS. REMOVED THE SKID THEN HAMMERED OUT WHAT WAS LEFT OF THE RIVETS. INSTALLED THE NEW SKID PLATE THEN INSTALLED A RIVET AND MOVED THE SKID AROUND TO LINE UP THE CORNERS. INSTALLED ALL THE RIVETS.



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
 www.southcountry.ca

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> [REDACTED] <b>Invoice Date:</b> 2/18/2025 <b>Location:</b> [REDACTED] <b>Work Order Number:</b> [REDACTED] <b>Payment Type:</b> [REDACTED]  <b>Page:</b> 6 of 12
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**/15178645FD Internal**

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
HXE169294	Skid Shoe Pop Rivet M6.48 X 24	37.00	0.74	0.74	\$27.38	N
HXE54477	FEED SKID PLATE RDF	1.00	782.80	782.80	\$782.80	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	10.62	10.62	\$10.62	N

**Labor: \$177.00      Parts: \$810.18      OL&M: \$0.00      Misc: \$10.62      Sub-Total: \$997.80**

**10171010645FD Internal**

**COMPLAINT:**

12 DRUM FINGERS, BUSHING AND FLANGES R&R - REPLACE 5 BROKEN

**CORRECTION:**

REMOVED THE COVERS FOR THE DRUM. NONE OF THE HARDWARE WOULD MOVE, HEATED EACH BOLT AND REMOVED ALL BUT ONE OF THESE COVERS THIS WAY THEN OTHER NEEDED TO BE PRYED OUT OF THE HOLE. BROUGHT THE ONE INSIDE AND HEATED THE NUT ON THE BACK THEN IT WOULD COME OUT. REPAIRED THE COVERS THAT WERE BENT. REMOVED THE BROKEN FINGERS FROM INSIDE THE DRUM. AUGER WOULD NOT SPIN TO GET AT THE BACK ONES, WENT TO REMOVE THE HEADER FROM THE COMBINE BUT THE PINS WOULD RETRACT. WENT UNDER AND CLEANED OUT THE PATH THE PINS RIDE ON. STILL WOULD NOT MOVE. PRYED THE PINS OVER. SET THE HEADER DOWN AND BACKED AWAY. REPLACED ALL THE DAMAGED FINGERS AND THEN INSTALLED ALL NEW GUIDES AND BUSHINGS FOR THOSE FINGERS. ALL THE COVERS WERE THEN REINSTALLED AND TIGHTENED DOWN.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
14M7298	Flange Nut M8	6.00	1.49	1.49	\$8.94	N
19M7866	Flange Head Cap Screw M8 X 20 GR10.9	8.00	1.78	1.78	\$14.24	N
AH228229	Auger Finger Kit ( Steel )	5.00	34.91	34.91	\$174.55	N
H169913	Spring Locking Clip	5.00	3.56	3.56	\$17.80	N
H217264	RETAINER	5.00	6.86	6.86	\$34.30	N
H217265	RETAINER	5.00	6.86	6.86	\$34.30	N



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
[www.southcountry.ca](http://www.southcountry.ca)

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> <b>Invoice Date:</b> 2/18/2025 <b>Location:</b> <b>Work Order Number:</b> <b>Payment Type:</b>  <b>Page:</b> 7 of 12
--------------------------	--------------------------	---

<b>Make/Model:</b>	<b>Meter:</b>	<b>Serial Number:</b>	<b>Eq ID:</b>	<b>Fleet No:</b>
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**10171010645FD Internal**

H217266	BALL	5.00	3.56	3.56	\$17.80	N
H87193	COVER	1.00	22.08	22.08	\$22.08	N

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	49.38	49.38	\$49.38	N

**Labor: \$823.05      Parts: \$324.01      OL&M: \$0.00      Misc: \$49.38      Sub-Total: \$1,196.44**

**GEN14- Internal**

COMPLAINT:  
 14 REPAIR REEL TUBE BEARINGS

CORRECTION:  
 REMOVED THE OLD BEARING AND FOUND IT HAD BEEN WORN INTO. REPLACED THE BEARING AND TIGHTENED THE REST.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
19M7658	Hex Head Cap Screw M10 X 50 GR10.9	1.00	3.96	3.96	\$3.96	N
A51212	LOCK NUT	1.00	1.88	1.88	\$1.88	N
AXE28803	Bearing	1.00	9.09	9.09	\$9.09	N

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	5.31	5.31	\$5.31	N

**Labor: \$88.50      Parts: \$14.93      OL&M: \$0.00      Misc: \$5.31      Sub-Total: \$108.74**

**GEN15- Internal**

COMPLAINT:  
 15 CLEAN OUT REEL DRIVE GEAR AND DRIVEN GEAR HOUSING - FULL OF CHAFF

CORRECTION:  
 CLEANED OUT THE HOUSING



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
[www.southcountry.ca](http://www.southcountry.ca)

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> [REDACTED] <b>Invoice Date:</b> 2/18/2025 <b>Location:</b> [REDACTED] <b>Work Order Number:</b> [REDACTED] <b>Payment Type:</b> [REDACTED]  <b>Page:</b> 8 of 12
--------------------------	--------------------------	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**GEN15- Internal**

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	5.31	5.31	\$5.31	N
<b>Labor: \$88.50</b>		<b>Parts: \$0.00</b>		<b>OL&amp;M: \$0.00</b>		<b>Misc: \$5.31</b>
<b>Sub-Total: \$93.81</b>						

**/140561645FD Internal**  
 COMPLAINT:  
 17 ADJUST ALL DRAPER TENSIONS

CORRECTION:  
 DONE UNDER SEGMENT 3

<b>Labor: \$0.00</b>	<b>Parts: \$0.00</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$0.00</b>	<b>Sub-Total: \$0.00</b>
----------------------	----------------------	-------------------------	---------------------	--------------------------

**GEN18- Internal**

COMPLAINT:  
 18 CLEAN OUT BELT TENSIONER AREA - FULL OF CHAFF

CORRECTION:  
 CLEANED AS MUCH MATERIAL AS POSSIBLE FROM THESE AREAS.

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	5.31	5.31	\$5.31	N
<b>Labor: \$88.50</b>		<b>Parts: \$0.00</b>		<b>OL&amp;M: \$0.00</b>		<b>Misc: \$5.31</b>
<b>Sub-Total: \$93.81</b>						

**GEN19- Internal**

COMPLAINT:  
 19 REPLACE RIGHT HAND POLY PAD ABOVE TENSIONER - TWISTED AND BENT



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
 www.southcountry.ca

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> Invoice Date: 2/18/2025 Location: Work Order Number: Payment Type:  Page: 9 of 12
--------------------------	--------------------------	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**GEN19- Internal**

**CORRECTION:**

REMOVED THE BOLT HOLDING THE POLY PIECE IN AND REMOVED IT. INSTALLED THE NEW PIECE AND TORQUED TO BOLT TO THE PROPER SPEC.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
HXE37806	Wear Plate	1.00	19.67	19.67	\$19.67	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	5.31	5.31	\$5.31	N
<b>Labor: \$88.50</b>		<b>Parts: \$19.67</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$5.31</b>	<b>Sub-Total: \$113.48</b>	

**/150527645FD Internal**

**COMPLAINT:**

20 REPLACE DECALS ON BOTH END SHIELDS - LEFT HAND MODEL NUMBER, RIGHT HAND DEERE AND MODEL NUMBER DECAL

**CORRECTION:**

REMOVED THE OLD JOHN DEERE STICKER ON THE RH DOOR AND REPLACED IT. REMOVED THE OLD 645 FD STICKERS AND REPLACED WITH NEW ONES

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
HXE44695	Label	2.00	34.06	34.06	\$68.12	N
JD5706	LABEL	1.00	44.89	44.89	\$44.89	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	10.62	10.62	\$10.62	N
<b>Labor: \$177.00</b>		<b>Parts: \$113.01</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$10.62</b>	<b>Sub-Total: \$300.63</b>	

**/15127645FD Internal**

**COMPLAINT:**

21 REPLACE MAIN GEARCASE OIL - NOT MARKED, LOOKS CLEAN



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
 www.southcountry.ca

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> <b>Invoice Date:</b> 2/18/2025 <b>Location:</b> <b>Work Order Number:</b> <b>Payment Type:</b>  <b>Page:</b> 10 of 12
--------------------------	--------------------------	--

<b>Make/Model:</b>	<b>Meter:</b>	<b>Serial Number:</b>	<b>Eq ID:</b>	<b>Fleet No:</b>
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**/15127645FD Internal**  
 CORRECTION:  
 DRAINED THE OIL IN THE MAIN GEARCASE. FILLED BACK UP WITH OIL.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
TY26815	3.78L 80W90 GL-5	1.00	51.75	51.75	\$51.75	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF50	ENVIRO FEE	1.00	0.50	0.50	\$0.50	N
SERVACCESS	SERVICE ACCESSORIES	1.00	21.24	21.24	\$21.24	N
<b>Labor: \$354.00</b>		<b>Parts: \$51.75</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$21.74</b>	<b>Sub-Total: \$427.49</b>	

**/KDOIL645FD Internal**  
 COMPLAINT:  
 22 CHANGE OIL IN KNIFE DRIVE GEARCASES (BOTH DRIVES) - NOT MARKED, DARK

CORRECTION:  
 CANNOT DRAIN THE OIL IN THESE GEARCASES AND BOTH WERE FILLED TO THE PROPER LEVEL.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
TY26815	3.78L 80W90 GL-5	1.00	51.75	51.75	\$51.75	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EF50	ENVIRO FEE	1.00	0.50	0.50	\$0.50	N
SERVACCESS	SERVICE ACCESSORIES	1.00	10.62	10.62	\$10.62	N
<b>Labor: \$177.00</b>		<b>Parts: \$51.75</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$11.12</b>	<b>Sub-Total: \$239.87</b>	

**/142664645FD Internal**  
 COMPLAINT:  
 23 CHANGE OIL IN CENTER FEED GEARCASE - NOT MARKED

CORRECTION:



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
 www.southcountry.ca

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> [REDACTED] <b>Invoice Date:</b> 2/18/2025 <b>Location:</b> [REDACTED] <b>Work Order Number:</b> [REDACTED] <b>Payment Type:</b> [REDACTED]  <b>Page:</b> 11 of 12
--------------------------	--------------------------	--

<b>Make/Model:</b>	<b>Meter:</b>	<b>Serial Number:</b>	<b>Eq ID:</b>	<b>Fleet No:</b>
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**/142664645FD Internal**  
 DRAINED AND CHANGED THE OIL IN THE GEARCASE.

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	15.93	15.93	\$15.93	N
<b>Labor: \$265.50</b>		<b>Parts: \$0.00</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$15.93</b>	<b>Sub-Total: \$281.43</b>	

**/170297645FD F Internal**  
 COMPLAINT:  
 24 ADJUST REEL HEIGHT - FINGERS CUT OFF, OUT OF SPEC

CORRECTION:  
 SET THE REEL TO THE PROPER POSITION AND THEN LOOSENED OFF THE JAM NUTS AND ADJUSTED THE REEL FINGERS TO 2 INCHES ABOVE THE CUTTER BAR.

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	7.97	7.97	\$7.97	N
<b>Labor: \$132.75</b>		<b>Parts: \$0.00</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$7.97</b>	<b>Sub-Total: \$140.72</b>	

**/940010645FD F Internal**  
 COMPLAINT:  
 25 CALIBRATE HEADER

CORRECTION:  
 CALIBRAINTED THE HEADER.

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SERVACCESS	SERVICE ACCESSORIES	1.00	15.93	15.93	\$15.93	N
<b>Labor: \$265.50</b>		<b>Parts: \$0.00</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$15.93</b>	<b>Sub-Total: \$281.43</b>	



Box 337  
 Highway 39 N.  
 Weyburn, SK, S4H 2K1  
 Phone: 306-842-4686  
 www.southcountry.ca

Moose Jaw, SK 306-692-2371  
 Mossbank, SK 306-354-2411  
 Assiniboia, SK 306-642-3366  
 Emerald Park, SK 306-721-5050  
 Weyburn, SK 306-842-4686  
 Southey, SK 306-726-2155  
 Raymore, SK 306-746-2110  
 Montmartre, SK 306-424-2212



**JOHN DEERE**

**SERVICE INVOICE**

Invoice To Account No: 0

Deliver To:

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	<b>Invoice Number:</b> [REDACTED] <b>Invoice Date:</b> 2/18/2025 <b>Location:</b> [REDACTED] <b>Work Order Number:</b> [REDACTED] <b>Payment Type:</b> [REDACTED]  <b>Page:</b> 12 of 12
--------------------------	--------------------------	--

<b>Make/Model:</b>	<b>Meter:</b>	<b>Serial Number:</b>	<b>Eq ID:</b>	<b>Fleet No:</b>
JOHN DEERE 2018 JD 645FD FLEX DRAPER PLA		1H0645FDHJ0800214	1H0645FDHJ0800214	

**/140621645FD F Internal**  
 COMPLAINT:  
 26 GREASE HEADER

CORRECTION:  
 GREASED THE HEADER.

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
SERVACCESS	SERVICE ACCESSORIES	1.00	4.25	4.25	\$4.25	N
<b>Labor: \$70.80</b>	<b>Parts: \$0.00</b>	<b>OL&amp;M: \$0.00</b>	<b>Misc: \$4.25</b>	<b>Sub-Total: \$75.05</b>		

<b>Customer PO No:</b>	[REDACTED]
<b>Tax Exempt No:</b>	[REDACTED]
<b>Advisor:</b>	[REDACTED]

<b>Labor:</b>	\$5,655.45
<b>Parts:</b>	\$2,034.71
<b>OL&amp;M:</b>	\$0.00
<b>Misc:</b>	\$307.40
<b>Grand Total:</b>	<b>\$7,997.56</b>

\*\*\* DOCUMENT COPY \*\*\*

GST Registration No: 897357802

G/L Entries	Br	Dpt	Acct	Sub	Ref	Description
	00	00	160	1	148259	USED AG EQUIPMENT
	05	40	382	1	815661	INTERNAL LABOR-AG
	00	00	178	15	815661	WORK IN PROCESS PARTS -MJ
	05	40	482	1	815661	COS INTERNAL LABOR-AG
	05	40	544	1	815661	SUPPLIES EXPENSE
	05	30	366	2	815661	JD PARTS-COUNTER
	00	00	166	5	815661	JD PARTS-MOOSE JAW
	05	30	375	3	815661	PARTS SPECIAL HANDLING
	05	30	466	2	815661	JD PARTS-COUNTER

**TERMS AND CONDITIONS**

Terms: Cash, Visa, Mastercard, AgriCard, John Deere Financial.  
 I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate the above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control.

Received by: .....Date: .....