


Swift Current Diesel

1920 Chaplin St W
 Swift Current, SK S9H 5G6
 Tel: (306) 773-4616
 Fax: (306) 778-3707

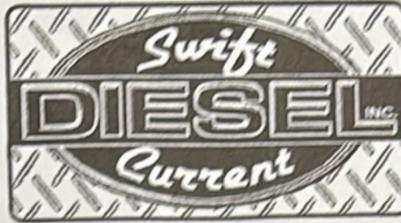

INVOICE

Invoice No.: 24312
 Date: Dec 10, 2021
 Re: Order No. 14034

Rd Bych #149.

Sold to:

[REDACTED]

[REDACTED]

2004 FORD F350 - BLUE
 VIN - 1FTSW31P14ED27228
 LIC PLATE - 761 IXI
 MILEAGE - 259,002KM

[REDACTED]

Business No.:

[REDACTED]

Quantity	Item	Description	Unit Price	Tax code	Amount
1	PFF4616	RACOR FUEL FILTER 03-07 6.0L FORD	101.40	GP	101.40
1	EHC2	ENVIRO HANDLING OVER 8"	2.00	GP	2.00
1	MAP0086	FUEL PRESSURE REGULATOR KIT 6.0L AP0086	79.02	GP	79.02
1	SDIAP80901	6.0 INJECTOR 04-07 POWERSTROKE	398.00	GP	398.00
1	MAP0028	ORING KIT 6.0L STANDPIPE AP0028	78.80	GP	78.80
1	M704SRED	FLEET CHARGE COOLANT RED (00560 GWA)	22.79	GP	22.79
4	EHC4	ENVIRO HANDLING ANTIFREEZE PER LITRE	0.30	GP	1.20
2	PP-18MMLOEM-O	CYLINDER HEADS	1,947.00	GP	3,894.00
1	MAP0043	HEAD GASKET KIT W/ARP STUDS 6.0L 18MM AP0043	2,150.00	GP	2,150.00
		Discount 19.81%	-426.00		-426.00
		- WRONG PART QUOTED DUE TO INCORRECT YEAR GIVEN- RESURFACE EXHAUST MANIFOLD			
1	SL	TUBE	250.00	GP	250.00
1	3C3Z9D477BA	CONNECTOR	70.18	GP	70.18
1	3C3Z9F485BA	CONNECTOR	24.17	GP	24.17
1	57312	OIL FILTER W/CAP FORD 6.0L/6.4L WIX	32.63	GP	32.63
1	EHC1	ENVIRO HANDLING UP TO 8"	1.50	GP	1.50
4	M10-4	4L 10W30 SB DEO NEMCO	34.57	GP	138.28
16	EHC3	ENVIRO HANDLING OIL PER LITRE	0.25	GP	4.00
1	K081265	MICRO-V BELT	113.11	GP	113.11
1	24861	ORING	3.44	GP	3.44
1	24822	ORING	3.44	GP	3.44
1	3888983	SEAL	2.72	GP	2.72
3	M704SRED	FLEET CHARGE COOLANT RED (00560 GWA)	22.79	GP	68.37
9	EHC4	ENVIRO HANDLING ANTIFREEZE PER LITRE	0.30	GP	2.70
4	MA5102	SYN AUTO TRANS FLUID A5102	10.99	GP	43.96
12	EHC4	ENVIRO HANDLING ANTIFREEZE PER LITRE	0.30	GP	3.60
1	SS	SHOP SUPPLIES	75.00	GP	75.00
1	L4033A	COMPUTER SCAN	129.73	GP	129.73
3	L4098	DIAGNOSE AND R&R INJECTORS	129.73	GP	389.19
27	L4098	R&R CYLINDER HEADS	129.73	GP	3,502.71

TRUCK CAME IN FOR RUNNING ROUGH.

SCANNED AND FOUND CODES FOR INJECTOR #2, ALSO NOTICED SOME STAINING ON COOLANT RESERVOIR BOTTLE SO WE TESTED FOR A HEAD GASKET LEAK AND FOUND ONE. CUSTOMER AT FIRST DIDN'T WANT TO SPEND THE MONEY ON DOING HEAD GASKETS SO I REPLACED THE ONE INJECTOR, JUST BEFORE FINISHING THE JOB THE CUSTOMER DECIDED TO DO THE HEADS.

Terms: Interest will be charged on accounts past 30 days at 2%/mo

Disclaimer of Warranties

All warranties on the products sold hereby are those made by the manufacturer. The seller, SWIFT CURRENT DIESEL, hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and SWIFT CURRENT DIESEL, neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

Continue...

CUSTOMER SIGNATURE: