

TEMP RETURN SERVICE REQUESTED

Phone: 813-620-1000

**Remit Payment to:**

Dobbs Equipment

PO Box 5198

Memphis, TN 38101-5198

513-4353



D. D. C. Equipment Inc  
 3875 NW 132nd St  
 Opa Locka, FL 33054-4553

1  
 1  
 196

**SERVICE INVOICE**

<b>Invoice #</b>	<b>1278716</b>
Invoice Date	2/19/2026
Work Order	482824
Invoiced By	
Work Performed	Andrew Iglesias, Javier Del Risco
Payment Method	Credit/Debit

Make/Model	Serial Number	Meter	Equipment ID	Fleet Number
JOHN DEERE 850J	1T0850JXKA0187062	2,807.00	16476W	

Gen1 - Retail

**COMPLAINT:**

DIAGNOSE-CODE-NO BLADE MOVEMENT-MACHINE MOVES  
 LOCATION: 3875 NW 132ND ST. OPALOCKA

**DIAGNOSTICS:**

Machine has code for CAN communication loss on the EHC to the CMU. Checked wiring with their mechanic. Continuity was good. Checked power coming from controller should be 5v nothing was there. Checked fuses and relays, all good. Power was there. With the mechanic we both came to the conclusion that it is the EHC Controller. Stated he wants a quote, and that they will have us do it. He's goin to try and open it up and clean it. I recommend to order new one and have us come out to install.

Miles: 25

Part Number	Description	Quantity	Unit Price	Extended Price
Part - AT305389	RELAY	3.00	\$56.89	\$170.67
Part - AT453118	ELECTROHYD	1.00	\$6,738.57	\$6,738.57

**Additional Part Charges**

Part - P0009	In Bound Freight	1.00	\$75.23	\$75.23	Taxable
Part - P0009	In Bound Freight	1.00	\$125.45	\$125.45	Taxable

Misc Charges	Description	Quantity	Unit Price	Extended Price
Misc	Travel Mileage	50.00	\$5.00	\$250.00

Labor	Parts	Misc	OL&M	Subtotal
\$1,687.50	\$7,109.92	\$250.00	\$0.00	\$9,047.42

Invoice #  
1278716



**Dobbs Equipment, LLC.**  
4343 Northwest 77th Ave  
Miami, FL 33166  
Phone: 305-592-5740 | Fax: 305-513-4353

**Remit Payment to:**  
Dobbs Equipment  
PO Box 5198  
Memphis, TN 38101-5198

Gen2 - Retail



**COMPLAINT:**

Machine not moving.

**DIAGNOSTICS:**

Javier D. Risco - Got to machine location and replaced the EHC ( Electro hydraulic controller ) All codes for CAN communication fault for blade control valve went away but the blade functions were not working at all. I checked hydraulic pressures and they are good. ( on the low end of the spectrum but good ) Again no active codes for the machine. Checked EHC software and it was correct. Checked joystick operation and it was good. Checked harnesses and it was good going to the controller. Checked hydraulic enable switch and it was good. Checked all electro controller valves for the hydraulic control valve and it was good. Checked system pressure relief valve as well as the compensating valve and it was good. i then noticed that the customer had an electrician working on the machine and made some changes to the original harness which caused a GROND wire to not be connected to a joystick handle which controls the ( ON/OFF ) button for the ( IGC ) Integrated Grade Control among other things. This caused an irregular voltage going to the blade angle switch and caused the EHC to understand that a hydraulic function was being actuated. For safety, It was not allowing the machine to fully enable hydraulic functions. Once i fixed the issue, all hydraulics functions started working properly with no active codes on the monitor and the tracks are also working. Called Ricardo and showed him in person that the machine was working as designed and the only issue i found for long term use was that the hydraulic pressures that were below standard. Machine is good to go and the customer will assemble everything back together.

Misc Charges	Description	Quantity	Unit Price	Extended Price
Misc	Environmental Fee	1.00	\$0.00	\$0.00
Misc	Shop Supplies	1.00	\$0.00	\$0.00
	<b>Labor</b>			
	<b>Parts</b>			
	<b>Misc</b>			
	<b>OL&amp;M</b>			
	<b>Subtotal</b>			
	\$937.50	\$0.00	\$0.00	\$0.00
				\$937.50

<b>Customer PO #</b>	
<b>Tax Exempt #</b>	FL 2017-12-01 RE
<b>Advisor</b>	Robaldo Hernandez

<b>Labor</b>	\$2,625.00
<b>Parts</b>	\$7,109.92
<b>Misc</b>	\$250.00
<b>OL&amp;M</b>	\$0.00
<b>Subtotal</b>	\$9,984.92
<b>Tax</b>	\$681.57
<b>Total</b>	\$10,666.49

Payment	Check#/Auth#/Override#	Credit card type	Credit card #	Signature	Amount
Credit/Debit	028387				\$10,666.49

Invoice #  
1278716



**DOBBS**  
EQUIPMENT

(844) 4 my DOBBS | dobbssequipment.com

**Dobbs Equipment, LLC.**  
4343 Northwest 77th Ave  
Miami, FL 33166  
Phone: 305-592-5740 | Fax: 305-513-4353

**Remit Payment to:**  
Dobbs Equipment  
PO Box 5198  
Memphis, TN 38101-5198

**EMV Invoice Details**




Received By: \_\_\_\_\_

Date: \_\_\_\_\_

**Terms & Conditions**

Payment in full is due thirty (30) days from the date of invoice (due date) on approved open accounts. Any amount not paid within thirty (30) days of the due date (interest-free period) will be subject to a monthly service charge of one and one-half percent (1.5%) or the maximum rate allowed by law, whichever is less, from the end of the interest-free period. All other terms are cash on delivery or cash in advance of delivery. Only approved forms of payment are acceptable. Export transactions require payment in advance or an approved letter of credit (LoC). Title to equipment listed hereon shall not pass to buyer until the purchase price, including all taxes, has been paid; but such title shall remain vested in seller until all sums due, or to become due from buyer, whether evidenced by note, book account, judgment or otherwise, shall have been fully paid, at which time ownership shall pass to buyer. Risk of loss shall pass to buyer or carrier upon shipment. Seller may exercise its legal remedies, including repossession of the equipment without notice, at any time a payment is overdue; buyer agrees to pay sellers legal fees and costs. Acceptance of equipment after repairs are performed is considered acceptance of the terms and conditions.

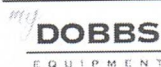

MY.DOBBS-EQUIPMENT.COM

ANYTIME. ANYWHERE. Manage your business through our My Dobbs Equipment online customer portal today! Order parts, request service, browse equipment & more at my.dobbssequipment.com.