

ROCKY MOUNTAIN EQUIPMENT

Rocky Mountain Equipment Canada Ltd. o/a Rocky Mountain Equipment

WESTLOCK
11140-100 Street
Westlock, AB T7P 2C3
Tel: (780) 349-3720
Fax: (780) 349-3308
Toll Free: 1-855-763-1427

INVOICE

E-mail - Aug 24

C/S Jim Holt

Puma 210

OWN YONDER FARMS

BOX 353

REDWATER AB T0A 2W0

Branch WESTLOCK		
Date 08/30/17	Time 14:57:45 (O)	Page 02
Account No. HOLT0004	Phone No. 7803982273	Reference No. W30547
Ship Via		Purchase Order
		G.S.T. No. 825 724 032 RT0001
Credit Card No.		Salesperson 470

Description of Work and Parts

STK#/WARRANTY		HRS	PIN/EIN	WARRANTY DATE	HRS	Fold --
AG00415	PUMA TRACTOR 210	2190	Z7BH01734 E0158199	07/03/08		
and tested unit for an hour and found to be working properly.						
R1300	FREON/LB	2	16.50		33.00	
8450 03	RELAY	1	30.94		30.94	
8700 05	CAB FILTER	2	57.72		115.44	
8700 09	CAB FILTER	1	42.63		42.63	
8700 1300	A/C leak stop	1	68.06		68.06	
	PARTS				290.07	
	LABOR				536.00	
135	REPAIR TOTAL==>				826.07	

REPAIR 3 C 00479 NA 07/22/17 07/24/17

Rear engine seal is leaking

CORRECTION:

-022 - torqued all bell housing bolts, re-installed all line hoses/connectors and routed wiring. re-installed external brackets covers. cleaned surfaces and re-installed all under frame mounts and brackets and torqued all hardware. re-installed front drive shaft. filled unit with coolant, ran unit and checked for any leaks. re-checked coolant level and topped up.

5800 3580	SEAL, OIL	1	72.16	72.16
8200 46	CLAMP, HOSE	1	8.45	8.45
8600 0200	ALLEN SCREW	1	4.80	4.80
8700 90	CORE-CLUTC	1-	101.25	101.25CR
8700 90	REMAN-CLUT	1	690.45	690.45
8700 0900	CORE-CLUTC		101.25	101.25
	PARTS			775.86
	LABOR			2010.00
135	REPAIR TOTAL==>			2785.86

CONTINUED ON PAGE 03


I have allowed work to be done along with the use of necessary materials. You and your employees may operate on the above machine for the purpose of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms of your credit until paid in full. an express mechanic's lien is acknowledged on above machine to secure the amount due. It is understood that the company assumes no responsibility for loss or damage by theft or fire to machine when for storage, sale, repair or while being tested. Estimates are for labour only. materials additional.

I hereby acknowledge my indebtedness in the amount of \$ _____ being the total amount owing or balance owing as shown hereon.

(signature)

(date)

(date)

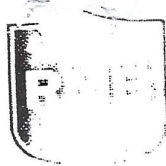

ROCKY MOUNTAIN EQUIPMENT

Rocky Mountain Equipment Canada Ltd. o/a Rocky Mountain Equipment

W-mail - Aug 24
C/S - Jim Holt

Ruma 210

TOWN YONDER FARMS
BOX 353
REDWATER AB T0A 2W0

WESTLOCK
11140-100 Street
Westlock, AB T7P 2C3
Tel: (780) 349-3720
Fax: (780) 349-3308
Toll Free: 1-855-763-1427

INVOICE

Branch			
WESTLOCK		Page	
Date	Time	03	
08/30/17	14:57:45 (O)		
Account No.	Phone No.	Reference No.	
HOLT0004	7803982273	W30547	
Ship Via		Purchase Order	
		G.S.T. No.	
		825 724 032 RT0001	
Credit Card No.		Salesperson	
		470	

Description of Work and Parts

STK#	AGCO	5	PUMA TRACTOR	210	HRS	2190	PIN/EIN	Z7BH01734	E0158199	WARRANTY DATE	07/03/08	HRS		Fold ---
------	------	---	--------------	-----	-----	------	---------	-----------	----------	---------------	----------	-----	--	----------

REPAIR 4 C 00479 NA 07/22/17 08/09/17

Quick attach hydraulic block leaking

CAUSE

failed sealing washers from loose fittings.

CORRECTIVE

Washed outer area of oil, ran unit and found two leaking fittings due to failed sealing washers, installed new washers and re-checked for leaks.

OIL	ENVIRO OIL>30	20	.05	1.00
73	HYTRAN ULTA BUL	20	4.15	83.00
	PARTS			84.00
	LABOR			134.00
	REPAIR TOTAL==>			218.00

13

REPAIR 5 C 00479 NA 07/22/17 08/09/17

Adjust park brake

CAUSE

brake pads worn beyond adjustment.

CORRECTIVE

Jacked up off ground and removed rear wheel, removed caliper, cleaned oil partially. Removed park brake assembly, removed r/r brake pads, cleaned mating surfaces, installed large sealant, lined up pads and discs and reassembled assembly, adjusted park brake cable. Changed hydraulic filters. Ropped up hydraulic oil, ran unit to temp and calibrated transmission.

FILTER	ENVIR FILT>8"	2	1.00	2.00
ZEPHYR	GSKT MAKER	1	24.50	24.50
4762	filter	1	198.38	198.38

CONTINUED ON PAGE 04

Changed Hydraulic Filter

I authorize the above work to be done along with the use of necessary materials. You and your employees may operate on the machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms until paid in full, an express mechanic's lien is acknowledged on above machine to secure the amount. I understand that the company assumes no responsibility for loss or damage by theft or fire to machine while being tested. Estimates are for labour only, materials additional.

I hereby acknowledge my indebtedness in the amount of \$ _____ being the total amount owing or balance owing as shown hereon.

(signature)

(date)

(date)



ROCKY MOUNTAIN EQUIPMENT

Rocky Mountain Equipment Canada Ltd. o/a Rocky Mountain Equipment

E-mail - Aug 24
C/S - Jim Holt

Puma 210

OWN YONDER FARMS
K 353
EDWATER AB T0A 2W0

WESTLOCK
11140-100 Street
Westlock, AB T7P 2C3
Tel: (780) 349-3720
Fax: (780) 349-3308
Toll Free: 1-855-763-1427

INVOICE

Branch WESTLOCK		
Date 08/30/17	Time 14:57:45 (O)	Page 04
Account No. HOLT0004	Phone No. 7803982273	Reference No. W30547
Ship Via		Purchase Order
		G.S.T. No. 825 724 032 RT0001
Credit Card No.		Salesperson 470

Description of Work and Parts

STK#, SET#		HRS	PIN/EIN	WARRANTY DATE	HRS	Fold --
AG000055	PUMA TRACTOR	2190	Z7BH01734	07/03/08		
	210		E0158199			
510000	SECTOR, TOOTHED	5 M	52.96		264.80	
510000	SECTOR, TOOTHED	2 M	41.95		83.90	
84000003	FILTER, HYDRAUL	1	130.80		130.80	
			PARTS		704.38	
			LABOR		1072.00	
13500019	REPAIR TOTAL==>				1776.38	


REPAIR 87300052	00479 NA	07/22/17	08/02/17		
Change on the crankcase breather					
Cover					
Re-install cover, r/r filters, re-installed cover.					
87300052	BREATHER	1	169.12		169.12
			PARTS		169.12
			LABOR		67.00
13500019	REPAIR TOTAL==>				236.12

REPAIR 13500019	7 C 00479 NA	07/22/17	08/08/17		
Add tappets					
COMMISSION					
Adjusted all valves were loose and set to spec.					
ANTIFRZ	ENVIRO ANTIFRZ	20	.16		3.20
B3000001	ANTI PREMIX 10L	2	29.00		58.00
			PARTS		61.20
			LABOR		804.00
13500019	REPAIR TOTAL==>				865.20

***** WORK ORDER TOTALS *****
PARTS 2085.83
LABOR 5022.00

CONTINUED ON PAGE 05

I agree that the work to be done along with the use of necessary materials. You and your employees may operate on the machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms until paid in full, an express mechanic's lien is acknowledged on above machine to secure the amount owed. It is understood that the company assumes no responsibility for loss or damage by theft or fire to machine while in storage, sale, repair or while being tested. Estimates are for labour only, materials additional.	I hereby acknowledge my indebtedness in the amount of \$ _____ being the total amount owing or balance owing as shown hereon. (signature) _____ (date) _____
--	--

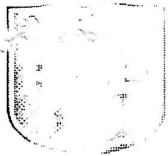

ROCKY MOUNTAIN EQUIPMENT

Rocky Mountain Equipment Canada Ltd. o/a Rocky Mountain Equipment

WESTLOCK
11140-100 Street
Westlock, AB T7P 2C3
Tel: (780) 349-3720
Fax: (780) 349-3308
Toll Free: 1-855-763-1427

INVOICE

E-mail - Aug 24
C/S - Jim Holt

DANN YONDER FARMS
BOX 353
BREMATER AB T0A 2W0

Branch WESTLOCK		
Date 08/30/17	Time 14:57:45 (O)	Page 05
Account No. HOLT0004	Phone No. 7803982273	Reference No. W30547
Ship Via		Purchase Order
		G.S.T. No. 825 724 032 RT0001
Credit Card No.		Salesperson 470

Description of Work and Parts

STK#	DESCRIPTION	HRS	PIN/EIN	WARRANTY DATE	HRS	Fold
AG004	PUMA TRACTOR	2190	Z7BH01734	07/03/08		---
	210		E0158199			
			DISPOSAL FEE		100.44	
			SHOP SUPPLIES		250.00	
			SUB TOTAL==>		7458.27	
			GST 825724032		372.94	
0445			VISA		7831.21	

Puma 210

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate at my place for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory to you until paid in full, an express mechanic's lien is acknowledged on above machine to secure the amount of my bill. It is understood that the company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional.

I hereby acknowledge my indebtedness in the amount of \$ _____ being the total amount owing or balance owing as shown hereon.

(signature)

(date)

(date)