

DOBBS PETERBILT
 DOBBS PETERBILT - Seattle, WA
 3707 Alport Way S
 Seattle, WA 98134
 Phone: 800-255-7363
 Fax: 206-587-3754
 Email:

Bill To:

Ship To: Hos Brothers Construction

P. O. BOX 1788
 WOODINVILLE OUTSIDE, WA 98072

Hos Brothers Construction
 7733 W Boston Rd
 PO Box 1788
 Woodinville Outside, WA 98072

TO VIEW AND PAY ONLINE GO TO: dobbstruckgroup.billtrust.com **EMERGENCY TOLL** **LDX BOR GDF**

Work: (206) 621-8573

Shop: 425-236-3961

Fax:

Customer P/O: 1171100

matthew.austin

ataylor

Chg R/O: 0

Completion Date: 10/02/2023

Unit Number: 1790

Model Year: 2015

Make/Model: Kenworth T800

Type: Truck

VIN: 1NKDX4EX9FJ445873

Meter: 515376.0 Miles

In-Service Date: 11/26/2014

ECM Reading: 16945.0

Task: 1

99V

DOBBS Courtesy Inspection

Department: Service

Complaint: Perform Dobbs Courtesy Inspection
 Cause:
 Correction:

Supp.

Part

Description / Ref Number

U/M

Quantity

Price

Extended Price

\$(0.01)


CHECK

DOBBS COURTESY INSPECTION

Task 1 Subtotals

\$(0.01)

Engine Assembly/Miscellaneous Repair

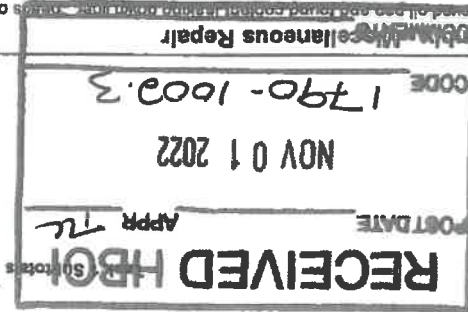

Department: Service

Complaint: Customer states: Coolant in oil, customer removed oil and found coolant. Engine overhaul - Check and Advise
 Cause: Engine swing with Cummins Recon Engine and aftertreatment clean. 2yr/200K Engine Warranty.
 Correction: Inspected vehicle and found signs of coolant in the oil. Removed oil pan, pick-up tube, and plate stiffener. Pressure tested cooling system with oil pan removed. Found external coolant leaks at hoses to transmission cooler and on hose from lower radiator pipe to hard pipe on frame rail. Checked for internal leaks, found cylinder #2 liner leaking, and source of leak coming from outside of liner. Upgraded video of leak to TruVideo. Drained coolant. Evacuated A/C system. Removed aftertreatment and sent to be cleaned. engine. Removed aftertreatment and sent to be cleaned. Groomed new engine and installed. Found fan hub is leaking. Found fan hub is leaking. Installed new fan hub, installed aftertreatment system. Charged A/C, filled cooling system, and filled oil. Ran vehicle to bleed cooling system. Performed break-in road test. Performed regen. Performed QC with no issues found.

Supp.

Part

Description / Ref Number

U/M

Quantity

Price

Extended Price

\$0.50

Tag Ser15

070-201-2

1/4" STEEL FLAT WASHER

C

5.00

\$0.10

\$(9,018.75)

CUM10

DR079RXCUM-C

Core Group:DR0658800 D/Core Class:

EA

-1.00

\$9,018.75

\$(549.02)

HOR10

78A9782RMAN-C

Core Group:H0R78/Core Class:

EA

-1.00

\$6.59

\$(6.59)

Phillips16

12-98044DSP

FITTING-45 ML ELBOW PS-L

EA

1.00

\$6.59

\$(6.59)

Original Invoice: 021R3998

DOBBS PETERBLT
 3707 Airport Way S
 Seattle, WA 98134
 Phone: 800-266-7383
 Fax: 208-587-3754
 Email:

Bill To:

Hos Brothers Construction
 7733 W Bostan Rd
 PO Box 1788
 Woodinville Outside, WA 98072

Work: (206) 621-8573 Shop: 425-236-3661 Fax:

Customer P/O: 117110p

mathew.austin
 aylor

Orig R/O: 0

Completion Date: 10/02/2023

SEAL	QTY	UNIT PRICE	TOTAL	DESCRIPTION	QTY	UNIT PRICE	TOTAL
SEA21	18		\$114.68	FLYWHEEL TURN	1.00	\$114.68	\$114.68
CUM10			\$12.80	GASKET-CIRCULAR 5"	1.00	\$12.80	\$12.80
CUM10			\$25.60	GASKET-CIRCULAR 5"	2.00	\$12.80	\$25.60
CUM10			\$25.60	GASKET-CIRCULAR 4"	2.00	\$12.80	\$25.60
CUM10			\$66.02	GASKET-DPF ASSY	2.00	\$33.01	\$66.02
CUM10			\$83.35	CLAMP-V BAND	1.00	\$83.35	\$83.35
CUM10			\$33.36	GASKET-AFM DEVICE	2.00	\$16.68	\$33.36
CUM15			\$4.94	SEALO RING	1.00	\$4.94	\$4.94
CUM15			\$23.45	APEX RED (ISX) PAINT	1.00	\$23.45	\$23.45
CUM10			\$6.14	SEAL-O RING	1.00	\$6.14	\$6.14
CUM10			\$22.31	GASKET-CONNECTION	1.00	\$22.31	\$22.31
CUM10			\$39.37	GASKET-AFM DEVICE	1.00	\$39.37	\$39.37
CUM10			\$4.45	GASKET-PUMP HYDRAULIC	1.00	\$4.45	\$4.45
CUM10			\$67.61	CLAMP-BAND	1.00	\$67.61	\$67.61
Tac Scr15			\$3.02	THREAD SEAL	1.00	\$3.02	\$3.02
Tac Scr15			\$3.62	3M SCOTCH-BRITE	1.00	\$3.62	\$3.62
BCA10			\$13.93	BEARING	1.00	\$13.93	\$13.93
Tac Scr15			\$24.50	CRMP SEAL BUTT CONN	26.00	\$0.98	\$24.50
PTBVN			\$6.72	WASHER-SEALING #8	2.00	\$3.36	\$6.72
HOR10			\$998.65	CLUTCH-FAN 2 SPEED	1.00	\$998.65	\$998.65
HOR10			\$549.02	Core Group:H0R79/Core Class:	1.00	\$549.02	\$549.02
Philps15			\$22.00	CABLE TIE-1"BLK NYL 50#	100.00	\$0.22	\$22.00
Philps15			\$44.00	CABLE TIE-1"BLK NYL 120#	100.00	\$0.44	\$44.00
Levha15			\$10.37	AGS SIL-GLYDE LUBE 12/4OZ	1.00	\$10.37	\$10.37
Levha15			\$6.90	ZEP M/C BRAKE CLNR 12/14OZ	1.00	\$6.90	\$6.90
MISC			\$595.41	DPF BAKE	1.00	\$595.41	\$595.41
TRP			\$49.92	CLAMP-CONSTANT TORQUE #44	8.00	\$6.24	\$49.92
PTBPR			\$25.90	HOSE-RADIATOR #40 J20R1-A	1.00	\$25.90	\$25.90
PTBPR			\$26.32	HOSE-RADIATOR #40 J20R1-A	1.00	\$26.32	\$26.32
DYC10			\$41.15	BELT-POLY 6 RIBS X 1620 E	1.00	\$41.15	\$41.15
TRP			\$78.77	BELT-POLY 12 RIBS X 2180	1.00	\$78.77	\$78.77
CUM10			\$47,142.66	ENGINE-ISX 15	1.00	\$47,142.66	\$47,142.66
CUM10			\$9,018.75	Core Group:DR0658800 D/Core Class:	1.00	\$9,018.75	\$9,018.75
TRPGT			\$169.83	COOLANT-TRP ELC 50/50 JU6	17.00	\$9.99	\$169.83

Invoice: 021R3998
 Date: 10/31/2023
 Repair Order: 3998
 Customer: 413689
 Branch: Seat
 Invoice Total: \$68,904.98
 *** Open Account - Charge ***
 Page 2 of 5

Ship To: Hos Brothers Construction
 P. O. BOX 1788
 WOODINVILLE OUTSIDE, WA 98072

DOBBS PETERBILT
 3707 Alport Way S
 Seattle, WA 98134
 Phone: 800-255-7383
 Fax: 208-587-3754
 Email:

Bill To:

Has Brothers Construction
 7733 W Bosolan Rd
 PO Box 1788
 Woodinville Outside, WA 98072

Ship To: Has Brothers Construction
 P. O. BOX 1788
 WOODINVILLE OUTSIDE, WA 98072

Invoice: 021R3998
 Date: 10/31/2023
 Repair Order: 3998
 Customer: 413689
 Branch: Seat
 Invoice Total: \$68,904.98
 *** Open Account - Charge ***
 Page 4 of 5

Customer P/O: 117110P mathew.aurlin ataylor Orig R/O: 0 Completion Date: 10/02/2023
 Work: (206) 621-8573 Shop: 425-236-3961 Fax:

Detail Tax Info:	Sales Tax	Total:	Total:	Total Parts:	Total Core Charge:	Total Core Ret:	Total EHC:	Total Labor:	Total Miscellaneous:	Invoice Subtotal:	Total Tax:	Total Invoice:
	\$6,408.45	\$6,408.45	\$6,408.45	\$51,921.53	\$9,567.77	\$9,567.77	\$0.00	\$0.01	\$10,574.98	\$62,496.53	\$6,408.45	\$68,904.98

Payment Method Open Account -
 Terms Net 30 Days
 Due Date 11/30/2023
 Dobbs Peterbilt - Seattle, WA
 P.O. Box 35144 #1022
 Seattle, WA 98124-5144

LIMITED WARRANTY

THIS LIMITED WARRANTY GIVES YOU SPECIFIC LEGAL RIGHTS AND YOU MAY ALSO HAVE OTHER RIGHTS, WHICH VARY FROM STATE TO STATE.

WHO IS COVERED: The Dealership issuing this invoice (the "Dealership") offers this limited warranty to only you, the customer listed on this repair order/invoice. It does not extend to any subsequent owner. It cannot be transferred to any other person.

WHAT IS COVERED: The Dealership warrants the workmanship of our labor performed in conjunction with repairs for 90 days (the "Warranty Period"). Said Warranty Period commences on the date ("Invoice Date") that the repairs are completed. The following items will void this Limited Warranty: If the failure was caused by misuse, abuse, lack of or improper maintenance, accident, alterations, oversteering, and/or lack of lubrication or coolant. For any failure caused by the Dealership's workmanship (labor) covered by this Limited Warranty, the Dealership will either repair or replace such failure, at its option, in the Dealership facility.

YOUR RESPONSIBILITIES: All items must be returned to our shop with transportation charges prepaid for our inspection and determination within 60 days from the date of the sales invoice covering said items. The customer is required to return the vehicle to the Dealership or authorized repair facility at the customer's expense. You must retain copies of your Repair Orders/Invoices, and, upon request, be able to present them to us when requesting coverage under this Limited Warranty. Upon return of the vehicle to you, you must pay for any parts, labor, products, expenses, freight and taxes that the Dealership is not obligated to provide or pay for under this Limited Warranty.

WHAT IS NOT COVERED: Repairs which are still covered by a manufacturer's warranty or recall or other third party warranty/service contract. The Dealership's Limited Warranty shall be secondary to any such warranty or service contract that provides coverage for repair claims covered hereunder. Damage caused by you for failure to use manufacturer approved fluids, or the lack thereof, including but not limited to oil, antifreeze, and DEF. Any failure or damage resulting from your failure to perform maintenance in accordance with the manufacturer's recommendations; your failure to maintain appropriate fluid levels (e.g. oil, water, DEF, transmission fluid); your continued operation of the vehicle after warning light notification; modification or operation of the vehicle in a manner that is not in conformance with the manufacturer's specifications or intended use; an accident or collision; your use of improper or contaminated fluids including fuel, and/or misuse, abuse, tampering, negligence, theft, vandalism, or acts of nature or God. Parts installed and/or repairs performed on vehicles used primarily for off road competition or engaging in a contest of speed or endurance of any type.

INSPECTION RIGHTS: The Dealership reserves the right to inspect the vehicle and any parts removed from or installed in the vehicle both prior to and after a repair is performed pursuant to a claim made under this Limited Warranty.



Dobbs Peterbilt - Seattle, WA
 3707 Airport Way S
 Seattle, WA 98134
 Phone: 800-255-7383
 Fax: 206-587-3754
 Email:

Bill To:

Hos Brothers Construction
 7733 W Bostan Rd
 PO Box 1788
 Woodinville Outside, WA 98072

Invoice: 021R3998
 Date: 10/31/2023
 Repair Order: 3998
 Customer: 413688
 Branch: Seat
 Invoice Total: \$68,904.98
 *** Open Account - Charge ***
 Page 5 of 5

Ship To: Hos Brothers Construction
 P. O. BOX 1788
 WOODINVILLE OUTSIDE, WA 98072

Customer P/O: 1171100

Work: (206) 621-8573

Shop: 425-236-3961

Fax:

Orig P/O: 0

Completion Date: 10/02/2023

EXCLUSIVE REMEDY: The performance of labor to effect repairs is the exclusive remedy available under this written Limited Warranty. THE PERFORMANCE OF LABOR TO EFFECT REPAIRS IS YOUR SOLE AND EXCLUSIVE REMEDY AND OUR ENTIRE LIABILITY FOR ANY BREACH OF THIS LIMITED WARRANTY. OUR LIABILITY SHALL UNDER NO CIRCUMSTANCES EXCEED THE ACTUAL AMOUNT PAID BY YOU FOR THE LABOR WE SUPPLIED, NOR SHALL WE UNDER ANY CIRCUMSTANCES BE LIABLE FOR ANY CONSEQUENTIAL, INCIDENTAL, SPECIAL OR PUNITIVE DAMAGES OR LOSSES, WHETHER DIRECT OR INDIRECT.

SOME STATES DO NOT ALLOW THE EXCLUSION OR LIMITATION OF INCIDENTAL OR CONSEQUENTIAL DAMAGES, SO THE ABOVE LIMITATION OR EXCLUSION MAY NOT APPLY TO YOU.

IMPLIED WARRANTY DISCLAIMER: The only warranty on parts and products sold in conjunction with repairs performed by the manufacturer or supplier of said parts or products. Except for the limited warranty on the workmanship of our labor, the Dealership expressly disclaims all implied warranties including any implied warranties of the merchantability and fitness for a particular purpose for any period beyond the Warranty Period. WE LIMIT THE DURATION AND REMEDIES OF ALL IMPLIED WARRANTIES, INCLUDING WITHOUT LIMITATION THE WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE TO THE DURATION OF WARRANTY PERIOD.

SOME STATES DO NOT ALLOW LIMITATIONS ON HOW LONG AN IMPLIED WARRANTY LASTS, SO THE ABOVE LIMITATION MAY NOT APPLY TO YOU.

NO ASSUMPTION OF LIABILITY: The Dealership does not authorize any other person to assume for it any liability in connection with the sales of any parts or products of this repair. THE FOLLOWING APPLIES TO ALL OF OUR CUSTOMERS

STORAGE CHARGES: I understand and agree that a daily storage charge may be assessed if I fail to pick up the vehicle after being notified that the repairs have been completed. Storage charges will accrue at the rate of \$45.00 per day beginning 15 days after the date of communication from the Dealership. Repairs to be performed within three days after the date of communication from the Dealership.

DISASSEMBLY/REASSEMBLY CHARGES: If you authorize disassembly of the vehicle or a vehicle component to provide an estimate or commencement of repairs and do not authorize completion of a repair or service, a charge will be imposed for disassembly, reassembly or partially completed work and you agree to pay the same. Such charges will be directly related to the actual amount of labor and parts involved in the inspection, repair or service. I have been advised that disassembly of the vehicle may prevent restoration of the vehicle to its prior condition.

DELAYS AND LEGAL LIABILITY: I understand and agree that the Dealership is not responsible for any delays caused by unavailability of parts or shipping by the supplier or transporter or any losses or downtime relating to such delays, nor is it responsible for loss or damage to the vehicle or articles left in the vehicle in the event of fire, theft, or any other cause beyond its control. The Dealership will not be responsible for personal property. You and your representative agree to hold the Dealership harmless and not liable for any missing or damaged property.

WARNING: Products being sold to you can expose you to chemicals which are known to the State of California to cause cancer, birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov.

Customer Signature: _____

Date: _____