



Benchmark Automotive Services Inc.
 3532 Massey Drive, Prince George, BC, V2N 2M4
 P:(250) 564-5000

J22-20
MAY

Invoice

Bill To Cariboo Railroad Contracting Corp.
 Hawryluk, Tim
 Unit 100-6565 Industrial Way
 Prince George, BC V2N5S6
 Canada

Plate BC MR9149
 Description 2018 GMC Sierra 1500 SLE V8 5.3L 5328CC
 325CID VIN C
 VIN 3GTU2MEC3JG339547
 Unit 45
 Odometer 313,236

Home (250) 612-7010
 Email thawryluk@cariboorail.com

Invoice # 48041
 Work Order # 58168
 Purchase Order # 45
 Service Advisor Missy
 Technician Andrew

Invoice Date 7/11/2025 10:40 AM
 Appointment 5/30/2025 8:00 AM
 Promised 5/30/2025 5:00 PM

Service

Level 1 Diagnostic

Transmission issue - Has been intermittantly making a high pitched squeal. Not consistant with any certain driving condition. Seems to be fine for a while then this will happen once in a while
 - intermittent concern, may be hard to duplicate, will need to check the basics and go from there - road test, scan, check fluids, run it in the air

Initial diagnosis, testing, inspection and research of the specific vehicle system as required. Perform road test where applicable. Report test result(s), system fault(s), component(s) failure and required repair(s). Additional diagnosis and testing time may be required at additional charges.

Labor \$179.95 *1GP
 Sub \$179.95

Technicians' Notes:

- Took for road test and confirmed client concern (kinda).
- Took for drive up university and found when it wanted to downshift it would squeal just slightly and only for a fraction of a second.
- Brought into shop and inspection transmission fluid level and condition, the level is okay, but the fluid is dark and smells very very burnt.
- I suspect the transmission is in the way out.

Transmission Service Level 2 - Remove transmission pan and inspect filter for metal contaminates

Road test transmission operation. Scan for codes. Inspect, clean and flush transmission fluid. Service filter and pan gasket. Removes contaminants and extends life of transmission. (Plus fluid and parts)

Labor \$144.95 *1GP
 Sub \$144.95

Technicians' Notes:

- Removed pan and filter.
- Cut filter open and found clutch material and some larger metal flakes.
- I suspect a service won't prolong the life of the transmission. I would recommend replacement.

Automatic Transmission Assembly, Remove & Install - REMAN - 2 year 60,000 warranty

Remove and Replace components as required to access and install materials, and/or perform needed service, adjustments as required. Additional fluids may be required to complete this service. Retest and verify repair as required. Perform final road test where applicable.

Labor		\$1,369.80 *1GP
Transmission Reman	1 Unit	\$4,608.87 *2GP
Exhaust Clamp	1 Unit	\$73.68 *2GP
Seal	1 Unit	\$21.21 *2GP
Exhaust Gasket	1 Unit	\$35.45 *2GP
Manifold Stud Kit	1 Unit	\$26.73 *2GP
A/C Condenser with Transmission Cooler	1 Unit	\$549.74 *2GP
Cooler Thermal Valve	1 Unit	\$207.01 *2GP
Exhaust Gasket	1 Unit	\$44.56 *2GP

Dexron VI ATF fluid	9.2 Unit	\$195.59 *2GP
Freight	1 Unit	\$584.62 GP
		Sub <u>\$7,717.06</u>

Technicians' Notes:

-All "Y" pipe nuts to the manifold were difficult to remove, most came off except for one that rounded off due to being siezed. Instead of cutting the stud off the manifold and have to perform an extraction, I ground down the exterior of the nut and tapped it off with a punch. (Pictured).

- Found transmission had been replaced previously and some small hold downs were broken as well as the starter plug, secured plug and hold downs with zip ties.
- Found some missing nuts, installed new aftermarket nuts.
- filled trans with 9.2L DEXOS 6.
- Replaced one manifold studs due to damage. Had to cut nut off and heat manifold studs due red hot to remove.
- Installed new stud in drivers manifold.

Air Conditioning Evac And Recharge R1234YF

Evacuate refrigerant from system . Inspect and test for leaks . recharge system. Test system efficiency. (Plus refrigerant)

Labor		\$399.88 *1GP
R-1234YF Refrigerant	19.4 Ounce	\$300.51 *2GP
		Sub <u>\$700.39</u>

Technicians' Notes:

Charged 0.55kg of R1234YF. installed 1/2 ounce dye

Computer Re-Program

Please acquire all active keys and fobs prior to re-flash. Re-program vehicle computers, modules or control units with updated information or programs from manufacturers data base. Re-test and road test operation to verify repair. *Note, re-flash / re-program does not include aftermarket products.

Labor		\$195.95 *1GP
		Sub <u>\$195.95</u>

Technicians' Notes:

Reprogrammed TCM and reset Adaptive relearn.

Complimentary DVVI "A" - No Charge

Complimentary 27 Point Inspection

Labor		\$0.00 *1GP
		Sub <u>\$0.00</u>

Technicians' Notes:

- TPMS.
- Windshield cracked.

Vehicle Look Over Inspection

Look over vehicle for pre existing damage , take pictures of all damage areas , take four corner pictures, take picture of gauge cluster with vehicle running.

Labor		\$0.00 *1GP
		Sub <u>\$0.00</u>

Total Parts		\$6,063.15
Total Labor	Job Code: Cariboo TI	\$2,290.53
Total Sublet	Equipment Unit #: 45	\$584.62
Total Before Taxes & Miscellaneous Charges	Comment: <i>Tim Hawryluk</i>	\$8,938.30
(*1) Shop Supplies on Labour		\$75.00 PG
(*2) Shop Supplies on Parts		\$75.00 GP
(G) Canada Revenue Agency (GST)		\$454.42
(P) BC Provincial Sales Tax	7 %	\$636.18
Grand Total		\$10,178.90

Warranty Statement – Benchmark Automotive Services Inc.

All parts and labour provided by Benchmark Automotive Services Inc. are covered by a 1-year / 20,000 km warranty (whichever comes first) from the date of invoice. This warranty covers defects in workmanship and manufacturer defects in parts supplied by us.

Conditions:

- Warranty is valid only if the vehicle is returned to Benchmark Automotive Services Inc. for inspection and/or repairs.
- Warranty does not cover damage caused by misuse, neglect, accidents, racing, or modifications.
- Customer-supplied parts are not covered under this warranty.
- Routine maintenance, diagnostic services, and wear-and-tear items (e.g., brakes, wipers,seals, filters) are not included.

Please retain this invoice as proof of warranty coverage.
If you experience any issues, please contact us promptly so we can assess and resolve the matter efficiently.

Cariboo Railroad Contracting Corp. charged \$10,178.90 to Account - 179 - Cariboo Railroad Contracting Corp. - Over Due 90 Days

Authorization(s)

5/29/2025 2:57 PM	\$224.12	In Person / Other Authorized by Cariboo Railroad Contracting Corp.
6/25/2025 1:32 PM		In Person / Other
Additional Cost	\$9,977.21	Authorized by Cariboo Railroad Contracting Corp.
Revised Authorization	\$10,201.33	



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 1 of 13
 02/25/2025 4:44 PM

CARIBOO RAILROAD CONTRACTING CORP

#117 3030 Pandosy St
 Kelowna, BC V1Y 0C4
 thawryluk@cariboorail.com
 +1 250-612-7010

2018 GMC Sierra 1500

3GTU2MEC3JG339547
 Engine: 5.3L V8 (C) L83
 FLEX FI
 Plate: WG0193
 Fleet #: 45
 Odometer In: 302266
 Odometer Out: 302268

Advisor: Laura Letendre
 Technician: 8 Sophie Ireland

GRAND TOTAL: \$4,670.87

BALANCE DUE: \$4,670.87

Reason for Customer's Visit

noise coming from front end, grinding noise from rear

SERVICES

1 Courtesy Vehicle Health & Safety Inspection & Check-In **SUBTOTAL: \$0.00**

LABOR

VEHICLE WALKAROUND
 RECORD KILOMETERS, LIC PLATE, VIN, & ENGINE HOURS (WHERE APPLICABLE)
 RECORD ENGINE HOURS (WHERE APPLICABLE) RECORD VEHICLE OPTIONS (AWD, 4X4, 2WD, A/C, AUTO, MANUAL)
 VEHICLE PRE-SCAN & DIGITAL VEHICLE INSPECTION - INCLUDES TESTING BLOCK HEATER
 "GOOD TO GO" COURTESY BATTERY TEST (For vehicles with easily accessible battery)
 TEST DRIVE (Cannot be performed if vehicle appears unsafe or other issues arise)

2 Complete Suspension Check-over/Inspection **SUBTOTAL: \$81.50**

customer said noise coming from front

LABOR

Test Drive
 Visual Inspection
 Grease Components (if necessary)
 ROAD TEST NO NOISES HEARD. VISUAL INSPECTION FOUND FRONT STRUTS LEAKING, UPPER BALL JOINTS HAVE SLIGHT PLAY, RH FRONT WHEEL BEARING VERY EXCESSIVE PLAY. LH FRONT BEARING FEELS SMOOTH WHEN SPUN.

3 Brake Inspection - Incl Test Drive & Wheel Removal **SUBTOTAL: \$104.00**

grinding noise coming from back

LABOR

Test drive
 Wheels off inspection
 Rotate tires as necessary
 Check and adjust tire pressure



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 2 of 13
 02/25/2025 4:44 PM

PERFORM BRAKE INSPECTION. FOUND FRONT BRAKES 8MM REMAIN, REAR BRAKES 10MM REMAIN. VERY SLIGHT UNEVEN WEAR ON REAR ROTORS, NO CONCERN PRESENT. ROAD TEST OK.

4 LiquiMoly - Premium Oil Service for HD Diesel or Gasoline Engine Oil Service (LOF Truck & Motorhome up to 5500)

SUBTOTAL: \$280.52

LABOR

- Drain and fill engine oil:
- Replace engine oil filter
- Replace Drain Plug and/or Gasket
- Lubricate suspension components as needed
- Reset Maintenance Monitor & Apply Service Reminder Label to Windshield
- Verify Engine Oil Level (Time & Procedures vary by manufacture)
- Top up coolant & WW Fluid as needed

DISCLAIMER: *** OIL STICKER PROVIDED WILL BE SHOWN IN 'MILES' AND NOT 'KILOMETERS', IT IS NOT SOMETHING WE CAN CHANGE AND FOR ALL INTENTS AND PURPOSES WE ARE REFERRING TO KM'S.

PARTS	QTY	EACH	TOTAL
OIL FILTER	1.0	\$7.74	\$7.74
0W-20 Synthetic Motor Oil	7.6	\$10.74	\$81.62
Washer Fluid Reservoir Cap	1.0	\$40.98	\$40.98
PREMIUM HD AIR FILTER	1.0	\$56.66	\$56.66

HAZMATS & FEES	QTY	FEE	TOTAL
Filter Enviro	1.0	\$1.00	\$1.00
Enviro	7.6	\$0.20	\$1.52

5 Remove & Replace: Control Arm

SUBTOTAL: \$1,114.40

LABOR

Remove & Replace: CONTROL ARM DOES NOT include alignment.

PARTS	QTY	EACH	TOTAL
Suspension Control Arm and Ball Joint Assembly	1.0	\$351.82	\$351.82
Suspension Control Arm and Ball Joint Assembly	1.0	\$351.82	\$351.82

6 Remove & Install Or Remove & Replace: Shock &/or Strut Assembly

SUBTOTAL: \$1,494.94

LABOR

Remove & Install or Remove & Replace: SHOCK &/OR STRUT ASSEMBLY DOES NOT include disassemble or alignment (where applicable).

PARTS	QTY	EACH	TOTAL
-------	-----	------	-------



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 3 of 13
 02/25/2025 4:44 PM

Suspension Strut Assembly	2.0	\$560.02	\$1,120.04
---------------------------	-----	----------	------------

7 Remove & Replace: Wheel Hub

SUBTOTAL: \$935.08

LABOR

Remove & Replace: WHEEL HUB

PARTS

	QTY	EACH	TOTAL
Wheel Bearing and Hub Assembly	1.0	\$638.42	\$638.42

8 Precision Four Wheel Alignment

SUBTOTAL: \$200.00

LABOR

Test drive before alignment
 Inspect ALL wheels, tires, steering & suspension components, shocks and/or struts
 Adjust tire pressures to factory specifications (if needed)
 Measure and record pre-alignment condition
 Perform alignment adjustments to factory specifications
 EXTRA TIME FOR RUSTED/SEIZED COMPONENTS
 Measure and record post-alignment condition
 Center steering wheel; calibrate zero point position (as needed)
 Test drive after alignment

9 INSTALL MISSING SPARE TIRE ASSEMBLY COMPONENTS

SUBTOTAL: \$163.00

LABOR

INSTALL MISSING SPARE TIRE ASSEMBLY COMPONENTS

10 QUALITY CONTROL - FINAL CHECK

SUBTOTAL: \$0.00

LABOR

Final Road Test
 Record final Kilometers
 Torque Tag: Placed on one of the following: Mirror - Shift Lever - Turn signal stock - Other
 Warning Lights & Diagnostic System Post-Scan
 Any & All Engine Covers, skid pans, & other trim pieces re-installed
 Client Driving Position & Cleanliness Check

HAZMATS & FEES	QTY	FEE	TOTAL
Branded Torque Tag	1.0	\$0.00	\$0.00
Nitrile Gloves - 1 Pair	1.0	\$0.00	\$0.00
Cleaning Wipes	1.0	\$0.00	\$0.00



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 4 of 13
 02/25/2025 4:44 PM

Terms of Service:

****Any jobs that require the removal of wheels/tires REQUIRE A RE-TORQUE within 100kms. Failure to do so could cause wheels to loosen, possibly causing an accident or damage.****

WE THANK YOU FOR CHOOSING CITY CENTRE AUTOMOTIVE FOR YOUR AUTO REPAIR NEEDS. TO SERVE YOU BETTER, WE HAVE A NATIONAL 2YR, 40,000km "Peace of Mind WARRANTY" PROGRAM THROUGH NAPA AUTOPRO, as well as our exclusive 10/400 Powertrain Warranty.

FOR ANY WARRANTY CONCERNS WHILE TRAVELLING, PLEASE CALL 1-866-GET-NAPA AND YOU WILL BE DIRECTED TO THE AUTOPRO/AUTOCARE NEAREST YOU.

ENTER FOR A CHANCE TO WIN \$50-\$100 ON OUR ONLINE SURVEY. @ napa-autopro-survey.com OR TRY OUR NEW MOBILE VERSION @ tinyurl.com/napaautopro. By signing this document or the duplicate onboarding form you agree to the following:

1. **DISCLAIMER REGARDING QUOTES and ESTIMATES:**
 Please note that all repair quotes provided by CITY CENTRE AUTOMOTIVE are estimates based on the information available at the time of assessment. While we make every effort to ensure the accuracy of our estimates, unforeseen circumstances may arise during the repair process, leading to adjustments in costs and timelines. Factors such as the discovery of additional damage, parts availability, and other unforeseeable complications may affect the final cost and duration of the repair. Therefore, the estimate provided should be considered as an approximation rather than a definitive price. We strive to keep our customers informed throughout the repair process and will notify you promptly of any changes to the initial estimate. Your understanding and cooperation in such situations are greatly appreciated.

2. **CUSTOM WORK, WIRING/ELECTRICAL and ACCESSORY INSTALLATIONS:**
 Due to the nature of the above mentioned work, service time is billed out at a straight hourly rate. (Hourly rate is dependent on the nature of the repair/installation/work)
 Upfront payments/deposits may be required.

3. **DISCLAIMER REGARDING VEHICLES and PERSONAL BELONGINGS IN OUR POSSESSION:**
 We take all necessary precautions to ensure your vehicle is safe while in our care, however, we are not responsible for damaged vehicles or the contents within them. Subsequently we are not responsible for lost/stolen property or vehicle thefts. If there are concerns with leaving your vehicle in our care long term (weeks, months, or more at a time), we recommend arranging to have the vehicle picked up.

4. **STORAGE FEES:**
 In the event that a vehicle is left with us over a long term, and that no prior arrangements have been made, a storage fee of \$30/day will be applied to the repair order. This applies to customer whom which we cannot make contact and vehicles left in our possession longer than one week after work is complete.

5. **SERVICE CHARGES and INTEREST:**
 For customers with charge/credit accounts, service charges of 8% per month will be applied to ALL unpaid Invoices past the 30 day period.

6. **"YES, DO THIS WORK"**
 I hereby authorize the corresponding service to be done along with the

GRAND TOTAL: \$4,670.87

Total Labor: \$1,721.82
 Total Parts: \$2,649.10
 Total Fees: \$2.52
 Total Sublets: \$0.00
 Materials & Consumables: \$75.00
 Sales Tax: \$222.43

BALANCE DUE: \$4,670.87

Job Code: caribooti
Equipment Unit #: unit 45
Comment: repairs

Tim Hawrylu



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 5 of 13
02/25/2025 4:44 PM

necessary materials.

7. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

City Centre Automotive staff may operate my vehicle for the purpose of testing, inspection, and delivery.

8. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

9. "ONLINE and TEXT COMMUNICATION OK"

I welcome emails and text messages from City Centre Automotive as a means of receiving copies of my estimate, work order, and invoice.

"HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to the above terms.

Authorization:

CARIBOO RAILROAD CONTRACTING CORP

02/24/2025



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 6 of 13
02/25/2025 4:44 PM

INSPECTION REPORT

Courtesy Vehicle Health & Safety Inspection & Check-In

WALK-AROUND



Written by Kevin Robinson at 02/24/2025 10:16 AM

MAINTENANCE REMINDER: Oil Service Indicator (window sticker or OB maintenance monitor) CHECK FUEL FILTER SERVICE INTERVAL (Diesel Vehicles ONLY)

STICKER INDICATES OIL CHANGE REQUIRED



LiquiMoly - Premium Oil Service for HD Diesel or Gasoline Engines Approved by CARIBOO RAILROAD CONTRACTING CORP, 12:32pm 2/24/25
\$280.52 +tax

Tom Howler

Written by Kevin Robinson at 02/24/2025 10:16 AM

"GOOD TO GO" - Battery Test Results & Condition of Battery Terminals



Written by Kevin Robinson at 02/24/2025 10:36 AM

VEHICLE START UP: Confirm proper operation of instrument cluster and note any warning lights

Tpms light on





City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 10 of 13
02/25/2025 4:44 PM



Written by Kevin Robinson at 02/24/2025 10:21 AM

- Front Brake Rotors
- Rear Brake Pads

Rear brakes 10mm



Written by Kevin Robinson at 02/24/2025 10:21 AM

- Rear Brake Rotors

Slight uneven wear on rotors



Written by Kevin Robinson at 02/24/2025 10:22 AM

- Check all brake hoses, calipers, and hardware
- Parking Brake Operation
- Brake Hard Lines
- PARTS NEEDED
- NOTES

LiquiMoly - Premium Oil Service for HD Diesel or Gasoline Engine Oil Service (LOF Truck & Motorhome up to 5500)

- NOTES:

Precision Four Wheel Alignment

- Tire pressure before alignment
- Road test before alignment
- Check shock absorbers
- Check Front & Rear Suspension & Steering Components



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 7 of 13
02/25/2025 4:44 PM

Written by Kevin Robinson at 02/24/2025 10:17 AM

TEST DRIVE NOTES:

INTERIOR: HVAC Controls, Cabin Air Filter, Entertainment Unit, Door Hardware (handles & locks), Window Controls, Multi-Function Controls

EXTERIOR: Glass, Lighting, Wipers, Trim

ENGINE START UP & IDLE - note odd noises, vibrations, slow crank, etc.

ON BOARD DIAGNOSTICS (OBD): System Pre-scan results: CEL, TPMS, ABS, STAB CONTROL, SRS, BATTERY, ETC.


Stored codes in modules. No lights or drivability concerns. Tpms light on



Written by Kevin Robinson at 02/24/2025 10:36 AM

UNDERHOOD: Accessory Belt System, Engine Air Filter, Upper Engine, Radiator, Coolant Tank & Hoses, A/C components, Engine Block Heater Plugin

Washer fluid tank missing cap, belt good, oil down to half and slightly dirty. Air filter in fair condition, air box retaining SCREWS at lid damaged.

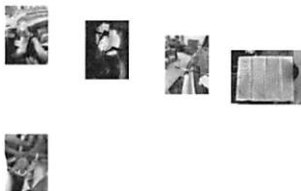

Written by Kevin Robinson at 02/24/2025 10:18 AM

FLUIDS: Coolant Level, Condition & Strength, Engine Oil, Brake & P/S Fluid Levels,

Engine oil down to half, sticker recommends service oil slightly dirty



Written by Kevin Robinson at 02/24/2025 10:18 AM

DRIVELINE: Differential/T-case/Transmission Fluid Levels & Condition



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 8 of 13
02/25/2025 4:44 PM

Previously recommended a driveline service. Can confirm that all fluids are still dark and need changed.

Written by Brett Hunziker at 02/24/2025 12:21 PM

- UNDERCAR: Steering & Suspension Components, Lower Engine, Transmission, Driveline Components, Exhaust System, Hard Lines & Hoses (fuel, brake, A/C)

Rear pinion seal appears to have seepage. Not dripping at this time



Written by Kevin Robinson at 02/24/2025 10:25 AM

- BRAKES: Linings, Surfaces, Calipers, Parking Brake Operation
- TIRES: Size, Brand, Measurements, Condition, Tread-wear, ALL MATCHING?
- OTHER: Findings & Notes

Complete Suspension Check-over/Inspection

Suspension Arms & Ball Joints

Play in upper ball joints



Remove & Replace: Control Arm \$1114.40 +tax

Approved by CARIBOO RAILROAD CONTRACTING CORP, 12:32pm 2/24/25

Tim Hourie

Written by Kevin Robinson at 02/24/2025 10:19 AM

- Stabilizer Bar
- Steering Gear
- Steering Components

Shocks/Struts

Front struts leaking



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 9 of 13
02/25/2025 4:44 PM



Precision Four Wheel Alignment \$200.00 +tax

Approved by CARIBOO RAILROAD CONTRACTING CORP, 12:32pm 2/24/25

Tim Hourie

Remove & Install Or Remove & Replace: Shock &/or Strut Assembly \$1494.94 +tax

Approved by CARIBOO RAILROAD CONTRACTING CORP, 12:32pm 2/24/25

Tim Hourie

Written by Kevin Robinson at 02/24/2025 10:20 AM

Drive Components (if applicable)

Rh front wheel bearing has excessive play. Lh front feels smooth



<https://services.shop->

[ware.com/uploads/v1/original/ifixaXossFkeUD6u8BMWm](https://services.shop-ware.com/uploads/v1/original/ifixaXossFkeUD6u8BMWm)

Remove & Replace: Wheel Hub \$935.08 +tax

Approved by CARIBOO RAILROAD CONTRACTING CORP, 12:32pm 2/24/25

Tim Hourie

Written by Kevin Robinson at 02/24/2025 10:21 AM

PARTS NEEDED

NOTES

Brake Inspection - Incl Test Drive & Wheel Removal

- TEST DRIVE Braking performance
- Tire Pressures
- Confirm ABS function (where applicable)
- Brake Lights
- Brake Fluid (Level & Quality)
- Front Brake Pads

Front brakes 8mm



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 11 of 13
02/25/2025 4:44 PM

- Check subframe
- Check wheel/rim/tire condition
- PRE & POST ALIGNMENT RESULTS ATTACHED - Actuals completed within factory specifications
- NOTES

QUALITY CONTROL - FINAL CHECK

- Post-Road test kilometers
- Torque Tag - _____
- Warning Lights Present?**
- Post-Scan Results - If relevant
- Re-installation of ALL covers, plates, air dams, etc
- Driving Position & Cleanliness
- FINAL NOTES:



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 12 of 13
02/25/2025 4:44 PM

FINDINGS

REMOVE AND REPLACE: AIR CLEANER ELEMENT BOX
\$643.72 +tax

Declined for Now by CARIBOO RAILROAD CONTRACTING CORP, 12:32pm 2/24/25
Tim Hoville

Written by Laura Letendre at 02/24/2025 11:52 AM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54570
Fleet PO# CARIBOO.TI

Page 13 of 13
02/25/2025 4:44 PM

Past Recommendations

DRIVELINE SERVICE (NOT INCL. TRANSMISSION)
\$419.81 +tax

Declined for Now by CARIBOO RAILROAD CONTRACTING CORP, 12:32pm 2/24/25

Tim Howarth

INSTALL MISSING SPARE TIRE ASSEMBLY
COMPONENTS \$163.00 +tax

Approved by CARIBOO RAILROAD CONTRACTING CORP, 12:32pm 2/24/25

Tim Howarth

Remove & Replace: Oil Pan Gasket \$559.66 +tax

Declined for Now by CARIBOO RAILROAD CONTRACTING CORP, 12:32pm 2/24/25

Tim Howarth



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 1 of 18
 01/22/2025 10:57 AM

CARIBOO RAILROAD CONTRACTING CORP
 #117 3030 Pandosy St
 Kelowna, BC V1Y 0C4
 Tfrohlich@cariboorail.com
 +1 250-640-0553

2018 GMC Sierra 1500
 3GTU2MEC3JG339547
 Engine: 5.3L V8 (C) L83
 FLEX FI
 Plate: WG0193
 Fleet #: 45
 Odometer In: 295709
 Odometer Out: 295715

Advisor: Harley Moon
 Technician: 5 Lee Wood

GRAND TOTAL: \$1,389.59

BALANCE DUE: \$1,389.59

Reason for Customer's Visit

randomly revs up

SERVICES

1 Vehicle Check-in & DVI (Digital Vehicle Inspection) SUBTOTAL: \$0.00

LABOR

VEHICLE WALKAROUND

RECORD KILOMETERS, LIC PLATE, VIN, & ENGINE HOURS (WHERE APPLICABLE)
 RECORD ENGINE HOURS (WHERE APPLICABLE) RECORD VEHICLE OPTIONS (AWD, 4X4, 2WD, A/C, AUTO, MANUAL)

VEHICLE PRE-SCAN & DIGITAL VEHICLE INSPECTION

TEST DRIVE (Cannot be performed if vehicle appears unsafe or other issues arise)

"GOOD TO GO" COURTESY BATTERY TEST (For vehicles with easily accessible battery)

Labor: \$0.00
 Parts: \$0.00
 Fees: \$0.00
 Sublet: \$0.00

2 check & advise: randomly revs up SUBTOTAL: \$163.00

LABOR

test drove and could not verify concern, found vehicle only reved up when getting going at a light will rev to about 2700 which is a bit high but did not find it to be random, would like more information, found 2 dtcs for the P0172 and P0174 Fuel trim running rich bank 1 and 2 codes, using identifix found test resetting the fuel trim and disconnecting the pcv hose and plugging the pcv valve and monitored the fuel trim, found to run good and did not fail test at this time and DTC's is not active, cleared dtc's should be monitored. found transmission fluid is dark and smell burn. would recommend an transmission service as could be related to the concern. no repair at this made or recommend at this time.

Labor: \$163.00
 Parts: \$0.00
 Fees: \$0.00
 Sublet: \$0.00

3 Remove & Replace: Transmission Oil Pan Gasket &/or Filter SUBTOTAL: \$753.68

LABOR

Remove & Replace: TRANSMISSION OIL PAN GASKET &/OR FILTER

Performed transmission service. Removed oil pan. Found some clutch material in fluid. No major metal shavings found. Removed and replaced transmission oil filter. Clean gasket surfaces and gasket reinstalled pan. Filled the fluid. Test drove vehicle. Found vehicle howling slightly at higher speeds under slight acceleration before down shift. Noise was confirmed from previous technician to be there . Feels like transmission is delaying downshift and hanging up slightly intermittantly. Suspect transmission issues would need further diag

Labor: \$530.57
 Parts: \$221.91
 Fees: \$1.20
 Sublet: \$0.00



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 2 of 18
 01/22/2025 10:57 AM

PARTS	PART #	QTY	EACH	TOTAL
AUTOMATIC TRANSMISSION/Transmission Filter Kit	58369	1.0	\$102.68	\$102.68
Multi-Vehicle ATF (BULK 208L)	126542	6.0	\$16.99	\$101.94
Trans-P/S Flush	TT16CA	1.0	\$17.29	\$17.29
HAZMATS & FEES		QTY	FEE	TOTAL
Enviro		6.0	\$0.20	\$1.20

4 Remove & Replace: Cabin Air Filter **SUBTOTAL: \$163.00**

LABOR Labor: \$122.25
 Remove & Replace: CABIN AIR FILTER Parts: \$40.75
Fees: \$0.00
Sublet: \$0.00

PARTS	PART #	QTY	EACH	TOTAL
CABIN AIR FILTER	230129	1.0	\$40.75	\$40.75

5 CHECK AND ADVISE; OIL PAN LEAKING **SUBTOTAL: \$32.60**

LABOR Labor: \$32.60
 CHECKING OIL PAN FOR LEAKS Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

6 LOF: Premium Oil Service for Gasoline Engines - (synthetic or conventional) \$65 plus Oil & Filter **SUBTOTAL: \$156.33**

LABOR Labor: \$65.00
 Drain and fill engine oil Parts: \$88.81
 Replace engine oil filter Fees: \$2.52
 Replace Drain plug and/or gasket Sublet: \$0.00
 Lubricate suspension components as needed
 Reset Maintenance Monitor & Apply Service Reminder Label to Windshield
 Verify Engine Oil Level (Time & Procedures vary by manufacture)
 Top up Coolant & WW Fluid as needed
 DISCLAIMER: *** OIL STICKER PROVIDED WILL BE SHOWN IN 'MILES' AND NOT 'KILOMETERS', IT IS NOT SOMETHING WE CAN CHANGE AND FOR ALL INTENTS AND PURPOSES WE ARE REFERRING TO KM'S.

PARTS	PART #	QTY	EACH	TOTAL
OIL FILTER	100255	1.0	\$7.19	\$7.19
0W-20 (60L Keg)	LM20366	7.6	\$10.74	\$81.62

HAZMATS & FEES		QTY	FEE	TOTAL
Filter Enviro		1.0	\$1.00	\$1.00
Enviro		7.6	\$0.20	\$1.52



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 3 of 18
01/22/2025 10:57 AM

7 QUALITY CONTROL - FINAL CHECK

SUBTOTAL: \$0.00

LABOR

Final Road Test
Record final Kilometers
Torque Tag: Placed on one of the following: Mirror - Shift Lever - Turn signal stock - Other
Warning Lights & Diagnostic System Post-Scan
Any & All Engine Covers, skid pans, & other trim pieces re-installed
Client Driving Position & Cleanliness Check

Labor: \$0.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

HAZMATS & FEES

	QTY	FEE	TOTAL
Branded Torque Tag	1.0	\$0.00	\$0.00
Nitrile Gloves - 1 Pair	1.0	\$0.00	\$0.00
Cleaning Wipes	1.0	\$0.00	\$0.00

Terms of Service:

****Any jobs that require the removal of wheels/tires REQUIRE A RE-TORQUE within 100kms. Failure to do so could cause wheels to loosen, possibly causing an accident or damage.****

WE THANK YOU FOR CHOOSING CITY CENTRE AUTOMOTIVE FOR YOUR AUTO REPAIR NEEDS. TO SERVE YOU BETTER, WE HAVE A NATIONAL 2YR, 40,000km "Peace of Mind WARRANTY" PROGRAM THROUGH NAPA AUTOPRO, as well as our exclusive 10/400 Powertrain Warranty.

FOR ANY WARRANTY CONCERNS WHILE TRAVELLING, PLEASE CALL 1-866-GET-NAPA AND YOU WILL BE DIRECTED TO THE AUTOPRO/AUTOCARE NEAREST YOU.

ENTER FOR A CHANCE TO WIN \$50-\$100 ON OUR ONLINE SURVEY.

@ napa-autopro-survey.com OR TRY OUR NEW MOBILE VERSION @ tinyurl.com/napaautopro. By signing this document or the duplicate onboarding form you agree to the following:

1. DISCLAIMER REGARDING QUOTES and ESTIMATES:

Please note that all repair quotes provided by CITY CENTRE AUTOMOTIVE are estimates based on the information available at the time of assessment. While we make every effort to ensure the accuracy of our estimates, unforeseen circumstances may arise during the repair process, leading to adjustments in costs and timelines. Factors such as the discovery of additional damage, parts availability, and other unforeseeable complications may affect the final cost and duration of the repair. Therefore, the estimate provided should be considered as an approximation rather than a definitive price. We strive to keep our customers informed throughout the repair process and will notify you promptly of any changes to the initial estimate. Your understanding and cooperation in such situations are greatly appreciated.

2. CUSTOM WORK, WIRING/ELECTRICAL and ACCESSORY INSTALLATIONS:

Due to the nature of the above mentioned work, service time is billed out at a straight hourly rate. (Hourly rate is dependent on the nature of the repair/installation/work)
Upfront payments/deposits may be required.

GRAND TOTAL: \$1,389.59

Total Labor: \$913.42
Total Parts: \$351.47
Total Fees: \$3.72
Total Sublets: \$0.00
Materials & Consumables: \$54.81
Sales Tax: \$66.17

BALANCE DUE: \$1,389.59

Job Code: CARIB00.TI

Task Code: A16NB

Equipment Unit #: 45

Comment: LOF, TRANS

Tammy Froelich

Jan 27, 2025

Rec Jan 22/25



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 4 of 18
01/22/2025 10:57 AM

3. DISCLAIMER REGARDING VEHICLES and PERSONAL BELONGINGS IN OUR POSSESSION:

We take all necessary precautions to ensure your vehicle is safe while in our care, however, we are not responsible for damaged vehicles or the contents within them. Subsequently we are not responsible for lost/stolen property or vehicle thefts. If there are concerns with leaving your vehicle in our care long term (weeks, months, or more at a time), we recommend arranging to have the vehicle picked up.

4. STORAGE FEES:

In the event that a vehicle is left with us over a long term, and that no prior arrangements have been made, a storage fee of \$30/day will be applied to the repair order. This applies to customer whom which we cannot make contact and vehicles left in our possession longer than one week after work is complete.

5. SERVICE CHARGES and INTEREST:

For customers with charge/credit accounts, service charges of 8% per month will be applied to ALL unpaid Invoices past the 30 day period.

6. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

7. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

City Centre Automotive staff may operate my vehicle for the purpose of testing, inspection, and delivery.

8. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

9. "ONLINE and TEXT COMMUNICATION OK"

I welcome emails and text messages from City Centre Automotive as a means of receiving copies of my estimate, work order, and invoice.

"HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to the above terms.

Authorization:



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 5 of 18
01/22/2025 10:57 AM

INSPECTION REPORT

Vehicle Check-in & DVI (Digital Vehicle Inspection)

- WALK-AROUND
- MAINTENANCE REMINDER: Oil Service Indicator (window sticker or OB maintenance monitor) CHECK FUEL FILTER SERVICE INTERVAL (Diesel Vehicles ONLY)
- "GOOD TO GO" - Battery Test Results & Condition of Battery Terminals
- VEHICLE START UP: Confirm proper operation of instrument cluster and note any warning lights
- TEST DRIVE NOTES:
- INTERIOR: HVAC Controls, Cabin Air Filter, Entertainment Unit, Door Hardware (handles & locks), Window Controls, Multi-Function Controls
- EXTERIOR: Glass, Lighting, Wipers, Trim
- ENGINE START UP & IDLE - note odd noises, vibrations, slow crank, etc.
- ON BOARD DIAGNOSTICS (OBD): System Pre-scan results: CEL, TPMS, ABS, STAB CONTROL, SRS, BATTERY, ETC.
- UNDERHOOD: Accessory Belt System, Engine Air Filter, Upper Engine, Radiator, Coolant Tank & Hoses, A/C components, Engine Block Heater Plugin
- FLUIDS: Coolant Level, Condition & Strength, Engine Oil, Brake & P/S Fluid Levels,
- DRIVELINE: Differential/T-case/Transmission Fluid Levels & Condition
- UNDERCAR: Steering & Suspension Components, Lower Engine, Transmission, Driveline Components, Exhaust System, Hard Lines & Hoses (fuel, brake, A/C)
- BRAKES: Linings, Surfaces, Calipers, Parking Brake Operation
- TIRES: Size, Brand, Measurements, Condition, Tread-wear, ALL MATCHING?
- OTHER: Findings & Notes

check & advise: randomly revs up

- test drive & inspection

Remove & Replace: Transmission Oil Pan Gasket &/or Filter

- Transmission pan

LOF: Premium Oil Service for Gasoline Engines - (synthetic or conventional) \$65 plus Oil & Filter

- NOTES:



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54267

Fleet PO# 45

Page 6 of 18
01/22/2025 10:57 AM

QUALITY CONTROL - FINAL CHECK

- Post-Road test kilometers
- Torque Tag - _____
- Warning Lights Present?**
- Post-Scan Results - If relevant
- Re-installation of ALL covers, plates, air dams, etc
- Driving Position & Cleanliness
- FINAL NOTES:



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 7 of 18
01/22/2025 10:57 AM

FINDINGS

WALK-AROUND



[https://services.shop-](https://services.shop-ware.com/uploads/v1/original/agNli9aL2jLn7bEdNJ3be)

[ware.com/uploads/v1/original/agNli9aL2jLn7bEdNJ3be](https://services.shop-ware.com/uploads/v1/original/agNli9aL2jLn7bEdNJ3be)

Written by 5 Lee Wood at 01/17/2025 03:27 PM

MAINTENANCE REMINDER: Oil Service Indicator (window sticker or OB maintenance monitor) CHECK FUEL FILTER SERVICE INTERVAL (Diesel Vehicles ONLY)

Over due.



Written by 5 Lee Wood at 01/17/2025 03:27 PM

VEHICLE START UP: Confirm proper operation of instrument cluster and note any warning lights

TPMS FLASHING

Written by 5 Lee Wood at 01/17/2025 03:27 PM

"GOOD TO GO" - Battery Test Results & Condition of Battery Terminals



Written by 5 Lee Wood at 01/17/2025 03:27 PM

UNDERHOOD: Accessory Belt System, Engine Air Filter, Upper Engine, Radiator, Coolant Tank & Hoses, A/C components, Engine Block Heater Plugin

Coolant level is low.
Missing washer fluid cap,

Written by 5 Lee Wood at 01/17/2025 03:27 PM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 8 of 18
01/22/2025 10:57 AM

TEST DRIVE NOTES:

Found engine revs to about 2700 before shifting and not often but did it after a stopping at a light.

Written by 5 Lee Wood at 01/17/2025 03:27 PM

FLUIDS: Coolant Level, Condition & Strength, Engine Oil, Brake & P/S Fluid Levels,

Engine oil is low
Coolant level is low
Brake fluid is good

Written by 5 Lee Wood at 01/17/2025 03:27 PM

ON BOARD DIAGNOSTICS (OBD): System Pre-scan results: CEL, TPMS, ABS, STAB CONTROL, SRS, BATTERY, ETC.

Engine

P0172 | Fuel Trim System Rich Bank 1 (Symptom 00) - Test Failed Since DTC Clear, Test Not Passed Since Power Up.
P0175 | Fuel Trim System Rich Bank 2 (Symptom 00) - Test Failed Since DTC Clear, Test Not Passed Since Power Up.

Antilock Brakes

U0073 | Control Module Communication Bus A Off (Symptom 00) - Test Not Passed Since DTC Cleared, History DTC, Test Not Passed Since Power Up.
U0422 | Invalid Data Received From Body Control Module Invalid Serial Data Received (Symptom 71) - Current DTC, History DTC, Test Not Passed Since Power Up, Current DTC Since Power Up, Warning Indicator Requested.

Body Control Module

B2955 | Security Sensor Data Circuit (Symptom 00) - Test Failed Since DTC Clear, History DTC.
C0750 | Left Front Tire Pressure Sensor Voltage Below Threshold (Symptom 03) - Current DTC, Test Failed Since DTC Clear, History DTC, Test Not Passed Since Power Up, Current DTC Since Power Up.
C0750 | Left Front Tire Pressure Sensor Too Few Pulses (Symptom 29) - Test Failed Since DTC Clear, History DTC.
C0755 | Right Front Tire Pressure Sensor Voltage Below Threshold (Symptom 03) - Current DTC, Test Failed Since DTC Clear, History DTC, Test Not Passed Since Power Up, Current DTC Since Power Up.
C0755 | Right Front Tire Pressure Sensor Too Few Pulses (Symptom 29) - Current DTC, Test Failed Since DTC Clear, History DTC, Test Not Passed Since Power Up, Current DTC Since Power Up.
C0760 | Left Rear Tire Pressure Sensor Voltage Below Threshold (Symptom 03) - Test Failed Since DTC Clear, History DTC.
C0765 | Right Rear Tire Pressure Sensor Voltage Below Threshold (Symptom 03) - Current DTC, Test Failed Since DTC Clear, History DTC, Test Not Passed Since Power Up, Current DTC Since Power Up.
C0765 | Right Rear Tire Pressure Sensor Too Few Pulses (Symptom 29) - Current DTC, Test Failed Since DTC Clear, History DTC, Current DTC Since Power Up.
U0100 | Lost Communication with Engine Control Module (Symptom 00) - Test Failed Since DTC Clear, History DTC.

Radio

B1325 | Control Module Power Circuit Voltage Below Threshold (Symptom 03) - Test Failed Since DTC Clear, History DTC.
U0164 | Lost Communication with HVAC Control Module (Symptom 00) - Test Failed Since DTC Clear, History DTC.

Tire Pressure Monitor

B2955 | Security Sensor Data Circuit (Symptom 00) - Test Failed Since DTC Clear, History DTC.
C0750 | Left Front Tire Pressure Sensor Voltage Below Threshold (Symptom 03) - Current DTC, Test Failed Since DTC



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 9 of 18
01/22/2025 10:57 AM

Clear, History DTC, Test Not Passed Since Power Up, Current DTC Since Power Up.
C0750 | Left Front Tire Pressure Sensor Too Few Pulses (Symptom 29) - Test Failed Since DTC Clear, History DTC.
C0755 | Right Front Tire Pressure Sensor Voltage Below Threshold (Symptom 03) - Current DTC, Test Failed Since DTC Clear, History DTC, Test Not Passed Since Power Up, Current DTC Since Power Up.
C0755 | Right Front Tire Pressure Sensor Too Few Pulses (Symptom 29) - Current DTC, Test Failed Since DTC Clear, History DTC, Test Not Passed Since Power Up, Current DTC Since Power Up.
C0760 | Left Rear Tire Pressure Sensor Voltage Below Threshold (Symptom 03) - Test Failed Since DTC Clear, History DTC.
C0765 | Right Rear Tire Pressure Sensor Voltage Below Threshold (Symptom 03) - Current DTC, Test Failed Since DTC Clear, History DTC, Test Not Passed Since Power Up, Current DTC Since Power Up.
C0765 | Right Rear Tire Pressure Sensor Too Few Pulses (Symptom 29) - Current DTC, Test Failed Since DTC Clear, History DTC, Current DTC Since Power Up.
U0100 | Lost Communication with Engine Control Module (Symptom 00) - Test Failed Since DTC Clear, History DTC.



[https://services.shop-](https://services.shop-ware.com/uploads/v1/original/_z-LbAlKpNaAokNgRUIwL)

[ware.com/uploads/v1/original/_z-LbAlKpNaAokNgRUIwL](https://services.shop-ware.com/uploads/v1/original/_z-LbAlKpNaAokNgRUIwL)

Written by 5 Lee Wood at 01/17/2025 03:27 PM

TIRES: Size, Brand, Measurements, Condition, Tread-wear, ALL MATCHING?



Written by 5 Lee Wood at 01/17/2025 03:27 PM

DRIVELINE: Differential/T-case/Transmission Fluid Levels & Condition

Not checked due to working on the ground.
Was recommended with last visit.

Written by 5 Lee Wood at 01/17/2025 03:27 PM

UNDERCAR: Steering & Suspension Components, Lower Engine, Transmission, Driveline Components, Exhaust System, Hard Lines & Hoses (fuel, brake, A/C)

Could not see much being on creeper. Oil pan looks wet.





City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 10 of 18
01/22/2025 10:57 AM

CHECK AND ADVISE; OIL PAN LEAKING \$163.00
+tax

Approved by phone, 4:58pm 1/20/25

Written by 5 Lee Wood at 01/17/2025 03:27 PM

BRAKES: Linings, Surfaces, Calipers, Parking Brake Operation

10mm around.



Written by 5 Lee Wood at 01/17/2025 03:27 PM

INTERIOR: HVAC Controls, Cabin Air Filter, Entertainment Unit, Door Hardware (handles & locks), Window Controls, Multi-Function Controls

Cabin air filter full of depre.



Remove & Replace: Cabin Air Filter \$203.75 +tax

Approved by phone, 4:58pm 1/20/25

Written by 5 Lee Wood at 01/17/2025 03:27 PM

test drive & inspection

test drove and could not verify concern, found vehicle only revved up when getting going at a light will rev to about 2700 which is a bit high but did not find it to be random, would like more information, found 2 dtcs for the P0172 and P0174 Fuel trim running rich bank 1 and 2 codes, using identifix found test resetting the fuel trim and disconnecting the pcV hose and plugging the pcV valve and monitored the fuel trim, found to run good and did not fail test at this time and DTC's is not active, cleared dtc's should be monitored.

found transmission fluid is dark and smell burn. would recommend an transmission service as could be related to the concern. no repair at this made or recommend at this time.

Remove & Replace: Transmission Oil Pan Gasket &/or Filter \$731.52 +tax

Approved by phone, 11:11am 1/20/25

Written by 5 Lee Wood at 01/20/2025 08:28 AM

Torque Tag - _____

N/A



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 11 of 18
01/22/2025 10:57 AM

Written by 5 Lee Wood at 01/20/2025 08:29 AM

Warning Lights Present?

TPMS Flashing

Written by 5 Lee Wood at 01/20/2025 08:29 AM

Post-Road test kilometers



Written by 5 Lee Wood at 01/20/2025 08:29 AM

Transmission pan

Transmission pan clutch material in fluid



Written by 3 MIKE HALEY at 01/20/2025 04:50 PM

Post-Scan Results - If relevant

tpms codes



<https://services.shop->

[ware.com/uploads/v1/original/0B2y9I0Urz6jfQJKmxv74](https://services.shop-ware.com/uploads/v1/original/0B2y9I0Urz6jfQJKmxv74)



Written by 5 Lee Wood at 01/20/2025 04:50 PM

WE HAVE ONE MORE HOUR OF DIAG AFTER WE TALK TO ORIGINAL TECH ON WHAT LEE FOUND.

Written by Harley Moon at 01/20/2025 05:07 PM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54267

Fleet PO# 45

Page 12 of 18
01/22/2025 10:57 AM

Confirmed oil pan seal is leaking.



Remove & Replace: Oil Pan Gasket	\$522.38 +tax
---	----------------------

Written by 8 Sophie Ireland at 01/21/2025 04:18 PM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 13 of 18
01/22/2025 10:57 AM

Past Recommendations

DRIVELINE SERVICE (NOT INCL. TRANSMISSION)
\$419.81 +tax

INSTALL MISSING SPARE TIRE ASSEMBLY
COMPONENTS \$408.47 +tax

Remove & Replace: Oil Pan Gasket \$537.76 +tax



City Centre Automotive


9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 14 of 18
01/22/2025 10:57 AM

Attached Images:

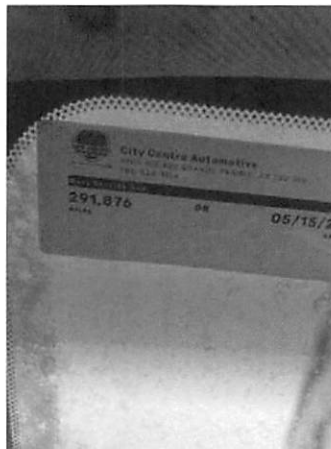



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54267

Fleet PO# 45

Page 15 of 18
01/22/2025 10:57 AM








City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54267

Fleet PO# 45

Page 16 of 18
01/22/2025 10:57 AM

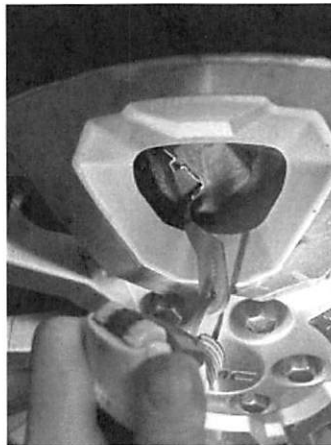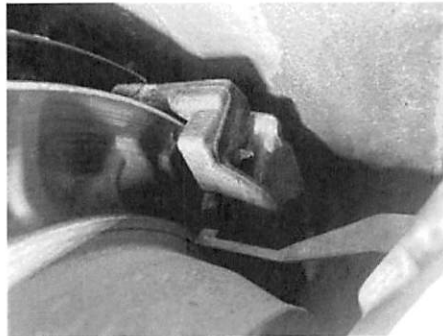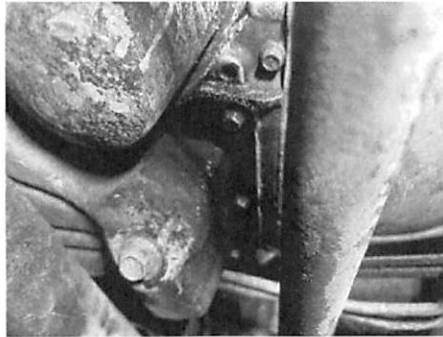






City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54267

Fleet PO# 45

Page 17 of 18
01/22/2025 10:57 AM

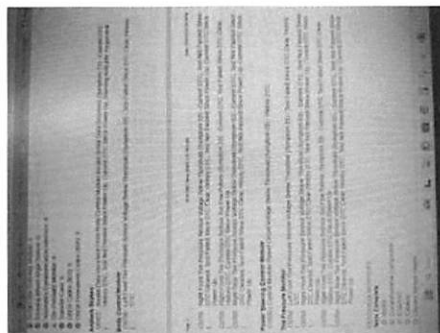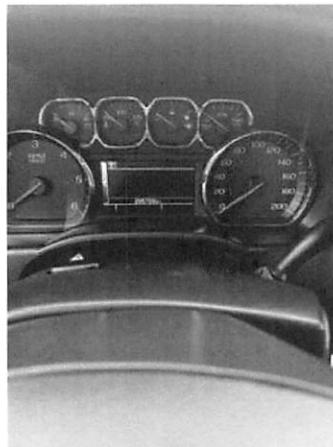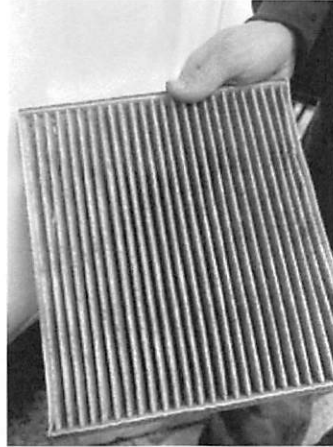




City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54267

Fleet PO# 45

Page 18 of 18
01/22/2025 10:57 AM

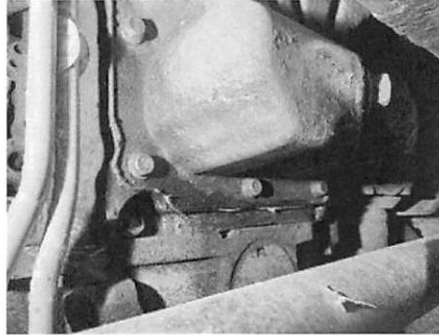



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54091

Page 1 of 7
 12/23/2024 1:45 PM

CARIBOO RAILROAD CONTRACTING CORP

#117 3030 Pandosy St
 Kelowna, BC V1Y 0C4
 thawryluk@cariboorail.com
 +1 250-612-7010

2018 GMC Sierra 1500

3GTU2MEC3JG339547
 Engine: 5.3L V8 (C) L83
 FLEX FI
 Plate: WG0193
 Fleet #: 45
 Odometer In: 289615
 Odometer Out: 289615

Advisor: Rick Hennigar

Technician: 8 Sophie Ireland

GRAND TOTAL: \$1,053.71

BALANCE DUE: \$1,053.71

SERVICES

1 Vehicle Check-in & DVI (Digital Vehicle Inspection) SUBTOTAL: \$0.00

LABOR

VEHICLE WALKAROUND
 RECORD KILOMETERS, LIC PLATE, VIN, & ENGINE HOURS (WHERE APPLICABLE)
 RECORD ENGINE HOURS (WHERE APPLICABLE) RECORD VEHICLE OPTIONS (AWD, 4X4, 2WD, A/C, AUTO, MANUAL)
 VEHICLE PRE-SCAN & DIGITAL VEHICLE INSPECTION
 TEST DRIVE (Cannot be performed if vehicle appears unsafe or other issues arise)
 "GOOD TO GO" COURTESY BATTERY TEST (For vehicles with easily accessible battery)

2 VEHICLE SOMETIMES WILL NOT START SUBTOTAL: \$163.00

VEHICLE SOMETIMES WILL NOT START

LABOR

VEHICLE SOMETIMES WILL NOT START

3 Remove & Replace: Starter Assembly SUBTOTAL: \$817.06

LABOR

Remove & Replace: STARTER ASSEMBLY replace pig tail

Job Code: Cariboo TI.hr
Equipment Unit #: Unit 45
Comment: Mechanical repairs

Tim Hawryluk

PARTS

	QTY
STARTER/Starter Motor	1.0
Starter Solenoid Pigtail	1.0

Terms of Service:

****Any jobs that require the removal of wheels/tires REQUIRE A RE-TORQUE within 100kms. Failure to do so could cause wheels to loosen, possibly causing an accident or damage.****

WE THANK YOU FOR CHOOSING CITY CENTRE AUTOMOTIVE FOR YOUR AUTO REPAIR NEEDS. TO SERVE YOU BETTER, WE HAVE A NATIONAL 2YR, 40,000km "Peace of Mind WARRANTY" PROGRAM THROUGH NAPA AUTOPRO, as well as our exclusive 10/400 Powertrain Warranty.

GRAND TOTAL: \$1,053.71

Total Labor: \$391.20
 Total Parts: \$588.86
 Total Fees: \$0.00
 Total Sublets: \$0.00
 Materials & Consumables: \$23.47
 Sales Tax: \$50.18

BALANCE DUE: \$1,053.71

**City Centre Automotive**

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54091

Page 2 of 7
12/23/2024 1:45 PM

FOR ANY WARRANTY CONCERNS WHILE TRAVELLING, PLEASE CALL 1-866-GET-NAPA AND YOU WILL BE DIRECTED TO THE AUTOPRO/AUTOCARE NEAREST YOU.

ENTER FOR A CHANCE TO WIN \$50-\$100 ON OUR ONLINE SURVEY. @ napa-autopro-survey.com OR TRY OUR NEW MOBILE VERSION @ tinyurl.com/napaautopro. By signing this document or the duplicate onboarding form you agree to the following:

1. DISCLAIMER REGARDING QUOTES and ESTIMATES:

Please note that all repair quotes provided by CITY CENTRE AUTOMOTIVE are estimates based on the information available at the time of assessment. While we make every effort to ensure the accuracy of our estimates, unforeseen circumstances may arise during the repair process, leading to adjustments in costs and timelines. Factors such as the discovery of additional damage, parts availability, and other unforeseeable complications may affect the final cost and duration of the repair. Therefore, the estimate provided should be considered as an approximation rather than a definitive price. We strive to keep our customers informed throughout the repair process and will notify you promptly of any changes to the initial estimate. Your understanding and cooperation in such situations are greatly appreciated.

2. CUSTOM WORK, WIRING/ELECTRICAL and ACCESSORY INSTALLATIONS:

Due to the nature of the above mentioned work, service time is billed out at a straight hourly rate. (Hourly rate is dependent on the nature of the repair/installation/work)

Upfront payments/deposits may be required.

3. DISCLAIMER REGARDING VEHICLES and PERSONAL BELONGINGS IN OUR POSSESSION:

We take all necessary precautions to ensure your vehicle is safe while in our care, however, we are not responsible for damaged vehicles or the contents within them. Subsequently we are not responsible for lost/stolen property or vehicle thefts. If there are concerns with leaving your vehicle in our care long term (weeks, months, or more at a time), we recommend arranging to have the vehicle picked up.

4. STORAGE FEES:

In the event that a vehicle is left with us over a long term, and that no prior arrangements have been made, a storage fee of \$30/day will be applied to the repair order. This applies to customer whom which we cannot make contact and vehicles left in our possession longer than one week after work is complete.

5. SERVICE CHARGES and INTEREST:

For customers with charge/credit accounts, service charges of 8% per month will be applied to ALL unpaid Invoices past the 30 day period.

6. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

7. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

City Centre Automotive staff may operate my vehicle for the purpose of testing, inspection, and delivery.

8. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

9. "ONLINE and TEXT COMMUNICATION OK"



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54091

Page 3 of 7
12/23/2024 1:45 PM

I welcome emails and text messages from City Centre Automotive as a means of receiving copies of my estimate, work order, and invoice.

"HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to the above terms.

Authorization:



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54091

Page 4 of 7
12/23/2024 1:45 PM

INSPECTION REPORT

Vehicle Check-in & DVI (Digital Vehicle Inspection)

WALK-AROUND



Written by 8 Sophie Ireland at 12/20/2024 01:50 PM

MAINTENANCE REMINDER: Oil Service Indicator (window sticker or OB maintenance monitor) CHECK FUEL FILTER SERVICE INTERVAL (Diesel Vehicles ONLY)



Written by 8 Sophie Ireland at 12/20/2024 01:50 PM

"GOOD TO GO" - Battery Test Results & Condition of Battery Terminals



Written by 8 Sophie Ireland at 12/20/2024 01:50 PM

VEHICLE START UP: Confirm proper operation of instrument cluster and note any warning lights

TEST DRIVE NOTES:

INTERIOR: HVAC Controls, Cabin Air Filter, Entertainment Unit, Door Hardware (handles & locks), Window Controls, Multi-Function Controls

EXTERIOR: Glass, Lighting, Wipers, Trim

ENGINE START UP & IDLE - note odd noises, vibrations, slow crank, etc.



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54091

Page 5 of 7
12/23/2024 1:45 PM

Can hear starter trying to engage but it's skipping and faulting

Written by 8 Sophie Ireland at 12/20/2024 01:50 PM

ON BOARD DIAGNOSTICS (OBD): System Pre-scan results: CEL, TPMS, ABS, STAB CONTROL, SRS, BATTERY, ETC.

Many stored codes



Written by 8 Sophie Ireland at 12/20/2024 01:50 PM

- UNDERHOOD: Accessory Belt System, Engine Air Filter, Upper Engine, Radiator, Coolant Tank & Hoses, A/C components, Engine Block Heater Plugin
- FLUIDS: Coolant Level, Condition & Strength, Engine Oil, Brake & P/S Fluid Levels,
- DRIVELINE: Differential/T-case/Transmission Fluid Levels & Condition
- UNDERCAR: Steering & Suspension Components, Lower Engine, Transmission, Driveline Components, Exhaust System, Hard Lines & Hoses (fuel, brake, A/C)
- BRAKES: Linings, Surfaces, Calipers, Parking Brake Operation
- TIRES: Size, Brand, Measurements, Condition, Tread-wear, ALL MATCHING?
- OTHER: Findings & Notes

VEHICLE SOMETIMES WILL NOT START

No start inspection

Confirmed intermittant no start condition. Can hear starter spinning but not engaging. internal failure of starter (worn out) need to replace starter.

Remove & Replace: Starter Assembly \$742.18 +tax

Approved by phone, 1:51pm 12/20/24

Written by 8 Sophie Ireland at 12/20/2024 01:46 PM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54091

Page 6 of 7
12/23/2024 1:45 PM

FINDINGS

Went to remove starter and found this is not the OE starter and the locking tab for the plug on the starter was broken and had been zip tied on, Attempted to do the same this with the new starter, but it orientated differently than the starter that was removed and it can not be properly secured to starter solenoid and will fall off over time causing a no start condition. Need the pigtail to be replaced.

Written by 8 Sophie Ireland at 12/23/2024 08:33 AM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54091

Page 7 of 7
12/23/2024 1:45 PM

Past Recommendations

DRIVELINE SERVICE (NOT INCL. TRANSMISSION)
\$419.81 +tax

INSTALL MISSING SPARE TIRE ASSEMBLY
COMPONENTS \$408.47 +tax

Remove & Replace: Oil Pan Gasket \$541.22 +tax



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54075

Page 1 of 5
12/20/2024 11:20 AM

**CARIBOO RAILROAD
CONTRACTING CORP**
#117 3030 Pandosy St
Kelowna, BC V1Y 0C4
thawryluk@cariboorail.com
+1 250-612-7010

2018 GMC Sierra 1500
3GTU2MEC3JG339547
Engine: 5.3L V8 (C) L83
FLEX FI
Plate: WG0193
Fleet #: 45
Odometer In: 289609
Odometer Out: 289609

Advisor: Rick Hennigar
Technician: 6 MATT
MISKOLCZI

GRAND TOTAL: \$601.99

✓ PAID

Reason for Customer's Visit

SLIPPED OUT OF GEAR GOING HILL WON'T GO INTO GEAR, CHECK STARTER SOMETIMES IT TAKES AWHILE TO START

SERVICES

1 CHECK & ADVISE: TRANSMISSION SLIPPING WON'T GO INTO GEAR

SUBTOTAL: \$467.37

LABOR

started outside checked transmission fluid was not on dipstick. added 2 liters drove into shop. found auxiliary transmission cooler line popped of and clip gone. got new clip and reinstalled line filled with fluid. test drove no more leaks shifts and drives good]

PARTS

	QTY	EACH	TOTAL
RETAINER	1.0	\$21.04	\$21.04
Multi-Vehicle ATF (BULK 208L)	7.0	\$16.99	\$118.93

HAZMATS & FEES

	QTY	FEE	TOTAL
Enviro	7.0	\$0.20	\$1.40

2 Charging System/AVR Test

SUBTOTAL: \$81.50

SOMETIMES IT TAKES A BIT TO START

LABOR

AVR Test
Battery Test

Terms of Service:

****Any jobs that require the removal of wheels/tires REQUIRE A RE-TORQUE within 100kms. Failure to do so could cause wheels to loosen, possibly causing an accident or damage.****

WE THANK YOU FOR CHOOSING CITY CENTRE AUTOMOTIVE FOR YOUR AUTO REPAIR NEEDS. TO SERVE YOU BETTER, WE HAVE A NATIONAL 2YR, 40,000km "Peace of Mind WARRANTY" PROGRAM THROUGH NAPA AUTOPRO, as well as our exclusive 10/400 Powertrain Warranty.

FOR ANY WARRANTY CONCERNS WHILE TRAVELLING, PLEASE

GRAND TOTAL: \$601.99

Total Labor: \$407.50
Total Parts: \$139.97
Total Fees: \$1.40
Total Sublets: \$0.00
Materials & Consumables: \$24.45
Sales Tax: \$28.67

✓ PAID

03/04/2025 12:16 PM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54075

Page 2 of 5
12/20/2024 11:20 AM

CALL 1-866-GET-NAPA AND YOU WILL BE DIRECTED TO THE
AUTOPRO/AUTOCARE NEAREST YOU.

Paid by Other - E TRANSFER: **\$601.99**

Notes: "EFT Recieved March 3rd."

ENTER FOR A CHANCE TO WIN \$50-\$100 ON OUR ONLINE SURVEY.
@ napa-autopro-survey.com OR TRY OUR NEW MOBILE VERSION @
tinyurl.com/napaautopro. By signing this document or the duplicate on-
boarding form you agree to the following:

1. DISCLAIMER REGARDING QUOTES and ESTIMATES:

Please note that all repair quotes provided by CITY CENTRE
AUTOMOTIVE are estimates based on the information available at the time
of assessment. While we make every effort to ensure the accuracy of our
estimates, unforeseen circumstances may arise during the repair process,
leading to adjustments in costs and timelines. Factors such as the
discovery of additional damage, parts availability, and other unforeseeable
complications may affect the final cost and duration of the repair. Therefore,
the estimate provided should be considered as an approximation rather
than a definitive price. We strive to keep our customers informed
throughout the repair process and will notify you promptly of any changes to
the initial estimate. Your understanding and cooperation in such situations
are greatly appreciated.

2. CUSTOM WORK, WIRING/ELECTRICAL and ACCESSORY INSTALLATIONS:

Due to the nature of the above mentioned work, service time is billed out at
a straight hourly rate. (Hourly rate is dependent on the nature of the
repair/installation/work)
Upfront payments/deposits may be required.

3. DISCLAIMER REGARDING VEHICLES and PERSONAL BELONGINGS IN OUR POSSESSION:

We take all necessary precautions to ensure your vehicle is safe while in
our care, however, we are not responsible for damaged vehicles or the
contents within them. Subsequently we are not responsible for lost/stolen
property or vehicle thefts. If there are concerns with leaving your vehicle in
our care long term (weeks, months, or more at a time), we recommend
arranging to have the vehicle picked up.

4. STORAGE FEES:

In the event that a vehicle is left with us over a long term, and that no prior
arrangements have been made, a storage fee of \$30/day will be applied to
the repair order. This applies to customer whom which we cannot make
contact and vehicles left in our possession longer than one week after work
is complete.

5. SERVICE CHARGES and INTEREST:

For customers with charge/credit accounts, service charges of 8% per
month will be applied to ALL unpaid Invoices past the 30 day period.

6. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the
necessary materials.

7. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

City Centre Automotive staff may operate my vehicle for the purpose of
testing, inspection, and delivery.

8. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of
services thereto.

9. "ONLINE and TEXT COMMUNICATION OK"

I welcome emails and text messages from City Centre Automotive as a



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54075

Page 3 of 5
12/20/2024 11:20 AM

means of receiving copies of my estimate, work order, and invoice.

"HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to the above terms.

Authorization:

CARIBOO RAILROAD CONTRACTING CORP

12/19/2024



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54075


Page 4 of 5
12/20/2024 11:20 AM

INSPECTION REPORT

Charging System/AVR Test

avr

passed avr an battery test



Written by 6 MATT MISKOLCZI at 12/19/2024 03:09 PM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54075

Page 5 of 5
12/20/2024 11:20 AM

Past Recommendations

DRIVELINE SERVICE (NOT INCL. TRANSMISSION)
\$419.81 +tax

**INSTALL MISSING SPARE TIRE ASSEMBLY
COMPONENTS** \$408.47 +tax

Remove & Replace: Oil Pan Gasket \$541.22 +tax



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54048

Page 1 of 14
 12/18/2024 4:18 PM

**CARIBOO RAILROAD
 CONTRACTING CORP**
 #117 3030 Pandosy St
 Kelowna, BC V1Y 0C4
 Tfrohlich@cariboorail.com
 +1 250-640-0553

2018 GMC Sierra 1500
 3GTU2MEC3JG339547
 Engine: 5.3L V8 (C) L83
 FLEX FI
 Plate: WG0193
 Fleet #: 45
 Odometer In: 289501
 Odometer Out: 289501

Advisor: Harley Moon
 Technician: 5 Lee Wood

GRAND TOTAL: \$1,588.24

BALANCE DUE: \$1,588.24

Reason for Customer's Visit

wiring hanging, coolant leaking

SERVICES

- 1 Vehicle Check-in & DVI (Digital Vehicle Inspection)** **SUBTOTAL: \$0.00**

LABOR Labor: \$0.00

VEHICLE WALKAROUND Parts: \$0.00

RECORD KILOMETERS, LIC PLATE, VIN, & ENGINE HOURS (WHERE APPLICABLE) Fees: \$0.00

RECORD ENGINE HOURS (WHERE APPLICABLE) RECORD VEHICLE OPTIONS (AWD, 4X4, 2WD, A/C, AUTO, MANUAL) Sublet: \$0.00

VEHICLE PRE-SCAN & DIGITAL VEHICLE INSPECTION

TEST DRIVE (Cannot be performed if vehicle appears unsafe or other issues arise)

"GOOD TO GO" COURTESY BATTERY TEST (For vehicles with easily accessible battery)

- 2 rehang wiring thats hanging ON D/S** **SUBTOTAL: \$195.60**

WIRE AND OR PLUG HANGING DOWN BY THE TRANSMISSION NOT PLUGGED INTO ANYTHING AND NEED TO KNOW WHAT IT'S FOR Labor: \$195.60

LABOR Parts: \$0.00

Fees: \$0.00

Sublet: \$0.00

- 3 check & advise: coolant leaking** **SUBTOTAL: \$163.00**

Used coolant pressure tester and set to max pressure 15psi, inspected and found coolant leak is coming from the radiator, Recommend replacing radiator Labor: \$163.00

LABOR Parts: \$0.00

Fees: \$0.00

Sublet: \$0.00

- 4 Remove & Replace: Radiator, Remove & Replace: Radiator** **SUBTOTAL: \$1,107.07**

LABOR Labor: \$423.80

Remove & Replace: RADIATOR Parts: \$683.27

Remove & Replace: SKID PLATE Fees: \$0.00

disassembled fan shroud and disconnected coolant hoses drained coolant from the system. Sublet: \$0.00

removed fan shroud and removed the bolts that hold assembly in place removed the bolt that hold



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #54048

Page 2 of 14
 12/18/2024 4:18 PM

the concenseer to rad, removed from vehicle installed new rad and installed bolt that hold rad to condenser assembly and set into place and installed fan shroud and installed coolant hoses and installed oil cooler lines, added cooloant to system and ran vehicle to temp, relearnedd tpms when warming up vehcile and watching coolant level, test drove. verified level, repair done

PARTS	PART #	QTY	EACH	TOTAL
RADIATOR	CU13397	1.0	\$683.27	\$683.27

Terms of Service:

****Any jobs that require the removal of wheels/tires REQUIRE A RE-TORQUE within 100kms. Failure to do so could cause wheels to loosen, possibly causing an accident or damage.****

WE THANK YOU FOR CHOOSING CITY CENTRE AUTOMOTIVE FOR YOUR AUTO REPAIR NEEDS. TO SERVE YOU BETTER, WE HAVE A NATIONAL 2YR, 40,000km "Peace of Mind WARRANTY" PROGRAM THROUGH NAPA AUTOPRO, as well as our exclusive 10/400 Powertrain Warranty.

FOR ANY WARRANTY CONCERNS WHILE TRAVELLING, PLEASE CALL 1-866-GET-NAPA AND YOU WILL BE DIRECTED TO THE AUTOPRO/AUTOCARE NEAREST YOU.

ENTER FOR A CHANCE TO WIN \$50-\$100 ON OUR ONLINE SURVEY. @ napa-autopro-survey.com OR TRY OUR NEW MOBILE VERSION @ tinyurl.com/napaautopro. By signing this document or the duplicate onboarding form you agree to the following:

1. **DISCLAIMER REGARDING QUOTES and ESTIMATES:**
 Please note that all repair quotes provided by CITY CENTRE AUTOMOTIVE are estimates based on the information available at the time of assessment. While we make every effort to ensure the accuracy of our estimates, unforeseen circumstances may arise during the repair process, leading to adjustments in costs and timelines. Factors such as the discovery of additional damage, parts availability, and other unforeseeable complications may affect the final cost and duration of the repair. Therefore, the estimate provided should be considered as an approximation rather than a definitive price. We strive to keep our customers informed throughout the repair process and will notify you promptly of any changes to the initial estimate. Your understanding and cooperation in such situations are greatly appreciated.

2. **CUSTOM WORK, WIRING/ELECTRICAL and ACCESSORY INSTALLATIONS:**

Due to the nature of the above mentioned work, service time is billed out at a straight hourly rate. (Hourly rate is dependent on the nature of the repair/installation/work)
 Upfront payments/deposits may be required.

3. **DISCLAIMER REGARDING VEHICLES and PERSONAL BELONGINGS IN OUR POSSESSION:**

We take all necessary precautions to ensure your vehicle is safe while in our care, however, we are not responsible for damaged vehicles or the contents within them. Subsequently we are not responsible for lost/stolen property or vehicle thefts. If there are concerns with leaving your vehicle in our care long term (weeks, months, or more at a time), we recommend arranging to have the vehicle picked up.

4. **STORAGE FEES:**

GRAND TOTAL: \$1,588.24

Total Labor: \$782.40
 Total Parts: \$683.27
 Total Fees: \$0.00
 Total Sublets: \$0.00
 Materials & Consumables: \$46.94
 Sales Tax: \$75.63

BALANCE DUE: \$1,588.24

Job Code: CARIB00.TI

Task Code: A16NB

Equipment Unit #: 45

Comment: RAD

Tammy Froelich

Dec 30, 2024

Rec Dec 23/24



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54048

Page 3 of 14
12/18/2024 4:18 PM

In the event that a vehicle is left with us over a long term, and that no prior arrangements have been made, a storage fee of \$30/day will be applied to the repair order. This applies to customer whom which we cannot make contact and vehicles left in our possession longer than one week after work is complete.

5. SERVICE CHARGES and INTEREST:

For customers with charge/credit accounts, service charges of 8% per month will be applied to ALL unpaid Invoices past the 30 day period.

6. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

7. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

City Centre Automotive staff may operate my vehicle for the purpose of testing, inspection, and delivery.

8. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

9. "ONLINE and TEXT COMMUNICATION OK"

I welcome emails and text messages from City Centre Automotive as a means of receiving copies of my estimate, work order, and invoice.

"HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to the above terms.

Authorization:



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54048

Page 4 of 14
12/18/2024 4:18 PM

INSPECTION REPORT

Vehicle Check-in & DVI (Digital Vehicle Inspection)

- WALK-AROUND
- MAINTENANCE REMINDER: Oil Service Indicator (window sticker or OB maintenance monitor) CHECK FUEL FILTER SERVICE INTERVAL (Diesel Vehicles ONLY)
- "GOOD TO GO" - Battery Test Results & Condition of Battery Terminals
- VEHICLE START UP: Confirm proper operation of instrument cluster and note any warning lights**
- TEST DRIVE NOTES:
- INTERIOR: HVAC Controls, Cabin Air Filter, Entertainment Unit, Door Hardware (handles & locks), Window Controls, Multi-Function Controls
- EXTERIOR: Glass, Lighting, Wipers, Trim
- ENGINE START UP & IDLE - note odd noises, vibrations, slow crank, etc.
- ON BOARD DIAGNOSTICS (OBD): System Pre-scan results: CEL, TPMS, ABS, STAB CONTROL, SRS, BATTERY, ETC.
- UNDERHOOD: Accessory Belt System, Engine Air Filter, Upper Engine, Radiator, Coolant Tank & Hoses, A/C components, Engine Block Heater Plugin
- FLUIDS: Coolant Level, Condition & Strength, Engine Oil, Brake & P/S Fluid Levels.
- DRIVELINE: Differential/T-case/Transmission Fluid Levels & Condition
- UNDERCAR: Steering & Suspension Components, Lower Engine, Transmission, Driveline Components, Exhaust System, Hard Lines & Hoses (fuel, brake, A/C)**
- BRAKES: Linings, Surfaces, Calipers, Parking Brake Operation
- TIRES: Size, Brand, Measurements, Condition, Tread-wear, ALL MATCHING?
- OTHER: Findings & Notes

rehang wiring thats hanging ON D/S

- hanging wiring

check & advise: coolant leaking

- coolant leak



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54048

Page 5 of 14
12/18/2024 4:18 PM

FINDINGS

coolant leak

Used coolant pressure tester and set to max pressure 15psi, inspected and found coolant leak is coming from the radiator, Recommend replacing radiator



**Remove & Replace: Radiator, Remove & Replace:
Radiator \$1107.07 +tax**

Approved by phone, 10:26am 12/18/24

Written by 5 Lee Wood at 12/18/2024 09:45 AM

MAINTENANCE REMINDER: Oil Service Indicator (window sticker or OB maintenance monitor) CHECK FUEL FILTER SERVICE INTERVAL (Diesel Vehicles ONLY)



Written by 5 Lee Wood at 12/18/2024 10:21 AM

WALK-AROUND



<https://services.shop->

[ware.com/uploads/v1/original/IUT46dfuP-8GrBMmrn3yv](https://services.shop-ware.com/uploads/v1/original/IUT46dfuP-8GrBMmrn3yv)

Written by 5 Lee Wood at 12/18/2024 10:21 AM

ON BOARD DIAGNOSTICS (OBD): System Pre-scan results: CEL, TPMS, ABS, STAB CONTROL, SRS, BATTERY, ETC.

TPMs light



<https://services.shop->

[ware.com/uploads/v1/original/Fz00R9bm5XbYWheARFoLJ](https://services.shop-ware.com/uploads/v1/original/Fz00R9bm5XbYWheARFoLJ)

Written by 5 Lee Wood at 12/18/2024 10:21 AM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54048

Page 6 of 14
12/18/2024 4:18 PM

"GOOD TO GO" - Battery Test Results & Condition of Battery Terminals



Written by 5 Lee Wood at 12/18/2024 10:21 AM

VEHICLE START UP: Confirm proper operation of instrument cluster and note any warning lights

Tpms

Written by 5 Lee Wood at 12/18/2024 10:21 AM

UNDERHOOD: Accessory Belt System, Engine Air Filter, Upper Engine, Radiator, Coolant Tank & Hoses, A/C components, Engine Block Heater Plugin

Cabin air should be replaced. Engine filter is okay would wait till oil change to replace,

Written by 5 Lee Wood at 12/18/2024 10:21 AM

TIRES: Size, Brand, Measurements, Condition, Tread-wear, ALL MATCHING?



Written by 5 Lee Wood at 12/18/2024 10:21 AM

UNDERCAR: Steering & Suspension Components, Lower Engine, Transmission, Driveline Components, Exhaust System, Hard Lines & Hoses (fuel, brake, A/C)

Signs of oil starting to leak, is sweating at this time, on the timing cover through the crankshaft position sensor, would note at this time. Oil leaking around oil pan



Remove & Replace: Oil Pan Gasket \$541.22 +tax

Written by 5 Lee Wood at 12/18/2024 10:21 AM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54048

Page 7 of 14
12/18/2024 4:18 PM

DRIVELINE: Differential/T-case/Transmission Fluid Levels & Condition



Written by 5 Lee Wood at 12/18/2024 10:21 AM

BRAKES: Linings, Surfaces, Calipers, Parking Brake Operation

10mm rear and 8mm fronts



Written by 5 Lee Wood at 12/18/2024 10:21 AM

hanging wiring

Found connect tired up in by abs module. Inspected found no DTCS relating to wiring looks like butt end connector when manufacturing harnesses will put butt end for options not applicable for some models, used zip ties to hold not onto harness and frame, tucked outta the way to keep from hanging again no further repair needed.



Written by 5 Lee Wood at 12/18/2024 03:58 PM



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54048

Page 8 of 14
12/18/2024 4:18 PM

Past Recommendations

DRIVELINE SERVICE (NOT INCL. TRANSMISSION)
\$419.81 +tax

INSTALL MISSING SPARE TIRE ASSEMBLY
COMPONENTS \$408.47 +tax



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54048

Page 9 of 14
12/18/2024 4:18 PM

Attached Images:





City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #54048

Page 10 of 14
12/18/2024 4:18 PM







City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54048

Page 11 of 14
12/18/2024 4:18 PM

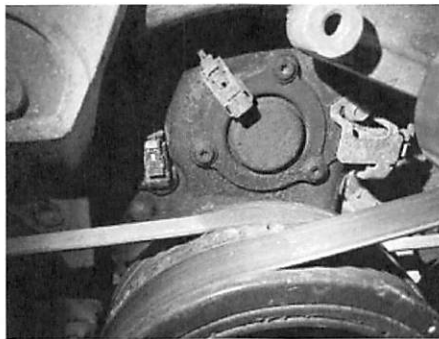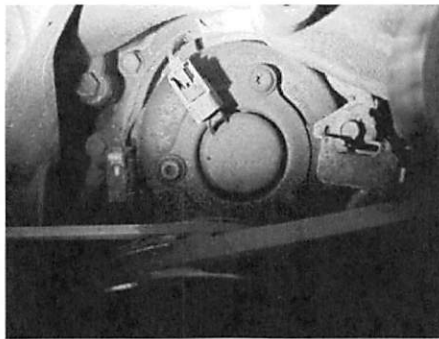




City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54048

Page 12 of 14
12/18/2024 4:18 PM

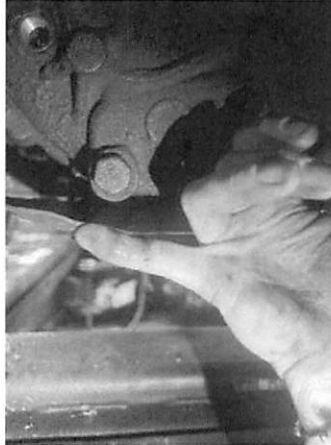



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54048

Page 13 of 14
12/18/2024 4:18 PM





City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #54048

Page 14 of 14
12/18/2024 4:18 PM





City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #53682

Page 1 of 12
 11/26/2024 2:17 PM

CARIBOO RAILROAD CONTRACTING CORP

#117 3030 Pandosy St
 Kelowna, BC V1Y 0C4
 Tfrohlich@cariboorail.com
 +1 250-640-0553

2018 GMC Sierra 1500

3GTU2MEC3JG339547
 Engine: 5.3L V8 (C) L83
 FLEX FI
 Plate: WG0193
 Fleet #: 45
 Odometer In: 286876
 Odometer Out: 286876

Advisor: Rick Hennigar

Technician: 3 MIKE HALEY

GRAND TOTAL: \$1,804.24

BALANCE DUE: \$1,804.24

Reason for Customer's Visit

OIL SERVICE, CLUNK IN FRONT END WHEN TURNING (THINKS IT MIGHT BE MUDFLAPS) FOG LIGHTS FLICKERING, REAR P/S TPMS

SERVICES

1

Vehicle Check-in

SUBTOTAL: \$0.00

LABOR

VEHICLE WALKAROUND

Labor: \$0.00

RECORD KILOMETERS, LIC PLATE, VIN, & ENGINE HOURS (WHERE APPLICABLE)

Parts: \$0.00

RECORD VEHICLE OPTIONS (AWD, 4X4, 2WD, A/C, AUTO, MANUAL)

Fees: \$0.00

RECORD ENGINE HOURS (WHERE APPLICABLE)

Sublet: \$0.00

TEST DRIVE

VEHICLE PRE-SCAN

"GOOD TO GO" COURTESY BATTERY TEST (Remove if battery test cannot be performed)

2

DIAG CLUNK IN FRONT END WHEN TURNING (THINKS IT MAY BE MUDFLAP)

SUBTOTAL: \$0.00

LABOR

Took vehicle for test drive did not hear any clunking in front end. Put on hoist inspected front and tight found three mudflaps loose need to resecure

Labor: \$0.00

Parts: \$0.00

Fees: \$0.00

Sublet: \$0.00

3

DIAG FOG LIGHTS FLICKERING

SUBTOTAL: \$0.00

LABOR

Turn on aftermarket fog lights they are currently working went to the front wiggled the wires found flickering when wiggling inspected wires found wires rub through need to fix wires

Labor: \$0.00

Parts: \$0.00

Fees: \$0.00

Sublet: \$0.00

4

LOF: Premium Oil Service for Gasoline Engines - (synthetic or conventional) \$65 plus Oil & Filter

SUBTOTAL: \$154.51

LABOR

Drain and fill engine oil

Labor: \$65.00

Parts: \$86.99

Fees: \$2.52

Replace engine oil filter

Sublet: \$0.00



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #53682

Page 2 of 12
 11/26/2024 2:17 PM

Replace drain plug gasket
 Reset Maintenance Monitor
 Lubricate suspension components as needed
 Perform multipoint inspection
 check & record coolant temperature

PLEASE BE ADVISED THAT THE OIL STICKER PROVIDED WILL BE SHOWN IN 'MILES' AND NOT 'KILOMETERS', IT IS NOT SOMETHING WE CAN CHANGE AND FOR ALL INTENTS AND PURPOSES WE ARE REFERRING TO KM'S.

Performed oil service and inspection

PARTS	PART #	QTY	EACH	TOTAL
0W-20 (60L Keg)	LM20366	7.6	\$10.50	\$79.80
OIL FILTER	100255	1.0	\$7.19	\$7.19
HAZMATS & FEES		QTY	FEE	TOTAL
Enviro		7.6	\$0.20	\$1.52
Filter Enviro		1.0	\$1.00	\$1.00

5 DIAG REAR PASSENGER TPMS LIGHT ON

SUBTOTAL: \$0.00

LABOR

Adjusted all tire pressures to 38 psi used TPMS scanner left hand, rear tire displays no sensor detected

Labor: \$0.00
 Parts: \$0.00
 Fees: \$0.00
 Sublet: \$0.00

6 check spare tire hoist [missing]

SUBTOTAL: \$0.00

LABOR

Inspected spare tire hoist spare tire Is there and spare tire tube to hoist all there missing bumper cover ends to spare tire hoist tube

Labor: \$0.00
 Parts: \$0.00
 Fees: \$0.00
 Sublet: \$0.00

7 Full Tire Replacement: Car & CUV UP TO 19" (MOUNT & BALANCE 4 TIRES)

SUBTOTAL: \$70.97

LABOR

MOUNT & BALANCE ONE TIRE (incl. New Valve Stems) SET PRESSURES TO SPEC & TORQUE WHEELS TO SPEC.

Disposal of Old Tires
 Remove & Replace Valve Stem as needed
 Bead Seal Application

Labor: \$25.00
 Parts: \$39.99
 Fees: \$5.98
 Sublet: \$0.00

PARTS	PART #	QTY	EACH	TOTAL
TPMS SENSOR (Rubber Stem)	1-SENSOR	1.0	\$39.99	\$39.99
HAZMATS & FEES		QTY	FEE	TOTAL
Valve Stem (Core or Stem)		1.0	\$3.99	\$3.99
BEAD SEAL		1.0	\$1.99	\$1.99



City Centre Automotive

9906 109 AVE
 GRANDE PRAIRIE, AB
 T8V 1R6
 780-538-1154
 service@citycentreauto.ca

Invoice #53682

Page 3 of 12
 11/26/2024 2:17 PM

8 REPAIR AND SECURE AFTER MARKET LIGHT WIRING

SUBTOTAL: \$81.50

LABOR Labor: \$81.50
 REPAIR AND SECURE AFTER MARKET LIGHT WIRING Parts: \$0.00
 Fees: \$0.00
 Sublet: \$0.00

9 Remove & Replace: Muffler, Remove & Replace: Muffler

SUBTOTAL: \$1,386.38

LABOR Labor: \$244.50
 Remove & Replace: MUFFLER Parts: \$1,141.88
 Remove & Replace: MUFFLER Fees: \$0.00
 Sublet: \$0.00
 Removed flex pipe back from vehicle new tail pipe resonator came dented new one on order
 -Tech #2: Installed the new exhaust pieces with clamps. Ran engine and checked for an exhaust leak and found none. Exhaust repairs are completed.

PARTS	PART #	QTY	EACH	TOTAL
MUFFLER	21919	1.0	\$371.63	\$371.63
EXHAUST CLAMP	35793	2.0	\$22.45	\$44.90
PIPE-EXTENSION PIPE	55686	1.0	\$347.83	\$347.83
Exhaust Clamp	36522	1.0	\$74.03	\$74.03
RESONATOR	55687	1.0	\$303.49	\$303.49

10 WARRANTY PART COME DAMAGED

SUBTOTAL: \$0.00

WARRANTY PART COME DAMAGED Labor: \$0.00
 Parts: \$0.00
 Fees: \$0.00
 Sublet: \$0.00

PARTS	PART #	QTY	EACH	TOTAL
RESONATOR	55687	1.0	\$0.00	\$0.00

Terms of Service:

WE THANK YOU FOR CHOOSING CITY CENTRE AUTOMOTIVE FOR YOUR AUTO REPAIR NEEDS. TO SERVE YOU BETTER, WE HAVE A NATIONAL 2YR, 40,000km "Peace of Mind WARRANTY" PROGRAM THROUGH NAPA AUTOPRO, as well as our exclusive 10/400 Powertrain Warranty.

FOR ANY WARRANTY CONCERNS WHILE TRAVELLING, PLEASE CALL 1-866-GET-NAPA AND YOU WILL BE DIRECTED TO THE AUTOPRO/AUTOCARE NEAREST YOU.

ENTER FOR A CHANCE TO WIN \$50-\$100 ON OUR ONLINE SURVEY.

@ napa-autopro-survey.com OR TRY OUR NEW MOBILE VERSION @ tinyurl.com/napaautopro. By signing this document or the duplicate on-boarding form you agree to the following:

1. DISCLAIMER REGARDING QUOTES and ESTIMATES:
 Please note that all repair quotes provided by CITY CENTRE AUTOMOTIVE are estimates based on the information available at the time of assessment. While we make every effort to ensure the accuracy of our

GRAND TOTAL: \$1,804.24

Total Labor: \$416.00
 Total Parts: \$1,268.86
 Total Fees: \$8.50
 Total Sublets: \$0.00
 Materials & Consumables: \$24.96
 Sales Tax: \$85.92

BALANCE DUE: \$1,804.24

Task Code: A16NB

Tammy Froehlich

Equipment Unit #: 45

Dec 2, 2024

Comment: LOF, TIRE SENSOR, MUFFLER

Rec Nov 26/24



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #53682

Page 4 of 12
11/26/2024 2:17 PM

estimates, unforeseen circumstances may arise during the repair process, leading to adjustments in costs and timelines. Factors such as the discovery of additional damage, parts availability, and other unforeseeable complications may affect the final cost and duration of the repair. Therefore, the estimate provided should be considered as an approximation rather than a definitive price. We strive to keep our customers informed throughout the repair process and will notify you promptly of any changes to the initial estimate. Your understanding and cooperation in such situations are greatly appreciated.

2. CUSTOM WORK, WIRING/ELECTRICAL and ACCESSORY INSTALLATIONS:

Due to the nature of the above mentioned work, service time is billed out at a straight hourly rate. (Hourly rate is dependent on the nature of the repair/installation/work)

Upfront payments/deposits may be required.

3. DISCLAIMER REGARDING VEHICLES and PERSONAL BELONGINGS IN OUR POSSESSION:

We take all necessary precautions to ensure your vehicle is safe while in our care, however, we are not responsible for damaged vehicles or the contents within them. Subsequently we are not responsible for lost/stolen property or vehicle thefts. If there are concerns with leaving your vehicle in our care long term (weeks, months, or more at a time), we recommend arranging to have the vehicle picked up.

4. STORAGE FEES:

In the event that a vehicle is left with us over a long term, and that no prior arrangements have been made, a storage fee of \$30/day will be applied to the repair order. This applies to customer whom which we cannot make contact and vehicles left in our possession longer than one week after work is complete.

5. SERVICE CHARGES and INTEREST:

For customers with charge/credit accounts, service charges of 8% per month will be applied to ALL unpaid Invoices past the 30 day period.

6. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

7. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

City Centre Automotive staff may operate my vehicle for the purpose of testing, inspection, and delivery.

8. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

9. "ONLINE and TEXT COMMUNICATION OK"

I welcome emails and text messages from City Centre Automotive as a means of receiving copies of my estimate, work order, and invoice.

"HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to the above terms.

Authorization:



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #53682

Page 5 of 12
11/26/2024 2:17 PM

INSPECTION REPORT

Vehicle Check-in

- Oil Service Windshield Sticker
- System Pre-scan results: CEL, TPMS, ABS, STAB CONTROL, SRS, BATTERY, ETC.**
- Battery Test Results
- Walk-around & Other Notes**

DIAG CLUNK IN FRONT END WHEN TURNING (THINKS IT MAY BE MUDFLAP)

- Mud flaps loose

DIAG FOG LIGHTS FLICKERING

- Wire to fog lights rubbed through

LOF: Premium Oil Service for Gasoline Engines - (synthetic or conventional) \$65 plus Oil & Filter

- Confirm proper operation of instruments and note SES/CEL warning lights
- Glass, exterior & interior lights & wiper operation & condition**
- Confirm engine start up and idle: note odd noises or operation
- Test & Record Coolant Temperature
- Accessory Belt System
- Check fluid levels and condition
- Inspect engine compartment: hoses, wiring, 12v battery & connections
- Check engine & cabin air filters
- Inspect undercarriage: seals, hoses, radiator, driveline, fuel supply system, brake lines & exhaust**
- Check Suspension
- Perform visual 4-wheel brake inspection (linings, surfaces, hoses, hydraulics)
- Check parking brake operation
- Check tires for proper inflation & wear
- Block heater performance/condition
- PARTS NEEDED

DIAG REAR PASSENGER TPMS LIGHT ON



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #53682

Page 6 of 12
11/26/2024 2:17 PM

LH rear tire

check spare tire hoist [missing]

Spare tire cowl missing

Full Tire Replacement: Car & CUV UP TO 19" (MOUNT & BALANCE 4 TIRES)

Brake Pad Measurements

Other Notes

Remove & Replace: Muffler, Remove & Replace: Muffler

Intermediate pipe

Resonator tailpipe came dented



City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #53682

Page 7 of 12
11/26/2024 2:17 PM

FINDINGS

Walk-around & Other Notes



<https://services.shop->

[ware.com/uploads/v1/original/1ngQ1vOLIQeV90TjUzePo](https://services.shop-ware.com/uploads/v1/original/1ngQ1vOLIQeV90TjUzePo)

**Remove & Replace: Muffler, Remove & Replace: Muffler
\$784.38 +tax**

Approved by phone, 3:32pm 11/15/24

Written by 3 MIKE HALEY at 11/15/2024 10:31 AM

System Pre-scan results: CEL, TPMS, ABS, STAB CONTROL, SRS, BATTERY, ETC.

Tpms light on

Written by 3 MIKE HALEY at 11/15/2024 10:31 AM

Oil Service Windshield Sticker

No oil change sticker in window

Written by 3 MIKE HALEY at 11/15/2024 10:31 AM

Battery Test Results

Battery good recharge 641 CCA 12.33 V

Written by 3 MIKE HALEY at 11/15/2024 10:50 AM

Wire to fog lights rubbed through



Written by 3 MIKE HALEY at 11/15/2024 10:50 AM

Spare tire cowl missing




City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #53682

Page 8 of 12
11/26/2024 2:17 PM



INSTALL MISSING SPARE TIRE ASSEMBLY COMPONENTS \$408.47 +tax

Declined for Now by Cynthia Kulchyski, 3:31pm 11/15/24

Written by 3 MIKE HALEY at 11/15/2024 11:38 AM

Mud flaps loose

Mud flaps loose



Written by 3 MIKE HALEY at 11/15/2024 11:38 AM

Glass, exterior & interior lights & wiper operation & condition

Aftermarket fog lights flicker when wire is moved

REPAIR AND SECURE AFTER MARKET LIGHT WIRING
\$81.50 +tax

Approved by phone, 3:32pm 11/15/24

Written by 3 MIKE HALEY at 11/15/2024 11:39 AM

LH rear tire



Written by 3 MIKE HALEY at 11/15/2024 11:39 AM

Inspect undercarriage: seals, hoses, radiator, driveline, fuel supply system, brake lines & exhaust

muffler has a rattle
T case fluid Dark





City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #53682

Page 9 of 12
11/26/2024 2:17 PM

DRIVELINE SERVICE (NOT INCL. TRANSMISSION)
\$419.81 +tax

Written by 3 MIKE HALEY at 11/15/2024 11:39 AM

Brake Pad Measurements

10mm R

Written by 10 JAYCE WOWK at 11/18/2024 04:13 PM

Other Notes

Replaced LR sensor. Relearned as well

Written by 10 JAYCE WOWK at 11/18/2024 04:13 PM

Repairs wiring for light bar, confirmed operation of light bar with switch on dash post repair. Repair complete.

Written by 8 Sophie Ireland at 11/18/2024 04:13 PM

Intermediate pipe

Central pipe damaged in two places and flex pipe is fraying.

 <https://services.shop->

ware.com/uploads/v1/original/rT96y
paNKT5DPz7uIfW6S

Written by Brett Hunziker at 11/18/2024 04:17 PM

Resonator tailpipe came dented

Tail pipe resonator came dented



Written by 3 MIKE HALEY at 11/26/2024 01:33 PM




City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #53682

Page 10 of 12
11/26/2024 2:17 PM

Attached Images:

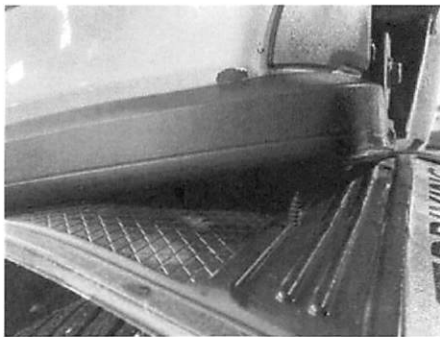




City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentrauto.ca

Invoice #53682

Page 11 of 12
11/26/2024 2:17 PM

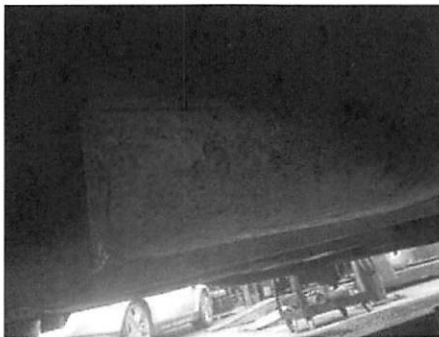





City Centre Automotive

9906 109 AVE
GRANDE PRAIRIE, AB
T8V 1R6
780-538-1154
service@citycentreauto.ca

Invoice #53682

Page 12 of 12
11/26/2024 2:17 PM

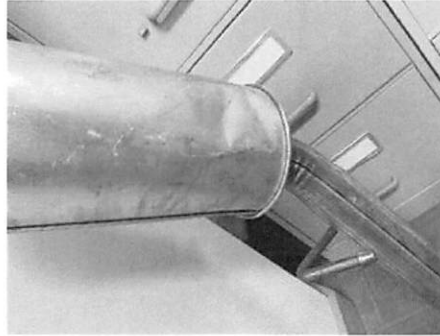

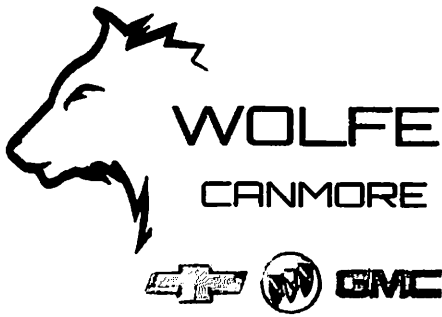

Wolfe Chevrolet GMC Buick Canmore Ltd.
 707 Railway Avenue Canmore, AB T1W-1P2
 Phone: 403-678-4222
 info@wolfeautomotive.com | www.wolfecanmore.com
 G.S.T # 791348477

SO# 267569

**SERVICE ORDER
 CUSTOMER COPY**



Printed 08/20/2024 6:08:32 PM

User Indy Page 1

Customer No
 Caribou Contracting
 117 3030
 Kelowna, BC E1Y 0C4

Home Cell Email **Bus Today**

Term VISA

Advisor	Gracie Powney	Promised	08/01/2024 6:00 PM	Tag#	1682
Shop	S1	Opened	07/29/2024 3:09 PM	Location	
Priority		Cashiered	08/20/2024 6:00 PM	PO #	

License	Odom In	Odom Out	In Service Date	Stock No
	270055	270062		
Year	Make	Model	Model Number	Colour
2018	GMC	SIERRA 1500	TK15543	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
3GTU2MEC3JG339547				
Engine	5.3L ECOTEC3 V8 WITH ACTIVE			

Request	Description	Job	CSR	Status
S11	CUSTOMER REPORTS VEHICLE IS NOT SHIFTING BETWEEN GEARS AND HAS NO POWER - CHECK AND ADVISE * TOWED IN *	1	A9055	Original

Labour	Description	Type	Amount
S11	CUSTOMER REPORTS THERE IS A TRANSMISSION ISSUE. THE VEHICLE IS INOPERATIVE. PLEASE CHECK AND ADVISE	C	359.90

Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount
19421426	FLUID	1		ROW4B7	CSO		37.71	37.71
19421425	FLUID	1		ROW4B8	CSO		8.50	8.50
Technician	A9033 -				Parts Total			46.21
Cause	INTERNALL TRANSMISSION FAILURE - METAL IN FLUID				Labour Total			359.90
Correction	PERFORMED INITIAL INSPECTION, CHECKED FLUID LEVEL AND CONDITION, FLUID LEVEL LOW, FLUID SMELLS BURNT, WILL NEED TO REMOVE TRANSMISSION FLUID PAN TO INSPECT FOR METAL IN FLUID OR OTHER DAMAGE,				Request Sub-total			406.11

GAINED ACCESS TO PAN, REMOVED TRANSMISSION FLUID PAN, FOUND METAL IN FLUID, INDICATES TORQUE CONVERTER FAILURE THAT SEND METAL THRU THE SYSTEM, WILL NEED NEW TRANSMISSION AND COOLER LINES AND AC CONDENSER (TRANSMISSION COOLER) INSTALLED PAN BACK AND FILLED FLUID TO DRIVE OUT VEHICLE

Request	Description	Job	CSR	Status
GMCSI	GM CANADA CERTIFIED SERVICE INSPECTION	2	A9055	Original

Labour	Description	Type	Amount
GMCSI	GMCSI INSPECTION	CS	0.00

Technician A9033 -
 Correction complete

Request	Description	Job	CSR	Status
S11	REPLACE TRANSMISSION, COOLER LINES, AC CONDENSER -CUSTOMER SUPPLIED TRANNY	4	A9055	Approved

Labour	Description	Type	Amount
S11	REPLACE TRANSMISSION, COOLER LINES, AC CONDENSER	C	2,609.28

Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount
19383805	CONDENSER	1		ROW1A	CSO	518.37	518.37	518.37

Wolfe Chevrolet GMC Buick Canmore Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

TERMS

ALL CHARGES DUE UPON RECEIPT OF STATEMENT. NO REFUNDS OR EXCHANGE ON STOCKED PARTS AFTER 30 DAYS OR SPECIAL ORDERS. NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR SPECIAL ORDERS. 20% HANDLING CHARGE ON ALL ACCEPTABLE RETURNS. NO REFUNDS WITHOUT THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S (EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER DETAILS. INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____

DATE: _____

G.S.T # 791348477



Wolfe Chevrolet GMC Buick Canmore Ltd.
 707 Railway Avenue Canmore, AB T1W-1P2
 Phone: 403-678-4222
 info@wolfeautomotive.com | www.wolfecanmore.com
 G.S.T # 791348477

SO# 267569

**SERVICE ORDER
 CUSTOMER COPY**



Printed 08/20/2024 6:08:32 PM

User Indy Page 2

Customer No
 Caribou Contracting
 117 3030
 Kelowna, BC E1Y 0C4

Home Cell Email

Bus Today

Term VISA

Advisor Gracie Powney **Promised** 08/01/2024 6:00 PM **Tag#** 1682
Shop S1 **Opened** 07/29/2024 3:09 PM **Location**
Priority **Cashiered** 08/20/2024 6:00 PM **PO #**

License **Odom In** 270055 **Odom Out** 270062 **In Service Date** **Stock No**

Year 2018 **Make** GMC **Model** SIERRA 1500 **Model Number** TK15543 **Colour**
Vehicle ID No 3GTU2MEC3JG339547 **Selling Dealer** **Extended Warranty** **Delivery Date**
Engine 5.3L ECOTEC3 V8 WITH ACTIVE

Vancouver 3*5 days							
19421426	FLUID	4	ROW4B7	CSO		37.71	150.84
Stock							
11548472	BOLT	4	GB6	CSO	7.87	7.87	31.48
Edmonton							
23107857	RETAINER,RR PROP SHF	2	OB5	CSO	7.06	7.06	14.12
Stock							
15035747	SEAL	1	BCD94	CSO	30.49	30.49	30.49
Edmonton							
20779889	CLAMP	1	BCD44	CSO	58.88	58.88	58.88
Stock							
15032594	NUT	6	OB6	CSO	10.53	10.53	63.18
Stock							
86816628	GASKET	1	D 6A	CSO	21.25	21.25	21.25
in stock							
85043948	PIPE	1	PEG3	CSO	253.14	253.14	253.14
13579648	SEAL	1	OB1	CSO	39.44	39.44	39.44
13579649	SEAL	1	OB1	CSO	29.04	29.04	29.04
15077362	SEAL	1	BCD105	CSO	31.65	31.65	31.65
19421425	FLUID	3	ROW4B8	CSO		8.50	25.50
R1234YF	R1234YF- REFRIGERANT	13	BULK	CSO	2.92	2.92	37.96
Technician	A9033 -				Parts Total		1,305.34
Cause	REPLACE TRANSMISSION, COOLER LINES, AC CONDENSER -CUSTOMER SUPPLIED TRANNY				Labour Total		2,609.28
Correction	REMOVED DRIVESHAFTS, EXHAUST, T-CASE, GAINED ACCES TO TRANSMISSION, SEPARATED FROM ENGINE, REMOVED TRANSMISSION, REPLACED TRANSMISISON COOLER HOSES, REPLACED AC CONDENSER, INSTALLED SUPPLIED USED TRANSMISSON, INSTALLED ALL PARTS BACK WITH NEW SEALS, GASKETS, CHARGED AC, PROGRAMMED TRANSMISSION RESET ADAPTS, FILLED AND SET FLUID LEVEL 18YN229310573				Request Sub-total		3,914.62

Request	Description	Job	CSR	Status
S11	REPLACE OIL COOLER LINES - LEAKING	5	A9055	Approved

Wolfe Chevrolet GMC Buick Canmore Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

TERMS

ALL CHARGES DUE UPON RECEIPT OF STATEMENT. NO REFUNDS OR EXCHANGE ON STOCKED PARTS AFTER 30 DAYS OR SPECIAL ORDERS. NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR SPECIAL ORDERS. 20% HANDLING CHARGE ON ALL ACCEPTABLE RETURNS. NO REFUNDS WITHOUT THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S (EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER DETAILS. INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____ DATE: _____ G.S.T # 791348477



Wolfe Chevrolet GMC Buick Canmore Ltd.
 707 Railway Avenue Canmore, AB T1W-1P2
 Phone: 403-678-4222
 info@wolfeautomotive.com | www.wolfecanmore.com
 G.S.T # 791348477

SO# 267569

**SERVICE ORDER
 CUSTOMER COPY**



Printed 08/20/2024 6:08:33 PM

User Indy Page 3

Customer No
 Caribou Contracting
 117 3030
 Kelowna, BC E1Y 0C4

Home Cell Email **Bus Today**

Term VISA

Advisor Gracie Powney **Promised** 08/01/2024 6:00 PM **Tag#** 1682
Shop S1 **Opened** 07/29/2024 3:09 PM **Location**
Priority **Cashiered** 08/20/2024 6:00 PM **PO #**

License **Odom In** 270055 **Odom Out** 270062 **In Service Date** **Stock No**

Year 2018 **Make** GMC **Model** SIERRA 1500 **Model Number** TK15543 **Colour**

Vehicle ID No 3GTU2MEC3JG339547 **Selling Dealer** **Extended Warranty** **Delivery Date**

Engine 5.3L ECOTEC3 V8 WITH ACTIVE

Labour	Description							Type	Amount
S11	REPLACE OIL COOLER LINES - LEAKING							C	431.88
Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount	
84791853	HOSE	1		PEG4	CSO	186.42	186.42	186.42	
Edmonton									
500010111	FULL SYNTHETIC SAE 0W20	8		BULK	CSO	7.57	7.57	60.56	
Technician	A9033 -							Parts Total	246.98
Cause	AS PER DIAGNOSE. . FURTHER EXAMINATION FOUND THE OIL COOLER LINES ARE LEAKING.							Labour Total	431.88
Correction	ACCESSED, REMOVED AND REPLACED THE OIL COOLER LINES WITH ALL OTHER RELATED NEW SEALS GASKETS AND/OR NON-REUSABLE HARDWARE AND REINSTALLED ALL COMPONENTS REMOVED FOR REPAIRS IN THE REVERSE ORDER OF REMOVAL. REMOVED THE SKID PLATE AND AIR INTAKE DUCT TO GAIN ACCESS TO THE OIL COOLER LINES. VERIFIED THE OIL COOLER LINES IS NO LONGER LEAKING.							Request Sub-total	678.86

Request	Description	Job	CSR	Status					
WB	REPLACE WIPER BLADES - WORN	6	A9055	Approved					
Labour	Description								
WB	REPLACE WIPER BLADES - WORN								
Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount	
23417074	BLADE	2		PEG1A	CQS	40.90	34.08	68.16	
Technician	A9033 -							Parts Total	68.16
Cause	WIPER BLADES REPLACEMENT							Labour Total	18.00
Correction	REPLACED THE FRONT WIPER BLADES.							Request Sub-total	86.16

Request	Description	Job	CSR	Status					
GBF	BG BRAKE SYSTEM FLUID EXCHANGE \$199.95 - DUE/DISCOLORED	7	A9055	Approved					
Labour	Description								
GBF	BG BRAKE SYSTEM FLUID EXCHANGE \$199.95 - DUE/DISCOLORED								
Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount	
BG84032	DOT 4 Brake Fluid	1		ROW4A2	CQS	50.77	50.77	50.77	
Stock									
Technician	A9033 -							Parts Total	50.77

Wolfe Chevrolet GMC Buick Canmore Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

TERMS


ALL CHARGES DUE UPON RECEIPT OF STATEMENT. NO REFUNDS OR EXCHANGE ON STOCKED PARTS AFTER 30 DAYS OR SPECIAL ORDERS. NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR SPECIAL ORDERS. 20% HANDLING CHARGE ON ALL ACCEPTABLE RETURNS. NO REFUNDS WITHOUT THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S (EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER DETAILS. INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____

DATE: _____

G.S.T # 791348477

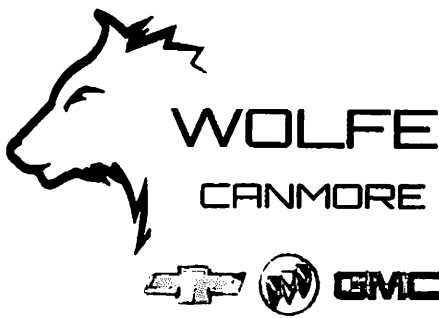

Wolfe Chevrolet GMC Buick Canmore Ltd.
 707 Railway Avenue Canmore, AB T1W-1P2
 Phone: 403-678-4222
 info@wolfeautomotive.com | www.wolfecanmore.com
 G.S.T # 791348477

SO# 267569

**SERVICE ORDER
 CUSTOMER COPY**



Printed 08/20/2024 6:08:33 PM

User Indy Page 4

Customer No Caribou Contracting 117 3030 Kelowna, BC E1Y 0C4		Advisor Gracie Powney	Promised 08/01/2024 6:00 PM	Tag# 1682
Home Cell Email	Bus Today	Shop S1	Opened 07/29/2024 3:09 PM	Location
Term VISA		Priority	Cashiered 08/20/2024 6:00 PM	PO #
License	Odom In 270055	Odom Out 270062	In Service Date	Stock No
Year 2018	Make GMC	Model SIERRA 1500	Model Number TK15543	Colour
Vehicle ID No 3GTU2MEC3JG339547	Selling Dealer	Extended Warranty	Delivery Date	
Engine 5.3L ECOTEC3 V8 WITH ACTIVE				

Cause	bg brake fluid service	Labour Total	149.18
Correction	performed bg brake fluid service	Request Sub-total	199.95

Request BIB	Description BULB INSTALL- BASIC - LEFT LIC PLATE	Job 8	CSR A9055	Status Approved
Labour BIB	Description BULB INSTALL- BASIC - LEFT LIC PLATE		Type CS	Amount 39.95
Part 13503401	Description BULB	Shp 1	SL	Bin BB4
			Type CQS	Retail 4.96
			Price 3.76	Amount 3.76
Technician A9033 -			Parts Total	3.76
Cause BULB INSTALL- BASIC - LEFT LIC PLATE			Labour Total	39.95
Correction REPLACED LEFT LIC PLATE BULB			Request Sub-total	43.71

Request S11	Description REPLACE ENGINE REAR MAIN SEAL WITH HOUSING - LEAKING - ADDITIONAL LABOR WHEN DOING TRANSMISSION	Job 9	CSR A9055	Status Approved
Labour S11	Description REPLACE ENGINE REAR MAIN SEAL WITH HOUSING - LEAKING - ADDITIONAL LABOR WHEN DOING TRANSMISSION		Type C	Amount 269.93
Part 12665076	Description SEAL	Shp 1	SL	Bin CSO24
			Type CSO	Retail 59.06
			Price 59.06	Amount 59.06
Edmonton 88901148	SEALANT	1		BCS19
			Type CSO	Retail 15.61
			Price 15.61	Amount 15.61
Technician A9033 -			Parts Total	74.67
Cause AS PER DIAGNOSE. FURTHER EXAMINATION FOUND THE REAR MAIN SEAL IS LEAKING FLUID.			Labour Total	269.93
Correction REMOVED THE TRANSMISSION AND FLEX PLATE TO GAIN ACCESS TO THE REAR MAIN SEAL. ACCESSED, REMOVED AND REPLACED THE REAR MAIN SEAL AND REINSTALLED ALL COMPONENTS REMOVED FOR REPAIRS IN THE REVERSE ORDER OF REMOVAL. VERIFIED THE REAR MAIN SEAL IS NO LONGER LEAKING.			Request Sub-total	344.60

Request S11	Description RESEAL OIL PAN - LEAKING	Job 10	CSR A9055	Status Approved
Labour	Description		Type	Amount

Wolfe Chevrolet GMC Buick Canmore Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

TERMS

ALL CHARGES DUE UPON RECEIPT OF STATEMENT. NO REFUNDS OR EXCHANGE ON STOCKED PARTS AFTER 90 DAYS OR SPECIAL ORDERS. NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR SPECIAL ORDERS. 20% HANDLING CHARGE ON ALL ACCEPTABLE RETURNS. NO REFUNDS WITHOUT THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S (EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER DETAILS. INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____ DATE: _____ G.S.T # 791348477



Wolfe Chevrolet GMC Buick Canmore Ltd.
 707 Railway Avenue Canmore, AB T1W-1P2
 Phone: 403-678-4222
 info@wolfeautomotive.com | www.wolfecanmore.com
 G.S.T # 791348477

SO# 267569

**SERVICE ORDER
 CUSTOMER COPY**



Printed 08/20/2024 6:08:33 PM

User Indy Page 5

Customer No
 Caribou Contracting
 117 3030
 Kelowna, BC E1Y 0C4

Home Cell Email **Bus Today**

Term VISA

Advisor Gracie Powney **Promised** 08/01/2024 6:00 PM **Tag#** 1682
Shop S1 **Opened** 07/29/2024 3:09 PM **Location**
Priority **Cashiered** 08/20/2024 6:00 PM **PO #**

License **Odom In** 270055 **Odom Out** 270062 **In Service Date** **Stock No**

Year 2018 **Make** GMC **Model** SIERRA 1500 **Model Number** TK15543 **Colour**
Vehicle ID No 3GTU2MEC3JG339547 **Selling Dealer** **Extended Warranty** **Delivery Date**
Engine 5.3L ECOTEC3 V8 WITH ACTIVE

Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount
S11	RESEAL OIL PAN - LEAKING							C 1,223.66
19369832	SEALANT	1		BCS18	CSO	32.44	32.44	32.44
12621086	SEAL	2		OB1	CSO	14.24	14.24	28.48
12666993	SEAL	1		GB1	CSO	7.44	7.44	7.44
12684038	FILTER PF26	1		FILTER	CSO	24.17	24.17	24.17
500010111	FULL SYNTHETIC SAE 0W20	8		BULK	CSO	7.57	7.57	60.56
12652951	TUBE	1			CSO	52.46	52.46	52.46
500010111	FULL SYNTHETIC SAE 0W20	8		BULK	CQS	7.57	7.57	60.56
12735811	FILTER	1			CQS	22.03	18.06	18.06
Technician	A9033 -							Parts Total 284.17
Cause	RESEAL OIL PAN - LEAKING							Labour Total 1,223.66
Correction	REMOVED STEERING GEAR, REMOVED FRONT DIFFERENTIAL, GAINED ACCESS TO OIL PAN, REMOVED OIL PAN, CLEANED PAN, REPLACED SEALS, APPLIED RTV, INSTALLED PAN, TORQUED TO SPECS, INSTALLED ALL REMOVED PARTS, INSTALLED DIFFERENTIAL AND STEERING GEAR, INSTALLED NEW FILTER AND FILLED OIL							Request Sub-total 1,507.83

Request	Description	Job	CSR	Status				
BSR	PERFORM REAR BRAKE RELINE. INCLUDES REPLACE REAR BRAKE SHOES AND MACHINE OR REPLACE DRUMS. - PADS LOW 3MM	11	A9055	Approved				
Labour	Description	Type	Amount					
BSR	PERFORM REAR BRAKE RELINE. INCLUDES REPLACE REAR BRAKE SHOES AND MACHINE OR REPLACE DRUMS. - PADS LOW 3MM	CS	249.95					
Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount
SG8312X	REAR PADS	1			CQS	196.58	196.58	196.58
23195438	ROTOR	2		ROW2C6	CQS	327.16	327.16	654.32
Technician	A9033 -							Parts Total 850.90
Cause	rear brakes replacement							Labour Total 249.95

Wolfe Chevrolet GMC Buick Canmore Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

TERMS

ALL CHARGES DUE UPON RECEIPT OF STATEMENT. NO REFUNDS OR EXCHANGE ON STOCKED PARTS AFTER 30 DAYS OR SPECIAL ORDERS. NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR SPECIAL ORDERS. 20% HANDLING CHARGE ON ALL ACCEPTABLE RETURNS. NO REFUNDS WITHOUT THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S (EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER DETAILS. INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____ DATE: _____ G.S.T # 791348477



Wolfe Chevrolet GMC Buick Canmore Ltd.
 707 Railway Avenue Canmore, AB T1W-1P2
 Phone: 403-678-4222
 info@wolfeautomotive.com | www.wolfecanmore.com
 G.S.T # 791348477

SO# 267569

**SERVICE ORDER
 CUSTOMER COPY**



Printed 08/20/2024 6:08:33 PM

User Indy Page 6

Customer No
 Caribou Contracting
 117 3030
 Kelowna, BC E1Y 0C4

Home **Bus**
Cell **Today**
Email

Term VISA

Advisor	Gracie Powney	Promised	08/01/2024 6:00 PM	Tag#	1682
Shop	S1	Opened	07/29/2024 3:09 PM	Location	
Priority		Cashiered	08/20/2024 6:00 PM	PO #	

License	Odom In	Odom Out	In Service Date	Stock No
	270055	270062		
Year	Make	Model	Model Number	Colour
2018	GMC	SIERRA 1500	TK15543	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
3GTU2MEC3JG339547				
Engine	5.3L ECOTEC3 V8 WITH ACTIVE			

Correction replaced rear pads and rotors, adjusted park brake shoes **Request Sub-total 1,100.85**

Request	Description	Job	CSR	Status				
S11	REPLACE L/F LOWER CONTROL ARM - WRONG ARM INSTALLED	12	A9055	Approved				
Labour	Description	Type	Amount					
S11	REPLACE L/F LOWER CONTROL ARM - WRONG ARM INSTALLED	C	359.90					
Part	Description	Shp	SL	Bin	Type	Retail	Price	Amount
L2000-3366178	F/L Lower Control Arm and ball joint ASSY	1		SPORD	CSO	611.20	611.20	611.20
1-2 day eta								
Technician	A9033 -			Parts Total		611.20		
Cause	REPLACE L/F LOWER CONTROL ARM - WRONG ARM INSTALLED			Labour Total		359.90		
Correction	REMOVED L/F BRAKE CALIPER, REMOVED L/F KNUCKLE, REMOVED SWAY BAR, REPLACED L/F LOWER CONTROL ARM, INSTALLED ALL PARTS BACK			Request Sub-total		971.10		

Request	Description	Job	CSR	Status
WA	WHEEL ALIGNMENTS \$179.95	13	A9055	Approved
Labour	Description	Type	Amount	
WA	WHEEL ALIGNMENTS \$179.95	CS	179.95	
Technician	A9033 -			Labour Total
Cause	WHEEL ALIGNMENT			Request Sub-total
Correction	PERFORMED WHEEL ALIGNMENT			179.95

Wolfe Chevrolet GMC Buick Canmore Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

TERMS

ALL CHARGES DUE UPON RECEIPT OF STATEMENT. NO REFUNDS OR EXCHANGE ON STOCKED PARTS AFTER 30 DAYS OR SPECIAL ORDERS. NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR SPECIAL ORDERS. 20% HANDLING CHARGE ON ALL ACCEPTABLE RETURNS. NO REFUNDS WITHOUT THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S (EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER DETAILS. INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$_____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____

DATE: _____

G.S.T # 791348477



Wolfe Chevrolet GMC Buick Canmore Ltd.
 707 Railway Avenue Canmore, AB T1W-1P2
 Phone: 403-678-4222
 info@wolfeautomotive.com | www.wolfecanmore.com
 G.S.T # 791348477

SO# 267569

**SERVICE ORDER
 CUSTOMER COPY**



Printed 08/20/2024 6:08:33 PM

User Indy Page 7

Customer No
 Caribou Contracting
 117 3030
 Kelowna, BC E1Y 0C4

Home Cell Email **Bus Today**

Term VISA

Advisor	Gracie Powney	Promised	08/01/2024 6:00 PM	Tag#	1682
Shop	S1	Opened	07/29/2024 3:09 PM	Location	
Priority		Cashiered	08/20/2024 6:00 PM	PO #	

License	Odom In	Odom Out	In Service Date	Stock No
	270055	270062		
Year	Make	Model	Model Number	Colour
2018	GMC	SIERRA 1500	TK15543	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
3GTU2MEC3JG339547				
Engine	5.3L ECOTEC3 V8 WITH ACTIVE			

Re-torque wheels after 100km

Labour	5,891.58
Parts	3,542.16
Supplies	150.00
Sub-Total	9,583.74
GST	479.19
Total Invoice	10,062.93
VISA	10,062.93

WOLFE CANMORE
 707 RAILWAY AVE
 CANMORE, AB. T1W 1P2
 403-678-4222

Additional W Date / Time		Phone Number	Comments	Amount
08/07/2024 1:00		(250) 640-0553		\$5,598.37
08/07/2024 1:00	SALE	(250) 640-0553		\$743.64
08/07/2024 1:00		(250) 640-0553		\$76.82
08/07/2024 1:00	Clerk #: 000049	(250) 640-0553		\$222.33
08/07/2024 1:00		(250) 640-0553		\$49.70
08/07/2024 1:00	REF#: 00000011	(250) 640-0553		\$456.36
08/07/2024 1:00	Batch #: 659	(250) 640-0553		\$1,790.60
08/07/2024 1:00	08/20/24	(250) 640-0553		\$1,138.34
08/07/2024 2:00		(250) 640-0553		\$1,025.09
08/07/2024 2:00	Inv/Tkt #: 267569	(250) 640-0553		\$206.94
Recommend Code	APPR CODE: 614111			
CEL ON	ENCRYPTED BY ELAVON			
S11	Trace: 11			
** Deferred Serv	VISA	Manual CNP	- PLEASE ADVISE - P2635, P018B	\$179.95
	*****9687	***	PIPE - BEND AND DAMAGED	\$1,614.38

AMOUNT \$10,062.93

APPROVED

THANK YOU / MERCI

CUSTOMER COPY

Wolfe Chevrolet GMC Buick Canmore Ltd. has the ability to contact you via Mobile Texting in regards to vehicle servicing or information requests. Please be advised that standard charges may apply.

TERMS

ALL CHARGES DUE UPON RECEIPT OF STATEMENT. NO REFUNDS OR EXCHANGE ON STOCKED PARTS AFTER 30 DAYS OR SPECIAL ORDERS. NO REFUNDS OR EXCHANGE ON ELECTRICAL ITEMS OR SPECIAL ORDERS. 20% HANDLING CHARGE ON ALL ACCEPTABLE RETURNS. NO REFUNDS WITHOUT THIS INVOICE.

ALL GENUINE PARTS & ACCESSORIES ARE WARRANTED FOR 12 MONTHS UNLIMITED KM'S (EXEMPTING MAINTENANCE AND WEAR AND TEAR ITEMS). INQUIRE FOR FURTHER DETAILS. INDEBTNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OR THE BALANCE OWING FOR REPAIRS, PARTS & ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.

CUSTOMER SIGNATURE: _____

DATE: _____

G.S.T # 791348477



RailCore X Inc.
 93-54200 Range Road 265
 Sturgeon County, AB T8T 0E2
 1-855-349-7245
 Email:roslyn@RailCoreXinc.com

INVOICE

Invoice No.: 4397
 Date: May 02, 2024
 Ship Date:
 Page: 1
 Re: Order No.

Sold to:
Cariboo Railroad Contracting Corp.
 459 N Dean Rd
 Auburn, AL 36830
 US

Ship to:
 Cariboo Railroad Contracting Corp.
 459 N Dean Rd
 Auburn, AL 36830
 US

Business No.: 726887870RT0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
			UNIT 45 2018 GMC 1500 VIN 3GTU2MEC3JG339547 KM 248757	G		
30914	Each	1.0	Wheel Hub Bearing Assembly	G	841.36	841.36
00538	Each	1.0	Sway Bar Link Kit	G	34.28	34.28
SRA	Each	2.1	Shop Rate (Automotive) Inspect and replace worn front left wheel bearing assembly	G	145.00	304.50
SUP	Dollars	304.5	Shop Supplies (Added to every hours of work)	G	0.06	18.27
SRA	Each	0.5	Shop Rate (Automotive) Replace Missing Saw Bar Link	G	145.00	72.50
SUP	Dollars	72.5	Shop Supplies (Added to every hours of work)	G	0.06	4.35
SRA	Each	0.5	Shop Rate (Automotive) Fix Mud Flaps	G	145.00	72.50
SUP	Dollars	72.5	Shop Supplies (Added to every hours of work)	G	0.06	4.35
			Subtotal:			1,352.11
			G - GST 5%			67.62
			GST			

Job Code: CARIBOO.OPS24

Task Code: A99

Equipment Unit #: 45

Comment: REPAIR

DocuSigned by:

 C2DEEF0C9EDD4F2...
 2024-05-28

Rec May 03/24

RailCore X Inc. GST: #726887870RT0001

Shipped By:	Tracking Number:	Total Amount	1,419.73
Comment: Thank You for your Business!!!		Amount Paid	0.00
Sold By:		Amount Owing	1,419.73



RailCore X Inc.
 93-54200 Range Road 265
 Sturgeon County, AB T8T 0E2
 1-855-349-7245
 Email:roslyn@RailCoreXinc.com

INVOICE

Invoice No.: 4234
 Date: Mar 20, 2024
 Ship Date:
 Page: 1
 Re: Order No.


Sold to:

Cariboo Railroad Contracting Corp.
 459 N Dean Rd
 Auburn, AL 36830
 US

Ship to:

Cariboo Railroad Contracting Corp.
 459 N Dean Rd
 Auburn, AL 36830
 US

Business No.: 726887870RT0001

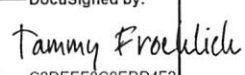Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
AB-6745	Each	1	UNIT 45 KM238588	G		
SRA	Each	2	Water Pump	G	350.00	350.00
			Shop Rate (Automotive) Replaced water pump	G	145.00	290.00
SUP	Dollars	290	Shop Supplies (Added to every hours of work)	G	0.06	17.40
Subtotal:						657.40
G - GST 5%						
GST						32.87
<p>Job Code: CARIBOO.OPS24</p> <p>Task Code: A99</p> <p>Equipment Unit #: 45</p> <p>Comment: WATERPUMP</p>						
<p>DocuSigned by:  C2DEEF0C9EDD4F2... 2024-03-21</p>						
<p>Rec Mar 20/24</p>						
RailCore X Inc. GST: #726887870RT0001						
Shipped By: Tracking Number:					Total Amount	690.27
Comment: Thank You for your Business!!!					Amount Paid	0.00
Sold By:					Amount Owing	690.27



RailCore X Inc.
 93-54200 Range Road 265
 Sturgeon County, AB T8T 0E2
 1-855-349-7245
 Email:roslyn@RailCoreXinc.com

INVOICE

Invoice No.: 4057
 Date: Feb 02, 2024
 Ship Date:
 Page: 1
 Re: Order No.

Sold to:

Cariboo Railroad Contracting Corp.
 459 N Dean Rd
 Auburn, AL 36830
 US

Ship to:

Cariboo Railroad Contracting Corp.
 459 N Dean Rd
 Auburn, AL 36830
 US

Business No.: 726887870RT0001

Item No.	Unit	Quantity	Description	Tax	Unit Price	Amount
			Unit 45			
MISC	Each	1	Injector	G	173.90	173.90
MISC	Each	1	Pads	G	145.79	145.79
MISC	Each	1	Seal Kit	G	30.29	30.29
MISC	Each	1	Rotor	G	163.60	163.60
SRA	Each	10	Shop Rate (Automotive)	G	145.00	1,450.00
SUP	Dollars	1	Shop Supplies (Added to every hours of work)	G	50.00	50.00
			Subtotal:			2,013.58
			G - GST 5%			100.68
			GST			
			Job Code: cariboo ops			
			Task Code: a16			
			Equipment Unit #: 45			
			Comment: repairs			
				Rec Feb 02/24		
RailCore X Inc. GST: #726887870RT0001						
Shipped By: _____ Tracking Number: _____					Total Amount	2,114.26
Comment: Thank You for your Business!!!					Amount Paid	0.00
Sold By: _____					Amount Owing	2,114.26

DocuSigned by:

 FEC3DE5E49404D9
 2024-02-05



T&B Fleet Services
 #2 877 Redonda St.
 Sunnyside, MB. R5R 0J4
 Phone: 204-222-3608
 Fleet Hirail Repairs & Vehicle Service

INVOICE

1999

Org. Est. # 001415
 GST #77259 9601 RT0001

INVOICE

Printed Date: 09/02/2022 Work Completed: 09/02/2022

Cariboo Central Railroad
 101 Cory Road
 Saskatoon, SK S7K 3J7
 Cell 1 306-831-7541 Marcel Boehm, Approver

2018 GMC - Sierra 1500 SLE - 5.3L, V8 (323CI) VIN(C)
 Lic # : SB 8322 Odometer In : 151717
 Unit # : 45
 VIN # : 3GTU2MEC3 JG339547

Part Description	/ Number	Qty	Sale	Ext	Labor Description	Hours	Ext
Remanufactured Starter <CORE> 52055 Shop Supplies		1.00	461.36	461.36	DIAGNOSING- Check Engine Light On FOUND A WHOLE LIST OF CODES , COULD BE THE FAULT OF STARTER SHORTING, CLEARED ALL CODES AND ROAD TESTED	1.00	125.00
				22.50	REMOVE SIDE STEP AND BRACKETS FOR BOTH SIDES REMOVED BOTH SIDE STEPS AND BRACKETS	1.00	125.00
					CHECK STARTER FOUND STARTER STARTS EVERY TIME , BUT IT DOESNT SOUND HEALTHY, REQUIRES STARTER,	0.50	62.50
					STARTER ASSEMBLY - Remove & Replace - V8	1.01	126.25
					Enviro Fees		4.50
					Taxes		
					GST		46.36
					PST		64.90

Org. Estimate 287.00 Revisions 0.00 Current Estimate 287.00

Labor:	438.75
Parts:	483.86
HazMat:	4.50
SubTotal:	927.11
Tax:	111.26
Total:	1,038.37
Bal Due:	\$1,038.37

[Payments -]

THANKS FOR YOUR BUSINESS!

Vehicle Received: 9/2/2022

Customer Number : 65

Wheel Nuts are torqued to factory specifications & must be rechecked within 100 KMS from time wheels were removed. T&B Fleet Services is not responsible for loss or damage to vehicles or articles left in vehicle in case of fire, theft, or any other cause beyond our control.
 Parts Warranty is set by the manufacturer , typically 1 year. Labor Warranty is 90 days and must be performed in our shop and cannot exceed the original cost of repairs.
 PAYMENT TERMS: Net 30 NOTE: if paying by credit card over the phone there will be a 2% charge to total invoice

Signature _____ Date _____

Visit us on the web: www.tbfleetservices.ca

Email Address: info@tbfleetservices.ca

Tech 7 Auto Repair Inc.
 1A 2605 Faithful Avenue
 Saskatoon, SK. S7K 5W2
 Phone: 306-978-2269 Fax: 000- -
 Let our Family Take Care of Yours!

INVOICE**7962**

780858338RC0001

INVOICE

Printed Date: 07/11/2022

Work Completed: 07/11/2022

cariboo central
 117 3030 panbosy street
 kelowna, bc
 Home 250-640-4557

2018 GMC - Sierra 1500 SLE - 5.3L, V8 (323CI) VIN(C)

Lic # :

Odometer In : 139384

VIN # : 3GTU2MEC3 JG339547

Part Description	Qty	Sale	Ext	Labor Description	Ext
cross countru batt	1.00	135.00	135.00	AVR Test	46.00
ROTOR,FRT BRK (COATED)/Disc	2.00	164.34	328.68	AVR Test	
Brake Rotor				DISC ROTOR - Remove & Replace - Front,Both -	115.00
Shop Supplies			16.10	[Includes: Replace Pads (if necessary). DOES NOT	
Hazardous Materials			1.99	include refinishing.]	
Taxes					
PST					38.57
GST					32.14

Job Code: CARIBOO.OPS23

Task Code: A99

Equipment Unit #: 45

Comment: BRAKES, BATTERY

Rec Jul 11/22

DocuSigned by:

Tammy Froelich
 275231AF148B49C...

Jul 12, 2022

Org. Estimate 0.00 Revisions 0.00 Current Estimate 0.00

Labor:	161.00
Parts:	479.78
HazMat:	1.99
SubTotal:	642.77
Tax:	70.71
Total:	713.48
Bal Due:	\$713.48

[Payments -]

Vehicle Received: 7/11/2022

Customer Number : 2241

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs there to.
 All Parts removed will be discarded unless instructed otherwise: Save all Parts _____. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.
 If wheels have been removed please return to the shop within 100km to retorque.

Signature _____ Date _____

Visit us on the web: www.tech7autorepair.comEmail Address: service@tech7autorepair.com