



Cummins South Pacific Pty. Ltd.

ABN NO. 42006332949

Campbellfield
Private Bag 9
Somerton VIC 3062
Ph: 03 9357 9200
Fax: 03 9357 9916

COPY

WORKSHOP TAX INVOICE

INVOICE NUMBER

1398563

INVOICE DATE

10/10/24

PAGE

1

Invoice To

Account Number 3200539
METCALF CRANE SERVICES PTY LTD
METCALF CRANE SERVICES PTY LTD
PO BOX 54
SOMERTON
VIC 3062

Customer

METCALF CRANE SERVICES PTY LTD
PO BOX 54
SOMERTON VIC 3062

Engine Model:	SIGNATURE/ISX/QSX	Eng No:	80577007	Equip Make:	KENWORTH
FleetNo:		Reg No:	XW680H	Cust Ord NO:	PO001471
Date in Service:	20/03/24	KLMS:	18700	HRS:	434
Repair Date:	02/10/24	Chassis NO:	479044	Currency:	AUD
C.O.No.	6747140	Work ordNo.	2916772	Facility	320

Complaint:

Active 3548 & Engine Service

Cause:

MAINTENANCE

Correction:

Complete JSA, Hard Card, ECM Download, and Check for Fault Codes.

Carry out vehicle Engine Service as per schedule which includes :

- Inspect engine and vehicle for coolant and oil leaks
- Inspect and report on Air Filter condition, replace if required
- Test coolant and check level
- Inspect and report on belts, tensioners, and pulleys
- Check all hoses and clamps
- Check batteries, and terminals
- Replace and date engine oil filter
- Replace engine oil
- Replace and date fuel filter/s
- Replace and date water filter, if required
- Check and torque sump plug
- Check power steering fluid level, top up if required
- Replace doser pump air supply filter, and perform airside flush
- Fill washer bottle with additive and top up
- Steam clean engine
- Fill out service sticker, fit to vehicle
- Check over and release vehicle back to service

Additional:

- ECM logged Active FC3548 Loss of Prime
- Inspect DEF tank pick up assembly for blockage, all clear
- Inspect DEF lines for blockages, all clear
- Inspect doser pump inlet fitting, fitting filter all clear
- Inspect DEF injector nozzle, all clear
- Cleaned and refit all DEF system parts
- Carry out 3x doser airside flushes
- Performed Doser Override Test, 100mL in 6 minutes, spray pattern correct, all okay

Cummins South Pacific Pty. Ltd. WORKSHOP TAX INVOICE



Campbellfield
Private Bag 9
Somerton VIC 3062
Ph: 03 9357 9200
Fax: 03 9357 9916

INVOICE NUMBER 1398563
INVOICE DATE 10/10/24
PAGE 2

Invoice To
Account Number 3200539

Customer METCALF CRANE SERVICES PTY LTD

Description	Operation	Unit price	Qty	Extension
-------------	-----------	------------	-----	-----------

- Found fault to become Inactive
- Cleared ECM of Inactive faults

Service Notes:

- Changed diff oils as per customer request
- Changed diff oil filter

=====

Capped Price Engine Service = \$ 850 + GST

Additional 3 Hrs Labour = \$ 570 + GST

Diff Oil = \$ 289.86 + GST

Diff Oil Filter = \$ 19.88 + GST

Banking Details

Cummins South Pacific Pty Ltd
Australia and New Zealand Banking Group Limited (ANZ)
Level 4, 100 Queen Street, Melbourne VIC 3000
Account No: 836551902 BSB:013 479
Swift Code: ANZBAU3M

Include Account and Invoice Numbers in Payment Reference

Description	Operation	Unit price	Qty	Extension
-------------	-----------	------------	-----	-----------

Labour	3		5.00	
--------	---	--	------	--

Material

1399.20	20LTR HP GEAR OIL 85W/140		2	
FF5825NN	FUEL FILTER		1	
AS2474	AIR OIL SEPARATOR		1	
LF14000NN	OIL FILTER COMBO SPIN ON		1	
1324	PREMIUM BLUE 8600 BULK OI		50	
FS19764	ELEMENT		1	
LF689	LUBE FILTER (REP.LF784)		1	

Cummins South Pacific Pty. Ltd. WORKSHOP TAX INVOICE



Campbellfield
Private Bag 9
Somerton VIC 3062
Ph: 03 9357 9200
Fax: 03 9357 9916

INVOICE NUMBER 1398563
INVOICE DATE 10/10/24
PAGE 3

Invoice To

Account Number 3200539

Customer METCALF CRANE SERVICES PTY LTD

Description	Operation	Unit price	Qty	Extension
-------------	-----------	------------	-----	-----------

SUB-TOTAL				1729.74
-----------	--	--	--	---------

G.S.T				172.97
-------	--	--	--	--------

INVOICE TOTAL				1902.71
---------------	--	--	--	---------

METCALF CRANE SERVICES PTY LTD

PRIME MOVER - INSPECTION & SERVICE REPORT

JOB NUMBER:	H24-02	UNIT NUMBER:	UH24	DATE:	19.03.2025
TRUCK MODEL:	Kenworth T610 sar	REGISTRATION NUMBER:	XW680H	KM'S:	43,626km
HOURS:	977 hrs				

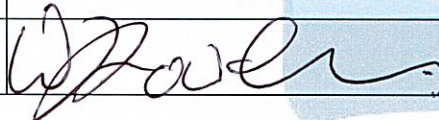
***NOTE: MAKE SURE THAT HOURS AND KILOMETRES ARE RECORDED – MAKE SURE A SERVICE STICKER IS FITTED**

SERVICE	DONE	OK	N/A	INITIAL	CHECK FAULT – COMMENTS – PLEASE NOTE ALL FINDINGS
TEST DRIVE					
Drain air pressure, check build up	☐	☒	☐		
Check park brake operation	☐	☒	☐		
Check braking operation	☐	☒	☐		
Check transmission operation	☐	☒	☐		
ELECTRICAL					
Operation of all lights	☐	☒	☐		
Check all warning systems:- horns	☐	☒	☐		
Check all warning systems:- flashing lights	☐	☒	☐		
Check all switch functions	☐	☒	☐		
Check wiper/washer operation & condition	☒	☒	☐		
Check air conditioning operation	☐	☒	☐		
CAB & PANEL					
Ensure items in cab are secure	☐	☒	☐		
Condition of cab glass & interior	☐	☒	☐		
Condition of cab, panels & doors	☐	☒	☐		
Check seat belt condition & mounting	☐	☒	☐		
STEERING					
Check all linkages & ball joints	☐	☒	☐		
Check ball joint rubber condition	☐	☒	☐		
Check & report leaks	☐	☒	☐		

SERVICE	DONE	OK	N/A	INITIAL	CHECK FAULT – COMMENTS – PLEASE NOTE ALL FINDINGS
BRAKES					
Drain water from air tanks	☐	☒	☐		
Check condition & thickness of linings	☐	☒	☐		
WHEELS					
Check tyre condition & pressures	☐	☒	☐		
Check wheel nuts	☐	☒	☐		
PLEASE USE ISOLATION PROCEDURES & TAGS					
Change engine oil & fill to level	☒	☐	☐		Type & Litres: 48ltrs E900
Change oil filters	☒	☐	☐		Filter No: LF14000NN
Change fuel filters	☒	☐	☐		Filter No: FF5776
Change fuel pre filter	☐	☒	☐		Filter No:
Check & clean air filter outer	☒	☐	☐		Filter No:
Check & clean air filter inner	☐	☐	☒		Filter No:
Check coolant level	☐	☒	☐		
Check & report coolant leaks	☐	☒	☐		
Check & report oil or fuel leaks	☐	☒	☐		
Check condition of hose & secure clips	☐	☒	☐		
Check condition of mounts	☐	☒	☐		
Check exhaust system	☐	☒	☐		
Check battery levels, clean & lube terminals	☐	☒	☐		
Check washer bottle level	☐	☒	☐		
Check air intake system	☐	☒	☐		
TRANSMISSION ☐					
Check & report any oil leaks	☐	☒	☐		
DIFFERENTIAL, FINAL DRIVES & DRIVELINES					
Check & report oil leaks	☐	☒	☐		
Fill oil to level	☐	☒	☐		
Check wear & lubricate drive shafts	☐	☒	☐		
BRAKES					
Adjust all brakes	☐	☒	☐		
Change air dryer filter	☐	☐	☒		

GENERAL COMMENTS

TYRE PRESSURE	AXLE 1	AXLE 2	AXLE 3	AXLE 4
INNER	110Psi	110Psi	110Psi	
OUTER	110psi	110Psi	110Psi	

INSPECTED BY:	Will Howden	QUALIFICATION:	Mechanic
SIGNATURE:		DATE:	19.03.2025

Certification by Responsible Person:

I certify that the described plant is to the manufacturers specifications and is being serviced and maintained by competent personnel to the manufacturer's recommendations

PRINT NAME:	Nick de Leur	POSITION:	Workshop Supervisor
SIGNATURE:		DATE:	19.03.2025

METCALF CRANE SERVICES PTY LTD

PRIME MOVER - INSPECTION & SERVICE REPORT

JOB NUMBER:	H24-04	UNIT NUMBER:	UH24	DATE:	01.06.2026
TRUCK MODEL:	Kenworth T610 SAR	REGISTRATION NUMBER:	XV680H	KM'S:	83,220km
HOURS:	2,120 Hrs				

***NOTE: MAKE SURE THAT HOURS AND KILOMETRES ARE RECORDED – MAKE SURE A SERVICE STICKER IS FITTED**

SERVICE	DONE	OK	N/A	INITIAL	CHECK FAULT – COMMENTS – PLEASE NOTE ALL FINDINGS
TEST DRIVE					
Drain air pressure, check build up	☐	☒	☐		
Check park brake operation	☐	☒	☐		
Check braking operation	☐	☒	☐		
Check transmission operation	☐	☒	☐		
ELECTRICAL					
Operation of all lights	☐	☒	☐		
Check all warning systems:- horns	☐	☒	☐		
Check all warning systems:- flashing lights	☐	☒	☐		
Check all switch functions	☐	☒	☐		
Check wiper/washer operation & condition	☒	☒	☐		
Check air conditioning operation	☐	☒	☐		
CAB & PANEL					
Ensure items in cab are secure	☐	☒	☐		
Condition of cab glass & interior	☐	☒	☐		
Condition of cab, panels & doors	☐	☒	☐		
Check seat belt condition & mounting	☐	☒	☐		
STEERING					
Check all linkages & ball joints	☐	☒	☐		
Check ball joint rubber condition	☐	☒	☐		
Check & report leaks	☐	☒	☐		

SERVICE	DONE	OK	N/A	INITIAL	CHECK FAULT – COMMENTS – PLEASE NOTE ALL FINDINGS
BRAKES					
Drain water from air tanks	☐	☒	☐		
Check condition & thickness of linings	☐	☒	☐		
WHEELS					
Check tyre condition & pressures	☐	☒	☐		
Check wheel nuts	☐	☒	☐		
PLEASE USE ISOLATION PROCEDURES & TAGS					
Change engine oil & fill to level	☒	☐	☐		Type & Litres: 50ltrs E900
Change oil filters	☒	☐	☐		Filter No: LF14000NN
Change fuel filters	☒	☐	☐		Filter No: FF5776
Change fuel pre filter	☐	☒	☐		Filter No: FS19764
Check & clean air filter outer	☐	☒	☐		Filter No: 2 x P625287
Check & clean air filter inner	☐	☐	☒		Filter No:
Check coolant level	☐	☒	☐		
Check & report coolant leaks	☐	☒	☐		
Check & report oil or fuel leaks	☐	☒	☐		
Check condition of hose & secure clips	☐	☒	☐		
Check condition of mounts	☐	☒	☐		
Check exhaust system	☐	☒	☐		
Check battery levels, clean & lube terminals	☐	☒	☐		
Check washer bottle level	☐	☒	☐		
Check air intake system	☐	☒	☐		
TRANSMISSION ☐					
Check & report any oil leaks	☐	☒	☐		
DIFFERENTIAL, FINAL DRIVES & DRIVELINES					
Check & report oil leaks	☐	☒	☐		
Fill oil to level	☐	☒	☐		
Check wear & lubricate drive shafts	☐	☒	☐		
BRAKES					
Adjust all brakes	☐	☒	☐		
Change air dryer filter	☐	☐	☒		

GENERAL COMMENTS
Nick repaired bent tank bracket etc etc.
Ordered new tank step.

TYRE PRESSURE	AXLE 1	AXLE 2	AXLE 3	AXLE 4
INNER	110Psi	110Psi	110Psi	
OUTER	110psi	110Psi	110Psi	

INSPECTED BY:	Will Howden	QUALIFICATION:	Mechanic
SIGNATURE:	<i>W. Howden</i>	DATE:	01.06.2026

Certification by Responsible Person:			
I certify that the described plant is to the manufacturers specifications and is being serviced and maintained by competent personnel to the manufacturer's recommendations			
PRINT NAME:	Bill Duncan	POSITION:	Workshop Supervisor
SIGNATURE:	<i>William Duncan</i>	DATE:	01.06.2026

METCALF CRANE SERVICES PTY LTD

PRIME MOVER - INSPECTION & SERVICE REPORT

JOB NUMBER:	H24-03	UNIT NUMBER:	UH24	DATE:	17.10.2025
TRUCK MODEL:	Kenworth T610 SAR	REGISTRATION NUMBER:	XW680H	KM'S:	61,745 km
HOURS:	1,503 Hrs				

***NOTE: MAKE SURE THAT HOURS AND KILOMETRES ARE RECORDED – MAKE SURE A SERVICE STICKER IS FITTED**

SERVICE	DONE	OK	N/A	INITIAL	CHECK FAULT – COMMENTS – PLEASE NOTE ALL FINDINGS
TEST DRIVE					
Drain air pressure, check build up	☐	☒	☐		
Check park brake operation	☐	☒	☐		
Check braking operation	☐	☒	☐		
Check transmission operation	☐	☒	☐		
ELECTRICAL					
Operation of all lights	☐	☒	☐		
Check all warning systems:- horns	☐	☒	☐		
Check all warning systems:- flashing lights	☐	☒	☐		
Check all switch functions	☐	☒	☐		
Check wiper/washer operation & condition	☒	☒	☐		
Check air conditioning operation	☐	☒	☐		
CAB & PANEL					
Ensure items in cab are secure	☐	☒	☐		
Condition of cab glass & interior	☐	☒	☐		
Condition of cab, panels & doors	☐	☒	☐		
Check seat belt condition & mounting	☐	☒	☐		
STEERING					
Check all linkages & ball joints	☐	☒	☐		
Check ball joint rubber condition	☐	☒	☐		
Check & report leaks	☐	☒	☐		

SERVICE	DONE	OK	N/A	INITIAL	CHECK FAULT – COMMENTS – PLEASE NOTE ALL FINDINGS
BRAKES					
Drain water from air tanks	☐	☒	☐		
Check condition & thickness of linings	☐	☒	☐		
WHEELS					
Check tyre condition & pressures	☐	☒	☐		
Check wheel nuts	☐	☒	☐		
PLEASE USE ISOLATION PROCEDURES & TAGS					
Change engine oil & fill to level	☒	☐	☐		Type & Litres: 50ltrs E900
Change oil filters	☒	☐	☐		Filter No: LF14000NN
Change fuel filters	☒	☐	☐		Filter No: FF5776
Change fuel pre filter	☐	☒	☐		Filter No:
Check & clean air filter outer	☐	☒	☐		Filter No:
Check & clean air filter inner	☐	☐	☒		Filter No:
Check coolant level	☐	☒	☐		
Check & report coolant leaks	☐	☒	☐		
Check & report oil or fuel leaks	☐	☒	☐		
Check condition of hose & secure clips	☐	☒	☐		
Check condition of mounts	☐	☒	☐		
Check exhaust system	☐	☒	☐		
Check battery levels, clean & lube terminals	☐	☒	☐		
Check washer bottle level	☐	☒	☐		
Check air intake system	☐	☒	☐		
TRANSMISSION ☐					
Check & report any oil leaks	☐	☒	☐		
DIFFERENTIAL, FINAL DRIVES & DRIVELINES					
Check & report oil leaks	☐	☒	☐		
Fill oil to level	☐	☒	☐		
Check wear & lubricate drive shafts	☐	☒	☐		
BRAKES					
Adjust all brakes	☐	☒	☐		
Change air dryer filter	☐	☐	☒		

GENERAL COMMENTS

TYRE PRESSURE	AXLE 1	AXLE 2	AXLE 3	AXLE 4
INNER	110Psi	110Psi	110Psi	
OUTER	110psi	110Psi	110Psi	

INSPECTED BY:	Phil Mifsud	QUALIFICATION:	Mechanic
SIGNATURE:	<i>P. Mifsud</i>	DATE:	17.10.2025

Certification by Responsible Person:

I certify that the described plant is to the manufacturers specifications and is being serviced and maintained by competent personnel to the manufacturer's recommendations

PRINT NAME:	Bill Duncan	POSITION:	Workshop Supervisor
SIGNATURE:	<i>William Duncan</i>	DATE:	17.10.2025