



Vehicle Standards and Inspection

Power Unit Inspection Certificate

This Certificate is issued under the authority of the Province of Saskatchewan

Decal #

Station #: 70041

Station Name: Karst Holdings Inc

Technician #: 81055

Technician Name: Don Rivard

Signing Officer #: 91698

Signing Officer Name: Scott Fender

Customer Details:

Name:

Address:

Inspection Completed Date: 10Aug2026

Inspection Expiry Date: 28Feb2027

Vehicle Details:

VIN: 1XP5DB9X04D815415

Odometer Reading: 280775 km

Year: 2004

Vehicle Make/Model: PETERBILT/HEAVY VEHICLE

Plate: 771 KVV

Jurisdiction: Saskatchewan

Unit:

Message(s): VIN has been validated.

This certificate does not warranty or guarantee the condition of this vehicle's components and systems for any period of time.

**SG**

Vehicle Standards and Inspection

Power Unit Record of Inspection

The Record of Inspection must be given to the customer regardless of whether the vehicle passes or fails.

Station #: 70041

Station Name: Karst Holdings Inc

Technician #: 81055

Technician Name: Don Rivard

Signing Officer #: 91698

Signing Officer Name: Scott Fender

Customer Details:

Name:

Address:

Vehicle Details:

VIN: 1XP5DB9X04D815415

Odometer Reading: 280775 km

Year: 2004

Vehicle Make/Model: PETERBILT HEAVY VEHICLE

Inspection Details:

Pass	Rejected	Corrected	Req Attn	DRIVERS COMPARTMENT	Comments
x				Vehicle Identification (5)	
x				Sun Visor Interior (8)	
x				Horn Operation (5)	
x				Mirrors (8)	
		x		Windshield Wipers/Washers (8)	REPLACE WIPER BLADES, REPAIR WASHERS
x				Windshield Defroster/Heater (8)	
x				Windshield/Other Glass (8)	
x				Gear Position Indicator & Neutral Switch (1)	
x				Instrument Lamps (6)	
x				Accessibility Features/Equip (5)	
x				Auxiliary Heaters (5)	
x				Auxiliary Drive Controls (5)	
x				Emergency Exits (8)	
x				Floor/Step Well Covering (8)	
x				Service/Exit Doors (8)	
x				Indicator Lamps (5)	
x				Instruments/Gauges (5)	
		x		Switches (7)	REPLACE HEATER FAN KNOB
x				Brake Pedal/Actuator (3)	
x				Clutch/Clutch Pedal (1)	

x				Fire Extinguisher/Hazard Kit (5)	
x				Seats/Seat Belts/SRS (8)	
x				Steering Column/Components (4)	
x				Auxiliary Controls/Equip (5)	
x				Speedometer/Odometer (5)	
x				Steering Lash/Travel (5)	
x				Accelerator Pedal/Actuator (1)	
x				Engine Shut Down Control (1)	
x				Engine Start Feature (1)	
x				Body Interior/Fixtures (8)	

Pass	Rejected	Corrected	Req Attn	BODY EXTERIOR	Comments
		x		Lamps (6)	REPLACE LH INNER HEADLAMP, REPAIR RH CLEARANCE LIGHT ON CAB GUARD
x				Headlamp Aim (6)	
x				Reflex Reflectors (6)	
x				Retro Reflective Markings (6)	
x				Body/Bumpers (8)	
x				Trailer Hitch (10)	
x				Cab Grab Handles/Steps (8)	
x				Attached Equipment (8)	
x				Cargo Bodies/Vessels (8)	
x				Sun Visor Exterior (8)	
x				Mud Flaps/Fenders (8)	
x				Trailer Power Cord (7)	
x				Chain/Headache Rack (5)	
x				Auxiliary Compartments (8)	
x				Hybrid Vehicle Drive Systems (1)	
x				Unitized Body Elements (8)	

Pass	Rejected	Corrected	Req Attn	ENGINE COMPARTMENT	Comments
x				Cab/Hood Safety Catches (8)	
x				Power Steering System (4)	
x				Fuel System (1)	
x				Battery/Wiring Condition (7)	
x				Air Suspended Cab (8)	
x				Cab Mounts (8)	
x				Drive Belts (1)	

Pass	Rejected	Corrected	Req Attn	CHASSIS	Comments
------	----------	-----------	----------	---------	----------

x				Hyd Brake System/Components (3.1)	
		x		Air Brake System/Components (3.2)	REPLACE RH BRAKE AND DRUM ON FORWARD DRIVE AXLE, REPLACE CLAMPS FOR AIR TANK UNDER LH SIDE OF CAB, REPLACE LH SLACK ADJUSTER ON FORWARD DRIVE AXLE, REPLACE BOTH BRAKE POTS ON FORWARD DRIVE AXLE, REPLACE HOSE TO LH BRAKE POT ON FORWARD DRIVE AXLE
x				Wheel Bearings (9)	
x				King Pins/Ball Joints (4)	
		x		Steering Linkage (4)	REPAIR POWER STEERING LEAK, REPLACE CROSS TUBE ASSEMBLY
x				Tires/Wheels (9)	
x				Self-Steering Axle (4)	
x				Engine/Transmission Mounts (1)	
x				Frame/Crossmembers/Mounts (8)	
		x		Suspension/Axles (2)	REPLACE LH REAR AIR BAG
x				Drive Shaft/Universal Joints (1)	
		x		Exhaust/Emission System (1)	REPLACE LH FLEX PIPE TO MUFFLER, REPLACE FLEX PIPE OFF OF TURBOCHARGER

Brake/Tire Measurements

Axle 1-Pass

Wheel1-On : Tire Tread Depth: 18/32 in

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: .620 in • Cam Rotation: 46.0 degrees • Brake Stroke: 1 1/2 in

Wheel2-On : Tire Tread Depth: 18/32 in

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: .620 in • Cam Rotation: 45.0 degrees • Brake Stroke: 1 1/2 in

Axle 2-Pass

Wheel1 : Tire Tread Depth: 19/32 in

Brake(1): No Brake

N/A

Wheel2-On : Tire Tread Depth: 19/32 in

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: .685 in • Cam Rotation: 36.0 degrees • Brake Stroke: 1 1/2 in

Wheel3-On : Tire Tread Depth: 18/32 in

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: .800 in • Cam Rotation: 10.0 degrees • Brake Stroke: 1 1/2 in

Wheel4 : Tire Tread Depth: 18/32 in

Brake(1): No Brake

N/A

Axle 3-Pass

Wheel1 : Tire Tread Depth: 18/32 in


Brake(1): No Brake

N/A

Wheel2-On : Tire Tread Depth: 18/32 in

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: .680 in • Cam Rotation: 38.0 degrees • Brake Stroke: 1 1/2 in

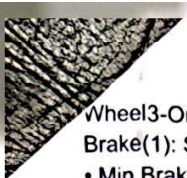

Wheel3-On : Tire Tread Depth: 17/32 in
Brake(1): S-CAM Brake
• Min Brake Lining/Pad: .505 in • Cam Rotation: 78.0 degrees • Brake Stroke: 1 1/2 in
Wheel4 : Tire Tread Depth: 17/32 in
Brake(1): No Brake
N/A

PASS - vehicle passes inspection	Decal #.	Inspection Completed Date: 10Aug2026
----------------------------------	----------	--------------------------------------

