

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:	Page:	1 of 74
Prv Phone:	Prv Phone:		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

COMPLAINT:

03 X9-Series Combine ValueMax Inspection

CORRECTION:



PATTISON AGRICULTURE LIMITED

610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681 Invoice Date: 6/24/2025 Location: 10 Work Order Number: 479721 Payment Type: Account Page: 2 of 74
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal**VALUEMAX GREEN LIGHT SELF PROPELLED COMBINE CHECKLIST**

HEADER SERIAL # _____

ENGINE HOURS 794SEPERATOR HOURS 497

DOES THIS UNIT GET A VALUEMAX STICKER ☐ YES ☐ NOHAS THE STICKER BEEN INSTALLED ☐ YES ☐ NO

need check air condition

Need wash combine

need install shield.

VMI done.

THIS UNIT HAS HAD THE CAB CLEANED _____ (INITIAL)

THIS UNIT HAS HAD A FINAL CHECKOVER _____ (INITIAL)

THIS UNIT HAS HAD A COMPLETE GREASE JOB _____ (INITIAL)

THINGS NOTED BUT NOT REPAIRED ON CUSTOMERS INSTRUCTIONS:

ValueMax Job Task

Serial Number, Check

Safety Shields, Remove

Initial Running, Check

Engine Hours, Check

Separator Hours, Check

Machine Frame, Check

Stored Diagnostic Trouble Codes, Check

Active Diagnostic Trouble Codes, Check

Software Update, Check

MTG/Remote Connection to Service Advisor, Check

PIP's Available

Fluid Scan Test, Perform

Engine RPM, Check

Multi-Function Control Lever, Check

Back-Up Alarm, Check

Transmission Speed Ranges, Check

AutoTrac System, Check

Park Brake, Check

Feeder House Raise-Lower, Fore-Aft, and Lateral Tilt, Check

Feeder House Safety Lock Functionality, Check

Feeder House Dust Fan Functionality, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	3 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Feeder House Dust Fan Functionality, Check
 Header Hydraulic Function, Check
 Grain Tank Cover Folding Functionality, Check
 Unloading Auger and Boot Swing Functionality, Check
 Unloading Auger Engage, Check
 Separator Engage Switch, Check
 Header Engage Switch, Check
 Header Reverser Engage Switch, Check
 Multi-Function Control Lever Quick Stop, Check
 Threshing Clearance Adjustment, Check [Need adjustment Concaves and need check position sensor]
 Rotor Speed Adjustment, Check
 Cleaning Fan Speed Adjustment, Check
 Chaffer and Sieve Setting Adjustment, Check [Chaffer and sieve position need adjustment]
 Residue Functionality, Check
 Chopper Speed Adjustment Function, Check
 Chopper High and Low Operation, Check
 Knife Bank Actuation Functionality, Check
 Feeder House Frame, Check
 Feeder House Position Sensor and Wiring Harness, Check
 Feeder House Drive Chain, Slip Clutch, Sprockets, Bearings, and Guide Rails, Check [Need replace chain and two guides]
 Feeder House Conveyor Chain and Eyebolts, Check [Need replace conveyor chain, if not replace chain and need remove half link (4) and replace two slats and need to alignment]
 Feeder House Conveyor Chain Slats, and Plastic Chain Guides, Check [Need replace two conveyor chain slats. Need replace four plastic guides]
 Lateral Tilt Frame Seal, Check
 Feeder House Dust Fan, Motor, Hoses, and Harnesses, Check
 Lateral Tilt Cylinders, Check
 Lateral Tilt Frame, Hoses, Sensor, and Wiring Harness, Check
 Feeder House Top Door and Seal, Check
 Feeder House Top Shaft Bearings, Sprockets, Plastic Wear Strips, Check [Need replace conveyor chain wear strips (all). Recommend replace sprockets (Sprockets maybe working one year)]
 Feeder House Backshaft Speed Sensor, Tone Wheel, and Wiring Harness, Check
 Feeder House Backshaft and Bearing, Check [Need replace bearing]
 Feeder House Front Drum and Bearings, Check
 Feeder House Pivoting Mid-floor and Mid-Floor Stop Blocks, Check
 Feeder House Feed Plate, Check
 Stone Trap, Check
 Feeder House Floor Sheet and Seal, Check
 Fore-Aft Tilt Cylinders, Check
 Fore-Aft Tilt Frame, Hoses, Sensor and Wiring Harness, Check
 Rotor Plastic Dust Shroud, Check
 Separator Feed Floor and Ramp, Check
 Rotor Bearings, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

610 3rd Avenue West, Box 1670

Shaunavon, SK S0N 2M0

Phone: (306) 297-2639

Fax: (306) 297-3827

Http://www.pattisonag.com

GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

**JOHN DEERE****SERVICE INVOICE**


Invoice To Account No:

Deliver To:

Internal Used	Stock No. 256545	Internal Used	Stock No. 256545	Invoice Number:	3400681
				Invoice Date:	6/24/2025
				Location:	10
				Work Order Number:	479721
				Payment Type:	Account
Bus Phone:		Bus Phone:			
Prv Phone:		Prv Phone:		Page:	4 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Rotor Bearings, Check
 Rotor Front Feed Flights, Check
 Feeder House Lift Cylinder Support, Pins, and Pivots, Check
 Feeder House Smart Lock, Check
 Feeder House Valve Block, Check
 Front-End Gear Case, Hoses, Fittings, Mounting Hardware, and Drive Shaft Bearing, Check
 Feeder House Reversing Motor, Hoses, Fittings and Mounting Hardware, Check
 Multi-Coupler Hydraulic Hoses, Harness, and Connections, Check
 Header Locking Pins and Latching Mechanisms, Check
 Feeder House Driven Belt, Belt Tensioners, Pulleys, and Bearings, Check [Need replace bearing]
 Feeder House Drive Belt and Tensioners, Check [Need replace bearing in tension pulley]
 Main Hydraulic Outer Pump Stack, Check
 Feeder House Pivots, Retainer and Bushing, Check
 Feeder House Pivot Hoses, Hose Mounting Hardware, and Wiring Harness, Check
 Feed Accelerator Speed Sensor and Wiring Harness, Check
 Feed Accelerator Supports, Wings, Wear Strips, and Flow Divider, Check
 Feed Accelerator Shaft and Bearings, Check [Need check pulley (maybe fixed bolt)]
 Feed Accelerator Drive Belt, Tensioner, and Idler, Check [Need replace bearing in tensioner pulley]
 Transmission Speed Ranges, Check
 Tracks or Tires, Check
 Front Drive Shaft Splines and Collars, Check
 Transmission Leaks, Lines, and Hoses (ProDrive XL), Check
 Front Hydrostatic Motors, Check
 Front Final Drive, Check
 Front-End Hydraulic Manifold, Check
 ACI Valve Block, Check
 Unloading Auger Drive Belt, Pulleys, Tensioner, Guide, and Shear Bolt, Check [Need replace bearings in both pulley and replace bushings in tension.
 Need replace belt.]
 Cross Auger Clutch Belt, Idler Pulley, Pulley, Check
 Grain Tank Cross Auger Bearings, Check
 Cross Auger Engage Cylinder, Check
 Cross Auger Speed Sensor and Harness, Check
 Vertical Unloading Auger Gearcase, Check [Need check and fixed gear case pulley]
 Vertical Unloading Auger and Housing, Check
 Unloading Auger Sump Clean Out, Check
 Threshing and Separating Covers, Check
 Cleaning Fan Housings and Fan Blades, Check
 Cleaning Fan Shaft, and Bearings, Check
 Cleaning Fan Driven Belt, Pulley, Idler and Bearing, Check
 Cleaning Fan Drive Sheaves, Belt, Linkage, Bearing and Hardware, Check
 Cleaning Fan Variable Drive Hydraulic Hose, Check
 Left Side Front Shake Pan, Chaffer, and Lower Spacing Mechanical Adjustment, Check

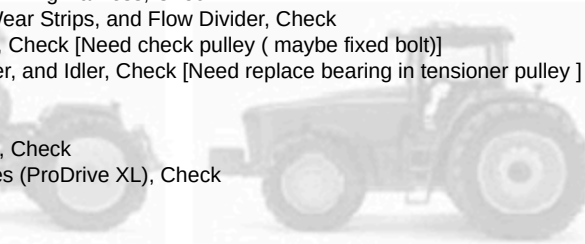

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	5 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Left Side Front Shake Pan, Chaffer, and Louver Spacing Mechanical Adjustment, Check
 Threshing and Separating Plastic Covers Left Side, Check
 Left Side Concave Position Sensor and Wiring Harness, Check
 Left Side Concave, Check [Need replace first set concave,
 Second set- one replace and one repair
 Third set-one replace and one repair
 (If need I show you what needs orders)]
 Left Side Concave Hangers and Hardware, Check
 Left Side Concave Fillers, Check
 Left Side Concave Z-Bar, Check
 Left Side Concave Isolation Hoses and Fittings, Check
 Left Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
 Front End Variable Driven Assembly and Belt, Check
 Front End Drive Assembly, Pulleys, and Belt, Check
 Left Side Separator Grates, Check
 Left Side Separator Loss Sensors, Check
 Left Side Threshing Elements, Check
 Left Side Separator Tines, Check [Need replace all sets]
 Left Side Rotor Rear Discharge Flights, Check
 Left Side Pitman Arms, Swing Arms, and Bearings, Check
 Left Side Shake Pan Frame, Swing Arms and Bushings, Check
 Clean Grain Auger Bearing, Speed Sensor, and Wiring Harness, Check
 Tailings Elevator Housing, Check
 Tailings Monitor Sensor and Wiring Harness, Check
 Tailings Auger, Auger Trough, and Lower Bearings, Check
 Tailings Elevator Conveyor Chain and Sprockets, Check
 Tailings Elevator Slip Clutch, Check
 Upper Tailings Return Auger Bearings, Check
 Upper Tailings Return Auger Flighting, Check
 Upper Tailings Delivery Auger Housing, Check
 Cleaning Shoe Driveshaft, Bearings, and Pitman Arm Cam, Check
 Active Tailings Camera, Check
 Active Tailings Wear Strips and Threshing Bars, Check
 Active Tailings Concave Adjustment, Check
 Active Tailings Drive Belt, Tensioner, and Pulley, Check
 Service Lights, Check [Need fixed harness]
 Rotor Variable Sheaves and Belt, Check
 Rotor Driven Assembly and Hoses, Check
 Rotor Drive Assembly, Hoses, Front End Drive Tensioner and Bearing, Check
 Chaffer and Sieve Element Electrical Adjust, Check
 Chopper Raise and Lower Actuator, Check
 Discharge Beater Belt, Pulleys, Tensioner, and Idlers, Check
 Left Side Discharge Be



PATTISON AGRICULTURE LIMITED

610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:	Page:	6 of 74
Prv Phone:	Prv Phone:		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Left Side Discharge Be



CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 7 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

ater Bearing, Check
 Rotor Grain Loss Sensor and Wiring Harness, Check [Not working second and third grain loss sensors]
 Unloading Auger Driveshaft Bearings, Sensor and Pulley, Check
 HADE, POD Controllers and Harnesses, Check
 Chopper Belt, Tensioner, and Idlers, Check
 Chopper Drive Pulleys, Check
 Chopper Gearcase, Oil Level, and Lube Line, Check [Need replace oil]
 Chaffer and Sieve, Check
 Tailboard, Check
 Return Pan, Check
 Rear Deflector, Check
 Discharge Beater Grate and Vanes, Check
 Discharge Beater Wear Strips, Check
 Chopper Inlet Seals, Check
 Straw Chopper Drive Belt Tensioner and Idler Pulley, Check
 Straw Chopper Drive Belt, Check
 Chopper Housing and Bearings, Check
 Chopper Stationary Knife, Actuator, and Wiring Harness, Check [Knife bank- need flip over and need replace Center knife]
 Chopper Blades, Check [Need replace kni]
 Tailboard Center Shroud, Check
 Tailboard Spreader Gearcases, Driveshafts, and Debris Flaps, Check
 Spreader Speed Sensor and Harness, Check
 Shroud Actuator and Harness, Check
 Tailboard Shaft Bearings, Check [Need replace bearing]
 Chop-to-Drop Door, Actuator, Linkage, Straw Rakes, and Wind Row Curtains, Check
 Spreader Drive Belt, Idlers, and Pulleys, Check [Driven pulley need clean and painted]
 Right Hand Residue Harness, Check
 Windrow Pivot Actuator and Harness, Check
 Left Hand Rear Wheel and Tire, Check
 Left Hand Steering Cylinder and Hoses, Check
 Left Hand Steering Tie Rod, Check
 Left Hand Axle Spindle and Bushing Assembly, Check
 Tow Hook, Check [Need fixed harness]
 Rear Axle Hardware, Check
 Rear Axle Pivot Bushing, Check
 Four Wheel Drive Motors and Seals, Check
 Right Hand Rear Wheel and Tire, Check
 Right Hand Steering Cylinder and Hoses, Check
 Right Hand Steering Tie Rod, Check
 Right Hand Spindle and Bushing Assembly, Check
 AutoTrac System Check



PATTISON AGRICULTURE LIMITED

610 3rd Avenue West, Box 1670

Shaunavon, SK S0N 2M0

Phone: (306) 297-2639

Fax: (306) 297-3827

Http://www.pattisonag.com

GST Number 818708372

Swift Current, SK

Maple Creek, SK

Kindersley, SK

Kyle, SK

Leader, SK

Unity, SK

North Battleford, SK

Humboldt, SK

Kelvington, SK

Shaunavon, SK

(306) 773-9351

(306) 662-2233

(306) 463-2683

(306) 375-2302

(306) 628-3889

(306) 228-2696

(306) 445-4468

(306) 682-2572

(306) 327-4355

(306) 297-2639

Yorkton, SK

Balcarres, SK

Moosomin, SK

Preeceville, SK

Russell, MB

Wynyard, SK

Kamsack, SK

Swan River, MB

(306) 783-9459

(306) 334-2492

(306) 435-3301

(306) 547-2007

(204) 773-2149

(306) 554-2536

(306) 542-2814

(204) 734-3466

**PATTISON**
AGRICULTURE**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	8 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Automatic System, Check

Wheel Angle Sensor and Wiring Harness, Check

Ether Start Aid, Check

Vacuum Fan Housing, Check

AutoTrac Valve, Fittings, and Hoses, Check

Right Side Discharge Beater Bearing, Check

Machine Fuse Center, Check

Batteries, Cables, and Connections, Check

Tailings Auger Bearing, Speed Sensor and Wiring Harness, Check

Shoe Drive Belt, Idler, Tensioner, and Bearings, Check

Pitman Arm Cams, Shoe Drive Shaft, and Drive Shaft Pulley, Check

Right Side Separator Loss Sensors, Check

Clean Grain Elevator Drive Belt, Idlers, and Tensioner, Check

Right Side Pitman Arms, Swing Arms, and Bearings, Check

Clean Grain Elevator Housing and Boot, Check [Need welding boot in said (need ask Serhii)]

Clean Grain Auger, Auger Trough, and Lower Bearings, Check [Need replace auger and bearings both side]

Clean Grain Elevator Chain and Sprockets, Check

Moisture Sensor, and Active Clean Grain Camera, Check

Threshing and Separating Covers, Check

Threshing and Separating Top Covers, Check

Right Side Separator Grates, Check

Right Side Concave Z-Bar, Check

Right Side Concave Hangers and Hardware, Check

Right Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check

Right Side Concave Isolation Hoses and Fittings, Check

Right Side Concave, Check [First set concave need replace all.

Second set- one replace,second need repair

Third set need replace all]

Right Side Concave Fillers, Check

Right Side Separator Tines, Check

Right Side Threshing Elements, Check

Right Side Rotor Rear Discharge Flights, Check

Right Side Concave Position Sensor and Wiring Harness, Check

Cleaning Fan Shaft Bearings, Lock Collars, and Speed Sensor, Check

Right Side Shake Pan Frame, Swing Arms and Bushings, Check

Heater Hoses, Check

Grain Tank Cross Auger Driven Belt, Pulley, and Tensioning Idler, Check

Right Side Grain Tank Cross Auger Bearings, Check

Loading Auger Drive Belt, Pulleys, and Tensioning Idler, Check [Need replace bearing in tension pulley]

IPM Controller and Harness, Check

Cab Wall Electrical Connectors, Check

Air Compressor Tank Drain, Check

Feed Accelerator Gear Case and Drives, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	9 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Feed Accelerator Gear Case and Drives, Check
 Right Hand Grain Tank Drain Covers, Check
 Engine RPM, Check
 Back-Up Alarm, Check
 Engine Deck Access Ladder and Light, Check [Need adjustment locker]
 Rotary Screen / Vacuum Fan Drive Belt and Tensioner, Check [Need replace tensioner and idler]
 Rotary Screen Driveshaft Belt and Bearings, Check [Need replace bearings and shaft]
 Rotary Screen, Check
 Fuel, Oil Cooler, A/C Condenser & Fins, Check
 Cooling Package Door Seal, Check
 Radiator Hoses, Lines, and Surge Tank, Check
 Engine Coolant Level, Check
 Water Pump, Check
 Thermostats, Check
 Diesel Exhaust Fluid Tank, Check
 Fuel Tank, Cap, Sensor and Lines, Check [Need replace cap]
 Hydraulic Reservoir, Check [Need fixed hose]
 ECU Connections and Seals, Check
 Main Engine Gear Case and Valve, Check
 Main Engine Gear Case Hydraulic Hoses, Check
 Main Hydraulic Inner Pump Stack, Check
 Hydraulic Valve Stack and Accumulator, Check
 Exhaust and DPF Exhaust System, Check
 Engine Fan Blades, Drive Belt, Shroud, Banjo Bolt, and Pitch Sensor, Check
 Engine Front Seals and Crankshaft Damper, Check
 Air Conditioning Compressor and Alternator Drive Belt, Check
 Air Compressor Pump and Drive Belt, Check
 Accessory Drive Mounting Hardware, Check
 Engine Rear Seals, Check
 Rotor Speed Sensor and Wiring Harness, Check
 Rocker Arm Cover, Check
 Exhaust Manifold, Check
 Turbocharger, Check
 Aftertreatment Harness Module and Sensor, Check
 EGR Valve and Actuator, Check
 Open Crankcase Vent (OCV) System, Check
 Rotor Gear Case, Check
 Rotor Driveshaft and U-Joints, Check
 Grain Tank Cover Cylinders, Hoses, Fittings, and Pins, Check
 Grain Tank Frame, Covers, Extensions, Linkage and Corner Flaps, Check
 Grain Tank Front and Rear Flip Ups, Linkages, and Rock Shaft Bushings, Check
 Grain Tank Level Switches and Wiring Harness, Check
 Grain Tank Loading Auger, Housing, Gear Cases, Bearings, Brackets and Oil, Check [Need replace grain tank unloading auger and



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	10 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Grain Tank Loading Auger, Housing, Gear Cases, Bearings, Brackets and Oil, Check [need replace grain tank unloading auger and bearing]

Grain Tank Loading Auger Actuator and Harness, Check

Clean Grain Elevator Mass Flow Sensor Impact Plate, Check

Grain Sample Trough, Check

Grain Tank Cross Augers, Troughs, and Covers, Check

Active Yield Sensors and Wiring Harnesses, Check

Grain Tank Window, Check

Grain Tank Camera and Light, Check

Unloading Auger Swing Cylinder, Fittings, Hoses and Pins, Check

Unloading Auger Latching Mechanism and Pin, Check

Primary Valve Block, Check

Folding Auger Drive Cog, Check

Unloading Auger Swing Bushing, and Pivot Point, Check

Unloading Auger Cradle, Pins and Hardware, Check

Unloading Horizontal Auger and Tube, Check

Unloading Auger Inspection Doors, Auger Flighting, and Auger Bearings, Check

Unloading Auger Folding Mechanism, Harness, Castings, and Pin, Check

Unloading Auger Lights, Camera, and Harness, Check

Unloading Auger Grain Saver Door and Boot, Check

Unloading Auger Boot Actuator and Harness, Check

Horizontal Auger 90° Gearcase, Check

Cab Ladder, Check

Mirrors, Check

Cab Door Cinch, Check

Windshield and Cab Glass, Check

Cab Roof, Check

GPS Receiver, Check

Gen 4 Command Center Display and Software, Check

AMS Software and Hardware, Check

Seat Operation and Seat Belt, Check

Park Brake, Check

Steering Column, Check

Armrest Functions, Check

Multi-Function Control Lever Neutral Safety Switch, Check

Wiper and Washer Operation, Check

Horn, Check

Air Conditioning System Operation, Check


Heater Operation, Check

Refrigerator, Check

Cab Radio, Check

Cab Warning Alarm, Check

Corner Post and Armrest Display, Check

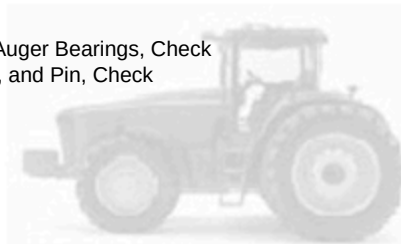

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 11 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Corner Post and Armrest Display, Check
 Active Header Control Displayed on Corner Post, Check
 Auxiliary Power Strip, Check
 Panels, Gull Wings, Gull Wing Cylinders and Safety Shields, Check
 Safety Decals and Signs, Check
 Ladder Safety Chains, Check
 Road Disconnect Switch, Check
 Rotary Beacon, Field, Transport, and Warning Lights, Check
 copy of Operator Seat Presence Switch, Check
 Fire Extinguisher, Check
 Operators Manual, Check
 Camera System, Check
 Toolbox, Check
 Static Drag Chain/Cable, Check
 Remote Front Grease Lines, Check
 Air Conditioning Drain



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:


Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 12 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

Hoses, Check
 Feed Accelerator Gear Case Oil, Check [Need change oil]
 Fuel Precleaner Filter, Check
 Engine Air Filters, Check
 Engine Oil and Filter, Check
 Diesel Exhaust Fluid (DEF) System
 Fuel Filters, Check
 Fuel Tank Breathers, Check
 Suction Screen, Check
 Hydrostatic and Hydraulic Filters, Check
 Final Drives Oil Level, Check
 Transmission Filters (ProDrive XL), Check
 Main Engine Gear Case Oil, Check
 Cab Fresh Air Filter, Check
 Cab Recirculation Filter, Check
 Grain Tank Loading Auger Gear Case Oil, Check
 Wiper Fluid Level, Check & Top Up [Need add fluid]
 Final Running, Check
 Safety Shields, Install
 Water from Air Compressor Reservoir, Drain
 Additional Jobs Required
 ValueMax Job Task
 Serial Number, Check
 Safety Shields, Remove
 Initial Running, Check
 Engine Hours, Check
 Separator Hours, Check
 Machine Frame, Check
 Stored Diagnostic Trouble Codes, Check
 Active Diagnostic Trouble Codes, Check
 Software Update, Check
 MTG/Remote Connection to Service Advisor, Check
 PIP's Available
 Fluid Scan Test, Perform
 Engine RPM, Check
 Multi-Function Control Lever, Check
 Back-Up Alarm, Check
 Transmission Speed Ranges, Check
 AutoTrac System, Check
 Park Brake, Check
 Feeder House Raise-Lower Fore-Aft and Lateral Tilt Check

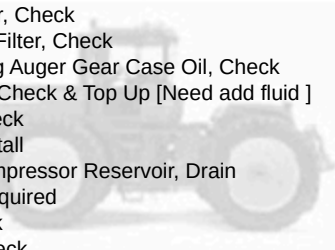

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	13 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Feeder House Raise Lower, Fore Aft, and Lateral Tilt, Check
 Feeder House Safety Lock Functionality, Check
 Feeder House Dust Fan Functionality, Check
 Header Hydraulic Function, Check
 Grain Tank Cover Folding Functionality, Check
 Unloading Auger and Boot Swing Functionality, Check
 Unloading Auger Engage, Check
 Separator Engage Switch, Check
 Header Engage Switch, Check
 Header Reverser Engage Switch, Check
 Multi-Function Control Lever Quick Stop, Check
 Threshing Clearance Adjustment, Check [Need adjustment Concaves and need check position sensor]
 Rotor Speed Adjustment, Check
 Cleaning Fan Speed Adjustment, Check
 Chaffer and Sieve Setting Adjustment, Check [Chaffer and sieve position need adjustment]
 Residue Functionality, Check
 Chopper Speed Adjustment Function, Check
 Chopper High and Low Operation, Check
 Knife Bank Actuation Functionality, Check
 Feeder House Frame, Check
 Feeder House Position Sensor and Wiring Harness, Check
 Feeder House Drive Chain, Slip Clutch, Sprockets, Bearings, and Guide Rails, Check [Need replace chain and two guides]
 Feeder House Conveyor Chain and Eyebolts, Check [Need replace conveyor chain, if not replace chain and need remove half link (4) and replace two slats and need to alignment]
 Feeder House Conveyor Chain Slats, and Plastic Chain Guides, Check [Need replace two conveyor chain slats. Need replace four plastic guides]
 Lateral Tilt Frame Seal, Check
 Feeder House Dust Fan, Motor, Hoses, and Harnesses, Check
 Lateral Tilt Cylinders, Check
 Lateral Tilt Frame, Hoses, Sensor, and Wiring Harness, Check
 Feeder House Top Door and Seal, Check
 Feeder House Top Shaft Bearings, Sprockets, Plastic Wear Strips, Check [Need replace conveyor chain wear strips (all). Recommend replace sprockets (Sprockets maybe working one year)]
 Feeder House Backshaft Speed Sensor, Tone Wheel, and Wiring Harness, Check
 Feeder House Backshaft and Bearing, Check [Need replace bearing]
 Feeder House Front Drum and Bearings, Check
 Feeder House Pivoting Mid-floor and Mid-Floor Stop Blocks, Check
 Feeder House Feed Plate, Check
 Stone Trap, Check
 Feeder House Floor Sheet and Seal, Check
 Fore-Aft Tilt Cylinders, Check
 Fore-Aft Tilt Frame, Hoses, Sensor and Wiring Harness, Check
 Rotor Plastic Dust Shroud, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
Bus Phone:	Bus Phone:	Work Order Number:	479721
Prv Phone:	Prv Phone:	Payment Type:	Account
		Page:	14 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Rotor Plastic Dust Shroud, Check
 Separator Feed Floor and Ramp, Check
 Rotor Bearings, Check
 Rotor Front Feed Flights, Check
 Feeder House Lift Cylinder Support, Pins, and Pivots, Check
 Feeder House Smart Lock, Check
 Feeder House Valve Block, Check
 Front-End Gear Case, Hoses, Fittings, Mounting Hardware, and Drive Shaft Bearing, Check
 Feeder House Reversing Motor, Hoses, Fittings and Mounting Hardware, Check
 Multi-Coupler Hydraulic Hoses, Harness, and Connections, Check
 Header Locking Pins and Latching Mechanisms, Check
 Feeder House Driven Belt, Belt Tensioners, Pulleys, and Bearings, Check [Need replace bearing]
 Feeder House Drive Belt and Tensioners, Check [Need replace bearing in tension pulley]
 Main Hydraulic Outer Pump Stack, Check
 Feeder House Pivots, Retainer and Bushing, Check
 Feeder House Pivot Hoses, Hose Mounting Hardware, and Wiring Harness, Check
 Feed Accelerator Speed Sensor and Wiring Harness, Check
 Feed Accelerator Supports, Wings, Wear Strips, and Flow Divider, Check
 Feed Accelerator Shaft and Bearings, Check [Need check pulley (maybe fixed bolt)]
 Feed Accelerator Drive Belt, Tensioner, and Idler, Check [Need replace bearing in tensioner pulley]
 Transmission Speed Ranges, Check
 Tracks or Tires, Check
 Front Drive Shaft Splines and Collars, Check
 Transmission Leaks, Lines, and Hoses (ProDrive XL), Check
 Front Hydrostatic Motors, Check
 Front Final Drive, Check
 Front-End Hydraulic Manifold, Check
 ACI Valve Block, Check
 Unloading Auger Drive Belt, Pulleys, Tensioner, Guide, and Shear Bolt, Check [Need replace bearings in both pulley and replace bushings in tension.
 Need replace belt.]
 Cross Auger Clutch Belt, Idler Pulley, Pulley, Check
 Grain Tank Cross Auger Bearings, Check
 Cross Auger Engage Cylinder, Check
 Cross Auger Speed Sensor and Harness, Check
 Vertical Unloading Auger Gearcase, Check [Need check and fixed gear case pulley]
 Vertical Unloading Auger and Housing, Check
 Unloading Auger Sump Clean Out, Check
 Threshing and Separating Covers, Check
 Cleaning Fan Housings and Fan Blades, Check
 Cleaning Fan Shaft, and Bearings, Check
 Cleaning Fan Driven Belt, Pulley, Idler and Bearing, Check
 Cleaning Fan Drive Shafts, Belt Linkage, Bearing and Hardware, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
Bus Phone:	Bus Phone:	Work Order Number:	479721
Prv Phone:	Prv Phone:	Payment Type:	Account
		Page:	15 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Cleaning Fan Drive Shafts, Belt, Linkage, Bearing and Hardware, Check
 Cleaning Fan Variable Drive Hydraulic Hose, Check
 Left Side Front Shake Pan, Chaffer, and Louver Spacing Mechanical Adjustment, Check
 Threshing and Separating Plastic Covers Left Side, Check
 Left Side Concave Position Sensor and Wiring Harness, Check
 Left Side Concave, Check [Need replace first set concave,
 Second set- one replace and one repair
 Third set-one replace and one repair
 (If need I show you what needs orders)]
 Left Side Concave Hangers and Hardware, Check
 Left Side Concave Fillers, Check
 Left Side Concave Z-Bar, Check
 Left Side Concave Isolation Hoses and Fittings, Check
 Left Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
 Front End Variable Driven Assembly and Belt, Check
 Front End Drive Assembly, Pulleys, and Belt, Check
 Left Side Separator Grates, Check
 Left Side Separator Loss Sensors, Check
 Left Side Threshing Elements, Check
 Left Side Separator Tines, Check [Need replace all sets]
 Left Side Rotor Rear Discharge Flights, Check
 Left Side Pitman Arms, Swing Arms, and Bearings, Check
 Left Side Shake Pan Frame, Swing Arms and Bushings, Check
 Clean Grain Auger Bearing, Speed Sensor, and Wiring Harness, Check
 Tailings Elevator Housing, Check
 Tailings Monitor Sensor and Wiring Harness, Check
 Tailings Auger, Auger Trough, and Lower Bearings, Check
 Tailings Elevator Conveyor Chain and Sprockets, Check
 Tailings Elevator Slip Clutch, Check
 Upper Tailings Return Auger Bearings, Check
 Upper Tailings Return Auger Flighting, Check
 Upper Tailings Delivery Auger Housing, Check
 Cleaning Shoe Driveshaft, Bearings, and Pitman Arm Cam, Check
 Active Tailings Camera, Check
 Active Tailings Wear Strips and Threshing Bars, Check
 Active Tailings Concave Adjustment, Check
 Active Tailings Drive Belt, Tensioner, and Pulley, Check
 Service Lights, Check [Need fixed harness]
 Rotor Variable Sheaves and Belt, Check
 Rotor Driven Assembly and Hoses, Check
 Rotor Drive Assembly, Hoses, Front End Drive Tensioner and Bearing, Check
 Chaffer and Sieve Element Electrical Adjust, Check
 Chaffer Drive and Lower Actuator, Check



PATTISON AGRICULTURE LIMITED

610 3rd Avenue West, Box 1670

Shaunavon, SK S0N 2M0

Phone: (306) 297-2639

Fax: (306) 297-3827

Http://www.pattisonag.com

GST Number 818708372

Swift Current, SK

Maple Creek, SK

Kindersley, SK

Kyle, SK

Leader, SK

Unity, SK

North Battleford, SK

Humboldt, SK

Kelvington, SK

Shaunavon, SK

(306) 773-9351

(306) 662-2233

(306) 463-2683

(306) 375-2302

(306) 628-3889

(306) 228-2696

(306) 445-4468

(306) 682-2572

(306) 327-4355

(306) 297-2639

Yorkton, SK

Balcarres, SK

Moosomin, SK

Preeceville, SK

Russell, MB

Wynyard, SK

Kamsack, SK

Swan River, MB

(306) 783-9459

(306) 334-2492

(306) 435-3301

(306) 547-2007

(204) 773-2149

(306) 554-2536

(306) 542-2814

(204) 734-3466

**PATTISON**
AGRICULTURE**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:	Page:	16 of 74
Prv Phone:	Prv Phone:		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

CROPPER RAISE AND LOWER ACTUATOR, CHECK

DISCHARGE BEATER BELT, PULLEYS, TENSIONER, AND IDLERS, CHECK

LEFT SIDE DISCHARGE BEATER BEARING, CHECK

ROTOR GRAIN LOSS SENSOR AND WIRING HARNESS, CHECK [NOT WORKING SECOND AND THIRD GRAIN LOSS SENS]



CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	17 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

ors]

Unloading Auger Driveshaft Bearings, Sensor and Pulley, Check

HADE, POD Controllers and Harnesses, Check

Chopper Belt, Tensioner, and Idlers, Check

Chopper Drive Pulleys, Check

Chopper Gearcase, Oil Level, and Lube Line, Check [Need replace oil]

Chaffer and Sieve, Check

Tailboard, Check

Return Pan, Check

Rear Deflector, Check

Discharge Beater Grate and Vanes, Check

Discharge Beater Wear Strips, Check

Chopper Inlet Seals, Check

Straw Chopper Drive Belt Tensioner and Idler Pulley, Check

Straw Chopper Drive Belt, Check

Chopper Housing and Bearings, Check

Chopper Stationary Knife, Actuator, and Wiring Harness, Check [Knife bank- need flip over and need replace Center knife]

Chopper Blades, Check [Need replace kni]

Tailboard Center Shroud, Check

Tailboard Spreader Gearcases, Driveshafts, and Debris Flaps, Check

Spreader Speed Sensor and Harness, Check

Shroud Actuator and Harness, Check

Tailboard Shaft Bearings, Check [Need replace bearing]

Chop-to-Drop Door, Actuator, Linkage, Straw Rakes, and Wind Row Curtains, Check

Spreader Drive Belt, Idlers, and Pulleys, Check [Driven pulley need clean and painted]

Right Hand Residue Harness, Check

Windrow Pivot Actuator and Harness, Check

Left Hand Rear Wheel and Tire, Check

Left Hand Steering Cylinder and Hoses, Check

Left Hand Steering Tie Rod, Check

Left Hand Axle Spindle and Bushing Assembly, Check

Tow Hook, Check [Need fixed harness]

Rear Axle Hardware, Check

Rear Axle Pivot Bushing, Check

Four Wheel Drive Motors and Seals, Check

Right Hand Rear Wheel and Tire, Check

Right Hand Steering Cylinder and Hoses, Check

Right Hand Steering Tie Rod, Check

Right Hand Spindle and Bushing Assembly, Check

AutoTrac System, Check

Wheel Angle Sensor and Wiring Harness, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
Bus Phone:	Bus Phone:	Work Order Number:	479721
Prv Phone:	Prv Phone:	Payment Type:	Account
		Page:	18 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Wheel Angle Sensor and Wiring Harness, Check
 Ether Start Aid, Check
 Vacuum Fan Housing, Check
 AutoTrac Valve, Fittings, and Hoses, Check
 Right Side Discharge Beater Bearing, Check
 Machine Fuse Center, Check
 Batteries, Cables, and Connections, Check
 Tailings Auger Bearing, Speed Sensor and Wiring Harness, Check
 Shoe Drive Belt, Idler, Tensioner, and Bearings, Check
 Pitman Arm Cams, Shoe Drive Shaft, and Drive Shaft Pulley, Check
 Right Side Separator Loss Sensors, Check
 Clean Grain Elevator Drive Belt, Idlers, and Tensioner, Check
 Right Side Pitman Arms, Swing Arms, and Bearings, Check
 Clean Grain Elevator Housing and Boot, Check [Need welding boot in said (need ask Serhii)]
 Clean Grain Auger, Auger Trough, and Lower Bearings, Check [Need replace auger and bearings both side]
 Clean Grain Elevator Chain and Sprockets, Check
 Moisture Sensor, and Active Clean Grain Camera, Check
 Threshing and Separating Covers, Check
 Threshing and Separating Top Covers, Check
 Right Side Separator Grates, Check
 Right Side Concave Z-Bar, Check
 Right Side Concave Hangers and Hardware, Check
 Right Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
 Right Side Concave Isolation Hoses and Fittings, Check
 Right Side Concave, Check [First set concave need replace all.
 Second set- one replace, second need repair
 Third set need replace all]
 Right Side Concave Fillers, Check
 Right Side Separator Tines, Check
 Right Side Threshing Elements, Check
 Right Side Rotor Rear Discharge Flights, Check
 Right Side Concave Position Sensor and Wiring Harness, Check
 Cleaning Fan Shaft Bearings, Lock Collars, and Speed Sensor, Check
 Right Side Shake Pan Frame, Swing Arms and Bushings, Check
 Heater Hoses, Check
 Grain Tank Cross Auger Driven Belt, Pulley, and Tensioning Idler, Check
 Right Side Grain Tank Cross Auger Bearings, Check
 Loading Auger Drive Belt, Pulleys, and Tensioning Idler, Check [Need replace bearing in tension pulley]
 IPM Controller and Harness, Check
 Cab Wall Electrical Connectors, Check
 Air Compressor Tank Drain, Check
 Feed Accelerator Gear Case and Drives, Check
 Right Hand Grain Tank Drain Covers, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
Bus Phone:	Bus Phone:	Work Order Number:	479721
Prv Phone:	Prv Phone:	Payment Type:	Account
		Page:	19 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Right Hand Grain Tank Drain Covers, Check
 Engine RPM, Check
 Back-Up Alarm, Check
 Engine Deck Access Ladder and Light, Check [Need adjustment locker]
 Rotary Screen / Vacuum Fan Drive Belt and Tensioner, Check [Need replace tensioner and idler]
 Rotary Screen Driveshaft Belt and Bearings, Check [Need replace bearings and shaft]
 Rotary Screen, Check
 Fuel, Oil Cooler, A/C Condenser & Fins, Check
 Cooling Package Door Seal, Check
 Radiator Hoses, Lines, and Surge Tank, Check
 Engine Coolant Level, Check
 Water Pump, Check
 Thermostats, Check
 Diesel Exhaust Fluid Tank, Check
 Fuel Tank, Cap, Sensor and Lines, Check [Need replace cap]
 Hydraulic Reservoir, Check [Need fixed hose]
 ECU Connections and Seals, Check
 Main Engine Gear Case and Valve, Check
 Main Engine Gear Case Hydraulic Hoses, Check
 Main Hydraulic Inner Pump Stack, Check
 Hydraulic Valve Stack and Accumulator, Check
 Exhaust and DPF Exhaust System, Check
 Engine Fan Blades, Drive Belt, Shroud, Banjo Bolt, and Pitch Sensor, Check
 Engine Front Seals and Crankshaft Damper, Check
 Air Conditioning Compressor and Alternator Drive Belt, Check
 Air Compressor Pump and Drive Belt, Check
 Accessory Drive Mounting Hardware, Check
 Engine Rear Seals, Check
 Rotor Speed Sensor and Wiring Harness, Check
 Rocker Arm Cover, Check
 Exhaust Manifold, Check
 Turbocharger, Check
 Aftertreatment Harness Module and Sensor, Check
 EGR Valve and Actuator, Check
 Open Crankcase Vent (OCV) System, Check
 Rotor Gear Case, Check
 Rotor Driveshaft and U-Joints, Check
 Grain Tank Cover Cylinders, Hoses, Fittings, and Pins, Check
 Grain Tank Frame, Covers, Extensions, Linkage and Corner Flaps, Check
 Grain Tank Front and Rear Flip Ups, Linkages, and Rock Shaft Bushings, Check
 Grain Tank Level Switches and Wiring Harness, Check
 Grain Tank Loading Auger, Housing, Gear Cases, Bearing, Brackets and Oil, Check [Need replace grain tank unloading auger and bearing]



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:


Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	20 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Leaving J

Grain Tank Loading Auger Actuator and Harness, Check
 Clean Grain Elevator Mass Flow Sensor Impact Plate, Check
 Grain Sample Trough, Check
 Grain Tank Cross Augers, Troughs, and Covers, Check
 Active Yield Sensors and Wiring Harnesses, Check
 Grain Tank Window, Check
 Grain Tank Camera and Light, Check
 Unloading Auger Swing Cylinder, Fittings, Hoses and Pins, Check
 Unloading Auger Latching Mechanism and Pin, Check
 Primary Valve Block, Check
 Folding Auger Drive Cog, Check
 Unloading Auger Swing Bushing, and Pivot Point, Check
 Unloading Auger Cradle, Pins and Hardware, Check
 Unloading Horizontal Auger and Tube, Check
 Unloading Auger Inspection Doors, Auger Flighting, and Auger Bearings, Check
 Unloading Auger Folding Mechanism, Harness, Castings, and Pin, Check
 Unloading Auger Lights, Camera, and Harness, Check
 Unloading Auger Grain Saver Door and Boot, Check
 Unloading Auger Boot Actuator and Harness, Check
 Horizontal Auger 90* Gearcase, Check
 Cab Ladder, Check
 Mirrors, Check
 Cab Door Cinch, Check
 Windshield and Cab Glass, Check
 Cab Roof, Check
 GPS Receiver, Check
 Gen 4 Command Center Display and Software, Check
 AMS Software and Hardware, Check
 Seat Operation and Seat Belt, Check
 Park Brake, Check
 Steering Column, Check
 Armrest Functions, Check
 Multi-Function Control Lever Neutral Safety Switch, Check
 Wiper and Washer Operation, Check
 Horn, Check
 Air Conditioning System Operation, Check
 Heater Operation, Check
 Refrigerator, Check
 Cab Radio, Check
 Cab Warning Alarm, Check
 Corner Post and Armrest Display, Check
 Active Header Control Display on Corner Post, Check

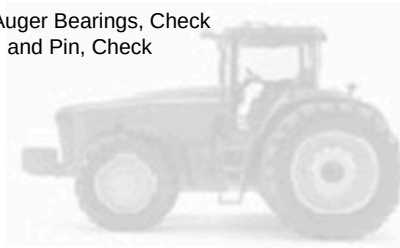

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 21 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Active Header Control Displayed on Corner Post, Check
 Auxiliary Power Strip, Check
 Panels, Gull Wings, Gull Wing Cylinders and Safety Shields, Check
 Safety Decals and Signs, Check
 Ladder Safety Chains, Check
 Road Disconnect Switch, Check
 Rotary Beacon, Field, Transport, and Warning Lights, Check
 copy of Operator Seat Presence Switch, Check
 Fire Extinguisher, Check
 Operators Manual, Check
 Camera System, Check
 Toolbox, Check
 Static Drag Chain/Cable, Check
 Remote Front Grease Lines, Check
 Air Conditioning Drain Hoses, Check
 Feed Accelerator Gear Case Oil, Check [Need change oil]
 Fuel Precleaner Filter, Check
 Engine Air Fi



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 22 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

lters, Check
 Engine Oil and Filter, Check
 Diesel Exhaust Fluid (DEF) System
 Fuel Filters, Check
 Fuel Tank Breathers, Check
 Suction Screen, Check
 Hydrostatic and Hydraulic Filters, Check
 Final Drives Oil Level, Check
 Transmission Filters (ProDrive XL), Check
 Main Engine Gear Case Oil, Check
 Cab Fresh Air Filter, Check
 Cab Recirculation Filter, Check
 Grain Tank Loading Auger Gear Case Oil, Check
 Wiper Fluid Level, Check & Top Up [Need add fluid]
 Final Running, Check
 Safety Shields, Install
 Water from Air Compressor Reservoir, Drain
 Additional Jobs Required
 ValueMax Job Task
 Serial Number, Check
 Safety Shields, Remove
 Initial Running, Check
 Engine Hours, Check
 Separator Hours, Check
 Machine Frame, Check
 Stored Diagnostic Trouble Codes, Check
 Active Diagnostic Trouble Codes, Check
 Software Update, Check
 MTG/Remote Connection to Service Advisor, Check
 PIP's Available
 Fluid Scan Test, Perform
 Engine RPM, Check
 Multi-Function Control Lever, Check
 Back-Up Alarm, Check
 Transmission Speed Ranges, Check
 AutoTrac System, Check
 Park Brake, Check
 Feeder House Raise-Lower, Fore-Aft, and Lateral Tilt, Check
 Feeder House Safety Lock Functionality, Check
 Feeder House Dust Fan Functionality, Check
 Header Hvdraulic Function, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	23 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Header Hydraulic Function, Check
 Grain Tank Cover Folding Functionality, Check
 Unloading Auger and Boot Swing Functionality, Check
 Unloading Auger Engage, Check
 Separator Engage Switch, Check
 Header Engage Switch, Check
 Header Reverser Engage Switch, Check
 Multi-Function Control Lever Quick Stop, Check
 Threshing Clearance Adjustment, Check [Need adjustment Concaves and need check position sensor]
 Rotor Speed Adjustment, Check
 Cleaning Fan Speed Adjustment, Check
 Chaffer and Sieve Setting Adjustment, Check [Chaffer and sieve position need adjustment]
 Residue Functionality, Check
 Chopper Speed Adjustment Function, Check
 Chopper High and Low Operation, Check
 Knife Bank Actuation Functionality, Check
 Feeder House Frame, Check
 Feeder House Position Sensor and Wiring Harness, Check
 Feeder House Drive Chain, Slip Clutch, Sprockets, Bearings, and Guide Rails, Check [Need replace chain and two guides]
 Feeder House Conveyor Chain and Eyebolts, Check [Need replace conveyor chain, if not replace chain and need remove half link (4) and replace two slats and need to alignment]
 Feeder House Conveyor Chain Slats, and Plastic Chain Guides, Check [Need replace two conveyor chain slats. Need replace four plastic guides]
 Lateral Tilt Frame Seal, Check
 Feeder House Dust Fan, Motor, Hoses, and Harnesses, Check
 Lateral Tilt Cylinders, Check
 Lateral Tilt Frame, Hoses, Sensor, and Wiring Harness, Check
 Feeder House Top Door and Seal, Check
 Feeder House Top Shaft Bearings, Sprockets, Plastic Wear Strips, Check [Need replace conveyor chain wear strips (all). Recommend replace sprockets (Sprockets maybe working one year)]
 Feeder House Backshaft Speed Sensor, Tone Wheel, and Wiring Harness, Check
 Feeder House Backshaft and Bearing, Check [Need replace bearing]
 Feeder House Front Drum and Bearings, Check
 Feeder House Pivoting Mid-floor and Mid-Floor Stop Blocks, Check
 Feeder House Feed Plate, Check
 Stone Trap, Check
 Feeder House Floor Sheet and Seal, Check
 Fore-Aft Tilt Cylinders, Check
 Fore-Aft Tilt Frame, Hoses, Sensor and Wiring Harness, Check
 Rotor Plastic Dust Shroud, Check
 Separator Feed Floor and Ramp, Check
 Rotor Bearings, Check
 Rotor Front Feed Flights, Check

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE


Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	24 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Motor Front Feed Lights, Check
 Feeder House Lift Cylinder Support, Pins, and Pivots, Check
 Feeder House Smart Lock, Check
 Feeder House Valve Block, Check
 Front-End Gear Case, Hoses, Fittings, Mounting Hardware, and Drive Shaft Bearing, Check
 Feeder House Reversing Motor, Hoses, Fittings and Mounting Hardware, Check
 Multi-Coupler Hydraulic Hoses, Harness, and Connections, Check
 Header Locking Pins and Latching Mechanisms, Check
 Feeder House Driven Belt, Belt Tensioners, Pulleys, and Bearings, Check [Need replace bearing]
 Feeder House Drive Belt and Tensioners, Check [Need replace bearing in tension pulley]
 Main Hydraulic Outer Pump Stack, Check
 Feeder House Pivots, Retainer and Bushing, Check
 Feeder House Pivot Hoses, Hose Mounting Hardware, and Wiring Harness, Check
 Feed Accelerator Speed Sensor and Wiring Harness, Check
 Feed Accelerator Supports, Wings, Wear Strips, and Flow Divider, Check
 Feed Accelerator Shaft and Bearings, Check [Need check pulley (maybe fixed bolt)]
 Feed Accelerator Drive Belt, Tensioner, and Idler, Check [Need replace bearing in tensioner pulley]
 Transmission Speed Ranges, Check
 Tracks or Tires, Check
 Front Drive Shaft Splines and Collars, Check
 Transmission Leaks, Lines, and Hoses (ProDrive XL), Check
 Front Hydrostatic Motors, Check
 Front Final Drive, Check
 Front-End Hydraulic Manifold, Check
 ACI Valve Block, Check
 Unloading Auger Drive Belt, Pulleys, Tensioner, Guide, and Shear Bolt, Check [Need replace bearings in both pulley and replace bushings in tension.
 Need replace belt.]
 Cross Auger Clutch Belt, Idler Pulley, Pulley, Check
 Grain Tank Cross Auger Bearings, Check
 Cross Auger Engage Cylinder, Check
 Cross Auger Speed Sensor and Harness, Check
 Vertical Unloading Auger Gearcase, Check [Need check and fixed gear case pulley]
 Vertical Unloading Auger and Housing, Check
 Unloading Auger Sump Clean Out, Check
 Threshing and Separating Covers, Check
 Cleaning Fan Housings and Fan Blades, Check
 Cleaning Fan Shaft, and Bearings, Check
 Cleaning Fan Driven Belt, Pulley, Idler and Bearing, Check
 Cleaning Fan Drive Sheaves, Belt, Linkage, Bearing and Hardware, Check
 Cleaning Fan Variable Drive Hydraulic Hose, Check
 Left Side Front Shake Pan, Chaffer, and Louver Spacing Mechanical Adjustment, Check
 Threshing and Separating Plastic Covers Left Side, Check

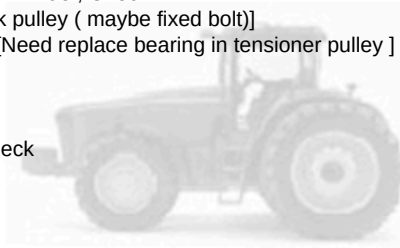

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
Bus Phone:	Bus Phone:	Work Order Number:	479721
Prv Phone:	Prv Phone:	Payment Type:	Account
		Page:	25 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Threshing and Separating Plastic Covers Left Side, Check
 Left Side Concave Position Sensor and Wiring Harness, Check
 Left Side Concave, Check [Need replace first set concave,
 Second set- one replace and one repair
 Third set-one replace and one repair
 (If need I show you what needs orders)]
 Left Side Concave Hangers and Hardware, Check
 Left Side Concave Fillers, Check
 Left Side Concave Z-Bar, Check
 Left Side Concave Isolation Hoses and Fittings, Check
 Left Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
 Front End Variable Driven Assembly and Belt, Check
 Front End Drive Assembly, Pulleys, and Belt, Check
 Left Side Separator Grates, Check
 Left Side Separator Loss Sensors, Check
 Left Side Threshing Elements, Check
 Left Side Separator Tines, Check [Need replace all sets]
 Left Side Rotor Rear Discharge Flights, Check
 Left Side Pitman Arms, Swing Arms, and Bearings, Check
 Left Side Shake Pan Frame, Swing Arms and Bushings, Check
 Clean Grain Auger Bearing, Speed Sensor, and Wiring Harness, Check
 Tailings Elevator Housing, Check
 Tailings Monitor Sensor and Wiring Harness, Check
 Tailings Auger, Auger Trough, and Lower Bearings, Check
 Tailings Elevator Conveyor Chain and Sprockets, Check
 Tailings Elevator Slip Clutch, Check
 Upper Tailings Return Auger Bearings, Check
 Upper Tailings Return Auger Flighting, Check
 Upper Tailings Delivery Auger Housing, Check
 Cleaning Shoe Driveshaft, Bearings, and Pitman Arm Cam, Check
 Active Tailings Camera, Check
 Active Tailings Wear Strips and Threshing Bars, Check
 Active Tailings Concave Adjustment, Check
 Active Tailings Drive Belt, Tensioner, and Pulley, Check
 Service Lights, Check [Need fixed harness]
 Rotor Variable Sheaves and Belt, Check
 Rotor Driven Assembly and Hoses, Check
 Rotor Drive Assembly, Hoses, Front End Drive Tensioner and Bearing, Check
 Chaffer and Sieve Element Electrical Adjust, Check
 Chopper Raise and Lower Actuator, Check
 Discharge Beater Belt, Pulleys, Tensioner, and Idlers, Check
 Left Side Discharge Beater Bearing, Check
 Rotor Grain Loss Sensor and Wiring Harness, Check [Not working second and third grain loss sensor]



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 26 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Rotor Grain Loss Sensor and wiring Harness, Check [not working second and third grain loss sensors]
 Unloading Auger Driveshaft Bearings, Sensor and Pulley, Check
 HADE, POD Controllers and Harnesses, Check
 Cho



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:


Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 27 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

pper Belt, Tensioner, and Idlers, Check
 Chopper Drive Pulleys, Check
 Chopper Gearcase, Oil Level, and Lube Line, Check [Need replace oil]
 Chaffer and Sieve, Check
 Tailboard, Check
 Return Pan, Check
 Rear Deflector, Check
 Discharge Beater Grate and Vanes, Check
 Discharge Beater Wear Strips, Check
 Chopper Inlet Seals, Check
 Straw Chopper Drive Belt Tensioner and Idler Pulley, Check
 Straw Chopper Drive Belt, Check
 Chopper Housing and Bearings, Check
 Chopper Stationary Knife, Actuator, and Wiring Harness, Check [Knife bank- need flip over and need replace Center knife]
 Chopper Blades, Check [Need replace kni]
 Tailboard Center Shroud, Check
 Tailboard Spreader Gearcases, Driveshafts, and Debris Flaps, Check
 Spreader Speed Sensor and Harness, Check
 Shroud Actuator and Harness, Check
 Tailboard Shaft Bearings, Check [Need replace bearing]
 Chop-to-Drop Door, Actuator, Linkage, Straw Rakes, and Wind Row Curtains, Check
 Spreader Drive Belt, Idlers, and Pulleys, Check [Driven pulley need clean and painted]
 Right Hand Residue Harness, Check
 Windrow Pivot Actuator and Harness, Check
 Left Hand Rear Wheel and Tire, Check
 Left Hand Steering Cylinder and Hoses, Check
 Left Hand Steering Tie Rod, Check
 Left Hand Axle Spindle and Bushing Assembly, Check
 Tow Hook, Check [Need fixed harness]
 Rear Axle Hardware, Check
 Rear Axle Pivot Bushing, Check
 Four Wheel Drive Motors and Seals, Check
 Right Hand Rear Wheel and Tire, Check
 Right Hand Steering Cylinder and Hoses, Check
 Right Hand Steering Tie Rod, Check
 Right Hand Spindle and Bushing Assembly, Check
 AutoTrac System, Check
 Wheel Angle Sensor and Wiring Harness, Check
 Ether Start Aid, Check
 Vacuum Fan Housing, Check
 AutoTrac Valve, Fittings, and Hoses, Check

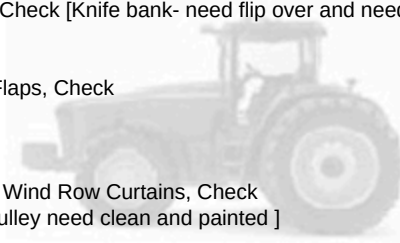

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	28 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Automatic Valve, Hangers, and Hoses, Check
 Right Side Discharge Beater Bearing, Check
 Machine Fuse Center, Check
 Batteries, Cables, and Connections, Check
 Tailings Auger Bearing, Speed Sensor and Wiring Harness, Check
 Shoe Drive Belt, Idler, Tensioner, and Bearings, Check
 Pitman Arm Cams, Shoe Drive Shaft, and Drive Shaft Pulley, Check
 Right Side Separator Loss Sensors, Check
 Clean Grain Elevator Drive Belt, Idlers, and Tensioner, Check
 Right Side Pitman Arms, Swing Arms, and Bearings, Check
 Clean Grain Elevator Housing and Boot, Check [Need welding boot in said (need ask Serhii)]
 Clean Grain Auger, Auger Trough, and Lower Bearings, Check [Need replace auger and bearings both side]
 Clean Grain Elevator Chain and Sprockets, Check
 Moisture Sensor, and Active Clean Grain Camera, Check
 Threshing and Separating Covers, Check
 Threshing and Separating Top Covers, Check
 Right Side Separator Grates, Check
 Right Side Concave Z-Bar, Check
 Right Side Concave Hangers and Hardware, Check
 Right Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
 Right Side Concave Isolation Hoses and Fittings, Check
 Right Side Concave, Check [First set concave need replace all.
 Second set- one replace, second need repair
 Third set need replace all]
 Right Side Concave Fillers, Check
 Right Side Separator Tines, Check
 Right Side Threshing Elements, Check
 Right Side Rotor Rear Discharge Flights, Check
 Right Side Concave Position Sensor and Wiring Harness, Check
 Cleaning Fan Shaft Bearings, Lock Collars, and Speed Sensor, Check
 Right Side Shake Pan Frame, Swing Arms and Bushings, Check
 Heater Hoses, Check
 Grain Tank Cross Auger Driven Belt, Pulley, and Tensioning Idler, Check
 Right Side Grain Tank Cross Auger Bearings, Check
 Loading Auger Drive Belt, Pulleys, and Tensioning Idler, Check [Need replace bearing in tension pulley]
 IPM Controller and Harness, Check
 Cab Wall Electrical Connectors, Check
 Air Compressor Tank Drain, Check
 Feed Accelerator Gear Case and Drives, Check
 Right Hand Grain Tank Drain Covers, Check
 Engine RPM, Check
 Back-Up Alarm, Check
 Engine Deck Access Ladder and Light Check [Need adjustment locker]



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	29 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Engine Deck Access Ladder and Light, Check [Need adjustment locker]
 Rotary Screen / Vacuum Fan Drive Belt and Tensioner, Check [Need replace tensioner and idler]
 Rotary Screen Driveshaft Belt and Bearings, Check [Need replace bearings and shaft]
 Rotary Screen, Check
 Fuel, Oil Cooler, A/C Condenser & Fins, Check
 Cooling Package Door Seal, Check
 Radiator Hoses, Lines, and Surge Tank, Check
 Engine Coolant Level, Check
 Water Pump, Check
 Thermostats, Check
 Diesel Exhaust Fluid Tank, Check
 Fuel Tank, Cap, Sensor and Lines, Check [Need replace cap]
 Hydraulic Reservoir, Check [Need fixed hose]
 ECU Connections and Seals, Check
 Main Engine Gear Case and Valve, Check
 Main Engine Gear Case Hydraulic Hoses, Check
 Main Hydraulic Inner Pump Stack, Check
 Hydraulic Valve Stack and Accumulator, Check
 Exhaust and DPF Exhaust System, Check
 Engine Fan Blades, Drive Belt, Shroud, Banjo Bolt, and Pitch Sensor, Check
 Engine Front Seals and Crankshaft Damper, Check
 Air Conditioning Compressor and Alternator Drive Belt, Check
 Air Compressor Pump and Drive Belt, Check
 Accessory Drive Mounting Hardware, Check
 Engine Rear Seals, Check
 Rotor Speed Sensor and Wiring Harness, Check
 Rocker Arm Cover, Check
 Exhaust Manifold, Check
 Turbocharger, Check
 Aftertreatment Harness Module and Sensor, Check
 EGR Valve and Actuator, Check
 Open Crankcase Vent (OCV) System, Check
 Rotor Gear Case, Check
 Rotor Driveshaft and U-Joints, Check
 Grain Tank Cover Cylinders, Hoses, Fittings, and Pins, Check
 Grain Tank Frame, Covers, Extensions, Linkage and Corner Flaps, Check
 Grain Tank Front and Rear Flip Ups, Linkages, and Rock Shaft Bushings, Check
 Grain Tank Level Switches and Wiring Harness, Check
 Grain Tank Loading Auger, Housing, Gear Cases, Bearing, Brackets and Oil, Check [Need replace grain tank unloading auger and bearing]
 Grain Tank Loading Auger Actuator and Harness, Check
 Clean Grain Elevator Mass Flow Sensor Impact Plate, Check
 Grain Sample Trough, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	30 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Grain Sample Trough, Check
 Grain Tank Cross Augers, Troughs, and Covers, Check
 Active Yield Sensors and Wiring Harnesses, Check
 Grain Tank Window, Check
 Grain Tank Camera and Light, Check
 Unloading Auger Swing Cylinder, Fittings, Hoses and Pins, Check
 Unloading Auger Latching Mechanism and Pin, Check
 Primary Valve Block, Check
 Folding Auger Drive Cog, Check
 Unloading Auger Swing Bushing, and Pivot Point, Check
 Unloading Auger Cradle, Pins and Hardware, Check
 Unloading Horizontal Auger and Tube, Check
 Unloading Auger Inspection Doors, Auger Flighting, and Auger Bearings, Check
 Unloading Auger Folding Mechanism, Harness, Castings, and Pin, Check
 Unloading Auger Lights, Camera, and Harness, Check
 Unloading Auger Grain Saver Door and Boot, Check
 Unloading Auger Boot Actuator and Harness, Check
 Horizontal Auger 90* Gearcase, Check
 Cab Ladder, Check
 Mirrors, Check
 Cab Door Cinch, Check
 Windshield and Cab Glass, Check
 Cab Roof, Check
 GPS Receiver, Check
 Gen 4 Command Center Display and Software, Check
 AMS Software and Hardware, Check
 Seat Operation and Seat Belt, Check
 Park Brake, Check
 Steering Column, Check
 Armrest Functions, Check
 Multi-Function Control Lever Neutral Safety Switch, Check
 Wiper and Washer Operation, Check
 Horn, Check
 Air Conditioning System Operation, Check
 Heater Operation, Check
 Refrigerator, Check
 Cab Radio, Check
 Cab Warning Alarm, Check
 Corner Post and Armrest Display, Check
 Active Header Control Displayed on Corner Post, Check
 Auxiliary Power Strip, Check
 Panels, Gull Wings, Gull Wing Cylinders and Safety Shields, Check
 Safety Decals and Signs, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE


Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	31 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Safety Decals and Signs, Check
 Ladder Safety Chains, Check
 Road Disconnect Switch, Check
 Rotary Beacon, Field, Transport, and Warning Lights, Check
 copy of Operator Seat Presence Switch, Check
 Fire Extinguisher, Check
 Operators Manual, Check
 Camera System, Check
 Toolbox, Check
 Static Drag Chain/Cable, Check
 Remote Front Grease Lines, Check
 Air Conditioning Drain Hoses, Check
 Feed Accelerator Gear Case Oil, Check [Need change oil]
 Fuel Precleaner Filter, Check
 Engine Air Filters, Check
 Engine Oil and Filter, Check
 Diesel Exhaust Fluid (DEF) System
 Fuel Filters, Check
 Fuel Tank Breath

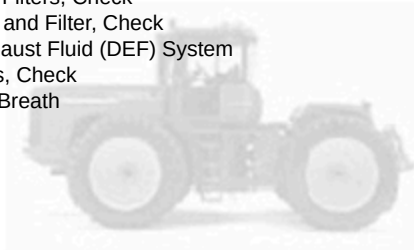

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 32 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

ers, Check
 Suction Screen, Check
 Hydrostatic and Hydraulic Filters, Check
 Final Drives Oil Level, Check
 Transmission Filters (ProDrive XL), Check
 Main Engine Gear Case Oil, Check
 Cab Fresh Air Filter, Check
 Cab Recirculation Filter, Check
 Grain Tank Loading Auger Gear Case Oil, Check
 Wiper Fluid Level, Check & Top Up [Need add fluid]
 Final Running, Check
 Safety Shields, Install
 Water from Air Compressor Reservoir, Drain
 Additional Jobs Required
 ValueMax Job Task
 Serial Number, Check
 Safety Shields, Remove
 Initial Running, Check
 Engine Hours, Check
 Separator Hours, Check
 Machine Frame, Check
 Stored Diagnostic Trouble Codes, Check
 Active Diagnostic Trouble Codes, Check
 Software Update, Check
 MTG/Remote Connection to Service Advisor, Check
 PIP's Available
 Fluid Scan Test, Perform
 Engine RPM, Check
 Multi-Function Control Lever, Check
 Back-Up Alarm, Check
 Transmission Speed Ranges, Check
 AutoTrac System, Check
 Park Brake, Check
 Feeder House Raise-Lower, Fore-Aft, and Lateral Tilt, Check
 Feeder House Safety Lock Functionality, Check
 Feeder House Dust Fan Functionality, Check
 Header Hydraulic Function, Check
 Grain Tank Cover Folding Functionality, Check
 Unloading Auger and Boot Swing Functionality, Check
 Unloading Auger Engage, Check
 Separator Engage Switch, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	
		Page: 33 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Separator Engage Switch, Check
 Header Engage Switch, Check
 Header Reverser Engage Switch, Check
 Multi-Function Control Lever Quick Stop, Check
 Threshing Clearance Adjustment, Check [Need adjustment Concaves and need check position sensor]
 Rotor Speed Adjustment, Check
 Cleaning Fan Speed Adjustment, Check
 Chaffer and Sieve Setting Adjustment, Check [Chaffer and sieve position need adjustment]
 Residue Functionality, Check
 Chopper Speed Adjustment Function, Check
 Chopper High and Low Operation, Check
 Knife Bank Actuation Functionality, Check
 Feeder House Frame, Check
 Feeder House Position Sensor and Wiring Harness, Check
 Feeder House Drive Chain, Slip Clutch, Sprockets, Bearings, and Guide Rails, Check [Need replace chain and two guides]
 Feeder House Conveyor Chain and Eyebolts, Check [Need replace conveyor chain, if not replace chain and need remove half link (4) and replace two slats and need to alignment]
 Feeder House Conveyor Chain Slats, and Plastic Chain Guides, Check [Need replace two conveyor chain slats. Need replace four plastic guides]
 Lateral Tilt Frame Seal, Check
 Feeder House Dust Fan, Motor, Hoses, and Harnesses, Check
 Lateral Tilt Cylinders, Check
 Lateral Tilt Frame, Hoses, Sensor, and Wiring Harness, Check
 Feeder House Top Door and Seal, Check
 Feeder House Top Shaft Bearings, Sprockets, Plastic Wear Strips, Check [Need replace conveyor chain wear strips (all). Recommend replace sprockets (Sprockets maybe working one year)]
 Feeder House Backshaft Speed Sensor, Tone Wheel, and Wiring Harness, Check
 Feeder House Backshaft and Bearing, Check [Need replace bearing]
 Feeder House Front Drum and Bearings, Check
 Feeder House Pivoting Mid-floor and Mid-Floor Stop Blocks, Check
 Feeder House Feed Plate, Check
 Stone Trap, Check
 Feeder House Floor Sheet and Seal, Check
 Fore-Aft Tilt Cylinders, Check
 Fore-Aft Tilt Frame, Hoses, Sensor and Wiring Harness, Check
 Rotor Plastic Dust Shroud, Check
 Separator Feed Floor and Ramp, Check
 Rotor Bearings, Check
 Rotor Front Feed Flights, Check
 Feeder House Lift Cylinder Support, Pins, and Pivots, Check
 Feeder House Smart Lock, Check
 Feeder House Valve Block, Check
 Front-End Gear Case, Hoses, Fittings, Mounting Hardware, and Drive Shaft Bearing, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	34 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Front-End Gear Case, Hoses, Fittings, Mounting Hardware, and Drive Shaft Bearing, Check
 Feeder House Reversing Motor, Hoses, Fittings and Mounting Hardware, Check
 Multi-Coupler Hydraulic Hoses, Harness, and Connections, Check
 Header Locking Pins and Latching Mechanisms, Check
 Feeder House Driven Belt, Belt Tensioners, Pulleys, and Bearings, Check [Need replace bearing]
 Feeder House Drive Belt and Tensioners, Check [Need replace bearing in tension pulley]
 Main Hydraulic Outer Pump Stack, Check
 Feeder House Pivots, Retainer and Bushing, Check
 Feeder House Pivot Hoses, Hose Mounting Hardware, and Wiring Harness, Check
 Feed Accelerator Speed Sensor and Wiring Harness, Check
 Feed Accelerator Supports, Wings, Wear Strips, and Flow Divider, Check
 Feed Accelerator Shaft and Bearings, Check [Need check pulley (maybe fixed bolt)]
 Feed Accelerator Drive Belt, Tensioner, and Idler, Check [Need replace bearing in tensioner pulley]
 Transmission Speed Ranges, Check
 Tracks or Tires, Check
 Front Drive Shaft Splines and Collars, Check
 Transmission Leaks, Lines, and Hoses (ProDrive XL), Check
 Front Hydrostatic Motors, Check
 Front Final Drive, Check
 Front-End Hydraulic Manifold, Check
 ACI Valve Block, Check
 Unloading Auger Drive Belt, Pulleys, Tensioner, Guide, and Shear Bolt, Check [Need replace bearings in both pulley and replace bushings in tension.
 Need replace belt.]
 Cross Auger Clutch Belt, Idler Pulley, Pulley, Check
 Grain Tank Cross Auger Bearings, Check
 Cross Auger Engage Cylinder, Check
 Cross Auger Speed Sensor and Harness, Check
 Vertical Unloading Auger Gearcase, Check [Need check and fixed gear case pulley]
 Vertical Unloading Auger and Housing, Check
 Unloading Auger Sump Clean Out, Check
 Threshing and Separating Covers, Check
 Cleaning Fan Housings and Fan Blades, Check
 Cleaning Fan Shaft, and Bearings, Check
 Cleaning Fan Driven Belt, Pulley, Idler and Bearing, Check
 Cleaning Fan Drive Sheaves, Belt, Linkage, Bearing and Hardware, Check
 Cleaning Fan Variable Drive Hydraulic Hose, Check
 Left Side Front Shake Pan, Chaffer, and Louver Spacing Mechanical Adjustment, Check
 Threshing and Separating Plastic Covers Left Side, Check
 Left Side Concave Position Sensor and Wiring Harness, Check
 Left Side Concave, Check [Need replace first set concave,
 Second set- one replace and one repair
 Third set- one replace and one repair



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	35 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

third set-one replace and one repair

(If need I show you what needs orders)]

Left Side Concave Hangers and Hardware, Check

Left Side Concave Fillers, Check

Left Side Concave Z-Bar, Check

Left Side Concave Isolation Hoses and Fittings, Check

Left Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check

Front End Variable Driven Assembly and Belt, Check

Front End Drive Assembly, Pulleys, and Belt, Check

Left Side Separator Grates, Check

Left Side Separator Loss Sensors, Check

Left Side Threshing Elements, Check

Left Side Separator Tines, Check [Need replace all sets]

Left Side Rotor Rear Discharge Flights, Check

Left Side Pitman Arms, Swing Arms, and Bearings, Check

Left Side Shake Pan Frame, Swing Arms and Bushings, Check

Clean Grain Auger Bearing, Speed Sensor, and Wiring Harness, Check

Tailings Elevator Housing, Check

Tailings Monitor Sensor and Wiring Harness, Check

Tailings Auger, Auger Trough, and Lower Bearings, Check

Tailings Elevator Conveyor Chain and Sprockets, Check

Tailings Elevator Slip Clutch, Check

Upper Tailings Return Auger Bearings, Check

Upper Tailings Return Auger Flighting, Check

Upper Tailings Delivery Auger Housing, Check

Cleaning Shoe Driveshaft, Bearings, and Pitman Arm Cam, Check

Active Tailings Camera, Check

Active Tailings Wear Strips and Threshing Bars, Check

Active Tailings Concave Adjustment, Check

Active Tailings Drive Belt, Tensioner, and Pulley, Check

Service Lights, Check [Need fixed harness]

Rotor Variable Sheaves and Belt, Check

Rotor Driven Assembly and Hoses, Check

Rotor Drive Assembly, Hoses, Front End Drive Tensioner and Bearing, Check

Chaffer and Sieve Element Electrical Adjust, Check

Chopper Raise and Lower Actuator, Check

Discharge Beater Belt, Pulleys, Tensioner, and Idlers, Check

Left Side Discharge Beater Bearing, Check

Rotor Grain Loss Sensor and Wiring Harness, Check [Not working second and third grain loss sensors]

Unloading Auger Driveshaft Bearings, Sensor and Pulley, Check

HADE, POD Controllers and Harnesses, Check

Chopper Belt, Tensioner, and Idlers, Check

Chopper Drive Pulleys, Check



PATTISON AGRICULTURE LIMITED

610 3rd Avenue West, Box 1670

Shaunavon, SK S0N 2M0

Phone: (306) 297-2639

Fax: (306) 297-3827

Http://www.pattisonag.com

GST Number 818708372

Swift Current, SK

Maple Creek, SK

Kindersley, SK

Kyle, SK

Leader, SK

Unity, SK

North Battleford, SK

Humboldt, SK

Kelvington, SK

Shaunavon, SK

(306) 773-9351

(306) 662-2233

(306) 463-2683

(306) 375-2302

(306) 628-3889

(306) 228-2696

(306) 445-4468

(306) 682-2572

(306) 327-4355

(306) 297-2639

Yorkton, SK

Balcarres, SK

Moosomin, SK

Preeceville, SK

Russell, MB

Wynyard, SK

Kamsack, SK

Swan River, MB

(306) 783-9459

(306) 334-2492

(306) 435-3301

(306) 547-2007

(204) 773-2149

(306) 554-2536

(306) 542-2814

(204) 734-3466


PATTISON
 AGRICULTURE


JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
Bus Phone:	Bus Phone:	Work Order Number:	479721
Prv Phone:	Prv Phone:	Payment Type:	Account
		Page:	36 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Chopper Drive Pulleys, Check

Chopper Gearcase, Oil Level, and Lube Line, C



CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:


Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 37 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

heck [Need replace oil]
 Chaffer and Sieve, Check
 Tailboard, Check
 Return Pan, Check
 Rear Deflector, Check
 Discharge Beater Grate and Vanes, Check
 Discharge Beater Wear Strips, Check
 Chopper Inlet Seals, Check
 Straw Chopper Drive Belt Tensioner and Idler Pulley, Check
 Straw Chopper Drive Belt, Check
 Chopper Housing and Bearings, Check
 Chopper Stationary Knife, Actuator, and Wiring Harness, Check [Knife bank- need flip over and need replace Center knife]
 Chopper Blades, Check [Need replace kni]
 Tailboard Center Shroud, Check
 Tailboard Spreader Gearcases, Driveshafts, and Debris Flaps, Check
 Spreader Speed Sensor and Harness, Check
 Shroud Actuator and Harness, Check
 Tailboard Shaft Bearings, Check [Need replace bearing]
 Chop-to-Drop Door, Actuator, Linkage, Straw Rakes, and Wind Row Curtains, Check
 Spreader Drive Belt, Idlers, and Pulleys, Check [Driven pulley need clean and painted]
 Right Hand Residue Harness, Check
 Windrow Pivot Actuator and Harness, Check
 Left Hand Rear Wheel and Tire, Check
 Left Hand Steering Cylinder and Hoses, Check
 Left Hand Steering Tie Rod, Check
 Left Hand Axle Spindle and Bushing Assembly, Check
 Tow Hook, Check [Need fixed harness]
 Rear Axle Hardware, Check
 Rear Axle Pivot Bushing, Check
 Four Wheel Drive Motors and Seals, Check
 Right Hand Rear Wheel and Tire, Check
 Right Hand Steering Cylinder and Hoses, Check
 Right Hand Steering Tie Rod, Check
 Right Hand Spindle and Bushing Assembly, Check
 AutoTrac System, Check
 Wheel Angle Sensor and Wiring Harness, Check
 Ether Start Aid, Check
 Vacuum Fan Housing, Check
 AutoTrac Valve, Fittings, and Hoses, Check
 Right Side Discharge Beater Bearing, Check
 Machine Fuse Center. Check

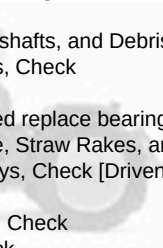

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	38 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Machine Use Center, Check

Batteries, Cables, and Connections, Check

Tailings Auger Bearing, Speed Sensor and Wiring Harness, Check

Shoe Drive Belt, Idler, Tensioner, and Bearings, Check

Pitman Arm Cams, Shoe Drive Shaft, and Drive Shaft Pulley, Check

Right Side Separator Loss Sensors, Check

Clean Grain Elevator Drive Belt, Idlers, and Tensioner, Check

Right Side Pitman Arms, Swing Arms, and Bearings, Check

Clean Grain Elevator Housing and Boot, Check [Need welding boot in said (need ask Serhii)]

Clean Grain Auger, Auger Trough, and Lower Bearings, Check [Need replace auger and bearings both side]

Clean Grain Elevator Chain and Sprockets, Check

Moisture Sensor, and Active Clean Grain Camera, Check

Threshing and Separating Covers, Check

Threshing and Separating Top Covers, Check

Right Side Separator Grates, Check

Right Side Concave Z-Bar, Check

Right Side Concave Hangers and Hardware, Check

Right Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check

Right Side Concave Isolation Hoses and Fittings, Check

Right Side Concave, Check [First set concave need replace all.

Second set- one replace, second need repair

Third set need replace all]

Right Side Concave Fillers, Check

Right Side Separator Tines, Check

Right Side Threshing Elements, Check

Right Side Rotor Rear Discharge Flights, Check

Right Side Concave Position Sensor and Wiring Harness, Check

Cleaning Fan Shaft Bearings, Lock Collars, and Speed Sensor, Check

Right Side Shake Pan Frame, Swing Arms and Bushings, Check

Heater Hoses, Check

Grain Tank Cross Auger Driven Belt, Pulley, and Tensioning Idler, Check

Right Side Grain Tank Cross Auger Bearings, Check

Loading Auger Drive Belt, Pulleys, and Tensioning Idler, Check [Need replace bearing in tension pulley]

IPM Controller and Harness, Check

Cab Wall Electrical Connectors, Check

Air Compressor Tank Drain, Check

Feed Accelerator Gear Case and Drives, Check

Right Hand Grain Tank Drain Covers, Check

Engine RPM, Check

Back-Up Alarm, Check

Engine Deck Access Ladder and Light, Check [Need adjustment locker]

Rotary Screen / Vacuum Fan Drive Belt and Tensioner, Check [Need replace tensioner and idler]

Rotary Screen Driveshaft Belt and Bearings, Check [Need replace bearings and shaft]

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	39 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Rotary Screen Driveshaft Belt and Bearings, Check [Need replace bearings and shaft]
 Rotary Screen, Check
 Fuel, Oil Cooler, A/C Condenser & Fins, Check
 Cooling Package Door Seal, Check
 Radiator Hoses, Lines, and Surge Tank, Check
 Engine Coolant Level, Check
 Water Pump, Check
 Thermostats, Check
 Diesel Exhaust Fluid Tank, Check
 Fuel Tank, Cap, Sensor and Lines, Check [Need replace cap]
 Hydraulic Reservoir, Check [Need fixed hose]
 ECU Connections and Seals, Check
 Main Engine Gear Case and Valve, Check
 Main Engine Gear Case Hydraulic Hoses, Check
 Main Hydraulic Inner Pump Stack, Check
 Hydraulic Valve Stack and Accumulator, Check
 Exhaust and DPF Exhaust System, Check
 Engine Fan Blades, Drive Belt, Shroud, Banjo Bolt, and Pitch Sensor, Check
 Engine Front Seals and Crankshaft Damper, Check
 Air Conditioning Compressor and Alternator Drive Belt, Check
 Air Compressor Pump and Drive Belt, Check
 Accessory Drive Mounting Hardware, Check
 Engine Rear Seals, Check
 Rotor Speed Sensor and Wiring Harness, Check
 Rocker Arm Cover, Check
 Exhaust Manifold, Check
 Turbocharger, Check
 Aftertreatment Harness Module and Sensor, Check
 EGR Valve and Actuator, Check
 Open Crankcase Vent (OCV) System, Check
 Rotor Gear Case, Check
 Rotor Driveshaft and U-Joints, Check
 Grain Tank Cover Cylinders, Hoses, Fittings, and Pins, Check
 Grain Tank Frame, Covers, Extensions, Linkage and Corner Flaps, Check
 Grain Tank Front and Rear Flip Ups, Linkages, and Rock Shaft Bushings, Check
 Grain Tank Level Switches and Wiring Harness, Check
 Grain Tank Loading Auger, Housing, Gear Cases, Bearing, Brackets and Oil, Check [Need replace grain tank unloading auger and bearing]
 Grain Tank Loading Auger Actuator and Harness, Check
 Clean Grain Elevator Mass Flow Sensor Impact Plate, Check
 Grain Sample Trough, Check
 Grain Tank Cross Augers, Troughs, and Covers, Check
 Active Yield Sensors and Wiring Harnesses, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	40 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Active Field Sensors and wiring harnesses, Check
 Grain Tank Window, Check
 Grain Tank Camera and Light, Check
 Unloading Auger Swing Cylinder, Fittings, Hoses and Pins, Check
 Unloading Auger Latching Mechanism and Pin, Check
 Primary Valve Block, Check
 Folding Auger Drive Cog, Check
 Unloading Auger Swing Bushing, and Pivot Point, Check
 Unloading Auger Cradle, Pins and Hardware, Check
 Unloading Horizontal Auger and Tube, Check
 Unloading Auger Inspection Doors, Auger Flighting, and Auger Bearings, Check
 Unloading Auger Folding Mechanism, Harness, Castings, and Pin, Check
 Unloading Auger Lights, Camera, and Harness, Check
 Unloading Auger Grain Saver Door and Boot, Check
 Unloading Auger Boot Actuator and Harness, Check
 Horizontal Auger 90* Gearcase, Check
 Cab Ladder, Check
 Mirrors, Check
 Cab Door Cinch, Check
 Windshield and Cab Glass, Check
 Cab Roof, Check
 GPS Receiver, Check
 Gen 4 Command Center Display and Software, Check
 AMS Software and Hardware, Check
 Seat Operation and Seat Belt, Check
 Park Brake, Check
 Steering Column, Check
 Armrest Functions, Check
 Multi-Function Control Lever Neutral Safety Switch, Check
 Wiper and Washer Operation, Check
 Horn, Check
 Air Conditioning System Operation, Check
 Heater Operation, Check
 Refrigerator, Check
 Cab Radio, Check
 Cab Warning Alarm, Check
 Corner Post and Armrest Display, Check
 Active Header Control Displayed on Corner Post, Check
 Auxiliary Power Strip, Check
 Panels, Gull Wings, Gull Wing Cylinders and Safety Shields, Check
 Safety Decals and Signs, Check
 Ladder Safety Chains, Check
 Road Disconnect Switch, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 41 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Road Disconnect Switch, Check
 Rotary Beacon, Field, Transport, and Warning Lights, Check
 copy of Operator Seat Presence Switch, Check
 Fire Extinguisher, Check
 Operators Manual, Check
 Camera System, Check
 Toolbox, Check
 Static Drag Chain/Cable, Check
 Remote Front Grease Lines, Check
 Air Conditioning Drain Hoses, Check
 Feed Accelerator Gear Case Oil, Check [Need change oil]
 Fuel Precleaner Filter, Check
 Engine Air Filters, Check
 Engine Oil and Filter, Check
 Diesel Exhaust Fluid (DEF) System
 Fuel Filters, Check
 Fuel Tank Breathers, Check
 Suction Screen, Check
 Hydrostatic and Hydraulic Filters, Check
 Final Drives Oil Level, Check
 Transmis



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	42 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

sion Filters (ProDrive XL), Check
 Main Engine Gear Case Oil, Check
 Cab Fresh Air Filter, Check
 Cab Recirculation Filter, Check
 Grain Tank Loading Auger Gear Case Oil, Check
 Wiper Fluid Level, Check & Top Up [Need add fluid]
 Final Running, Check
 Safety Shields, Install
 Water from Air Compressor Reservoir, Drain
 Additional Jobs Required
 ValueMax Job Task
 Serial Number, Check
 Safety Shields, Remove
 Initial Running, Check
 Engine Hours, Check
 Separator Hours, Check
 Machine Frame, Check
 Stored Diagnostic Trouble Codes, Check
 Active Diagnostic Trouble Codes, Check
 Software Update, Check
 MTG/Remote Connection to Service Advisor, Check
 PIP's Available
 Fluid Scan Test, Perform
 Engine RPM, Check
 Multi-Function Control Lever, Check
 Back-Up Alarm, Check
 Transmission Speed Ranges, Check
 AutoTrac System, Check
 Park Brake, Check
 Feeder House Raise-Lower, Fore-Aft, and Lateral Tilt, Check
 Feeder House Safety Lock Functionality, Check
 Feeder House Dust Fan Functionality, Check
 Header Hydraulic Function, Check
 Grain Tank Cover Folding Functionality, Check
 Unloading Auger and Boot Swing Functionality, Check
 Unloading Auger Engage, Check
 Separator Engage Switch, Check
 Header Engage Switch, Check
 Header Reverser Engage Switch, Check
 Multi-Function Control Lever Quick Stop, Check
 Threshing Clearance Adjustment, Check [Need adjustment Concaves and need check position sensor 1



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE



Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	43 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Threshing Clearance Adjustment, Check [need adjustment sensors and need check position sensor]
 Rotor Speed Adjustment, Check
 Cleaning Fan Speed Adjustment, Check
 Chaffer and Sieve Setting Adjustment, Check [Chaffer and sieve position need adjustment]
 Residue Functionality, Check
 Chopper Speed Adjustment Function, Check
 Chopper High and Low Operation, Check
 Knife Bank Actuation Functionality, Check
 Feeder House Frame, Check
 Feeder House Position Sensor and Wiring Harness, Check
 Feeder House Drive Chain, Slip Clutch, Sprockets, Bearings, and Guide Rails, Check [Need replace chain and two guides]
 Feeder House Conveyor Chain and Eyebolts, Check [Need replace conveyor chain, if not replace chain and need remove half link (4) and replace two slats and need to alignment]
 Feeder House Conveyor Chain Slats, and Plastic Chain Guides, Check [Need replace two conveyor chain slats. Need replace four plastic guides]
 Lateral Tilt Frame Seal, Check
 Feeder House Dust Fan, Motor, Hoses, and Harnesses, Check
 Lateral Tilt Cylinders, Check
 Lateral Tilt Frame, Hoses, Sensor, and Wiring Harness, Check
 Feeder House Top Door and Seal, Check
 Feeder House Top Shaft Bearings, Sprockets, Plastic Wear Strips, Check [Need replace conveyor chain wear strips (all). Recommend replace sprockets (Sprockets maybe working one year)]
 Feeder House Backshaft Speed Sensor, Tone Wheel, and Wiring Harness, Check
 Feeder House Backshaft and Bearing, Check [Need replace bearing]
 Feeder House Front Drum and Bearings, Check
 Feeder House Pivoting Mid-floor and Mid-Floor Stop Blocks, Check
 Feeder House Feed Plate, Check
 Stone Trap, Check
 Feeder House Floor Sheet and Seal, Check
 Fore-Aft Tilt Cylinders, Check
 Fore-Aft Tilt Frame, Hoses, Sensor and Wiring Harness, Check
 Rotor Plastic Dust Shroud, Check
 Separator Feed Floor and Ramp, Check
 Rotor Bearings, Check
 Rotor Front Feed Flights, Check
 Feeder House Lift Cylinder Support, Pins, and Pivots, Check
 Feeder House Smart Lock, Check
 Feeder House Valve Block, Check
 Front-End Gear Case, Hoses, Fittings, Mounting Hardware, and Drive Shaft Bearing, Check
 Feeder House Reversing Motor, Hoses, Fittings and Mounting Hardware, Check
 Multi-Coupler Hydraulic Hoses, Harness, and Connections, Check
 Header Locking Pins and Latching Mechanisms, Check
 Feeder House Driven Belt, Belt Tensioners, Pulleys, and Bearings, Check [Need replace bearing]

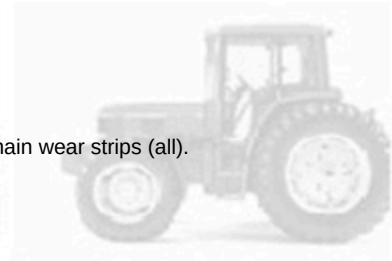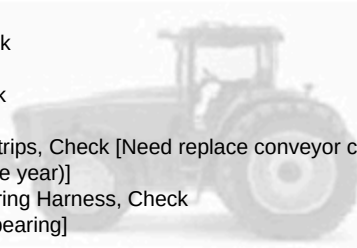

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE


Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:	Page:	44 of 74
Prv Phone:	Prv Phone:		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Feeder House Drive Belt, Belt Tensioners, Pulleys, and Bearings, Check [Need replace bearing]
 Feeder House Drive Belt and Tensioners, Check [Need replace bearing in tension pulley]
 Main Hydraulic Outer Pump Stack, Check
 Feeder House Pivots, Retainer and Bushing, Check
 Feeder House Pivot Hoses, Hose Mounting Hardware, and Wiring Harness, Check
 Feed Accelerator Speed Sensor and Wiring Harness, Check
 Feed Accelerator Supports, Wings, Wear Strips, and Flow Divider, Check
 Feed Accelerator Shaft and Bearings, Check [Need check pulley (maybe fixed bolt)]
 Feed Accelerator Drive Belt, Tensioner, and Idler, Check [Need replace bearing in tensioner pulley]
 Transmission Speed Ranges, Check
 Tracks or Tires, Check
 Front Drive Shaft Splines and Collars, Check
 Transmission Leaks, Lines, and Hoses (ProDrive XL), Check
 Front Hydrostatic Motors, Check
 Front Final Drive, Check
 Front-End Hydraulic Manifold, Check
 ACI Valve Block, Check
 Unloading Auger Drive Belt, Pulleys, Tensioner, Guide, and Shear Bolt, Check [Need replace bearings in both pulley and replace bushings in tension.
 Need replace belt.]
 Cross Auger Clutch Belt, Idler Pulley, Pulley, Check
 Grain Tank Cross Auger Bearings, Check
 Cross Auger Engage Cylinder, Check
 Cross Auger Speed Sensor and Harness, Check
 Vertical Unloading Auger Gearcase, Check [Need check and fixed gear case pulley]
 Vertical Unloading Auger and Housing, Check
 Unloading Auger Sump Clean Out, Check
 Threshing and Separating Covers, Check
 Cleaning Fan Housings and Fan Blades, Check
 Cleaning Fan Shaft, and Bearings, Check
 Cleaning Fan Driven Belt, Pulley, Idler and Bearing, Check
 Cleaning Fan Drive Sheaves, Belt, Linkage, Bearing and Hardware, Check
 Cleaning Fan Variable Drive Hydraulic Hose, Check
 Left Side Front Shake Pan, Chaffer, and Louver Spacing Mechanical Adjustment, Check
 Threshing and Separating Plastic Covers Left Side, Check
 Left Side Concave Position Sensor and Wiring Harness, Check
 Left Side Concave, Check [Need replace first set concave,
 Second set- one replace and one repair
 Third set-one replace and one repair
 (If need I show you what needs orders)]
 Left Side Concave Hangers and Hardware, Check
 Left Side Concave Fillers, Check
 Left Side Concave 7-Bar, Check

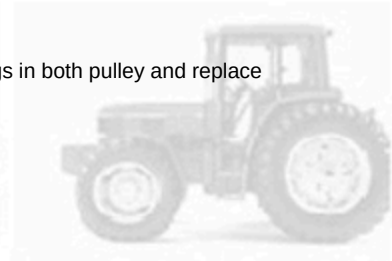

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
Bus Phone:	Bus Phone:	Work Order Number:	479721
Prv Phone:	Prv Phone:	Payment Type:	Account
		Page:	45 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Left Side Concave 2-Bar, Check
 Left Side Concave Isolation Hoses and Fittings, Check
 Left Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
 Front End Variable Driven Assembly and Belt, Check
 Front End Drive Assembly, Pulleys, and Belt, Check
 Left Side Separator Grates, Check
 Left Side Separator Loss Sensors, Check
 Left Side Threshing Elements, Check
 Left Side Separator Tines, Check [Need replace all sets]
 Left Side Rotor Rear Discharge Flights, Check
 Left Side Pitman Arms, Swing Arms, and Bearings, Check
 Left Side Shake Pan Frame, Swing Arms and Bushings, Check
 Clean Grain Auger Bearing, Speed Sensor, and Wiring Harness, Check
 Tailings Elevator Housing, Check
 Tailings Monitor Sensor and Wiring Harness, Check
 Tailings Auger, Auger Trough, and Lower Bearings, Check
 Tailings Elevator Conveyor Chain and Sprockets, Check
 Tailings Elevator Slip Clutch, Check
 Upper Tailings Return Auger Bearings, Check
 Upper Tailings Return Auger Flighting, Check
 Upper Tailings Delivery Auger Housing, Check
 Cleaning Shoe Driveshaft, Bearings, and Pitman Arm Cam, Check
 Active Tailings Camera, Check
 Active Tailings Wear Strips and Threshing Bars, Check
 Active Tailings Concave Adjustment, Check
 Active Tailings Drive Belt, Tensioner, and Pulley, Check
 Service Lights, Check [Need fixed harness]
 Rotor Variable Sheaves and Belt, Check
 Rotor Driven Assembly and Hoses, Check
 Rotor Drive Assembly, Hoses, Front End Drive Tensioner and Bearing, Check
 Chaffer and Sieve Element Electrical Adjust, Check
 Chopper Raise and Lower Actuator, Check
 Discharge Beater Belt, Pulleys, Tensioner, and Idlers, Check
 Left Side Discharge Beater Bearing, Check
 Rotor Grain Loss Sensor and Wiring Harness, Check [Not working second and third grain loss sensors]
 Unloading Auger Driveshaft Bearings, Sensor and Pulley, Check
 HADE, POD Controllers and Harnesses, Check
 Chopper Belt, Tensioner, and Idlers, Check
 Chopper Drive Pulleys, Check
 Chopper Gearcase, Oil Level, and Lube Line, Check [Need replace oil]
 Chaffer and Sieve, Check
 Tailboard, Check
 Return Bar, Check



PATTISON AGRICULTURE LIMITED

610 3rd Avenue West, Box 1670

Shaunavon, SK S0N 2M0

Phone: (306) 297-2639

Fax: (306) 297-3827

Http://www.pattisonag.com

GST Number 818708372

Swift Current, SK

Maple Creek, SK

Kindersley, SK

Kyle, SK

Leader, SK

Unity, SK

North Battleford, SK

Humboldt, SK

Kelvington, SK

Shaunavon, SK

(306) 773-9351

(306) 662-2233

(306) 463-2683

(306) 375-2302

(306) 628-3889

(306) 228-2696

(306) 445-4468

(306) 682-2572

(306) 327-4355

(306) 297-2639

Yorkton, SK

Balcarres, SK

Moosomin, SK

Preeceville, SK

Russell, MB

Wynyard, SK

Kamsack, SK

Swan River, MB

(306) 783-9459

(306) 334-2492

(306) 435-3301

(306) 547-2007

(204) 773-2149

(306) 554-2536

(306) 542-2814

(204) 734-3466

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 46 of 74

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE X9 1000

793

1H0X910XCP0825255

175890

Return Part, Check

Rear Deflector, Check

Disch



CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:


Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	47 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

arge Beater Grate and Vanes, Check
 Discharge Beater Wear Strips, Check
 Chopper Inlet Seals, Check
 Straw Chopper Drive Belt Tensioner and Idler Pulley, Check
 Straw Chopper Drive Belt, Check
 Chopper Housing and Bearings, Check
 Chopper Stationary Knife, Actuator, and Wiring Harness, Check [Knife bank- need flip over and need replace Center knife]
 Chopper Blades, Check [Need replace kni]
 Tailboard Center Shroud, Check
 Tailboard Spreader Gearcases, Driveshafts, and Debris Flaps, Check
 Spreader Speed Sensor and Harness, Check
 Shroud Actuator and Harness, Check
 Tailboard Shaft Bearings, Check [Need replace bearing]
 Chop-to-Drop Door, Actuator, Linkage, Straw Rakes, and Wind Row Curtains, Check
 Spreader Drive Belt, Idlers, and Pulleys, Check [Driven pulley need clean and painted]
 Right Hand Residue Harness, Check
 Windrow Pivot Actuator and Harness, Check
 Left Hand Rear Wheel and Tire, Check
 Left Hand Steering Cylinder and Hoses, Check
 Left Hand Steering Tie Rod, Check
 Left Hand Axle Spindle and Bushing Assembly, Check
 Tow Hook, Check [Need fixed harness]
 Rear Axle Hardware, Check
 Rear Axle Pivot Bushing, Check
 Four Wheel Drive Motors and Seals, Check
 Right Hand Rear Wheel and Tire, Check
 Right Hand Steering Cylinder and Hoses, Check
 Right Hand Steering Tie Rod, Check
 Right Hand Spindle and Bushing Assembly, Check
 AutoTrac System, Check
 Wheel Angle Sensor and Wiring Harness, Check
 Ether Start Aid, Check
 Vacuum Fan Housing, Check
 AutoTrac Valve, Fittings, and Hoses, Check
 Right Side Discharge Beater Bearing, Check
 Machine Fuse Center, Check
 Batteries, Cables, and Connections, Check
 Tailings Auger Bearing, Speed Sensor and Wiring Harness, Check
 Shoe Drive Belt, Idler, Tensioner, and Bearings, Check
 Pitman Arm Cams, Shoe Drive Shaft, and Drive Shaft Pulley, Check
 Right Side Separator Loss Sensors, Check

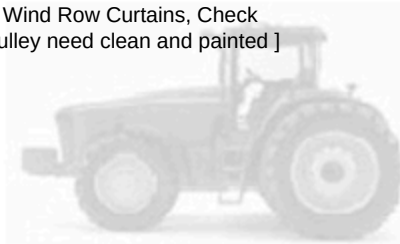

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	48 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Right Side Separator Loss Sensors, Check
 Clean Grain Elevator Drive Belt, Idlers, and Tensioner, Check
 Right Side Pitman Arms, Swing Arms, and Bearings, Check
 Clean Grain Elevator Housing and Boot, Check [Need welding boot in said (need ask Serhii)]
 Clean Grain Auger, Auger Trough, and Lower Bearings, Check [Need replace auger and bearings both side]
 Clean Grain Elevator Chain and Sprockets, Check
 Moisture Sensor, and Active Clean Grain Camera, Check
 Threshing and Separating Covers, Check
 Threshing and Separating Top Covers, Check
 Right Side Separator Grates, Check
 Right Side Concave Z-Bar, Check
 Right Side Concave Hangers and Hardware, Check
 Right Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
 Right Side Concave Isolation Hoses and Fittings, Check
 Right Side Concave, Check [First set concave need replace all.
 Second set- one replace,second need repair
 Third set need replace all]
 Right Side Concave Fillers, Check
 Right Side Separator Tines, Check
 Right Side Threshing Elements, Check
 Right Side Rotor Rear Discharge Flights, Check
 Right Side Concave Position Sensor and Wiring Harness, Check
 Cleaning Fan Shaft Bearings, Lock Collars, and Speed Sensor, Check
 Right Side Shake Pan Frame, Swing Arms and Bushings, Check
 Heater Hoses, Check
 Grain Tank Cross Auger Driven Belt, Pulley, and Tensioning Idler, Check
 Right Side Grain Tank Cross Auger Bearings, Check
 Loading Auger Drive Belt, Pulleys, and Tensioning Idler, Check [Need replace bearing in tension pulley]
 IPM Controller and Harness, Check
 Cab Wall Electrical Connectors, Check
 Air Compressor Tank Drain, Check
 Feed Accelerator Gear Case and Drives, Check
 Right Hand Grain Tank Drain Covers, Check
 Engine RPM, Check
 Back-Up Alarm, Check
 Engine Deck Access Ladder and Light, Check [Need adjustment locker]
 Rotary Screen / Vacuum Fan Drive Belt and Tensioner, Check [Need replace tensioner and idler]
 Rotary Screen Driveshaft Belt and Bearings, Check [Need replace bearings and shaft]
 Rotary Screen, Check
 Fuel, Oil Cooler, A/C Condenser & Fins, Check
 Cooling Package Door Seal, Check
 Radiator Hoses, Lines, and Surge Tank, Check
 Engine Coolant Level, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	49 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Engine Coolant Level, Check
 Water Pump, Check
 Thermostats, Check
 Diesel Exhaust Fluid Tank, Check
 Fuel Tank, Cap, Sensor and Lines, Check [Need replace cap]
 Hydraulic Reservoir, Check [Need fixed hose]
 ECU Connections and Seals, Check
 Main Engine Gear Case and Valve, Check
 Main Engine Gear Case Hydraulic Hoses, Check
 Main Hydraulic Inner Pump Stack, Check
 Hydraulic Valve Stack and Accumulator, Check
 Exhaust and DPF Exhaust System, Check
 Engine Fan Blades, Drive Belt, Shroud, Banjo Bolt, and Pitch Sensor, Check
 Engine Front Seals and Crankshaft Damper, Check
 Air Conditioning Compressor and Alternator Drive Belt, Check
 Air Compressor Pump and Drive Belt, Check
 Accessory Drive Mounting Hardware, Check
 Engine Rear Seals, Check
 Rotor Speed Sensor and Wiring Harness, Check
 Rocker Arm Cover, Check
 Exhaust Manifold, Check
 Turbocharger, Check
 Aftertreatment Harness Module and Sensor, Check
 EGR Valve and Actuator, Check
 Open Crankcase Vent (OCV) System, Check
 Rotor Gear Case, Check
 Rotor Driveshaft and U-Joints, Check
 Grain Tank Cover Cylinders, Hoses, Fittings, and Pins, Check
 Grain Tank Frame, Covers, Extensions, Linkage and Corner Flaps, Check
 Grain Tank Front and Rear Flip Ups, Linkages, and Rock Shaft Bushings, Check
 Grain Tank Level Switches and Wiring Harness, Check
 Grain Tank Loading Auger, Housing, Gear Cases, Bearing, Brackets and Oil, Check [Need replace grain tank unloading auger and bearing]
 Grain Tank Loading Auger Actuator and Harness, Check
 Clean Grain Elevator Mass Flow Sensor Impact Plate, Check
 Grain Sample Trough, Check
 Grain Tank Cross Augers, Troughs, and Covers, Check
 Active Yield Sensors and Wiring Harnesses, Check
 Grain Tank Window, Check
 Grain Tank Camera and Light, Check
 Unloading Auger Swing Cylinder, Fittings, Hoses and Pins, Check
 Unloading Auger Latching Mechanism and Pin, Check
 Primary Valve Block, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 50 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Primary Valve Block, Check
 Folding Auger Drive Cog, Check
 Unloading Auger Swing Bushing, and Pivot Point, Check
 Unloading Auger Cradle, Pins and Hardware, Check
 Unloading Horizontal Auger and Tube, Check
 Unloading Auger Inspection Doors, Auger Flighting, and Auger Bearings, Check
 Unloading Auger Folding Mechanism, Harness, Castings, and Pin, Check
 Unloading Auger Lights, Camera, and Harness, Check
 Unloading Auger Grain Saver Door and Boot, Check
 Unloading Auger Boot Actuator and Harness, Check
 Horizontal Auger 90* Gearcase, Check
 Cab Ladder, Check
 Mirrors, Check
 Cab Door Cinch, Check
 Windshield and Cab Glass, Check
 Cab Roof, Check
 GPS Receiver, Check
 Gen 4 Command Center Display and Software, Check
 AMS Software and Hardware, Check
 Seat Operation and Seat Belt, Check
 Park Brake, Check
 Steering Column, Check
 Armrest Functions, Check
 Multi-Function Control Lever Neutral Safety Switch, Check
 Wiper and Washer Operation, Check
 Horn, Check
 Air Conditioning System Operation, Check
 Heater Operation, Check
 Refrigerator, Check
 Cab Radio, Check
 Cab Warning Alarm, Check
 Corner Post and Armrest Display, Check
 Active Header Control Displayed on Corner Post, Check
 Auxiliary Power Strip, Check
 Panels, Gull Wings, Gull Wing Cylinders and Safety Shields, Check
 Safety Decals and Signs, Check
 Ladder Safety Chains, Check
 Road Disconnect Switch, Check
 Rotary Beacon, Field, Transport, and Warning Lights, Check
 copy of Operator Seat Presence Switch, Check
 Fire Extinguisher, Check
 Operators Manual, Check
 Camera System, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE


Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 51 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Camera System, Check
 Toolbox, Check
 Static Drag Chain/Cable, Check
 Remote Front Grease Lines, Check
 Air Conditioning Drain Hoses, Check
 Feed Accelerator Gear Case Oil, Check [Need change oil]
 Fuel Precleaner Filter, Check
 Engine Air Filters, Check
 Engine Oil and Filter, Check
 Diesel Exhaust Fluid (DEF) System
 Fuel Filters, Check
 Fuel Tank Breathers, Check
 Suction Screen, Check
 Hydrostatic and Hydraulic Filters, Check
 Final Drives Oil Level, Check
 Transmission Filters (ProDrive XL), Check
 Main Engine Gear Case Oil, Check
 Cab Fresh Air Filter, Check
 Cab Recirculation

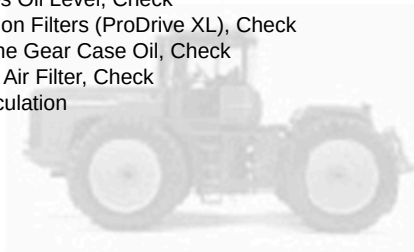

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 52 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

Filter, Check
 Grain Tank Loading Auger Gear Case Oil, Check
 Wiper Fluid Level, Check & Top Up [Need add fluid]
 Final Running, Check
 Safety Shields, Install
 Water from Air Compressor Reservoir, Drain
 Additional Jobs Required
 ValueMax Job Task
 Serial Number, Check
 Safety Shields, Remove
 Initial Running, Check
 Engine Hours, Check
 Separator Hours, Check
 Machine Frame, Check
 Stored Diagnostic Trouble Codes, Check
 Active Diagnostic Trouble Codes, Check
 Software Update, Check
 MTG/Remote Connection to Service Advisor, Check
 PIP's Available
 Fluid Scan Test, Perform
 Engine RPM, Check
 Multi-Function Control Lever, Check
 Back-Up Alarm, Check
 Transmission Speed Ranges, Check
 AutoTrac System, Check
 Park Brake, Check
 Feeder House Raise-Lower, Fore-Aft, and Lateral Tilt, Check
 Feeder House Safety Lock Functionality, Check
 Feeder House Dust Fan Functionality, Check
 Header Hydraulic Function, Check
 Grain Tank Cover Folding Functionality, Check
 Unloading Auger and Boot Swing Functionality, Check
 Unloading Auger Engage, Check
 Separator Engage Switch, Check
 Header Engage Switch, Check
 Header Reverser Engage Switch, Check
 Multi-Function Control Lever Quick Stop, Check
 Threshing Clearance Adjustment, Check [Need adjustment Concaves and need check position sensor]
 Rotor Speed Adjustment, Check
 Cleaning Fan Speed Adjustment, Check
 Chaffer and Sieve Setting Adjustment Check [Chaffer and sieve position need adjustment]



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE


Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	53 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Chaper and Drive Setting Adjustment, Check [Chaper and drive position need adjustment]
 Residue Functionality, Check
 Chopper Speed Adjustment Function, Check
 Chopper High and Low Operation, Check
 Knife Bank Actuation Functionality, Check
 Feeder House Frame, Check
 Feeder House Position Sensor and Wiring Harness, Check
 Feeder House Drive Chain, Slip Clutch, Sprockets, Bearings, and Guide Rails, Check [Need replace chain and two guides]
 Feeder House Conveyor Chain and Eyebolts, Check [Need replace conveyor chain, if not replace chain and need remove half link (4) and replace two slats and need to alignment]
 Feeder House Conveyor Chain Slats, and Plastic Chain Guides, Check [Need replace two conveyor chain slats. Need replace four plastic guides]
 Lateral Tilt Frame Seal, Check
 Feeder House Dust Fan, Motor, Hoses, and Harnesses, Check
 Lateral Tilt Cylinders, Check
 Lateral Tilt Frame, Hoses, Sensor, and Wiring Harness, Check
 Feeder House Top Door and Seal, Check
 Feeder House Top Shaft Bearings, Sprockets, Plastic Wear Strips, Check [Need replace conveyor chain wear strips (all). Recommend replace sprockets (Sprockets maybe working one year)]
 Feeder House Backshaft Speed Sensor, Tone Wheel, and Wiring Harness, Check
 Feeder House Backshaft and Bearing, Check [Need replace bearing]
 Feeder House Front Drum and Bearings, Check
 Feeder House Pivoting Mid-floor and Mid-Floor Stop Blocks, Check
 Feeder House Feed Plate, Check
 Stone Trap, Check
 Feeder House Floor Sheet and Seal, Check
 Fore-Aft Tilt Cylinders, Check
 Fore-Aft Tilt Frame, Hoses, Sensor and Wiring Harness, Check
 Rotor Plastic Dust Shroud, Check
 Separator Feed Floor and Ramp, Check
 Rotor Bearings, Check
 Rotor Front Feed Flights, Check
 Feeder House Lift Cylinder Support, Pins, and Pivots, Check
 Feeder House Smart Lock, Check
 Feeder House Valve Block, Check
 Front-End Gear Case, Hoses, Fittings, Mounting Hardware, and Drive Shaft Bearing, Check
 Feeder House Reversing Motor, Hoses, Fittings and Mounting Hardware, Check
 Multi-Coupler Hydraulic Hoses, Harness, and Connections, Check
 Header Locking Pins and Latching Mechanisms, Check
 Feeder House Driven Belt, Belt Tensioners, Pulleys, and Bearings, Check [Need replace bearing]
 Feeder House Drive Belt and Tensioners, Check [Need replace bearing in tension pulley]
 Main Hydraulic Outer Pump Stack, Check
 Feeder House Pivots Retainer and Rushing, Check

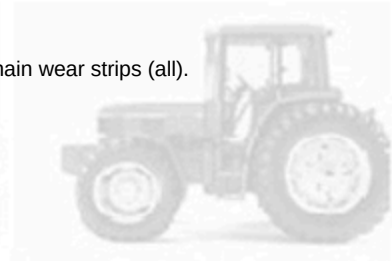

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	54 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Feeder House Pivots, Retainer and Bushing, Check
 Feeder House Pivot Hoses, Hose Mounting Hardware, and Wiring Harness, Check
 Feed Accelerator Speed Sensor and Wiring Harness, Check
 Feed Accelerator Supports, Wings, Wear Strips, and Flow Divider, Check
 Feed Accelerator Shaft and Bearings, Check [Need check pulley (maybe fixed bolt)]
 Feed Accelerator Drive Belt, Tensioner, and Idler, Check [Need replace bearing in tensioner pulley]
 Transmission Speed Ranges, Check
 Tracks or Tires, Check
 Front Drive Shaft Splines and Collars, Check
 Transmission Leaks, Lines, and Hoses (ProDrive XL), Check
 Front Hydrostatic Motors, Check
 Front Final Drive, Check
 Front-End Hydraulic Manifold, Check
 ACI Valve Block, Check
 Unloading Auger Drive Belt, Pulleys, Tensioner, Guide, and Shear Bolt, Check [Need replace bearings in both pulley and replace bushings in tension.
 Need replace belt.]
 Cross Auger Clutch Belt, Idler Pulley, Pulley, Check
 Grain Tank Cross Auger Bearings, Check
 Cross Auger Engage Cylinder, Check
 Cross Auger Speed Sensor and Harness, Check
 Vertical Unloading Auger Gearcase, Check [Need check and fixed gear case pulley]
 Vertical Unloading Auger and Housing, Check
 Unloading Auger Sump Clean Out, Check
 Threshing and Separating Covers, Check
 Cleaning Fan Housings and Fan Blades, Check
 Cleaning Fan Shaft, and Bearings, Check
 Cleaning Fan Driven Belt, Pulley, Idler and Bearing, Check
 Cleaning Fan Drive Sheaves, Belt, Linkage, Bearing and Hardware, Check
 Cleaning Fan Variable Drive Hydraulic Hose, Check
 Left Side Front Shake Pan, Chaffer, and Louver Spacing Mechanical Adjustment, Check
 Threshing and Separating Plastic Covers Left Side, Check
 Left Side Concave Position Sensor and Wiring Harness, Check
 Left Side Concave, Check [Need replace first set concave,
 Second set- one replace and one repair
 Third set-one replace and one repair
 (If need I show you what needs orders)]
 Left Side Concave Hangers and Hardware, Check
 Left Side Concave Fillers, Check
 Left Side Concave Z-Bar, Check
 Left Side Concave Isolation Hoses and Fittings, Check
 Left Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
 Front End Variable Driven Assembly and Belt, Check

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	55 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Front End Variable Driven Assembly and Belt, Check
 Front End Drive Assembly, Pulleys, and Belt, Check
 Left Side Separator Grates, Check
 Left Side Separator Loss Sensors, Check
 Left Side Threshing Elements, Check
 Left Side Separator Tines, Check [Need replace all sets]
 Left Side Rotor Rear Discharge Flights, Check
 Left Side Pitman Arms, Swing Arms, and Bearings, Check
 Left Side Shake Pan Frame, Swing Arms and Bushings, Check
 Clean Grain Auger Bearing, Speed Sensor, and Wiring Harness, Check
 Tailings Elevator Housing, Check
 Tailings Monitor Sensor and Wiring Harness, Check
 Tailings Auger, Auger Trough, and Lower Bearings, Check
 Tailings Elevator Conveyor Chain and Sprockets, Check
 Tailings Elevator Slip Clutch, Check
 Upper Tailings Return Auger Bearings, Check
 Upper Tailings Return Auger Flighting, Check
 Upper Tailings Delivery Auger Housing, Check
 Cleaning Shoe Driveshaft, Bearings, and Pitman Arm Cam, Check
 Active Tailings Camera, Check
 Active Tailings Wear Strips and Threshing Bars, Check
 Active Tailings Concave Adjustment, Check
 Active Tailings Drive Belt, Tensioner, and Pulley, Check
 Service Lights, Check [Need fixed harness]
 Rotor Variable Sheaves and Belt, Check
 Rotor Driven Assembly and Hoses, Check
 Rotor Drive Assembly, Hoses, Front End Drive Tensioner and Bearing, Check
 Chaffer and Sieve Element Electrical Adjust, Check
 Chopper Raise and Lower Actuator, Check
 Discharge Beater Belt, Pulleys, Tensioner, and Idlers, Check
 Left Side Discharge Beater Bearing, Check
 Rotor Grain Loss Sensor and Wiring Harness, Check [Not working second and third grain loss sensors]
 Unloading Auger Driveshaft Bearings, Sensor and Pulley, Check
 HADE, POD Controllers and Harnesses, Check
 Chopper Belt, Tensioner, and Idlers, Check
 Chopper Drive Pulleys, Check
 Chopper Gearcase, Oil Level, and Lube Line, Check [Need replace oil]
 Chaffer and Sieve, Check
 Tailboard, Check
 Return Pan, Check
 Rear Deflector, Check
 Discharge Beater Grate and Vanes, Check
 Discharge Beater Wear Strips, Check



CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED

610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 56 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Discharge Beater wear Strips, Check
 Chopper Inlet Seals, Check
 Straw Chopper D



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	57 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

rive Belt Tensioner and Idler Pulley, Check
 Straw Chopper Drive Belt, Check
 Chopper Housing and Bearings, Check
 Chopper Stationary Knife, Actuator, and Wiring Harness, Check [Knife bank- need flip over and need replace Center knife]
 Chopper Blades, Check [Need replace kni]
 Tailboard Center Shroud, Check
 Tailboard Spreader Gearcases, Driveshafts, and Debris Flaps, Check
 Spreader Speed Sensor and Harness, Check
 Shroud Actuator and Harness, Check
 Tailboard Shaft Bearings, Check [Need replace bearing]
 Chop-to-Drop Door, Actuator, Linkage, Straw Rakes, and Wind Row Curtains, Check
 Spreader Drive Belt, Idlers, and Pulleys, Check [Driven pulley need clean and painted]
 Right Hand Residue Harness, Check
 Windrow Pivot Actuator and Harness, Check
 Left Hand Rear Wheel and Tire, Check
 Left Hand Steering Cylinder and Hoses, Check
 Left Hand Steering Tie Rod, Check
 Left Hand Axle Spindle and Bushing Assembly, Check
 Tow Hook, Check [Need fixed harness]
 Rear Axle Hardware, Check
 Rear Axle Pivot Bushing, Check
 Four Wheel Drive Motors and Seals, Check
 Right Hand Rear Wheel and Tire, Check
 Right Hand Steering Cylinder and Hoses, Check
 Right Hand Steering Tie Rod, Check
 Right Hand Spindle and Bushing Assembly, Check
 AutoTrac System, Check
 Wheel Angle Sensor and Wiring Harness, Check
 Ether Start Aid, Check
 Vacuum Fan Housing, Check
 AutoTrac Valve, Fittings, and Hoses, Check
 Right Side Discharge Beater Bearing, Check
 Machine Fuse Center, Check
 Batteries, Cables, and Connections, Check
 Tailings Auger Bearing, Speed Sensor and Wiring Harness, Check
 Shoe Drive Belt, Idler, Tensioner, and Bearings, Check
 Pitman Arm Cams, Shoe Drive Shaft, and Drive Shaft Pulley, Check
 Right Side Separator Loss Sensors, Check
 Clean Grain Elevator Drive Belt, Idlers, and Tensioner, Check
 Right Side Pitman Arms, Swing Arms, and Bearings, Check
 Clean Grain Elevator Housing and Root. Check [Need welding hoot in said (need ask Serhiil]



PATTISON AGRICULTURE LIMITED

610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		

**JOHN DEERE****SERVICE INVOICE**

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	58 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Clean Grain Elevator Housing and Boot, Check [Need replace boot in side (Need ask Gerry)]
 Clean Grain Auger, Auger Trough, and Lower Bearings, Check [Need replace auger and bearings both side]
 Clean Grain Elevator Chain and Sprockets, Check
 Moisture Sensor, and Active Clean Grain Camera, Check
 Threshing and Separating Covers, Check
 Threshing and Separating Top Covers, Check
 Right Side Separator Grates, Check
 Right Side Concave Z-Bar, Check
 Right Side Concave Hangers and Hardware, Check
 Right Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
 Right Side Concave Isolation Hoses and Fittings, Check
 Right Side Concave, Check [First set concave need replace all.
 Second set- one replace, second need repair
 Third set need replace all]
 Right Side Concave Fillers, Check
 Right Side Separator Tines, Check
 Right Side Threshing Elements, Check
 Right Side Rotor Rear Discharge Flights, Check
 Right Side Concave Position Sensor and Wiring Harness, Check
 Cleaning Fan Shaft Bearings, Lock Collars, and Speed Sensor, Check
 Right Side Shake Pan Frame, Swing Arms and Bushings, Check
 Heater Hoses, Check
 Grain Tank Cross Auger Driven Belt, Pulley, and Tensioning Idler, Check
 Right Side Grain Tank Cross Auger Bearings, Check
 Loading Auger Drive Belt, Pulleys, and Tensioning Idler, Check [Need replace bearing in tension pulley]
 IPM Controller and Harness, Check
 Cab Wall Electrical Connectors, Check
 Air Compressor Tank Drain, Check
 Feed Accelerator Gear Case and Drives, Check
 Right Hand Grain Tank Drain Covers, Check
 Engine RPM, Check
 Back-Up Alarm, Check
 Engine Deck Access Ladder and Light, Check [Need adjustment locker]
 Rotary Screen / Vacuum Fan Drive Belt and Tensioner, Check [Need replace tensioner and idler]
 Rotary Screen Driveshaft Belt and Bearings, Check [Need replace bearings and shaft]
 Rotary Screen, Check
 Fuel, Oil Cooler, A/C Condenser & Fins, Check
 Cooling Package Door Seal, Check
 Radiator Hoses, Lines, and Surge Tank, Check
 Engine Coolant Level, Check
 Water Pump, Check
 Thermostats, Check
 Diesel Exhaust Fluid Tank Check



CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	59 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Diesel Exhaust Fluid Tank, Check
 Fuel Tank, Cap, Sensor and Lines, Check [Need replace cap]
 Hydraulic Reservoir, Check [Need fixed hose]
 ECU Connections and Seals, Check
 Main Engine Gear Case and Valve, Check
 Main Engine Gear Case Hydraulic Hoses, Check
 Main Hydraulic Inner Pump Stack, Check
 Hydraulic Valve Stack and Accumulator, Check
 Exhaust and DPF Exhaust System, Check
 Engine Fan Blades, Drive Belt, Shroud, Banjo Bolt, and Pitch Sensor, Check
 Engine Front Seals and Crankshaft Damper, Check
 Air Conditioning Compressor and Alternator Drive Belt, Check
 Air Compressor Pump and Drive Belt, Check
 Accessory Drive Mounting Hardware, Check
 Engine Rear Seals, Check
 Rotor Speed Sensor and Wiring Harness, Check
 Rocker Arm Cover, Check
 Exhaust Manifold, Check
 Turbocharger, Check
 Aftertreatment Harness Module and Sensor, Check
 EGR Valve and Actuator, Check
 Open Crankcase Vent (OCV) System, Check
 Rotor Gear Case, Check
 Rotor Driveshaft and U-Joints, Check
 Grain Tank Cover Cylinders, Hoses, Fittings, and Pins, Check
 Grain Tank Frame, Covers, Extensions, Linkage and Corner Flaps, Check
 Grain Tank Front and Rear Flip Ups, Linkages, and Rock Shaft Bushings, Check
 Grain Tank Level Switches and Wiring Harness, Check
 Grain Tank Loading Auger, Housing, Gear Cases, Bearing, Brackets and Oil, Check [Need replace grain tank unloading auger and bearing]
 Grain Tank Loading Auger Actuator and Harness, Check
 Clean Grain Elevator Mass Flow Sensor Impact Plate, Check
 Grain Sample Trough, Check
 Grain Tank Cross Augers, Troughs, and Covers, Check
 Active Yield Sensors and Wiring Harnesses, Check
 Grain Tank Window, Check
 Grain Tank Camera and Light, Check
 Unloading Auger Swing Cylinder, Fittings, Hoses and Pins, Check
 Unloading Auger Latching Mechanism and Pin, Check
 Primary Valve Block, Check
 Folding Auger Drive Cog, Check
 Unloading Auger Swing Bushing, and Pivot Point, Check
 Unloading Auger Cradle, Pins and Hardware, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 60 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Unloading Auger Cradle, Pins and Hardware, Check
 Unloading Horizontal Auger and Tube, Check
 Unloading Auger Inspection Doors, Auger Flighting, and Auger Bearings, Check
 Unloading Auger Folding Mechanism, Harness, Castings, and Pin, Check
 Unloading Auger Lights, Camera, and Harness, Check
 Unloading Auger Grain Saver Door and Boot, Check
 Unloading Auger Boot Actuator and Harness, Check
 Horizontal Auger 90* Gearcase, Check
 Cab Ladder, Check
 Mirrors, Check
 Cab Door Cinch, Check
 Windshield and Cab Glass, Check
 Cab Roof, Check
 GPS Receiver, Check
 Gen 4 Command Center Display and Software, Check
 AMS Software and Hardware, Check
 Seat Operation and Seat Belt, Check
 Park Brake, Check
 Steering Column, Check
 Armrest Functions, Check
 Multi-Function Control Lever Neutral Safety Switch, Check
 Wiper and Washer Operation, Check
 Horn, Check
 Air Conditioning System Operation, Check
 Heater Operation, Check
 Refrigerator, Check
 Cab Radio, Check
 Cab Warning Alarm, Check
 Corner Post and Armrest Display, Check
 Active Header Control Displayed on Corner Post, Check
 Auxiliary Power Strip, Check
 Panels, Gull Wings, Gull Wing Cylinders and Safety Shields, Check
 Safety Decals and Signs, Check
 Ladder Safety Chains, Check
 Road Disconnect Switch, Check
 Rotary Beacon, Field, Transport, and Warning Lights, Check
 copy of Operator Seat Presence Switch, Check
 Fire Extinguisher, Check
 Operators Manual, Check
 Camera System, Check
 Toolbox, Check
 Static Drag Chain/Cable, Check
 Remote Front Cross Line, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE


Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 61 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Remote Front Grease Lines, Check
 Air Conditioning Drain Hoses, Check
 Feed Accelerator Gear Case Oil, Check [Need change oil]
 Fuel Precleaner Filter, Check
 Engine Air Filters, Check
 Engine Oil and Filter, Check
 Diesel Exhaust Fluid (DEF) System
 Fuel Filters, Check
 Fuel Tank Breathers, Check
 Suction Screen, Check
 Hydrostatic and Hydraulic Filters, Check
 Final Drives Oil Level, Check
 Transmission Filters (ProDrive XL), Check
 Main Engine Gear Case Oil, Check
 Cab Fresh Air Filter, Check
 Cab Recirculation Filter, Check
 Grain Tank Loading Auger Gear Case Oil, Check
 Wiper Fluid Level, Check & Top Up [Need add fluid]
 F

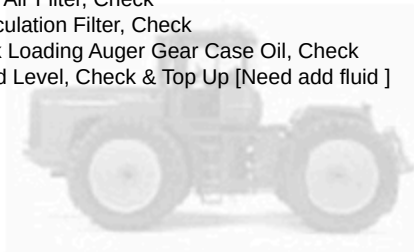

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 62 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

inal Running, Check
 Safety Shields, Install
 Water from Air Compressor Reservoir, Drain
 Additional Jobs Required
 ValueMax Job Task
 Serial Number, Check
 Safety Shields, Remove
 Initial Running, Check
 Engine Hours, Check
 Separator Hours, Check
 Machine Frame, Check
 Stored Diagnostic Trouble Codes, Check
 Active Diagnostic Trouble Codes, Check
 Software Update, Check
 MTG/Remote Connection to Service Advisor, Check
 PIP's Available
 Fluid Scan Test, Perform
 Engine RPM, Check
 Multi-Function Control Lever, Check
 Back-Up Alarm, Check
 Transmission Speed Ranges, Check
 AutoTrac System, Check
 Park Brake, Check
 Feeder House Raise-Lower, Fore-Aft, and Lateral Tilt, Check
 Feeder House Safety Lock Functionality, Check
 Feeder House Dust Fan Functionality, Check
 Header Hydraulic Function, Check
 Grain Tank Cover Folding Functionality, Check
 Unloading Auger and Boot Swing Functionality, Check
 Unloading Auger Engage, Check
 Separator Engage Switch, Check
 Header Engage Switch, Check
 Header Reverser Engage Switch, Check
 Multi-Function Control Lever Quick Stop, Check
 Threshing Clearance Adjustment, Check [Need adjustment Concaves and need check position sensor]
 Rotor Speed Adjustment, Check
 Cleaning Fan Speed Adjustment, Check
 Chaffer and Sieve Setting Adjustment, Check [Chaffer and sieve position need adjustment]
 Residue Functionality, Check
 Chopper Speed Adjustment Function, Check
 Chonner Hinh and Low Operation, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE


Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	63 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Chopper High and Low Operation, Check
 Knife Bank Actuation Functionality, Check
 Feeder House Frame, Check
 Feeder House Position Sensor and Wiring Harness, Check
 Feeder House Drive Chain, Slip Clutch, Sprockets, Bearings, and Guide Rails, Check [Need replace chain and two guides]
 Feeder House Conveyor Chain and Eyebolts, Check [Need replace conveyor chain, if not replace chain and need remove half link (4) and replace two slats and need to alignment]
 Feeder House Conveyor Chain Slats, and Plastic Chain Guides, Check [Need replace two conveyor chain slats. Need replace four plastic guides]
 Lateral Tilt Frame Seal, Check
 Feeder House Dust Fan, Motor, Hoses, and Harnesses, Check
 Lateral Tilt Cylinders, Check
 Lateral Tilt Frame, Hoses, Sensor, and Wiring Harness, Check
 Feeder House Top Door and Seal, Check
 Feeder House Top Shaft Bearings, Sprockets, Plastic Wear Strips, Check [Need replace conveyor chain wear strips (all). Recommend replace sprockets (Sprockets maybe working one year)]
 Feeder House Backshaft Speed Sensor, Tone Wheel, and Wiring Harness, Check
 Feeder House Backshaft and Bearing, Check [Need replace bearing]
 Feeder House Front Drum and Bearings, Check
 Feeder House Pivoting Mid-floor and Mid-Floor Stop Blocks, Check
 Feeder House Feed Plate, Check
 Stone Trap, Check
 Feeder House Floor Sheet and Seal, Check
 Fore-Aft Tilt Cylinders, Check
 Fore-Aft Tilt Frame, Hoses, Sensor and Wiring Harness, Check
 Rotor Plastic Dust Shroud, Check
 Separator Feed Floor and Ramp, Check
 Rotor Bearings, Check
 Rotor Front Feed Flights, Check
 Feeder House Lift Cylinder Support, Pins, and Pivots, Check
 Feeder House Smart Lock, Check
 Feeder House Valve Block, Check
 Front-End Gear Case, Hoses, Fittings, Mounting Hardware, and Drive Shaft Bearing, Check
 Feeder House Reversing Motor, Hoses, Fittings and Mounting Hardware, Check
 Multi-Coupler Hydraulic Hoses, Harness, and Connections, Check
 Header Locking Pins and Latching Mechanisms, Check
 Feeder House Driven Belt, Belt Tensioners, Pulleys, and Bearings, Check [Need replace bearing]
 Feeder House Drive Belt and Tensioners, Check [Need replace bearing in tension pulley]
 Main Hydraulic Outer Pump Stack, Check
 Feeder House Pivots, Retainer and Bushing, Check
 Feeder House Pivot Hoses, Hose Mounting Hardware, and Wiring Harness, Check
 Feed Accelerator Speed Sensor and Wiring Harness, Check
 Feed Accelerator Supports, Wings, Wear Strips, and Flow Divider, Check

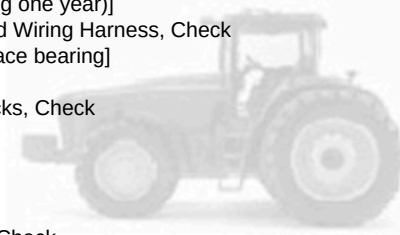

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE


Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	64 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Feed Accelerator Supports, wings, wear strips, and Flow Divider, Check
 Feed Accelerator Shaft and Bearings, Check [Need check pulley (maybe fixed bolt)]
 Feed Accelerator Drive Belt, Tensioner, and Idler, Check [Need replace bearing in tensioner pulley]
 Transmission Speed Ranges, Check
 Tracks or Tires, Check
 Front Drive Shaft Splines and Collars, Check
 Transmission Leaks, Lines, and Hoses (ProDrive XL), Check
 Front Hydrostatic Motors, Check
 Front Final Drive, Check
 Front-End Hydraulic Manifold, Check
 ACI Valve Block, Check
 Unloading Auger Drive Belt, Pulleys, Tensioner, Guide, and Shear Bolt, Check [Need replace bearings in both pulley and replace bushings in tension.
 Need replace belt.]
 Cross Auger Clutch Belt, Idler Pulley, Pulley, Check
 Grain Tank Cross Auger Bearings, Check
 Cross Auger Engage Cylinder, Check
 Cross Auger Speed Sensor and Harness, Check
 Vertical Unloading Auger Gearcase, Check [Need check and fixed gear case pulley]
 Vertical Unloading Auger and Housing, Check
 Unloading Auger Sump Clean Out, Check
 Threshing and Separating Covers, Check
 Cleaning Fan Housings and Fan Blades, Check
 Cleaning Fan Shaft, and Bearings, Check
 Cleaning Fan Driven Belt, Pulley, Idler and Bearing, Check
 Cleaning Fan Drive Sheaves, Belt, Linkage, Bearing and Hardware, Check
 Cleaning Fan Variable Drive Hydraulic Hose, Check
 Left Side Front Shake Pan, Chaffer, and Louver Spacing Mechanical Adjustment, Check
 Threshing and Separating Plastic Covers Left Side, Check
 Left Side Concave Position Sensor and Wiring Harness, Check
 Left Side Concave, Check [Need replace first set concave,
 Second set- one replace and one repair
 Third set-one replace and one repair
 (If need I show you what needs orders)]
 Left Side Concave Hangers and Hardware, Check
 Left Side Concave Fillers, Check
 Left Side Concave Z-Bar, Check
 Left Side Concave Isolation Hoses and Fittings, Check
 Left Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
 Front End Variable Driven Assembly and Belt, Check
 Front End Drive Assembly, Pulleys, and Belt, Check
 Left Side Separator Grates, Check
 Left Side Separator Loss Sensors, Check

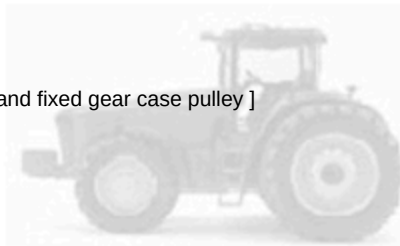

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	65 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Left Side Separator Loss Sensors, Check
 Left Side Threshing Elements, Check
 Left Side Separator Tines, Check [Need replace all sets]
 Left Side Rotor Rear Discharge Flights, Check
 Left Side Pitman Arms, Swing Arms, and Bearings, Check
 Left Side Shake Pan Frame, Swing Arms and Bushings, Check
 Clean Grain Auger Bearing, Speed Sensor, and Wiring Harness, Check
 Tailings Elevator Housing, Check
 Tailings Monitor Sensor and Wiring Harness, Check
 Tailings Auger, Auger Trough, and Lower Bearings, Check
 Tailings Elevator Conveyor Chain and Sprockets, Check
 Tailings Elevator Slip Clutch, Check
 Upper Tailings Return Auger Bearings, Check
 Upper Tailings Return Auger Flighting, Check
 Upper Tailings Delivery Auger Housing, Check
 Cleaning Shoe Driveshaft, Bearings, and Pitman Arm Cam, Check
 Active Tailings Camera, Check
 Active Tailings Wear Strips and Threshing Bars, Check
 Active Tailings Concave Adjustment, Check
 Active Tailings Drive Belt, Tensioner, and Pulley, Check
 Service Lights, Check [Need fixed harness]
 Rotor Variable Sheaves and Belt, Check
 Rotor Driven Assembly and Hoses, Check
 Rotor Drive Assembly, Hoses, Front End Drive Tensioner and Bearing, Check
 Chaffer and Sieve Element Electrical Adjust, Check
 Chopper Raise and Lower Actuator, Check
 Discharge Beater Belt, Pulleys, Tensioner, and Idlers, Check
 Left Side Discharge Beater Bearing, Check
 Rotor Grain Loss Sensor and Wiring Harness, Check [Not working second and third grain loss sensors]
 Unloading Auger Driveshaft Bearings, Sensor and Pulley, Check
 HADE, POD Controllers and Harnesses, Check
 Chopper Belt, Tensioner, and Idlers, Check
 Chopper Drive Pulleys, Check
 Chopper Gearcase, Oil Level, and Lube Line, Check [Need replace oil]
 Chaffer and Sieve, Check
 Tailboard, Check
 Return Pan, Check
 Rear Deflector, Check
 Discharge Beater Grate and Vanes, Check
 Discharge Beater Wear Strips, Check
 Chopper Inlet Seals, Check
 Straw Chopper Drive Belt Tensioner and Idler Pulley, Check
 Straw Chopper Drive Belt, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 66 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Straw Chopper Drive Belt, Check
 Chopper Housing and Bearings, Check
 C



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	67 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

hopper Stationary Knife, Actuator, and Wiring Harness, Check [Knife bank- need flip over and need replace Center knife]
 Chopper Blades, Check [Need replace kni]
 Tailboard Center Shroud, Check
 Tailboard Spreader Gearcases, Driveshafts, and Debris Flaps, Check
 Spreader Speed Sensor and Harness, Check
 Shroud Actuator and Harness, Check
 Tailboard Shaft Bearings, Check [Need replace bearing]
 Chop-to-Drop Door, Actuator, Linkage, Straw Rakes, and Wind Row Curtains, Check
 Spreader Drive Belt, Idlers, and Pulleys, Check [Driven pulley need clean and painted]
 Right Hand Residue Harness, Check
 Windrow Pivot Actuator and Harness, Check
 Left Hand Rear Wheel and Tire, Check
 Left Hand Steering Cylinder and Hoses, Check
 Left Hand Steering Tie Rod, Check
 Left Hand Axle Spindle and Bushing Assembly, Check
 Tow Hook, Check [Need fixed harness]
 Rear Axle Hardware, Check
 Rear Axle Pivot Bushing, Check
 Four Wheel Drive Motors and Seals, Check
 Right Hand Rear Wheel and Tire, Check
 Right Hand Steering Cylinder and Hoses, Check
 Right Hand Steering Tie Rod, Check
 Right Hand Spindle and Bushing Assembly, Check
 AutoTrac System, Check
 Wheel Angle Sensor and Wiring Harness, Check
 Ether Start Aid, Check
 Vacuum Fan Housing, Check
 AutoTrac Valve, Fittings, and Hoses, Check
 Right Side Discharge Beater Bearing, Check
 Machine Fuse Center, Check
 Batteries, Cables, and Connections, Check
 Tailings Auger Bearing, Speed Sensor and Wiring Harness, Check
 Shoe Drive Belt, Idler, Tensioner, and Bearings, Check
 Pitman Arm Cams, Shoe Drive Shaft, and Drive Shaft Pulley, Check
 Right Side Separator Loss Sensors, Check
 Clean Grain Elevator Drive Belt, Idlers, and Tensioner, Check
 Right Side Pitman Arms, Swing Arms, and Bearings, Check
 Clean Grain Elevator Housing and Boot, Check [Need welding boot in said (need ask Serhii)]
 Clean Grain Auger, Auger Trough, and Lower Bearings, Check [Need replace auger and bearings both side]
 Clean Grain Elevator Chain and Sprockets, Check
 Moisture Sensor and Active Clean Grain Camera Check



PATTISON AGRICULTURE LIMITED
610 3rd Avenue West, Box 1670
Shaunavon, SK S0N 2M0
Phone: (306) 297-2639
Fax: (306) 297-3827
Http://www.pattisonag.com
GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	68 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Moisture Sensor, and Active Grain Grain Camera, Check
Threshing and Separating Covers, Check
Threshing and Separating Top Covers, Check
Right Side Separator Grates, Check
Right Side Concave Z-Bar, Check
Right Side Concave Hangers and Hardware, Check
Right Side Concave Isolation Hydraulic Cylinders, Boots, and Pins, Check
Right Side Concave Isolation Hoses and Fittings, Check
Right Side Concave, Check [First set concave need replace all.
Second set- one replace, second need repair
Third set need replace all]
Right Side Concave Fillers, Check
Right Side Separator Tines, Check
Right Side Threshing Elements, Check
Right Side Rotor Rear Discharge Flights, Check
Right Side Concave Position Sensor and Wiring Harness, Check
Cleaning Fan Shaft Bearings, Lock Collars, and Speed Sensor, Check
Right Side Shake Pan Frame, Swing Arms and Bushings, Check
Heater Hoses, Check
Grain Tank Cross Auger Driven Belt, Pulley, and Tensioning Idler, Check
Right Side Grain Tank Cross Auger Bearings, Check
Loading Auger Drive Belt, Pulleys, and Tensioning Idler, Check [Need replace bearing in tension pulley]
IPM Controller and Harness, Check
Cab Wall Electrical Connectors, Check
Air Compressor Tank Drain, Check
Feed Accelerator Gear Case and Drives, Check
Right Hand Grain Tank Drain Covers, Check
Engine RPM, Check
Back-Up Alarm, Check
Engine Deck Access Ladder and Light, Check [Need adjustment locker]
Rotary Screen / Vacuum Fan Drive Belt and Tensioner, Check [Need replace tensioner and idler]
Rotary Screen Driveshaft Belt and Bearings, Check [Need replace bearings and shaft]
Rotary Screen, Check
Fuel, Oil Cooler, A/C Condenser & Fins, Check
Cooling Package Door Seal, Check
Radiator Hoses, Lines, and Surge Tank, Check
Engine Coolant Level, Check
Water Pump, Check
Thermostats, Check
Diesel Exhaust Fluid Tank, Check
Fuel Tank, Cap, Sensor and Lines, Check [Need replace cap]
Hydraulic Reservoir, Check [Need fixed hose]
ECU Connections and Seals, Check



PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 69 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

LEO Connections and Seals, Check
 Main Engine Gear Case and Valve, Check
 Main Engine Gear Case Hydraulic Hoses, Check
 Main Hydraulic Inner Pump Stack, Check
 Hydraulic Valve Stack and Accumulator, Check
 Exhaust and DPF Exhaust System, Check
 Engine Fan Blades, Drive Belt, Shroud, Banjo Bolt, and Pitch Sensor, Check
 Engine Front Seals and Crankshaft Damper, Check
 Air Conditioning Compressor and Alternator Drive Belt, Check
 Air Compressor Pump and Drive Belt, Check
 Accessory Drive Mounting Hardware, Check
 Engine Rear Seals, Check
 Rotor Speed Sensor and Wiring Harness, Check
 Rocker Arm Cover, Check
 Exhaust Manifold, Check
 Turbocharger, Check
 Aftertreatment Harness Module and Sensor, Check
 EGR Valve and Actuator, Check
 Open Crankcase Vent (OCV) System, Check
 Rotor Gear Case, Check
 Rotor Driveshaft and U-Joints, Check
 Grain Tank Cover Cylinders, Hoses, Fittings, and Pins, Check
 Grain Tank Frame, Covers, Extensions, Linkage and Corner Flaps, Check
 Grain Tank Front and Rear Flip Ups, Linkages, and Rock Shaft Bushings, Check
 Grain Tank Level Switches and Wiring Harness, Check
 Grain Tank Loading Auger, Housing, Gear Cases, Bearing, Brackets and Oil, Check [Need replace grain tank unloading auger and bearing]
 Grain Tank Loading Auger Actuator and Harness, Check
 Clean Grain Elevator Mass Flow Sensor Impact Plate, Check
 Grain Sample Trough, Check
 Grain Tank Cross Augers, Troughs, and Covers, Check
 Active Yield Sensors and Wiring Harnesses, Check
 Grain Tank Window, Check
 Grain Tank Camera and Light, Check
 Unloading Auger Swing Cylinder, Fittings, Hoses and Pins, Check
 Unloading Auger Latching Mechanism and Pin, Check
 Primary Valve Block, Check
 Folding Auger Drive Cog, Check
 Unloading Auger Swing Bushing, and Pivot Point, Check
 Unloading Auger Cradle, Pins and Hardware, Check
 Unloading Horizontal Auger and Tube, Check
 Unloading Auger Inspection Doors, Auger Flighting, and Auger Bearings, Check
 Unloading Auger Folding Mechanism, Harness, Castings, and Pin, Check

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK	(306) 773-9351	Yorkton, SK	(306) 783-9459
Maple Creek, SK	(306) 662-2233	Balcarres, SK	(306) 334-2492
Kindersley, SK	(306) 463-2683	Moosomin, SK	(306) 435-3301
Kyle, SK	(306) 375-2302	Preeceville, SK	(306) 547-2007
Leader, SK	(306) 628-3889	Russell, MB	(204) 773-2149
Unity, SK	(306) 228-2696	Wynyard, SK	(306) 554-2536
North Battleford, SK	(306) 445-4468	Kamsack, SK	(306) 542-2814
Humboldt, SK	(306) 682-2572	Swan River, MB	(204) 734-3466
Kelvington, SK	(306) 327-4355		
Shaunavon, SK	(306) 297-2639		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	70 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Unloading Auger Filling Mechanism, Harness, Castings, and Pin, Check

Unloading Auger Lights, Camera, and Harness, Check

Unloading Auger Grain Saver Door and Boot, Check

Unloading Auger Boot Actuator and Harness, Check

Horizontal Auger 90* Gearcase, Check

Cab Ladder, Check

Mirrors, Check

Cab Door Cinch, Check

Windshield and Cab Glass, Check

Cab Roof, Check

GPS Receiver, Check

Gen 4 Command Center Display and Software, Check

AMS Software and Hardware, Check

Seat Operation and Seat Belt, Check

Park Brake, Check

Steering Column, Check

Armrest Functions, Check

Multi-Function Control Lever Neutral Safety Switch, Check

Wiper and Washer Operation, Check

Horn, Check

Air Conditioning System Operation, Check

Heater Operation, Check

Refrigerator, Check

Cab Radio, Check

Cab Warning Alarm, Check

Corner Post and Armrest Display, Check

Active Header Control Displayed on Corner Post, Check

Auxiliary Power Strip, Check

Panels, Gull Wings, Gull Wing Cylinders and Safety Shields, Check

Safety Decals and Signs, Check

Ladder Safety Chains, Check

Road Disconnect Switch, Check

Rotary Beacon, Field, Transport, and Warning Lights, Check

copy of Operator Seat Presence Switch, Check

Fire Extinguisher, Check

Operators Manual, Check

Camera System, Check

Toolbox, Check


Static Drag Chain/Cable, Check

Remote Front Grease Lines, Check

Air Conditioning Drain Hoses, Check

Feed Accelerator Gear Case Oil, Check [Need change oil]

Fuel Preheater Filter, Check

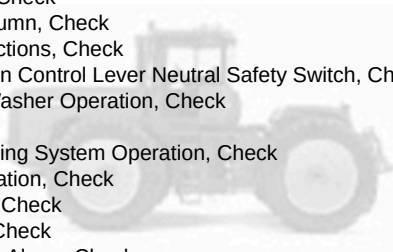

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE


Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 71 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

Fuel Precleaner Filter, Check
 Engine Air Filters, Check
 Engine Oil and Filter, Check
 Diesel Exhaust Fluid (DEF) System
 Fuel Filters, Check
 Fuel Tank Breathers, Check
 Suction Screen, Check
 Hydrostatic and Hydraulic Filters, Check
 Final Drives Oil Level, Check
 Transmission Filters (ProDrive XL), Check
 Main Engine Gear Case Oil, Check
 Cab Fresh Air Filter, Check
 Cab Recirculation Filter, Check
 Grain Tank Loading Auger Gear Case Oil, Check
 Wiper Fluid Level, Check & Top Up [Need add fluid]
 Final Running, Check
 Safety Shields, Install
 Water from Air Compressor Reservoir, Drain

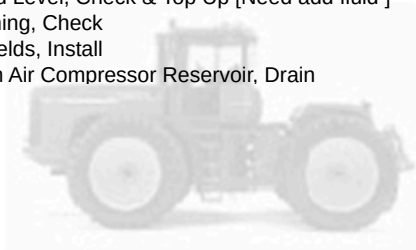

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26859	INSPECTION+ 3 FLUID TEST KIT	1.00	85.83	0.00	\$0.00	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
---------------	-------------	----------	------------	-----------	----------------	-----------

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 72 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000122469 Internal

DISI	LAB DISC INTERN	-1.00	1,290.00	1,290.00	(\$1,290.00)	N
------	-----------------	-------	----------	----------	--------------	---

Labor: \$5,150.00	Parts: \$0.00	OL&M: \$0.00	Misc: (\$1,290.00)	Sub-Total: \$3,860.00
--------------------------	----------------------	-------------------------	---------------------------	------------------------------

EXPERT-1000000241271 Internal

COMPLAINT:

11 X9 Used Combine, Wash and Prepare for Display.

CORRECTION:

1. Blow off all chaff off of the combine.
2. Wash out radiator and all coolers.
3. Clean out grain tank and unloading auger.
4. Wash exterior panels and all shields.
5. Vacuum cab and wash floor mat.
6. Clean windows.

Saturday, June 21, 2025 2:49 PM - rinsed off unit from top to bottom, had a few built up areas in the engine compartment, once i cleaned all that out i washed all the pulleys and surfaces on the left and right side of the combine, sprayed out feederhouse and serperator. had to locate all the shields, once i found them i washed them and installed with WH, gave everything a quick rinse again and gave the cab a quick clean, it was quite clean to begin with. Ran unit up to make sure the fan worked all good, backed it to just outside the washbay. cleaned wash bay after. DP

Labor: \$2,070.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,070.00
--------------------------	----------------------	-------------------------	---------------------	------------------------------

EXPERT-1000000163000 Internal

COMPLAINT:

12 ValueMax Cab Clean.

CORRECTION:

Friday, April 4, 2025 10:55 AM - wiped all surfaces and seats, removed cup holders and cleaned. cleaned interior windows and screens. swept and scrubbed floor mat and put down plastic to avoid getting dirty again. dp cab dane wash.

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number:	3400681
		Invoice Date:	6/24/2025
		Location:	10
		Work Order Number:	479721
		Payment Type:	Account
Bus Phone:	Bus Phone:		
Prv Phone:	Prv Phone:	Page:	73 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000163000 Internal

Labor: \$451.84	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$451.84
------------------------	----------------------	-------------------------	---------------------	----------------------------

EXPERT-1000000211907 Internal

COMPLAINT:

56 Engine Cooling Fan, Remove and Replace

CORRECTION:

Remove cap screws and shield.

Remove cap screws and nuts and fan shroud.

Disconnect and cap hydraulic hose.

Disconnect electrical connector and remove solenoid.

Remove tie bands.

Attach an appropriate lifting device to the fan and remove cap screws and fan.

Install in reverse order of removal following these special instructions:

- To aid in fan installation, thread two M8 studs into the fan assembly for easier alignment to the fan hub.

- Torque fan hub cap screws to specification.

Friday, June 20, 2025 10:30 PM - removed old broken fan and blade shards, installed new fan and torqued fan bolts to 15 FT/LBS, re installed all sheilds just needs run up. KB

6/23/2025- LS Ran up- good to go

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
--------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------

CONTINUED ON NEXT PAGE->

PATTISON AGRICULTURE LIMITED
 610 3rd Avenue West, Box 1670
 Shaunavon, SK S0N 2M0
 Phone: (306) 297-2639
 Fax: (306) 297-3827
 Http://www.pattisonag.com
 GST Number 818708372

Swift Current, SK (306) 773-9351	Yorkton, SK (306) 783-9459
Maple Creek, SK (306) 662-2233	Balcarres, SK (306) 334-2492
Kindersley, SK (306) 463-2683	Moosomin, SK (306) 435-3301
Kyle, SK (306) 375-2302	Preeceville, SK (306) 547-2007
Leader, SK (306) 628-3889	Russell, MB (204) 773-2149
Unity, SK (306) 228-2696	Wynyard, SK (306) 554-2536
North Battleford, SK (306) 445-4468	Kamsack, SK (306) 542-2814
Humboldt, SK (306) 682-2572	Swan River, MB (204) 734-3466
Kelvington, SK (306) 327-4355	
Shaunavon, SK (306) 297-2639	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No:

Deliver To:

Internal Used Stock No. 256545	Internal Used Stock No. 256545	Invoice Number: 3400681
		Invoice Date: 6/24/2025
		Location: 10
		Work Order Number: 479721
		Payment Type: Account
Bus Phone:	Bus Phone:	
Prv Phone:	Prv Phone:	Page: 74 of 74

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE X9 1000	793	1H0X910XCP0825255	175890	

EXPERT-1000000211907 Internal

AXE100375	Fan Kit	1.00	6,163.90	6,163.90	\$6,163.90	N
-----------	---------	------	----------	----------	------------	---

Comments: tech started engine with racoon in fan after sitting on lot for months

Labor: \$1,120.00	Parts: \$6,163.90	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$7,283.90
--------------------------	--------------------------	-------------------------	---------------------	------------------------------

INVOICE CONTAINS \$85.83 DISCOUNT

Miscellaneous Charges:

SERVICE ACCESSORIES	\$150.00
---------------------	----------

Customer PO No:

Tax Exempt No:

Advisor: Joanne Thronberg

Labor: \$8,791.84

Parts: \$6,163.90

OL&M: \$0.00

Misc: (\$1,140.00)

Grand Total: \$13,815.74

*** DOCUMENT COPY ***

ALL QUOTES ISSUED ARE VALID FOR 7 DAY FROM ISSUE -- MIN \$35 ON EMERGENCY/UNIT DOWN ORDERS -- 25% RESTOCKING FOR RET

TERMS AND CONDITIONS

I hereby authorize the above repair work be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery. I agree to pay cash for such repair parts and labour on delivery of machine(s) or on terms satisfactory to you, and until paid in full, any such unpaid balance shall constitute a lien on this machinery. I further agree that you will not be held responsible for loss or damage to said machinery from fire, theft or other causes beyond your control

Received by: Date: