




Annual Inspection Certificate
&
Safety Standards Certificate

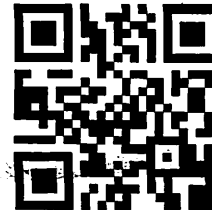

VEHICLE INFORMATION

Plate#:	V3468J	Year:	2022
VIN:	1UYVS2537N7445723	Make:	UTILITY TRAILER.
GVWR (kg):	29500	Model:	TRAILER
Odometer ():		Type:	Trailer

CERTIFICATE INFORMATION

Annual Inspection Certificate	Expires at the end of: Jul 2026
Safety Standards Certificate	Expires at the end of: September 5, 2025
Vehicle Inspection Certificate Number	DG30AF85
Inspection Start Date	Jul 31, 2025 System Time: 10 : 25
Inspection End Date	Jul 31, 2025 System Time: 12 : 21

VEHICLE INSPECTION CENTRE

Vehicle Inspection Centre #: 11378	Technician: GURJOT GREWAL
FLEET CARE INC.	
O/A FLEET CARE INC.	
273 GLIDDEN RD #1, BRAMPTON, ON	
BRAMPTON, ON L6W1H9	Technician ID: 218299
647-308-0037	STO ID/Account: 20006374
	Trade Code: 310T


I certify that I inspected this vehicle on the inspection date in accordance with the inspection procedures established by directive under s. 100.7 of the Highway Traffic Act and that the vehicle meets the required equipment and performance standards as detailed in the Vehicle Inspection Report with the above referenced Vehicle Inspection Certificate Number.

This Certificate is not a warranty on the condition of the vehicle.

Vehicle Inspection Questions?

Call the Public Contact Centre 1-833-420-2103 or go to

<https://www.ontario.ca/page/driveon-emissions-and-safety-inspection-program>.

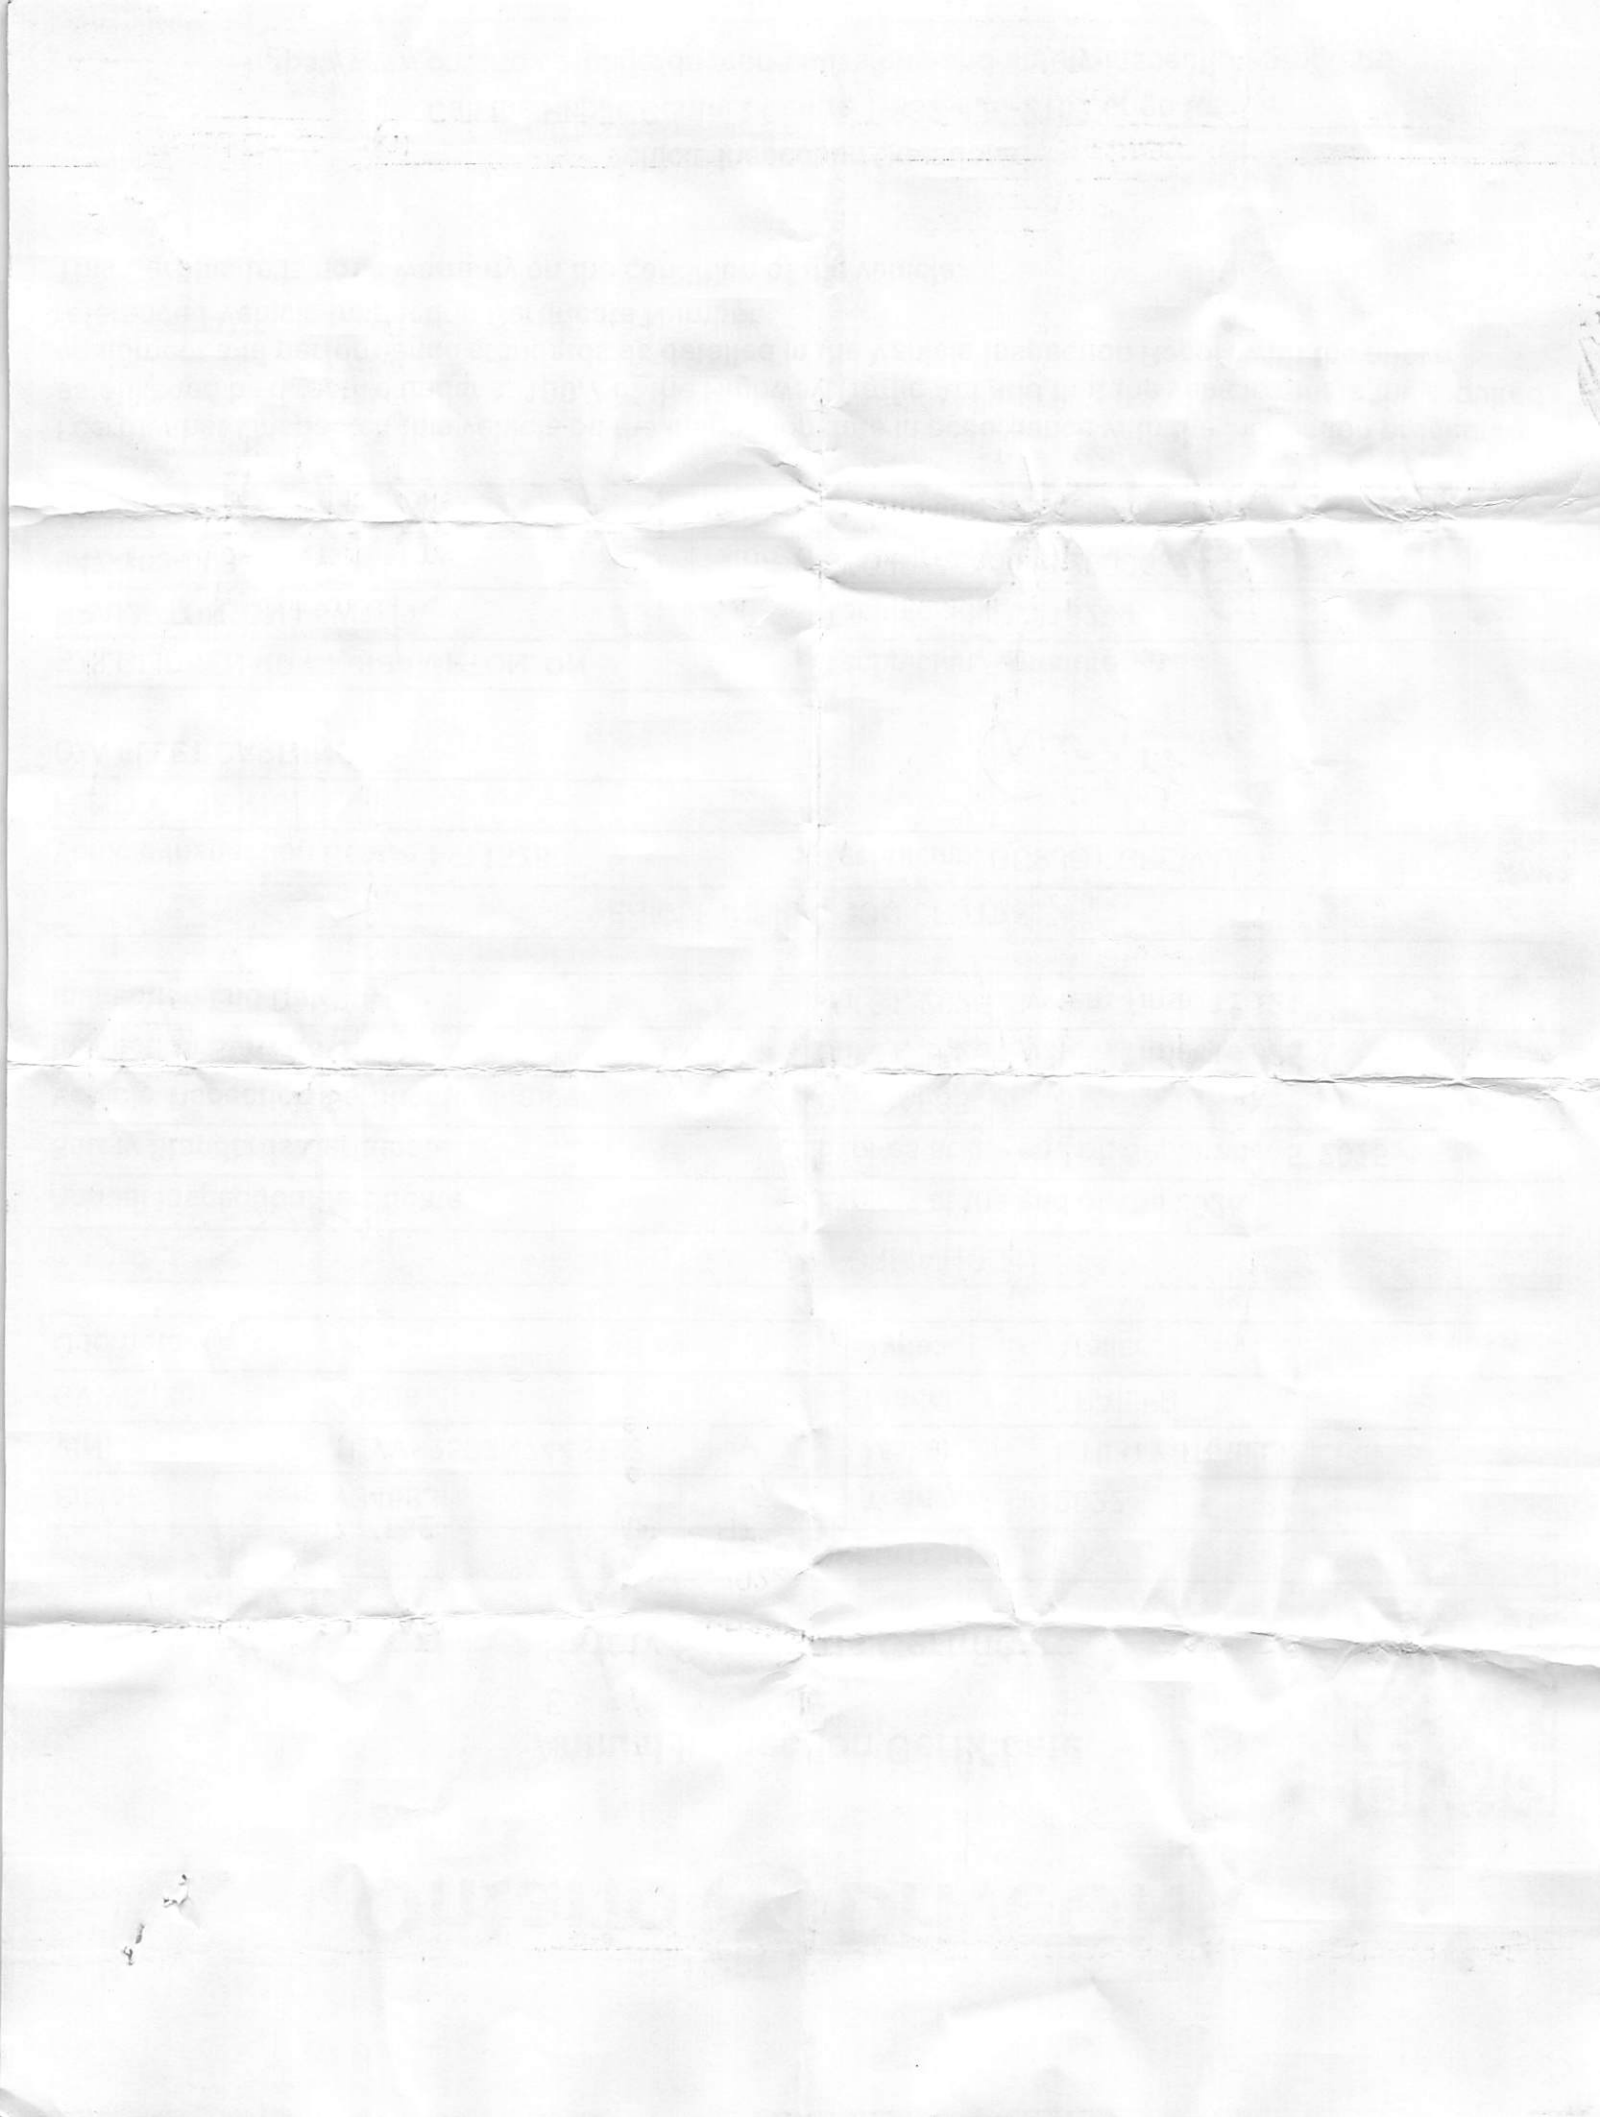

MINISTRY OF TRANSPORTATION
SAFETY INSPECTION REPORT



Vehicle Inspection Certificate Number: DG30AF85

Start Date / Time: Jul 31, 2025, 10:25 AM

End Date / Time: Jul 31, 2025, 12:21 PM

VEHICLE/ENGINE INFORMATION

CHASSIS

Plate#: V3468J

Year: 2022

VIN: 1UYVS2537N7445723

Make: UTILITY TRAILER

GVWR(kg): 29500

Model: TRAILER

Odometer:

Fleet ID: 11378

SAFETY INSPECTION RESULT

PASS

SAFETY SYSTEM INSPECTION RESULTS

All Safety System Components Passed Inspection

MANDATORY ITEMS

Inspection Item	Result
Axle 1, Driver Side, Inner Tire	
Tire Tread Depth (mm)	12
Initial Tire Pressure (kPa)	725
Axle 1, Driver Side, Outer Tire	
Tire Tread Depth (mm)	12
Initial Tire Pressure (kPa)	725
Drum Brakes	
Bonded/riveted continuous strip	
Shoe Lining Thickness (mm)	13
Drum Inside Diameter (mm)	418.06
Within OEM specifications?	Yes
S-Cam Drum Brakes	
Chamber Type (size)	30
Brake Stroke (mm)	32

Inspection Item	Result
Axle 1, Passenger Side, Inner Tire	
Tire Tread Depth (mm)	7
Initial Tire Pressure (kPa)	725
Axle 1, Passenger Side, Outer Tire	
Tire Tread Depth (mm)	12
Initial Tire Pressure (kPa)	725
Drum Brakes	
Bonded/riveted continuous strip	
Shoe Lining Thickness (mm)	13
Drum Inside Diameter (mm)	418.14
Within OEM specifications?	Yes
S-Cam Drum Brakes	
Chamber Type (size)	30
Brake Stroke (mm)	32

Inspection Item	Result
Axle 2, Driver Side, Inner Tire	
Tire Tread Depth (mm)	10
Initial Tire Pressure (kPa)	725
Axle 2, Driver Side, Outer Tire	

Inspection Item	Result
Axle 2, Passenger Side, Inner Tire	
Tire Tread Depth (mm)	10
Initial Tire Pressure (kPa)	725
Axle 2, Passenger Side, Outer Tire	

Drum Brakes		Drum Brakes	
Bonded/riveted continuous strip		Bonded/riveted continuous strip	
Shoe Lining Thickness (mm)	13	Shoe Lining Thickness (mm)	13
Drum Inside Diameter (mm)	418.14	Drum Inside Diameter (mm)	418.24
Within OEM specifications?	Yes	Within OEM specifications?	Yes
S-Cam Drum Brakes		S-Cam Drum Brakes	
Chamber Type (size)	30	Chamber Type (size)	30
Brake Stroke (mm)	32	Brake Stroke (mm)	32

Vehicle Inspection Centre #: 11378
FLEET CARE INC.
273 GLIDDEN RD #1, BRAMPTON, ON
BRAMPTON, ON L6W1H9
647-308-0037
Software Version: 2024.08.21.1

Technician #: 218299
Name: GURJOT GREWAL
Report Number: 438
Tablet ID: 804
STO ID/Account: 20006374
Trade Code: 310T

Vehicle Inspection Questions? Call the Public Contact Centre 1-833-420-2103 or go to
<https://www.ontario.ca/page/driveon-emissions-and-safety-inspection-program>