



Vehicle Standards and Inspection

Semi-Trailer Inspection Certificate

This Certificate is issued under the authority of the Province of Saskatchewan

SOS-21

Decal # A241861

Station #: 71821

Station Name: Lonestar Auto Repair & Towing

Technician #: 88286

Technician Name: Leonard Lanegraff

Signing Officer #: 87961

Signing Officer Name: Cody Hobelsberger

Customer Details:

Name: J Alexander Trucking

Address: Box 475, Unity, Saskatchewan, S0K 4L0

Inspection Completed Date: 07Aug2025

Inspection Expiry Date: 31Aug2026

Vehicle Details:

VIN: 2MFB2S4DXNR009694

Hubometer Reading:

Year: 2022

Vehicle Make/Model: MIDLAND TRAILER/TRAILER


Plate: 762 MFG

Jurisdiction: Saskatchewan

Unit:

Message(s): VIN has been validated.

This certificate does not warranty or guarantee the condition of this vehicle's components and systems for any period of time.

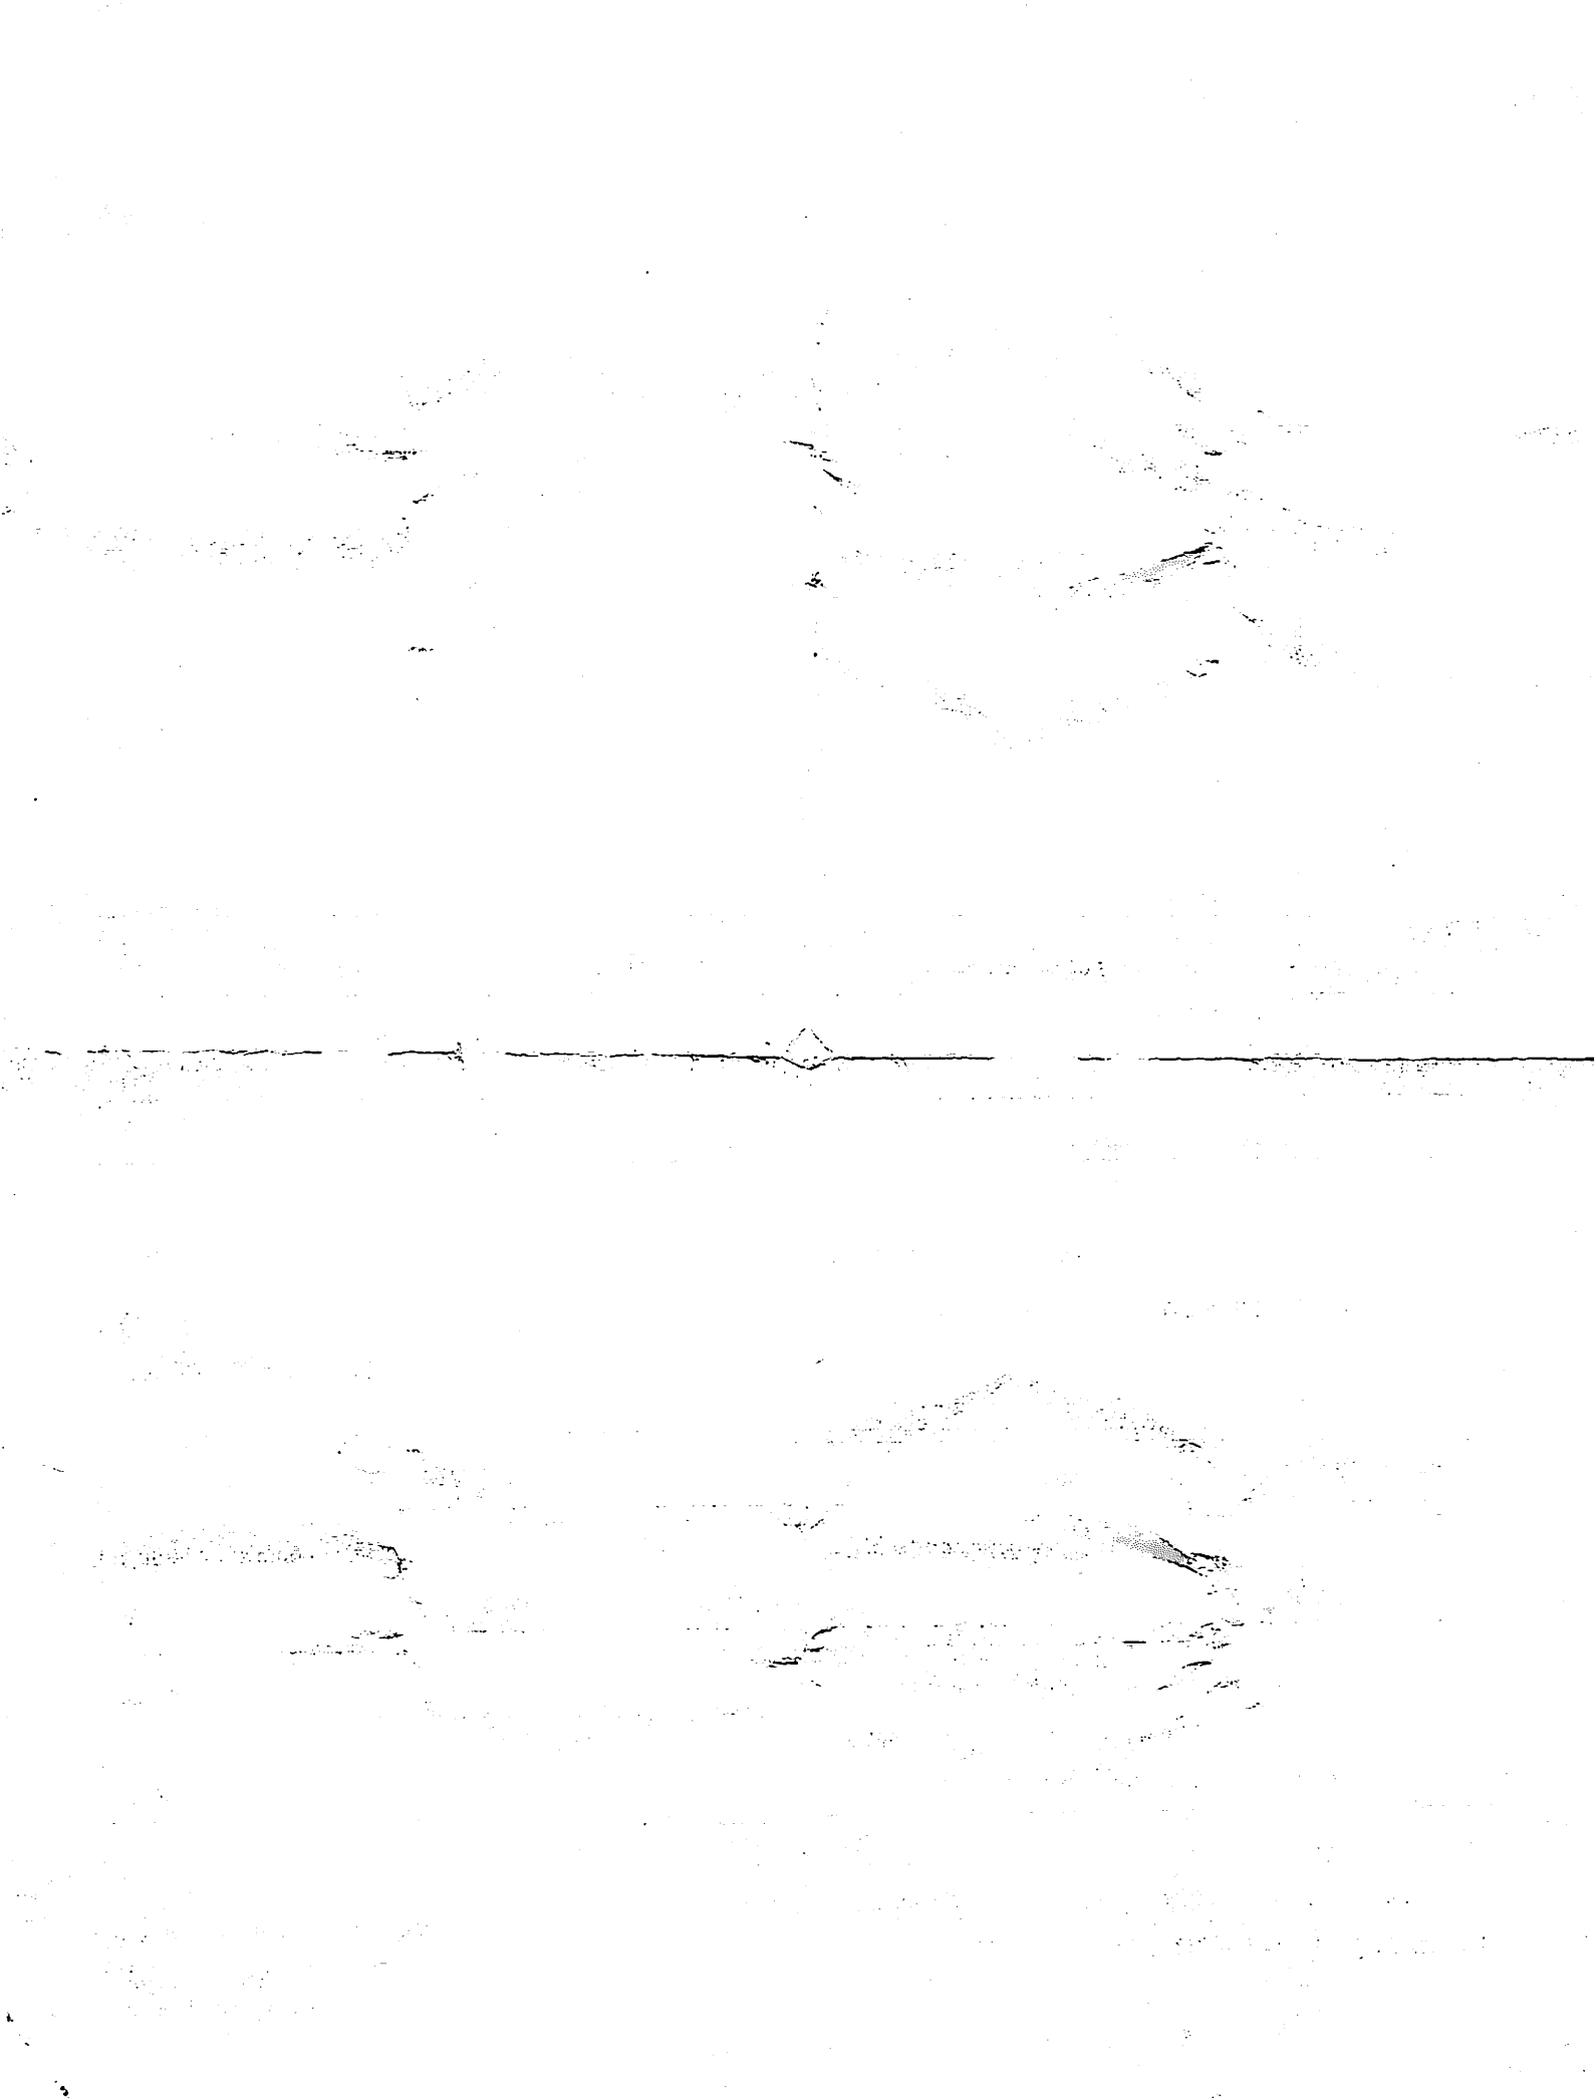



Vehicle Standards and Inspection

Semi-Trailer Record of Inspection

The Record of Inspection must be given to the customer regardless of whether the vehicle passes or fails.

Station #: 71821	Station Name: Lonestar Auto Repair & Towing
Technician #: 88286	Technician Name: Leonard Lanegraff
Signing Officer #: 87961	Signing Officer Name: Cody Hobelsberger

Customer Details:	
Name: J Alexander Trucking	Address: Box 475, Unity, Saskatchewan, S0K 4L0

Vehicle Details:	
VIN: 2MFB2S4DXNR009694	Hubometer Reading:
Year: 2022	Vehicle Make/Model: MIDLAND TRAILER TRAILER

Inspection Details:

Pass	Rejected	Corrected	Req Attn	DRIVERS COMPARTMENT	Comments
x				Vehicle Identification (5)	
x				Fire Extinguisher (5)	
x				Auxiliary Controls/Equip (5)	

Pass	Rejected	Corrected	Req Attn	BODY EXTERIOR	Comments
x				Lamps (6)	
x				Reflex Reflectors (6)	
x				Retro Reflective Markings (6)	
x				Trailer Hitch (10)	
x				Attached Equipment (8)	
x				Cargo Bodies/Vessels (8)	
x				Mud Flaps/Fenders (8)	
x				Landing Gear (8)	
x				Rear Impact Guard (8)	
x				Trailer Power Cord (7)	

Pass	Rejected	Corrected	Req Attn	ENGINE COMPARTMENT	Comments
x				Fuel System (1)	
x				Battery/Wiring Condition (7)	

Pass	Rejected	Corrected	Req Attn	CHASSIS	Comments
x				Hyd Brake System/Components (3.1)	
		x		Air Brake System/Components (3.2)	#3 AXLE BRAKE SHOES/DRUMS
x				Elec Brake System/Components (3.1)	
x				Wheel Bearings (9)	
x				Tires/Wheels (9)	
x				Self-Steering Axle (2&4)	
x				Frame/Crossmembers/Mounts (8)	
x				Suspension/Axles (2)	
x				Exhaust/Emission System (1)	
x				Sliding Axle Assembly (if equipped) (8)	

Brake/Tire Measurements

Axle 1-Pass

Wheel1 : Tire Tread Depth: 8 mm

Brake(1): No Brake

N/A

Wheel2-On : Tire Tread Depth: 6 mm

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 9/16 in • Cam Rotation: 83.0 degrees • Brake Stroke: 1 1/2 in

Wheel3-On : Tire Tread Depth: 6 mm

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 9/16 in • Cam Rotation: 83.0 degrees • Brake Stroke: 1 1/2 in

Wheel4 : Tire Tread Depth: 7 mm

Brake(1): No Brake

N/A

Axle 2-Pass

Wheel1 : Tire Tread Depth: 9 mm

Brake(1): No Brake

N/A

Wheel2-On : Tire Tread Depth: 7 mm

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 3/8 in • Cam Rotation: 123.0 degrees • Brake Stroke: 1 7/16 in

Wheel3-On : Tire Tread Depth: 7 mm

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 3/8 in • Cam Rotation: 123.0 degrees • Brake Stroke: 1 7/16 in

Wheel4 : Tire Tread Depth: 9 mm

Brake(1): No Brake

N/A

Axle 3-Pass

Wheel1 : Tire Tread Depth: 6 mm

Brake(1): No Brake

N/A

Wheel2-On : Tire Tread Depth: 6 mm

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 7/8 in • Cam Rotation: 15 degrees • Brake Stroke: 1 1/2 in

Wheel3-On : Tire Tread Depth: 6 mm

Brake(1): S-CAM Brake

• Min Brake Lining/Pad: 7/8 in • Cam Rotation: 15 degrees • Brake Stroke: 1 1/2 in

Wheel4 : Tire Tread Depth: 6 mm

Brake(1): No Brake

N/A

PASS - vehicle passes inspection

Decal # A241861

Inspection Completed Date: 07Aug2025

