



ROUGH TERRAIN CRANE Annual Report

RTC A 212182-15



CraneSafe®

Div of The Crane Industry Council of Australia
ABN 73 002 565 773

PO Box 136
MOUNT WAVERLEY VIC 3149
Phone: +61 (03) 9501 0078
Email: assessments@cranesafe.com.au

Initial Inspection Date: 12 Mar 2026

Conforms to Checklist: Yes

Issued Date: 17 Mar 2026

Next Inspection Date: 24 Mar 2027

INSPECTED FOR & OWNED BY

Metcalf Crane Services Pty Ltd

ABN 43 076 537 749

PO Box 54 SOMERTON

VIC 3062

REPRESENTATIVE

Mr. Tim Metcalf

03 9308 0044

workshop@metcalfcranes.com.au



Tadano GR-300E-3-00102

MACHINE HOURS

3109

KILOMETERS

35

SERIAL NUMBER

562435

PLANT NUMBER

NOT SUPPLIED

DESIGN REGISTRATION NO.

CR6-189704/15

PLANT REGISTRATION NO.

NOT APPLICABLE

ROAD REGISTRATION

NOT REGISTERED

YOM

2023

MAX LOAD

30000 kg

NUMBER OF AXLES

2

Assessed By

Name John Carroll

Phone 0418 508 870

Company Jatco Engineering VIC Pty Ltd

Reg No. VIC1017

Email info@jatco.com.au

Address PO Box 260 BALLARAT VIC 3353

Assessment

Country Where Assessed	Australia	State	VIC
Operators Manual in English	OK	Log Book	OK
Maintenance Records	OK	Crane Safety Manual	No
Major Inspection Report Sighted	No		

This report is confirmation that the crane has undergone an annual inspection to the appropriate standard and is considered safe for continued operation at time of inspection. This report is confirmation that the crane has undergone a visual inspection on the date(s) stated and meets the standards of the CraneSafe assessment program at the time of inspection. The CraneSafe annual inspection is in addition to and does not replace pre-operation and routine inspections, maintenance and repairs necessary to comply with work, health and safety laws and requirements. In no event shall either CraneSafe or CraneSafe Endorsed Assessors be liable for any direct, indirect, punitive, incidental, special or consequential damages, including but not limited to loss of income, revenue, opportunity, goodwill, profit, anticipated saving or value of equipment arising out of or in any way connected with the use of the services, whether based on contract, tort, strict liability or otherwise, even if advised of the possibility of any such damages. This report is provided solely for the benefit of the Company named on its face. No other person is entitled to rely on anything contained in this Report and must make and rely solely on their own inspection and assessment in all respects and for all purposes.

Accredited for compliance with ISO/IEC 17020

NATA is a signatory to the ILAC Mutual Recognition Arrangement for the mutual recognition of the equivalence of testing, medical testing, calibration and inspection reports

All CraneSafe forms, checklists, surveys, audits and reports together with the embedded methodology contained within are the intellectual property of The Crane Industry Council of Australia and may not be used without The Crane Industry Council of Australia's prior written consent.

© 2009-2026 The Crane Industry Council of Australia

Boom and Attachments

Base Section	OK	Boom Pinning System	OK
No. 1 Section	OK	Proximity Switches	N/A
No. 2 Section	OK	Boom Length Recoil Drum(s)	OK
No. 3 Section	OK	Mechanical Boom Angle Indicator	OK
No. 4 Section	N/A	Fixed Jib	OK
No. 5 Section	N/A	Luffing Jib	N/A
Head Sheaves and bearings	OK	Recoil Drums	OK
Idler Sheave and Bearing	OK	Boom / Attachments / Electrics	OK
Rooster Sheave and Bearing	OK	Extension / Fly Jib	OK
Extension / Fly Jib Mounts	OK	Sheaves and Bearings	OK
Shimming and Alignment	OK	Boom Hazard Striping	OK
Boom Lift Cylinders	OK	Rotating Beacon(s)	OK
Lock Valve(s)	OK	Main Hoist Rope Socket and Pins	OK
Extension Cylinders	OK	Correct Assembly and Connection of Hoist Rope	OK
Lock Valve(s)	OK	Socket	
Extend Ropes / Chains	OK	Auxiliary Hoist Rope Socket and Pins	OK
Retract Ropes / Chains	OK	Correct Assembly and Connection of Auxiliary Hoist	OK
		Rope Socket	
		Anemometer	OK

ANTI-TWO BLOCKS

Boom Head	OK
Rooster Sheave	OK
Extension / Fly	OK

HOOK BLOCKS - WITH CRANE			
Description	Main hook	Hook Shank Retainer	OK
Manufacturer's Identification	OK	Branded WLL (kg)	OK
562435		30000kg	
Branded with Tare Weight (kg)	OK	Sheaves and Bearings	OK
270kg		4	
Swivel	OK	Hook	OK
Safety Latches	OK		

HOOK BLOCKS - WITH CRANE No. 2			
Description	Siingle line hook	Hook Shank Retainer	OK
Manufacturer's Identification	OK	Branded WLL (kg)	OK
562435		4000kg	
Branded with Tare Weight (kg)	OK	Sheaves and Bearings	N/A
100kg		Swivel	OK
Hook	OK	Safety Latches	OK

Revolving Frame and Cabin

Frame	OK	Control Cables / Pilot Hoses	OK
Counterweight Attachment - Security	OK	Heater	OK
Counterweight Hazard Striping	OK	Air Conditioner	OK
Boom Mounting Lugs	OK	Gauges	OK
Boom Mounting Pins	OK	Anti Two-Block Alarms	OK
Lift Cylinder Lugs	OK	Horn	OK
Lift Cylinder Pins	OK	Access Steps	OK
Cab Glass and Mirrors	OK	Doors and Locks	OK
Sheet Metal / Guards	OK	Crane Level Indicator	OK
Seat Assembly including Seat Belt	OK	Outrigger Controls	OK
Throttle	OK	Cab Mounts	OK
Dead Man Controls	OK	Front Wiper	OK
Free Fall Lockout	N/A	Roof Wiper	OK
Decals / Signs - In English	OK	Windscreen Wiper / Washer	OK
Load Charts in English as per AS1418	OK	Switches and Relays	OK
Control Levers - Clearly Marked	OK	Steering Assembly	OK

Slew System

Slew Transmission & Oil Level	OK	Base Weld	OK
No Leaks Present	OK	Smooth Operation	OK
Slew Brake	OK	Rotary Coupling	OK
Lock Valve(s)	OK	Slew Bolts	OK
House Lock	OK	Bearing Play Considered Acceptable	OK
Slew Pinion	OK	Backlash Considered Acceptable	OK
Slew Gear	OK	Electrical Swivel	OK
Slewing Ring	OK		

Main Winch

Winch Condition & Oil Level	OK	Drum Turn Indicator	OK
No Leaks Present	OK	Rope Spooling	OK
Winch Attachment, Pins / Bolts	OK	Main Wire Rope	OK
Brake Caliper and Disc	N/A	Correct Assembly and Connection of Hoist Rope	OK
Friction Pads	OK	Anchor	
Brake Operation	OK	Drum Locking Pawl Mechanism	N/A
		Clutch Linings and Cylinder Protection	N/A

Auxiliary Winch

Winch Condition & Oil Level	OK	Drum Turn Indicator	OK
No Leaks Present	OK	Rope Spooling	OK
Winch Attachment, Pins / Bolts	OK	Auxiliary Wire Rope	OK
Brake Caliper and Disc	N/A	Correct Assembly and Connection of Auxiliary Hoist	OK
Friction Pads	OK	Rope Anchor	
Brake Operation	OK	Drum Locking Pawl Mechanism	N/A
		Clutch Linings and Cylinder Protection	N/A

Hydraulic System

No Hydraulic Leaks Present	OK	Main Winch Motor	OK
Hydraulic Reservoir & Oil Level	OK	Auxiliary Winch Motor	OK
Return Filters and Housing	OK	Winch Control Valve(s)	OK
Hydraulic Lines \ Hoses and Fittings	OK	Auxiliary Winch Valve	OK
Oil Cooler(s)	OK	Boom Lift Valve	OK
Main Pump(s)	OK	Boom Extension Valve	OK
Slew Pump	OK	Pressure Lines and Hoses	OK
Steering Pump	OK	Power Steering Cylinders	OK
Pilot Pump	OK	Vertical Outrigger Cylinders	OK
Relief Valves	OK	Horizontal Outrigger Cylinders	OK
Pressure Filter and Housing	OK	Outrigger Control Valves	OK
Slew Motor(s)	OK	Outrigger Lock Valves	OK
Slew Valve	OK		

Air Systems

Compressor	OK	Brake Chambers	OK
Air Reservoirs	OK	Brake Valves	OK
Drain Valves	OK	Air Cylinders	OK
Air Lines	OK	Air Dryer	OK

Chassis Inspection

Frame	OK	Rear Wheels and Tyres	OK
Suspension System	OK	Outrigger Boxes	OK
Steering Components	OK	Outrigger Beams	OK
Front Axle(s)	OK	Outrigger Pads	OK
Rear Axle(s)	OK	Markings for Alternate Outrigger Widths	OK
Differentials	OK	Outrigger Hazard Striping	OK
Reduction Hubs	OK	Sheet Metal / Guards	OK
Drive Lines	OK	Decals / Signs - In English	OK
Front Brake(s)	OK	Doors and Locks	OK
Rear Brake(s)	OK	Outrigger Controls and Labeling	OK
Parking Brake	OK	Earth Strap	OK
Front Wheels and Tyres	OK	Fire Extinguisher	OK

Electrical Systems

Rotating Beacon(s)	OK	Stop Lights	OK
Battery Box	OK	Directional indicators	OK
Battery Cables	OK	Hazard Lights	OK
Battery Isolator	OK	Clearance Lights	N/A
Starter	OK	Switches and Relays	OK
Head Lights	OK	Back-up Alarm	OK
Tail Lights	OK	Horn for Road Travel	OK

Drive Systems

Radiator & Coolant Level	OK	Engine Oil Pressure & Oil Level	OK
Radiator Hoses	OK	No Abnormal Engine Noises Present	OK
Fan	OK	Fuel Tank & Diesel Level	OK
Fan Guard	OK	Power Shift / Range Shift	OK
Oil Cooler(s)	OK	Drive Coupling	OK
Fuel Lines	OK	Abnormal Transmission Noise	OK
Throttle	OK	No Leaks Present	OK
Engine Mounts	OK	Pump Drives	OK
Power Transmission Belts	OK	Pump Disconnects (PTO)	OK
Muffler / Spark Arrestor	OK	Output Coupling	OK

Rated Capacity Indicator (RCI)			
Load Chart Reference Number	ISO -GR300EX		
Printed Chart - No Load	OK		
		Printed Chart	RCI
		Boom Angle, deg	N/A°
		Boom Length, m	31.00m
		Radius, m	10.00m
		Load, kg	6200kg
RCI Load Charts		75%	
Rated Capacity Limiter (RCL)			
Load Chart Reference Number	ISO GR-300EX		
Rated Load - Boom Fully Extended	OK	RCI	Measured
		Radius, m	13.50m
		Load, kg	4700kg
Rated Load in Stability		OK	
		RCI	Measured
		Radius, m	13.50m
		Load, kg	4700kg
Line Pull Test		OK	
		RCI	Measured
		Load, kg	4000kg
Winch Brake Test		OK	
		RCI	Measured
		Load, kg	4000kg
RCL Warning Lights and Alarms	OK	Rated Capacity Limiter Fitted	OK

Functional Tests - Auxiliary Winch

Load Chart Reference Number	GR -300EX		
Rated Load - Boom Fully Extended	N/A	Rated Load in Stability	N/A
Line Pull Test	OK		
		RCI	Measured
		Load, kg	4000kg4457kg
Winch Brake Test	OK		
		RCI	Measured
		Load, kg	4000kg4457kg
RCL Warning Lights and Alarms	OK	Rated Capacity Limiter Fitted	OK

Function Tests - On Rubber

Load Chart Reference Number	GR-300EX on rubber creep		
Rated Load in Stability	OK		
		RCI	Measured
		Radius, m	6.00m6.00m
		Load, kg	6000kg6000kg
RCL Warning Lights and Alarms	OK	Rated Capacity Limiter Fitted	OK

Crack Inspection

No Cracks Detected	OK
--------------------	----

Any third party testing is not included in the CraneSafe NATA accreditation.

Manufacturer Additional

N/A

Site Requirements

N/A

Crane



Model



Serial Number



Superstructure Hours




Kilometers



Unit 126 - Service Record 18.06.2025.pdf

Maintenance Records

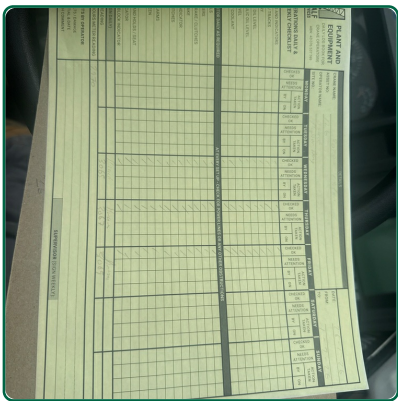

U126 3 monthly report 08.01.2026.pdf

Maintenance Records

Boom and Attachments




Base Section




Head Sheaves and bearings



Rooster Sheave and Bearing

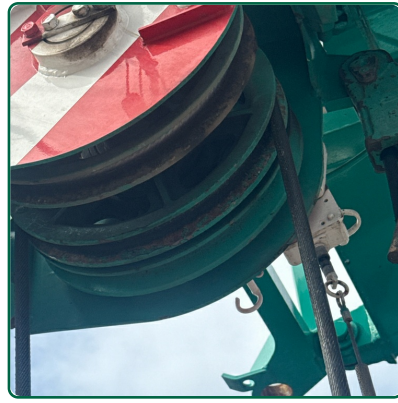

Sheaves and Bearings

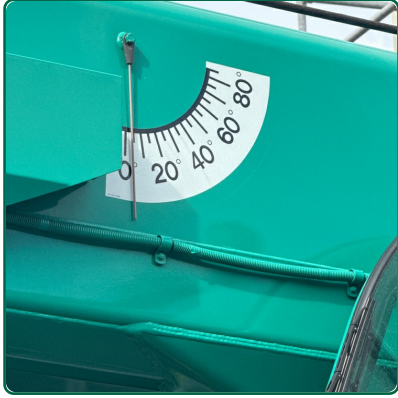

Mechanical Boom Angle Indicator



Boom Hazard Striping



Rotating Beacon(s)



Main Hoist Rope Socket and Pins



Correct Assembly and Connection of Hoist Rope Socket



Auxiliary Hoist Rope Socket and Pins



**Correct Assembly and
Connection of Auxiliary Hoist
Rope Socket**



Anemometer



Rooster Sheave



Boom Head



Extension / Fly Jib



Description



Hook Shank Retainer



Manufacturer's Identification



Description



Hook Shank Retainer



Manufacturer's Identification



Manufacturer's Identification



Lift Cylinder Pins



Lift Cylinder Pins



Cab Glass and Mirrors

Slew System



Slew Brake

Main Winch

Checked at service intervals

Winch Condition & Oil Level



Correct Assembly and
Connection of Hoist Rope
Anchor



Correct Assembly and
Connection of Hoist Rope
Anchor

Auxiliary Winch

Checked at service intervals

Winch Condition & Oil Level



Correct Assembly and
Connection of Auxiliary Hoist
Rope Anchor



Auxiliary Winch Motor

*Internal with no leaks detected at the
time of inspection*

Air Cylinders



Outrigger Boxes



Outrigger Boxes



Outrigger Boxes



Outrigger Boxes



Outrigger Boxes



Markings for Alternate
Outrigger Widths

Electrical Systems

Drive Systems

Working satisfactory at the time of inspection

Switches and Relays

Working satisfactory at the time of inspection

Power Shift / Range Shift

Functional Tests - Main Winch

Load Chart Reference Number

Line Pull Test

Load

Load



Line Pull Test



Rated Load - Boom Fully Extended




Load




Load

Functional Tests - Auxiliary Winch

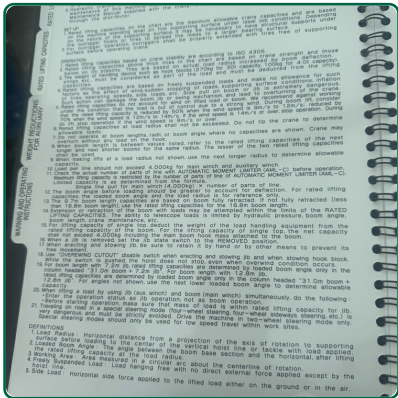

Rated Load - Boom Fully Extended

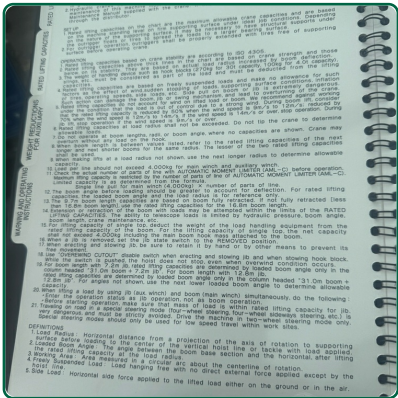

Line Pull Test




Load



Load

Function Tests - On Rubber

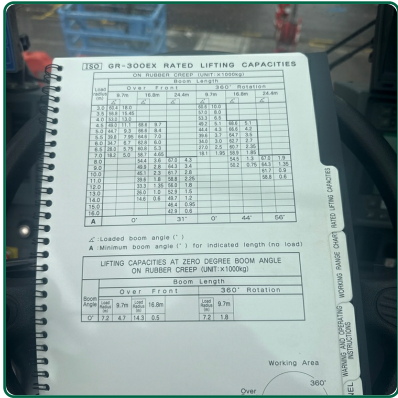

Load Chart Reference Number

Wire Rope Certificate



Rope Termination (End 1)



Rope Termination (End 2)



Rope Termination (End 1)



Rope Termination (End 2)

Accreditation no. 19898

Company Name: Metcalf Crane Services Pty Ltd
Crane Make & Model: Tadano GR-300E-3-00102

Crane Serial No.: 562435
Year of Manufacture: 2023

Length of Rope: 170.00m
Rope Construction: 35 x 7
Surface Finish: Uncoated
Direction of Rope Lay: Ordinary Right Hand Lay
Decision: Pass

Wire Rope Application: Main Hoist
Rope Termination (End 1): Wedge Type Socket
Rope Termination (End 2): Wedge Type Socket
Rope Diameter: 16.00mm



Position Inspected (approx. metres)		10	31	52	73	94	115	160
Number of Visible Wire Breaks (over a length of 6x the rope's dia) AS2759-2004 Clause 14.4		0	0	0	0	0	0	0
Degree of Damage and Deformation of Rope AS2759-2004 Clause 14.13		0	0	0	0	0	0	0
Abrasion of Outer Wires AS2759-2004 Clause 14.9	Degree of Deterioration	0	0	0	0	0	0	0
Corrosion AS2759-2004 Clause 14.8	Degree of Deterioration	0	0	0	0	0	0	0
Reduction of Rope Diameter AS2759-2004 Clause 14.9	Measurement (mm)	16.50	16.50	16.50	16.50	16.50	16.50	16.50
	Measurement 90° (mm)	16.50	16.50	16.50	16.50	16.50	16.50	16.50
Additional Comments								

Degree of Deterioration:

1 = slight, 2 = medium, 3 = high, 4 = very high, 5 = discard

At time of inspection, the rope measurements and construction was in accordance with the requirements of AS2759 - 2004 Section 13 and the operators manual supplied with the crane.

Date Inspected: 12 Mar 2026
Date Issued: 17/03/2026

John Carroll
Assessor No: VIC1017

CraneSafe®



Accreditation no. 19898

Company Name: Metcalf Crane Services Pty Ltd
Crane Make & Model: Tadano GR-300E-3-00102

Crane Serial No.: 562435
Year of Manufacture: 2023

Length of Rope: 98.00m
Rope Construction: Tokyo rope
Surface Finish: Uncoated
Direction of Rope Lay: Ordinary Right Hand Lay
Decision: Pass

Wire Rope Application: Aux Hoist
Rope Termination (End 1): Wedge Type Socket
Rope Termination (End 2): Wedge Type Socket
Rope Diameter: 16.00mm



Position Inspected (approx. metres)		10	21	32	43	54	65	88
Number of Visible Wire Breaks (over a length of 6x the rope's dia) AS2759-2004 Clause 14.4		0	0	0	0	0	0	0
Degree of Damage and Deformation of Rope AS2759-2004 Clause 14.13		0	0	0	0	0	0	0
Abrasion of Outer Wires AS2759-2004 Clause 14.9	Degree of Deterioration	0	0	0	0	0	0	0
Corrosion AS2759-2004 Clause 14.8	Degree of Deterioration	0	0	0	0	0	0	0
Reduction of Rope Diameter AS2759-2004 Clause 14.9	Measurement (mm)	16.50	16.40	16.50	16.50	16.50	16.50	16.50
	Measurement 90° (mm)	16.50	16.50	16.50	16.50	16.50	16.50	16.50
Additional Comments								

Degree of Deterioration:

1 = slight, 2 = medium, 3 = high, 4 = very high, 5 = discard

At time of inspection, the rope measurements and construction was in accordance with the requirements of AS2759 - 2004 Section 13 and the operators manual supplied with the crane.

Date Inspected: 12 Mar 2026
Date Issued: 17/03/2026

John Carroll
Assessor No: VIC1017

CraneSafe®



Accreditation no. 19898

Company Name: Metcalf Crane Services Pty Ltd
Crane Make & Model: Tadano GR-300E-3-00102

Crane Serial No.: 562435
Year of Manufacture: 2023

Item Inspected		
AS1418.5-2013 Annex K.1		
Hook Block	MANUFACTURERS ID no.	562435
	FORM OF HOOK	Single
	NOMINAL LIFTING LOAD	30000kg
	MASS	270kg
AS1418.5-2013 Annex K.3		
Sheave	NUMBER OF SHEAVES	4
	ROPE DIAMETER	16mm
	KIND OF MATERIAL	Metal
	GROOVE WEAR	☒
	ROTATING / BEARING	☒
	BRUISING	☒
	CRACKS	☒
	CHIPS	☒
AS1418.5-2013 Annex K.2		
Lifting Hook	WEAR	☒
	CRACKS	☒
	DEFORMATION	☒
	SAFETY LATCH	☒
	SWIVEL	☒
	BEARING	☒
	HOOK BRUISING	☒
	Y - Y MEASUREMENT	200mm
AS1418.5-2013 Clause 4.2.13		



At time of Inspection, the hook block was in accordance with the requirements of AS1418 Part 5 2013 and the load charts supplied with the crane.

Date Inspected: 12 Mar 2026
Date Issued: 17/03/2026

John Carroll
Assessor No: VIC1017

Hook Block Certificate

Certificate No:
RTC HB.2 212182-15.1

Accreditation no. 19898

Company Name: Metcalf Crane Services Pty Ltd
Crane Make & Model: Tadano GR-300E-3-00102

Crane Serial No.: 562435
Year of Manufacture: 2023

Item Inspected		
AS1418.5-2013 Annex K.1		
Hook Block	MANUFACTURERS ID no.	562435
	FORM OF HOOK	Single
	NOMINAL LIFTING LOAD	4000kg
	MASS	100kg
AS1418.5-2013 Annex K.3		
Sheave	NUMBER OF SHEAVES	N/A
	ROPE DIAMETER	N/Amm
	KIND OF MATERIAL	N/A
	GROOVE WEAR	N/A
	ROTATING / BEARING	N/A
	BRUISING	N/A
	CRACKS	N/A
	CHIPS	N/A
AS1418.5-2013 Annex K.2		
Lifting Hook	WEAR	☒
	CRACKS	☒
	DEFORMATION	☒
	SAFETY LATCH	☒
	SWIVEL	☒
	BEARING	☒
	HOOK BRUISING	☒
	Y - Y MEASUREMENT	100mm
AS1418.5-2013 Clause 4.2.13		



At time of Inspection, the hook block was in accordance with the requirements of AS1418 Part 5 2013 and the load charts supplied with the crane.

Date Inspected: 12 Mar 2026
Date Issued: 17/03/2026

John Carroll
Assessor No: VIC1017



ROUGH TERRAIN CRANE CERTIFICATE OF ANNUAL INSPECTION AND TESTING

Certificate Number: VIC212182 Green Sticker by CraneSafe Assessment Number: RTC A 212182-15



CraneSafe®

Div of The Crane Industry Council of Australia
ABN 73 002 565 773

PO Box 136
MOUNT WAVERLEY VIC 3149
Phone: +61 (03) 9501 0078
Email: assessments@cranesafe.com.au

Inspection Date: 12 Mar 2026

Renewal Date: 24 Mar 2027

Issued Date: 17 Mar 2026

COMPANY

Metcalfe Crane Services Pty Ltd

ABN 43 076 537 749

PO Box 54 SOMERTON VIC 3062

REPRESENTATIVE

Mr. Tim Metcalfe Phone: 03 9308 0044

Email: workshop@metcalfecranes.com.au



Tadano GR-300E-3-00102

ASSESSED BY

John Carroll

Reg No: VIC1017

Phone: 0418 508 870

Email: info@jatco.com.au

COMPANY

Jatco Engineering VIC Pty Ltd

PO Box 260 BALLARAT

VIC 3353

**SUPERSTRUCTURE
HOURS
3109**

**SERIAL NUMBER
562435**

**PLANT NUMBER
NOT SUPPLIED**

**YEAR OF MANUFACTURE
2023**

This certificate is confirmation that the crane has undergone an annual inspection to the appropriate standard and is considered safe for continued operation at time of inspection.

John Carroll

Inspection

Inspection in Accordance With

☐ AS2550.1 & AS2550.5 ☐ EN (FEM&ISO) ☐ JIS ☒ Codes of Practice ☐ Manufacturer's Instructions.

Comments

Inspection to crane safe check list only

Accredited for compliance with ISO/IEC 17020
NATA is a signatory to the ILAC Mutual Recognition Arrangement for the mutual recognition of the equivalence of testing, medical testing, calibration and inspection reports

© 2009-2026 The Crane Industry Council of Australia

All CraneSafe forms, checklists, surveys, audits and reports together with the embedded methodology contained within are the intellectual property of The Crane Industry Council of Australia and may not be used without The Crane Industry Council of Australia's prior written consent.



ROUGH TERRAIN CRANE LOAD INDICATOR CERTIFICATION

Certificate Number: VIC212182 Green Sticker by CraneSafe Assessment Number: RTC A 212182-15



CraneSafe®

Div of The Crane Industry Council of Australia
ABN 73 002 565 773

PO Box 136
MOUNT WAVERLEY VIC 3149
Phone: +61 (03) 9501 0078
Email: assessments@cranesafe.com.au

Inspection Date: 12 Mar 2026

Renewal Date: 24 Mar 2027

Issued Date: 17 Mar 2026

Tadano GR-300E-3-00102

MACHINE HOURS
3109

SERIAL NUMBER
562435

PLANT NUMBER
NOT SUPPLIED

YEAR OF MANUFACTURE
2023

COMPANY

Metcalfe Crane Services Pty Ltd

ABN 43 076 537 749

PO Box 54 SOMERTON VIC 3062

REPRESENTATIVE

Mr. Tim Metcalfe Phone: 03 9308 0044

Email: workshop@metcalfecranes.com.au

ASSESSED BY

John Carroll

Reg No: VIC1017

Phone: 0418 508 870

Email: info@jatco.com.au

COMPANY

Jatco Engineering VIC Pty Ltd

PO Box 260 BALLARAT

VIC 3353

RATED CAPACITY INDICATOR (RCI)

Load Chart Reference Number ISO -GR300EX

PRINTED CHART - NO LOAD

	Printed Chart	Rated Capacity Indicator
Boom Angle, deg	N/A	N/A
Boom Length, m	31.00	31.00
Radius, m	10.00	10.00
Load, kg	6,200.00	6,200.00

RATED CAPACITY LIMITER (RCL)

Load Chart Reference Number ISO GR-300EX

RATED LOAD - BOOM FULLY EXTENDED

	Rated Capacity Indicator	Measured
Radius, m	13.50	13.50
Load, kg	4,700.00	44,861.00

RATED LOAD IN STABILITY

	Rated Capacity Indicator	Measured
Radius, m	13.50	13.50
Load, kg	4,700.00	44,861.00

LINE PULL TEST

	Rated Capacity Indicator	Measured
Load, kg	4,000.00	4,403.00


WINCH BRAKE TEST

	Rated Capacity Indicator	Measured
Load, kg	4,000.00	4,403.00


At the time of test, the load indicator was reading in accordance with the requirements of AS1418.1 & AS1418.5 and the load charts supplied with the crane

John Carroll


Load Chart Reference Number

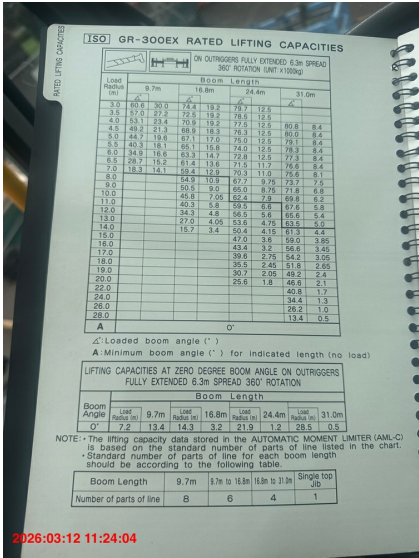

Line Pull Test

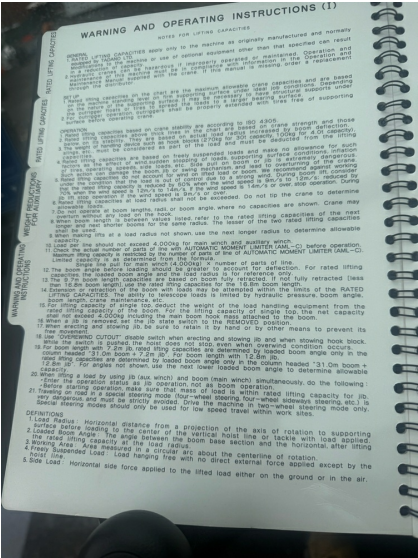

Load

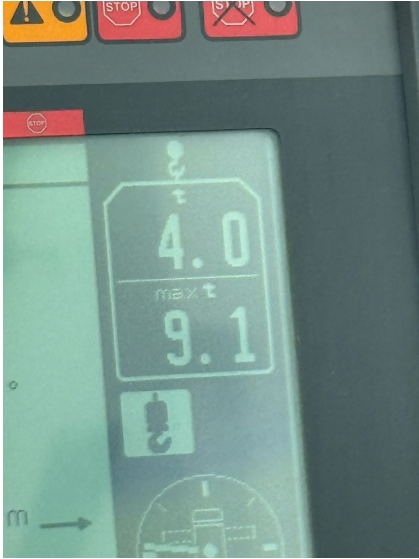

Load



Line Pull Test



Rated Load - Boom Fully Extended



Load



Load

