


Swift Current Diesel


1920 Chaplin St W
 Swift Current, SK S9H 5G6
 Tel: (306) 773-4616
 Fax: (306) 778-3707

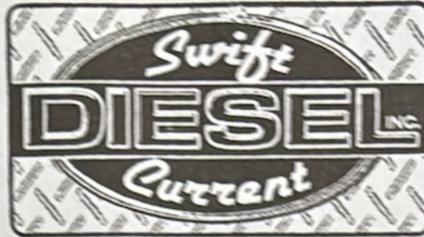

INVOICE

Invoice No.: 27826
 Date: Jan 03, 2024
 Re: Order No. 15776

Sold to:

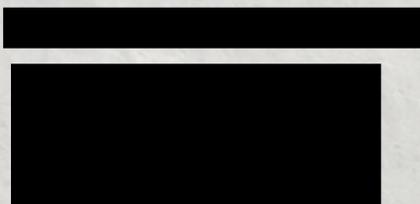

2004 FORD F350 6.0L 761 IXI
 1FTSW31P14GD27228
 272,275KM

Business No.: 10510 4020

Quantity	Item	Description	Unit Price	Tax code	Amount
1	57312	OIL FILTER W/CAP FORD 6.0L/6.4L WIX	48.54	GP	48.54
1	EHC2	ENVIRO HANDLING OVER 8"	2.00	GP	2.00
1	33899	FUEL FILTER	135.72	GP	135.72
1	EHC2	ENVIRO HANDLING OVER 8"	2.00	GP	2.00
3	DZF1GC	AMSOIL 0W40 SYN SS DEO 3.78L	62.98	GP	188.94
3	DZFQT	AMSOIL 0W40 SYN SS DEO 946ML	17.98	GP	53.94
15	EHC3	ENVIRO HDLG OIL - LITRE	0.25	GP	3.75
1	42731	AIR FILTER 03-07 6.0L FORD	141.25	GP	141.25
1	906LLB2	BULB	4.93	GP	4.93
1	SS	SHOP SUPPLIES	20.00	GP	20.00
1	L4090A	CHANGE OIL POWERSTROKE	55.21	G	55.21
4	L4098	GENERAL INSPECTION AND FILTER CHANGE	138.03	GP	552.12
		PERFORMED ENGINE OIL AND FILTER CHANGE. REPLACED FUEL FILTERS AND AIR FILTER. TESTED FUEL PRESSURE, FOUND 60 PSI KOEO AND IS GOOD.		G	
		CHECKED STEERING AND SUSPENSION, FOUND LEFT UPPER BALL JOINT LOOSE. CHECKED ALL FLUIDS, FOUND ALL FLUIDS AT PROPER LEVEL. ADJUSTED TIRE PRESSURES. CHECKED ALL LIGHTS, FOUND REVERSE LIGHTS AND RIGHT CAB LIGHT DO NOT WORK.		G	
		CHECKED POWER TO REVERSE LIGHTS FOUND NO PWER. CHECKED FUSE, FOUND GOOD. CHECKED POWER AND GROUND TO RELAY, FOUND NO CONTROL GROUND.		G	
		INSPECTED WIRING, FOUND C1010 CONNECTOR IN ENGINE COMPARTMENT DISCONNECTED. CONNECTED CONNECTOR, FOUND REVERSE LIGHTS WORK. REPLACED CAB LIGHT BULB. CHECKED FOR HEAD GASKET LEAK, FOUND FLUID TURNS GREEN BUT NO BUBBLES IN FLUID.		G	
		HEAD GASKETS PASS LEAK TEST.		G	
		Subtotal:			1,208.40
		G - GST 5%			
		GP - GST 5%, PST 6%			
		GST			60.44
		PST			68.74
Terms: Interest will be charged on accounts past 30 days at 2%/mo Disclaimer of Warranties All warranties on the products sold hereby are those made by the manufacturer. The seller, SWIFT CURRENT DIESEL, hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and SWIFT CURRENT DIESEL, neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.					
CUSTOMER SIGNATURE:					Total Amount
					1,337.58