



Commercial Vehicle Inspection Certificate
Traffic Safety Act

PART 1 - VEHICLE OWNER AND VEHICLE IDENTIFICATION


Vehicle Type:	Trailer	Seating Capacity:	
GVW:	kg	Brake Type:	Air
Owner Name:	OVERLAND WEST FREIGHTLINES LTD		
Address:	6803 30 ST SE		
City:	CALGARY	Province:	AB
		Postal Code:	T2C1N6
Telephone Number:	(780) 448-9494		
Vehicle Identification Number:	1DW1A53209S086921		
Make:	Stoughton	Model:	ZGPVW-535TSCAR
Year:	2009	Unit Number:	53V120
Odometer:	KM	Licence Plate Number:	X28987
		Province:	AB

IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE

PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Commercial Vehicle.

Inspection Facility Name:	Facility Number:
Gill Truck Services Corporation	19558
Inspection Technician Name:	Technician Number:
Randhir Gill	C0898
Inspection Technician Signature:	
Inspection Date:	2023/06/14

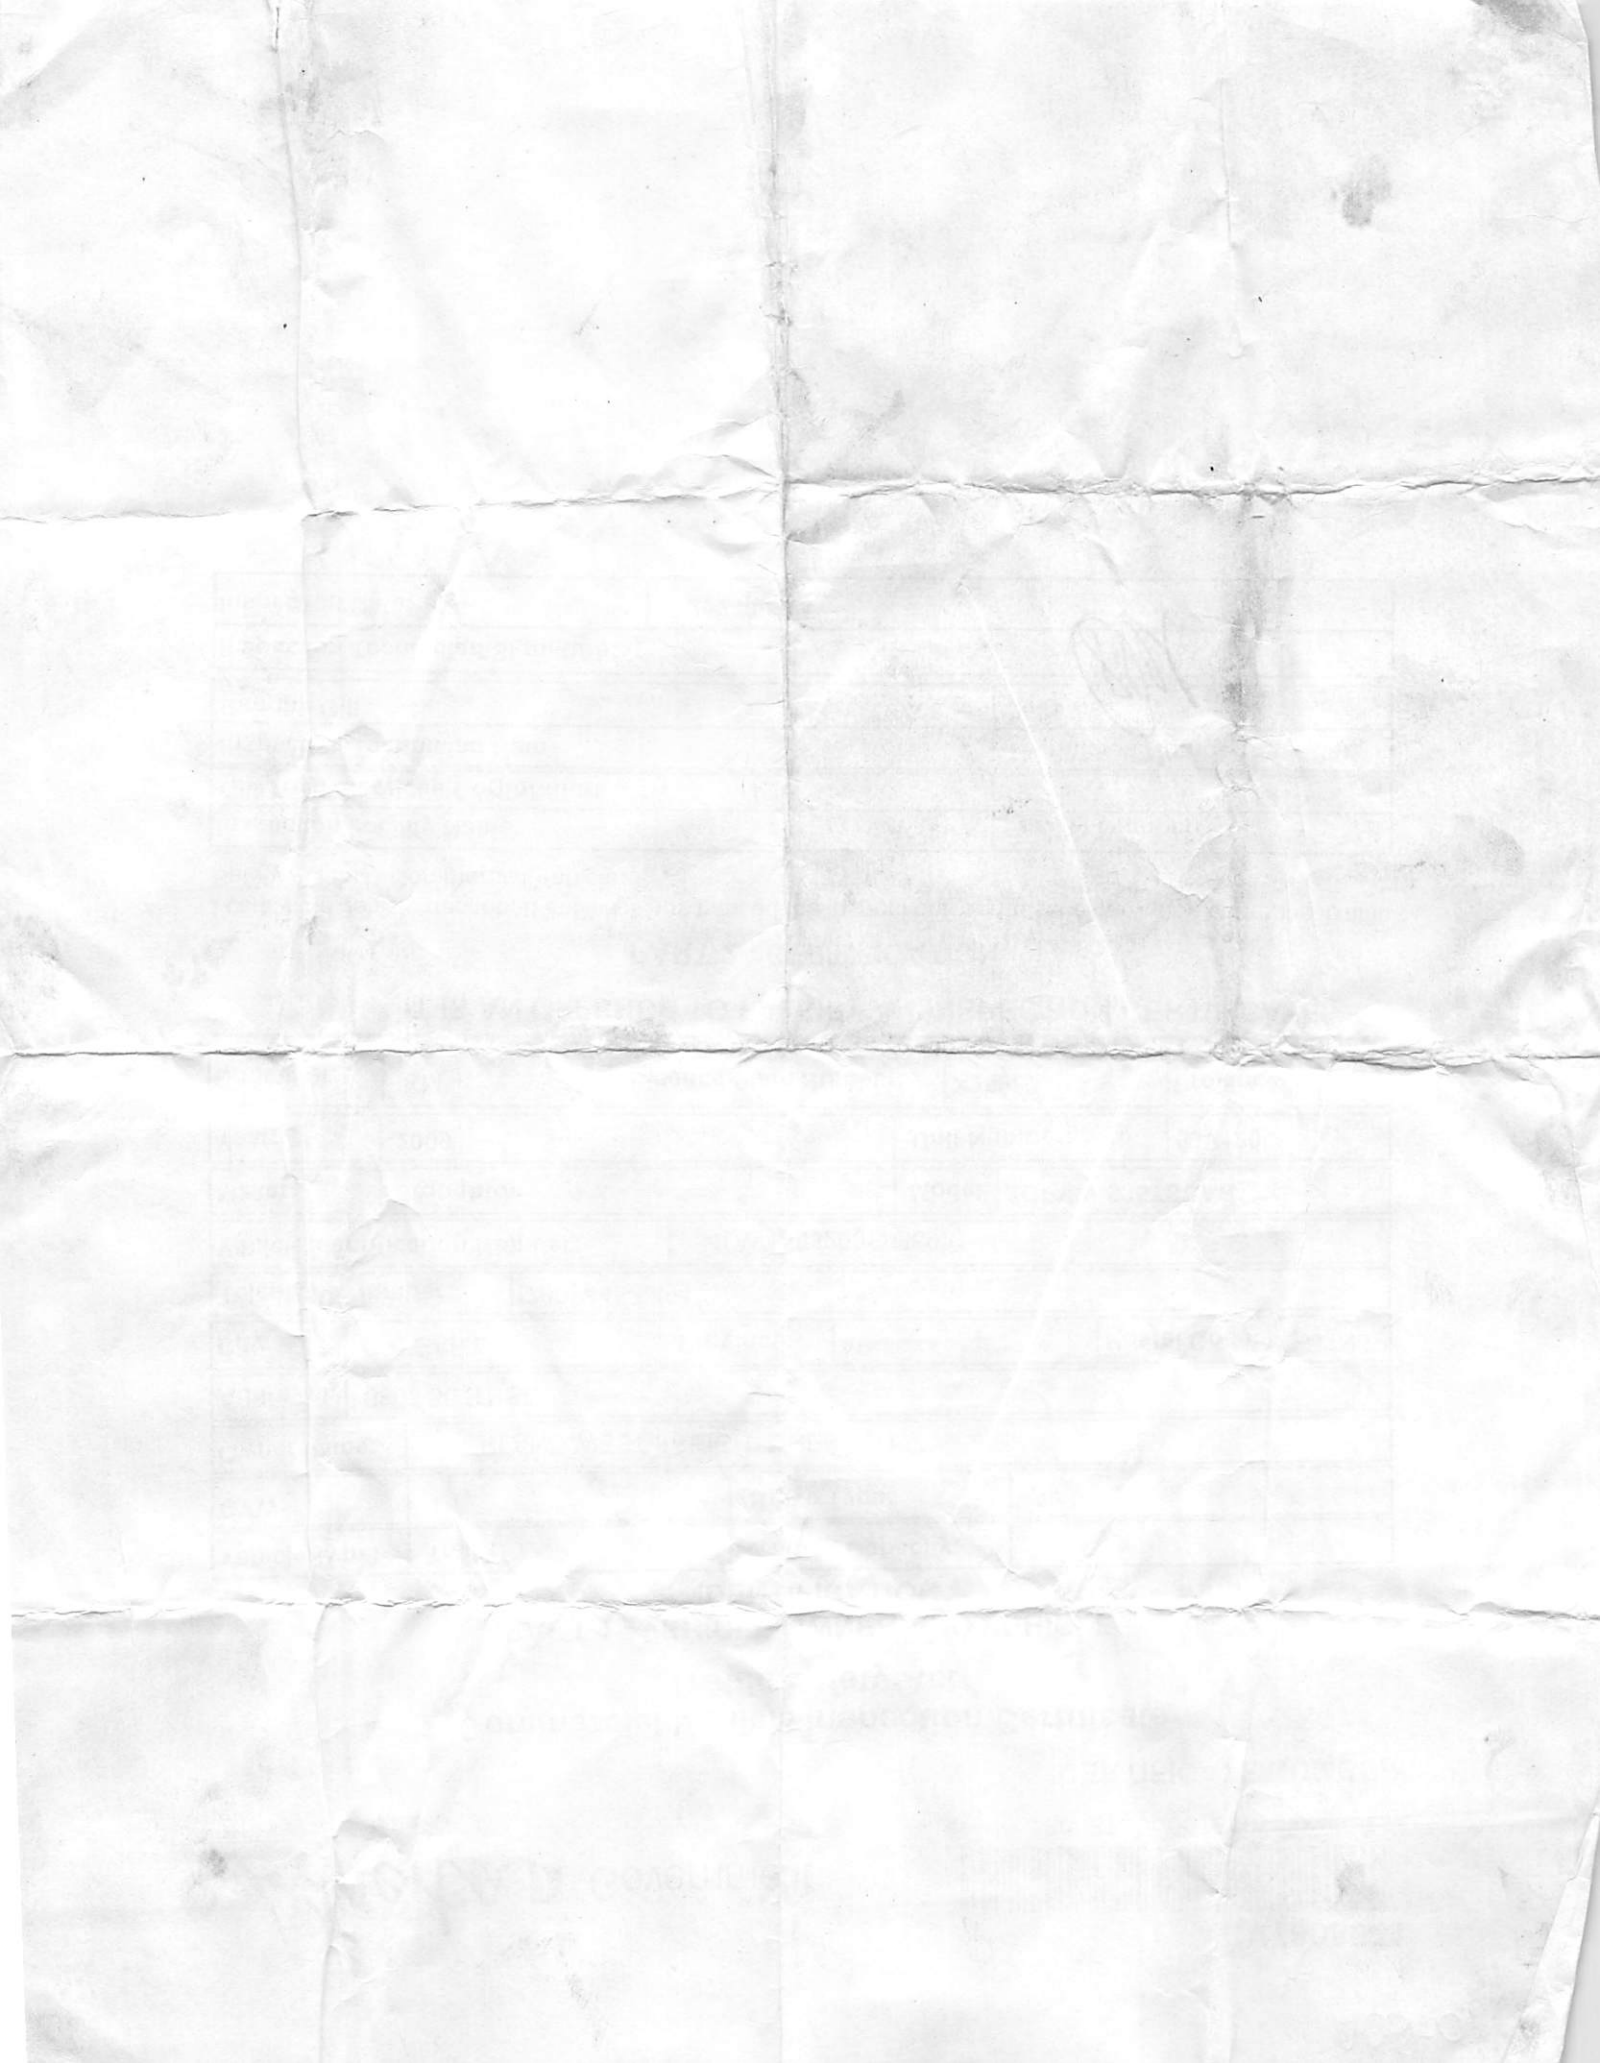

Decal Number: GC14690
Decal Expiry Date: 2025-Jul-31
Inspection Number: 20990892

Inspection Result:

PASS

INSPECTOR: MROKE, GURPAL SINGH / 108739
WORK ORDER #: 20850

INSP. TYPE: Complete
INSP. CLASS: Class 3 - Trailer and Semi-Trailer
INSP. REASON: Annual

INSP. START: 2024-Jul-03 08:00 AM PDT
INSP. COMPLETE: 2024-Jul-03 10:00 AM PDT

VEHICLE JUR: Alberta
PLATE #: X28987
LICENCED GVW(kg): 999999
VEHICLE YEAR: 2009
MAKE: STOUGHTON
MODEL:

REGI:
UNIT/FLEET#: 53V120
BODY STYLE: Trailer
ODOMETER:
HUB ODOMETER: 31506 KM
BRAKE TYPE: Air
FUEL TYPE: Not Applicable

VIN: 1DW1A53209S086921
OWNER/LESSEE NAME: OVERLAND, WEST FREIGHT LINES LTD
ADDRESS: 6803A 30 ST SE
Calgary, Alberta
T2C1N6, Canada

Vehicle Identification (VIN)

- Section 1 - Power Train
- Section 2 - Suspension
- Section 3 - Brake System
- Section 3A - Air Brakes
- Section 3H - Hydraulic Brakes
- Section 4 - Steering
- Section 5 - Instruments and Auxiliary Equipment
- Section 6 - Lamps
- Section 7 - Electrical System
- Section 8 - Frame and Body
- Section 9A - Tires
- Section 9B - Wheels
- Section 10 - Coupling Devices
- Section 11 - Other Vehicle Components

Passed
Not Applicable
Repaired (same day) REPLACED AXLE#1 AND AXLE#2 BOTH SIDES SHOCKS.
Repaired (same day) REPLACED ALL BRAKES AND DRUMS.
Passed
Not Applicable
Not Applicable
Not Applicable
Repaired (same day) REPLACE REAR RIGHT SIDE MARKER LIGHT, ID LIGHT
Passed
Passed
Passed
Passed
Passed
Not Applicable

Air Brake Chamber Type, Size and Push Rod Stroke (mm)

Axles	Type	Size	Slack Adj.	Left	Right
1	Clamp	30	Automatic	40	45
2	Clamp	30	Automatic	40	45

Comment:

Tire Tread Depth (mm)

Outer L	Inner L	Inner R	Outer R	Steering
10	10	9	10	
9	8	10	10	

Comment:

Air Brake Camshaft Rotation (degrees)

Axles	Left	Right
1	85	95
2	95	105

Comment:

Brake Lining/Pad (mm)

Lining/Pad	Left	Right
Lining (Shoe)	14	12
Lining (Shoe)	14	10

Comment:

Rotor Thickness or Drum Inside Diameter (mm)

Rotor/Drum	Left	Right
Drum	420.30	420.54
Drum	419.38	420.75

Comment:


Inspection Comments:

Has this Vehicle been road tested? No

Road Test Date:

Road Tester:

Inspector: MROKE, GURPAL SINGH

Signature: 

This Inspection Report was submitted to CVSE on 2024-Jul-03 01:09 PMPDT

The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle in and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSC/VIP at the Commercial Vehicle Safety Enforcement

CVSE0014

7/3/2024 1:00:29 PM PDT

