

INVOICE#

6371

DATE: Aug. 16, 2024

DRIVER

UNIT#

SD 27

ENGINE HOURS:

POSTED

PLEASE DESCRIBE ISSUES WITH TRUCK OR TRAILER

Grease

check lights

check hub oil's → Replace plug L1, L2, R3

Adjust brakes

L3 brake shoes worn out → New shoes 419.78 mm

R3 dustcover missing

Rubber air lines rubbing through plastic air line
to QR valve above #2 axle

MECHANIC SIGNATURE:

[Signature]

Parts

- 1 set Q + brake shoes
- 1 - 16.5" brake drum
- 1 - Clamp on dustcover PN: D34056-1
- 1 - 5" dustcover clamp PN: 5-28501-500



Inv# 5773

Maintenance Request

Unit 2455-SD27

Date ~~24~~ Oct 3-2023

Driver R-Feij

Engine Hours 12641

Repairs Needed	Completed By
PS rear axle of trailer needs new brake pot- trailer brakes dont work well.	

POSTED

INVOICE# 5734

DATE: Sept. 28, 2023

DRIVER _____

UNIT# SD27

ENGINE HOURS: _____

PLEASE DESCRIBE ISSUES WITH TRUCK OR TRAILER

Replace ABS relay valve

Replace L1 brake pot

Replace R2 brake pot

POSTED

MECHANIC SIGNATURE:

[Signature]

INVOICE# 5703

DATE: SEPT 16/23

DRIVER _____

UNIT# SD27

POSTED

ENGINE HOURS: _____

PLEASE DESCRIBE ISSUES WITH TRUCK OR TRAILER

- REPLACED BOTH REAR RIGHT SIDE TIRES
- REPLACED INNER TIRE ON LEFT #2 AXLE
- SET UP BRAKES

MECHANIC SIGNATURE: _____

INVOICE# 5561

DATE: Aug. 15, 2023

DRIVER _____

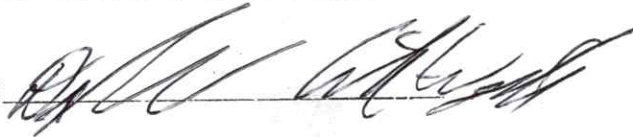
UNIT# 5D27

ENGINE HOURS: _____

POSTER

PLEASE DESCRIBE ISSUES WITH TRUCK OR TRAILER

RH midship turn signal N/W → replace pigtail
+ 64 16

MECHANIC SIGNATURE: 



COMMERCIAL VEHICLE RECORD OF INSPECTION TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY

The original Record of Inspection must be given to the customer regardless of whether the vehicle passes or not.

Type of Vehicle

Gross Vehicle Weight registered

Vehicle Information

VIN

Unit Number

Year

Make

Model

Odometer

SD27

Registered Owner's Name

Plate Number

Address

Postal Code

Phone Number

Inv# 5534

POSTED

Drum Brakes:

Disc Brakes:

		LEFT		FRONT		RIGHT		
100 psi	100 psi	419.48	mm	Drums/Rotors	419.48	mm	100 psi	100 psi
18 mm	18 mm	22	mm	Linings/Pads	22	mm	16 mm	13 mm
		36	mm	Push Rod Travel	36	mm		
100 psi	100 psi	419.11	mm	Drums/Rotors	419.11	mm	100 psi	100 psi
12 mm	8 mm	16	mm	Linings/Pads	11	mm	15 mm	16 mm
		36	mm	Push Rod Travel	36	mm		
100 psi	100 psi	419.11	mm	Drums/Rotors	419.11	mm	100 psi	100 psi
13 mm	13 mm	12	mm	Linings/Pads	13	mm	6 mm	7 mm
		36	mm	Push Rod Travel	36	mm		
psi	psi		mm	Drums/Rotors		mm	psi	psi
mm	mm		mm	Linings/Pads		mm	mm	mm
			mm	Push Rod Travel		mm		
psi	psi		mm	Drums/Rotors		mm	psi	psi
mm	mm		mm	Linings/Pads		mm	mm	mm
			mm	Push Rod Travel		mm		
psi	psi		mm	Drums/Rotors		mm	psi	psi
mm	mm		mm	Linings/Pads		mm	mm	mm
			mm	Push Rod Travel		mm		

Park Brake Lining Left mm Right mm Trans mm
Wheel Torque Checked Inner ft lbs Outer ft lbs

INVOICE# _____

DATE: _____

DRIVER _____

UNIT# _____

ENGINE HOURS: _____

PLEASE DESCRIBE ISSUES WITH TRUCK OR TRAILER

- Top ~~top~~ corners of tub cracked.
- middles of tub cracked.
- # 2 axle LH Fender (changed)
- # 2 axle RH Fender (changed)
- License Plate light N/W
- LH rear side marker light out
- ABS light flashing with 4ways. → Problem in Truck
- Adjust Brakes
- hub oil levels.
- # 1 axle RH/LH new Brake Shoes.
- # 1 axle area Both xmembers cracked ~~on~~ Both sides.
- # 2 axle LH Slack adjuster
- # 3 axle LH & RH Slack Adjuster

MECHANIC SIGNATURE: _____

INVOICE# 5242

DATE: April 27, 2023

DRIVER _____

UNIT# SD27

ENGINE HOURS: _____

PLEASE DESCRIBE ISSUES WITH TRUCK OR TRAILER

POSTED

- Grease
- Adjust brakes
- Secure L2 + R3 Fender
- Unbend LH Taillight box

MECHANIC SIGNATURE: [Signature]

INVOICE# 5206

DATE: April 15
14, 2023

DRIVER _____

UNIT# SD Q7

ENGINE HOURS: _____

POSTED

PLEASE DESCRIBE ISSUES WITH TRUCK OR TRAILER

- New brakes front axle both sides (8mm) (monitor)
- front cylinder leaks (monitor)
- missing grease nipple rear cylinder can not get one in no threads
- ✓ - Set Brakes
- ~~Pin holder off drive side front pin~~
- ~~bolt missing on back driver side pin~~
- ✓ - new fender passenger side front axle
- ~~loose bolt on pin rear passenger side, middle bolt pin, front bolt pin~~
- ✓ - cracks driver side above pin hanger
- outside plastic pieces on front axle tri functionals Not in place (Broken)
- ✓ - rear mud flap passenger side
- ✓ - passenger side front axle tires chunks missing and low tread

MECHANIC SIGNATURE: Tyler Pickett

INVOICE# 4883

DATE: Nov 15 122

DRIVER _____

UNIT# SD27

ENGINE HOURS: 25935

Kilometres: 768,835 Km

PLEASE DESCRIBE ISSUES WITH TRUCK OR TRAILER

- Replace missing rear lower ram pin

POSTED

MECHANIC SIGNATURE: _____

PART NUMBER

This image shows a single sheet of white paper with horizontal blue or grey ruling lines. A vertical margin line is present on the left side, creating a narrow left margin. The paper appears slightly aged or off-white. There are some faint smudges and marks on the surface, particularly near the top left corner. The overall appearance is that of a standard notebook page.

INVOICE# 4728

DATE: Oct 31 22

DRIVER _____

UNIT# SD27

ENGINE HOURS: _____

PLEASE DESCRIBE ISSUES WITH TRUCK OR TRAILER

- LH #1 fender busted
- Wheel hub levels
- RH #2 brake shoes at 3mm (new) ^{Drum} (420.12)
- Grease
- Set brakes

POSTED

MECHANIC SIGNATURE: _____

INVOICE# 4398

DATE: Aug. 15, 2022

DRIVER _____

UNIT# SD 27

ENGINE HOURS: _____

PLEASE DESCRIBE ISSUES WITH TRUCK OR TRAILER

- Grease + Inspect
- check hub oils
- L2 wheel seal leaking
- Adjust brakes

POSTED

MECHANIC SIGNATURE: _____

[Signature]

INVOICE# 4038

DATE: June 27/22

DRIVER _____

UNIT# SD 27

ENGINE HOURS: _____

POSTED

PLEASE DESCRIBE ISSUES WITH TRUCK OR TRAILER

- Hydraulic pressure line is no good
- RH side signal lights not working

MECHANIC SIGNATURE: _____

INVOICE#

2978

DATE:

Jan 22nd/21

DRIVER

UNIT#

SD27

ENGINE HOURS:

POSTED

PLEASE DESCRIBE ISSUE WITH TRUCK OR TRAILER

- Unit # to put on
- LH & RH cracks at front of trailer
- #1 cross mem cracked @ top
- Tub crack @ #4 x-mem
- #5 x-mem cracked @ top LH
- RH middle tipping hinge cracked top
- #2 axle x-mem cracked
- #2 axle LH brake pot
- #3 axle RH & LH brake pots
- #1 & 2 axle shoes
- 5 hub caps
- LH rear light box bent

MECHANIC SIGNATURE

- GH Local 100% pay rate
- 2 yr cap
- #1 & 2 ex/6 2 months
- #3 ex/6 BH & GH 100% pay
- #4 ex/6 GH 100% pay
- #5 ex/6 X-men 100% pay
- BH 100% pay 100% pay 100% pay
- #2 X-men 100% pay 100% GH
- Top 100% pay 100% pay 100% pay
- #1 100% pay 100% pay 100% pay
- GH & BH 100% pay 100% pay 100% pay
- Diff # 100% pay 100% pay

2007

10/10/07

INVOICE# _____

DATE: JAN 23/21

DRIVER _____

UNIT# SD 278

ENGINE HOURS: _____

PLEASE DESCRIBE ISSUE WITH TRUCK OR TRAILER

* #3 axle LH ~~side~~ wheel seal (new drum)

* Re shim S-cam #3 axle RH side.

MECHANIC SIGNATURE

COMMERCIAL VEHICLE RECORD OF INSPECTION TRAILER, SEMI-TRAILER, C-DOLLY, CONVERTER DOLLY

The original Record of Inspection must be given to the customer regardless of whether the vehicle passes or not.

Type of Vehicle		Gross Vehicle Weight registered	
Vehicle Information			
VIN	Unit Number	Year	Make
	SD27		Cross country
			Registered Owner's Name
			Fire Ridge Transport
		Address	Postal Code
			Phone Number
			Odometer
			N/A
			Plate Number

Drum Brakes:

Disc Brakes:

		LEFT	FRONT	RIGHT		
psi	psi	421.42 (new)	Drums/Rotors	421.62 (new)	psi	psi
6	5	12 (new)	Linings/Pads	8 (new)	5	6
mm	mm	mm	Push Rod Travel	mm	mm	mm
psi	psi	New	Drums/Rotors	421.48 (new)	psi	psi
7	8	16	Linings/Pads	8 (new)	3	7
mm	mm	mm	Push Rod Travel	mm	mm	mm
psi	psi	421.42 (new)	Drums/Rotors	419.15	psi	psi
7	6	14	Linings/Pads	15	6	6
mm	mm	mm	Push Rod Travel	mm	mm	mm
psi	psi		Drums/Rotors		psi	psi
			Linings/Pads			
mm	mm		Push Rod Travel		mm	mm
psi	psi		Drums/Rotors		psi	psi
			Linings/Pads			
mm	mm		Push Rod Travel		mm	mm
psi	psi		Drums/Rotors		psi	psi
			Linings/Pads			
mm	mm		Push Rod Travel		mm	mm

Park Brake Lining Left mm Right mm Trans mm
Wheel Torque Checked Inner ft lbs Outer ft lbs