



Commercial Vehicle Inspection Report

Decal Number: PY00832
Decal Expiry Date: 2026-Apr-30
Inspection Number: 21300375

Inspection Result:
PASS

FACILITY: NORTHERN B.C. TRUCKERS' / N5398
INSPECTOR: JOHNSON, DALE Grant / 108415
WORK ORDER #:
INSP. TYPE: Complete
INSP. CLASS: Class 3 - Trailer and Semi-Trailer
INSP. REASON: Annual
INSP. START: 2025-Apr-01 05:15 PM MST
INSP. COMPLETE: 2025-Apr-01 06:15 PM MST

VEHICLE JUR: British Columbia
PLATE #: 55459K
LICENCED GVW(kg): 999999
VEHICLE YEAR: 2004
MAKE: TRAILTECH
MODEL:
REGI: 03186294
UNIT/FLEET#: S221
BODY STYLE: Flat Deck Trailer
ODOMETER:
HUB ODOMETER:
BRAKE TYPE: Air
FUEL TYPE:
VIN: 2CUDCEXN342014924
OWNER/LESSEE NAME: ENVIROBORE DRILLING, LTD
ADDRESS: BOX 144 RPO
Fort St John, British Columbia
V1J0K9, Canada

A08-4

Vehicle Identification (VIN)	Result
Section 1 - Power Train	Passed
Section 2 - Suspension	Not Applicable
Section 3 - Brake System	Passed
Section 3A - Air Brakes	Not Applicable
Section 3H - Hydraulic Brakes	Repaired (same day) ABS LIGHT
Section 4 - Steering	Not Applicable
Section 5 - Instruments and Auxiliary Equipment	Not Applicable
Section 6 - Lamps	Repaired (same day) LEFT MIDCHIP MARKER
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Passed
Section 9A - Tires	Passed
Section 9B - Wheels	Passed
Section 10 - Coupling Devices	Passed
Section 11 - Other Vehicle Components	Not Applicable

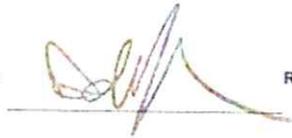
Air Brake Chamber Type, Size and Push Rod Stroke (mm)				Tire Tread Depth (mm)						
Axles	Type	Size	Slack Adj.	Left	Right	Outer L	Inner L	Inner R	Outer R	Steering
1	Clamp	30	Automatic	28	26	14	14	14	14	
2	Clamp	30	Automatic	32	26	14	14	14	14	

Comment: _____

Air Brake Camshaft Rotation (degrees)			Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)		
Axles	Left	Right	Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	25	30	Lining (Shoe)	21	21	Drum		
2	30	30	Lining (Shoe)	21	21	Drum		

Comment: _____

Comment: Air Brake Camshaft Rotation performed. Rotor Thickness or Drum Diameter not measured.

Inspection Comments:
Has this Vehicle been road tested? No
Inspector: JOHNSON, DALE Grant
Road Test Date: _____
Signature: 
Road Tester: _____

This Inspection Report was submitted to CVSE on 2025-Apr-04 12:14 PM MST
The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSCVIP at the Commercial Vehicle Safety Enforcement.

CVSE0014

4/4/2025 12:14 11 PM MST