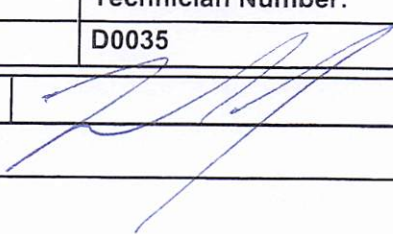



CERTIFICATE NUMBER
**Commercial Vehicle Inspection Certificate
Traffic Safety Act**
**PART 1 - VEHICLE OWNER AND VEHICLE
IDENTIFICATION**

Vehicle Type:	Truck	Seating Capacity:	
GVW:	63500 kg	Brake Type:	Air
Owner Name:	Pioneer Truck Lines Ltd		
Address:	8321 1 St NW		
City:	Edmonton	Province:	AB
Postal Code:	T6P1X2		
Telephone Number:	(780) 467-8880		
Vehicle Identification Number:	1XKZDP0X7KJ950813		
Make:	Kenworth	Model:	Construct
Year:	2019	Unit Number:	9177
Odometer:	854829 KM	Licence Plate Number:	0AZ193
Province:	AB		

IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE
PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Commercial Vehicle.

Inspection Facility Name:	Facility Number:
2097942 Alberta Ltd	19493
Inspection Technician Name:	Technician Number:
Matthew Johnson	D0035
Inspection Technician Signature:	
Inspection Date:	2026/05/01

**COMMERCIAL VEHICLE RECORD OF INSPECTION
TRUCK AND TRUCK-TRACTOR**

The original Record of Inspection must be given to the customer regardless of whether the vehicle passes or not.

Type of Vehicle										Gross Vehicle Weight registered									
Truck										63500 kg									
Vehicle Information																			
VIN	1	X	K	Z	D	P	0	X	7	K	J	9	5	0	8	1	3		
Unit Number				Year				Make				Model				Odometer			
9177				2019				Kenworth				Construct				854,829			
Registered Owner's Name																Plate Number			
Pioneer Truck Lines Ltd																0AZ193			
Address												Postal Code				Phone Number			
8321 1 St NW												T6P1X2				(780) 467-8880			

Drum Brakes: A-Full Inspection with Drum Removed

Disc Brakes:

		<u>LEFT</u>		<u>FRONT</u>		<u>RIGHT</u>			
92 psi		419.96	mm	Drums/Rotors		421.97	mm	92 psi	
12 mm		21	mm	Linings/Pads		20	mm	12 mm	
		30	mm	Push Rod Travel		30	mm		
78 psi	88 psi	423.6	mm	Drums/Rotors		423.79	mm	98 psi	62 psi
10 mm	20 mm	16	mm	Linings/Pads		15	mm	15 mm	3 mm
		44	mm	Push Rod Travel		32	mm		
101 psi	58 psi	421.08	mm	Drums/Rotors		421.05	mm	68 psi	88 psi
15 mm	15 mm	15	mm	Linings/Pads		20	mm	15 mm	15 mm
		41	mm	Push Rod Travel		51	mm		
psi	psi		mm	Drums/Rotors			mm	psi	psi
mm	mm		mm	Linings/Pads			mm	mm	mm
			mm	Push Rod Travel			mm		
psi	psi		mm	Drums/Rotors			mm	psi	psi
mm	mm		mm	Linings/Pads			mm	mm	mm
			mm	Push Rod Travel			mm		
psi	psi		mm	Drums/Rotors			mm	psi	psi
mm	mm		mm	Linings/Pads			mm	mm	mm
			mm	Push Rod Travel			mm		

Park Brake Lining Left NA mm Right NA mm Trans NA mm
 Wheel Torque Checked ☒ Inner NA ft lbs Outer 500 ft lbs

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

Section 1 - Power Train

Component	P	F	NA	Component	P	F	NA
1.1. Accelerator Pedal/Throttle Actuator	✓			1.8. Engine Start Safety Feature	✓		
1.2. Exhaust System	✓			1.9. Gear Position Indicator	✓		
1.3. Emission Control Systems and Devices	✓			1.10. Engine or Accessory Drive Belt	✓		
1.4. Drive Shaft	✓			1.11. Hybrid Electric Vehicle & Electric Vehicle Power Train System			✓
1.5. Clutch and Clutch Pedal			✓	1.12. Gasoline or Diesel Fuel System	✓		
1.6. Engine/Transmission Mount	✓			1.13. Pressurized or Liquefied Fuel System (LPG, CNG, & LNG)			✓
1.7. Engine/Shut Down	✓			* SEE APPENDIX A*			

NOTES:

APPENDIX "A"

Component	P	F	NA	Component	P	F	NA
A.1. Liquefied Petroleum Gas (LPG or Propane) Fuel System			✓	A.3. Liquefied Natural Gas (LNG) Fuel System			✓
A.2. Compressed Natural Gas (CNG) Fuel System			✓				

NOTES:

Section 2 - Suspension

Component	P	F	NA	Component	P	F	NA
2.1. Suspension & Frame Attachments	✓			2.5. Air Suspension	✓		
2.2. Axle Attaching & Tracking Components	✓			2.6. Self-Steer and Controlled-Steer Axle	✓		
2.3. Axle & Axle Assembly	✓			2.7. Shock Absorber/Strut Assembly	✓		
2.4. Spring & Spring Attachment	✓						

NOTES:

SPRING PIN BUSHINGS WORN OUT AT AXLE #1- REPLACED ALL 6 (FRONT/REAR)
#2L SHOCK LEAKING- REPLACED

Section 3H - Hydraulic Brakes

Component	P	F	NA	Component	P	F	NA
3H.1. Hydraulic System Components			✓	3H.13. Disc Brake System Components			✓
3H.2. Brake Pedal/Actuator			✓	3H.14. Mechanical Parking Brake			✓
3H.3. Vacuum Assist (Boost) System			✓	3H.15. Spring-Applied Air-Released Parking Brake			✓
3H.4. Hydraulic Assist (Boost) System			✓	3H.16. Spring-Applied Hydraulic-Released Parking Brake			✓
3H.5. Air Assist (Boost) System			✓	3H.17. Anti-Lock Brake System (ABS)			✓
3H.6. Air-Over-Hydraulic Brake System			✓	3H.18. Stability Control System			✓
3H.11. Brake System Indicator Lamps			✓	3H.19. Brake Performance			✓
3H.12. Drum Brake System Components			✓				

NOTES:

Section 3A - Air Brakes

Component	P	F	NA	Component	P	F	NA
3A.1. Air Compressor	✓			3A.13. Air System Components	✓		
3A.2. Air Supply System	✓			3A.14. Brake Chamber	✓		
3A.4. Air Tank	✓			3A.15. Drum Brake System Components	✓		
3A.5. Air Tank Check Valves	✓			3A.16. S-Cam Drum Brake System	✓		
3A.6. Brake Pedal/Actuator	✓			3A.17. Brake Shoe Travel (Wedge Brakes)			✓
3A.7. Treadle Valve and Trailer Hand Valve	✓			3A.18. Disc Brake System Components			✓
3A.8. Brake Valves & Controls	✓			3A.19. Anti-Lock Brake System (ABS)	✓		
3A.9. Proportioning, Inversion or Modulation Valve	✓			3A.21. Stability Control System	✓		
3A.10. Towing Vehicle (Tractor) Protection System	✓			3A.23. Brake Performance	✓		

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

Section 3A - Air Brakes

Component	P	F	NA	Component	P	F	NA
3A.11. Parking Brake & Emergency Application	✓						

NOTES:

TREADLE VALVE LEAKING FROM EXHAUST PORT- REPLACED
#2 AXLE DRUMS OVER MAX ALLOWABLE WEAR- REPLACED DRUMS AND BRAKE SHOES
#3L BRAKE SHOES COMING APART- REPLACED SHOES
PASS SIDE AIR TANK RUSTED THROUGH AND LEAKING- REPLACED

Section 4 - Steering

Component	P	F	NA	Component	P	F	NA
4.1. Steering Control and Linkage	✓			4.4. Kingpin	✓		
4.2. Power Steering System (Hydraulic and Electric)	✓			4.5. Self-Steer and Controlled-Steer Axle			✓
4.3. Steering Operation (Active Steer Axle)	✓						

NOTES:

Section 5 - Instruments and Auxiliary Equipment

Component	P	F	NA	Component	P	F	NA
5.1. Fire Extinguisher	✓			5.8. Heater & Windshield Defroster	✓		
5.2. Hazard Warning Kit	✓			5.9. Fuel-Burning Auxiliary Heater	✓		
5.3. Horn	✓			5.10. Chain/"Headache" Rack	✓		
5.5. Speedometer	✓			5.11. Auxiliary Controls and Devices			✓
5.6. Odometer	✓			5.12. Auxiliary Drive Controls			✓
5.7. Windshield Wiper/Washer	✓						

NOTES:

Section 6 - Lamps

Component	P	F	NA	Component	P	F	NA
6.1. Required Lamps	✓			6.4. Instrument Panel Lamps	✓		
6.2. Reflex Reflector	✓			6.5. Headlamp Aim	✓		
6.3. Retro-Reflective Marking	✓						

NOTES:

Section 7 - Electrical System

Component	P	F	NA	Component	P	F	NA
7.1. Wiring	✓			7.3. Trailer Cord (output to towed vehicle)	✓		
7.2. Battery	✓						

NOTES:

Section 8 - Body

Component	P	F	NA	Component	P	F	NA
8.1. Hood or Engine Enclosure	✓			8.12. Bumper	✓		
8.2. Tilt Cab			✓	8.13. Windshield	✓		
8.3. Air-Suspended Cab	✓			8.14. Side Windows	✓		
8.4. Cab and Passenger-Vehicle Body	✓			8.15. Rear Window			✓
8.5. Cargo Body			✓	8.16. Interior Sun Visor	✓		
8.6. Frame, Rails & Mounts	✓			8.17. Exterior Windshield Sun Visor	✓		
8.7. Unitized Body Elements	✓			8.18. Rear-View Mirror	✓		
8.8. Cab or Cargo Door	✓			8.19. Seat	✓		

COMMERCIAL VEHICLE RECORD OF INSPECTION TRUCK AND TRUCK-TRACTOR

Section 8 - Body

Component	P	F	NA	Component	P	F	NA
8.9. Cargo Tank or Vessel			✓	8.20. Seat Belt/Occupant Restraint	✓		
8.10. Body, Device or Equipment Attached or Mounted to the Vehicle	✓			8.21. Fender/Mud Flap	✓		
8.11. Refrigeration/Heater Unit Fuel System (Reefer or Auxiliary Power Unit (APU))			✓	8.24. Aerodynamic Device & Attachment			✓

NOTES:

Section 9 - Tires and Wheels

Component	P	F	NA	Component	P	F	NA
9.1. Tire Tread Depth	✓			9.7. Wheel/Rim (Applies to all wheel types)	✓		
9.2. Tire Tread Condition	✓			9.8. Multi-Piece Wheel/Rim			✓
9.3. Tire Sidewall & Manufacturer Markings	✓			9.9. Spoke Wheel/Demountable Rim System			✓
9.4. Tire Inflation Pressure	✓			9.10. Disc Wheel System			✓
9.5. Wheel Hub	✓			9.11. Wheel Fasteners (Nuts, Bolts and Studs)	✓		
9.6. Wheel Bearing	✓						

NOTES:

#1R WHEEL SEAL LEAKING- REPLACED WHEEL SEAL AND BRAKE SHOES
 #1 AXLE HUB CAPS BADLY CORRODED AND SWELLING- REPLACED
 #1R WHEEL BEARINGS RUSTING- REPLACED BEARINGS/RACES
 ALL TIRES LOW ON AIR- TOPPED UP 105PSI STEERS, 100PSI DRIVES
 ADJUSTED ALL BRAKES

Section 10 - Couplers and Hitches

Component	P	F	NA	Component	P	F	NA
10.1. Hitch Assembly, Structure & Attaching Components			✓	10.5. Roll-Coupling Hitch			✓
10.2. Secondary Attachment (Safety Chain or Cable)			✓	10.6. Automated Coupling Device			✓
10.3. Pintle Hook, Pin Hitch, or Coupler Hitch			✓	10.7. Fifth Wheel Coupler	✓		
10.4. Ball Type Hitch			✓	10.8. Oscillating Fifth Wheel Coupler			✓

NOTES:

5TH WHEEL OUT OF ADJUSTMENT- ADJUSTED

Certification

The Vehicle for which this Record of Inspection is issued has **PASSED** (Certificate #8479320) the inspection and I certify it has been inspected in accordance with the Vehicle Inspection Regulation, Alberta Regulation 211/2006 and the applicable Inspection Manual.

Date of Inspection

2026/05/01

Technician Number

D0035

Facility Number

19493

Signature



Customer Acknowledgment

I understand if a vehicle inspection identifies defects and repairs are required, once repaired, the vehicle and this Record of Inspection (ROI) may be presented to any Vehicle Inspection Facility within 10 days of the initial inspection and only the failed items noted on this ROI are required to be re-inspected. If the vehicle is not returned for re-inspection within 10 days of the initial date of inspection, a new inspection must be conducted.

Date (Year/Month/Day)

2026/05/01

Customer Signature